

Report No.: FZ400315-01

Project No: CB10410005

FCC DFS Test Report

: Wireless eMTA Equipment

Brand Name : Ubee

Model No. : DVW32C

: XCNDVW32C FCC ID

: 47 CFR FCC Part 15.407 Standard

Frequency Range: 5250 MHz - 5350 MHz

5470 MHz - 5725 MHz

Applicant : Ubee Interactive Corp.

10F-1, No.5, Taiyuan 1st St. Jhubei, Hsinchu, 302, Taiwan

: Ubee Interactive Corp. Manufacturer

10F-1, No.5, Taiyuan 1st St. Jhubei, Hsinchu, 302, Taiwan

: Master Operate Mode

The product sample received on Sep. 19, 2014 and completely tested on Sep. 23, 2015. We, SPORTON, would like to declare that the tested sample has been evaluated in accordance with the procedures given in FCC KDB 905462 D02 UNII DFS Compliance Procedures New Rules v01r02 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Sam Chen

SPORTON INTERNATIONAL INC.

1190



Table of Contents

Report No.: FZ4O0315-01

| 1 | GENERAL DESCRIPTION | 5 |
|------|---|---------|
| 1.1 | Information | 5 |
| 1.2 | Accessories | 14 |
| 1.3 | Support Equipment | 14 |
| 1.4 | Testing Applied Standards | 14 |
| 1.5 | Testing Location Information | 14 |
| 2 | TEST CONFIGURATION OF EUT | 15 |
| 2.1 | Test Channel Frequencies Configuration | 15 |
| 2.2 | The Worst Case Measurement Configuration | 15 |
| 3 | DYNAMIC FREQUENCY SELECTION (DFS) TEST RESULT | 16 |
| 3.1 | General DFS Information | 16 |
| 3.2 | Radar Test Waveform Calibration | 19 |
| 3.3 | UNII Detection Bandwidth | 36 |
| 3.4 | Channel Availability Check (CAC) | 40 |
| 3.5 | In-service Monitoring | 47 |
| 3.6 | Statistical Performance Check | 52 |
| 4 | TEST EQUIPMENT AND CALIBRATION DATA | 125 |
| 5 | MEASUREMENT UNCERTAINTY | 126 |
| APPI | ENDIX A. TEST PHOTOS | A1 ~ A2 |

Page No.

Report Version

Issued Date

: 2 of 126

: Rev. 01

: Oct. 19, 2015

Summary of Test Result

| Conformance Test Specifications | | | | | | | |
|---------------------------------|------------------------|--|---------------------------------------|----------|--|--|--|
| Report Clause | Ref. Std. Clause | Description | Limit | Result | | | |
| 3.3 | FCC KDB 905462 7.8.1 | DFS: UNII Detection Bandwidth Measurement | 100% of the 99% BW | Complied | | | |
| 3.4 | FCC KDB 905462 7.8.2.1 | DFS: Initial Channel Availability Check Time | CAC ≥ 60 sec | Complied | | | |
| 3.4 | FCC KDB 905462 7.8.2.2 | DFS: Radar Burst at the Beginning of the Channel Availability Check Time | Detection Threshold: -63 dBm | Complied | | | |
| 3.4 | FCC KDB 905462 7.8.2.3 | DFS: Radar Burst at the End of the Channel Availability Check Time | Detection Threshold: -63 dBm | Complied | | | |
| 3.5 | FCC KDB 905462 7.8.3 | DFS: In-Service Monitoring for Channel Move Time (CMT) | CMT ≤ 10sec | Complied | | | |
| 3.5 | FCC KDB 905462 7.8.3 | DFS: In-Service Monitoring for Channel Closing Transmission Time (CCTT) | CCTT ≤ 60 ms starting at CMT 200ms | Complied | | | |
| 3.5 | FCC KDB 905462 7.8.3 | DFS: In-Service Monitoring for Non-Occupancy Period (NOP) | NOP ≥ 30 min | Complied | | | |
| 3.6 | FCC KDB 905462 7.8.4 | DFS: Statistical Performance Check | Table 5 - 7 (KDB 905462) | Complied | | | |
| 3.1.4 | FCC KDB 905462 8.1 | User Access Restrictions | DFS controls | Complied | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 3 of 126 : Rev. 01 Report Version

Issued Date

: Oct. 19, 2015

Revision History

| Report No. | Version | Description | Issued Date |
|-------------|---------|-------------------------|---------------|
| FZ4O0315-01 | Rev. 01 | Initial issue of report | Oct. 19, 2015 |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 4 of 126 Report Version : Rev. 01

Issued Date : Oct. 19, 2015



1 General Description

1.1 Information

FCC ID: XCNDVW32C

1.1.1 RF General Information

| Specification Items | Description | | | |
|-----------------------------|--|--|--|--|
| Product Type | WLAN (3TX, 3RX) | | | |
| Radio Type | Intentional Transceiver | | | |
| Power Type | From battery 7.4V or Internal power supply | | | |
| Modulation | IEEE 802.11a: OFDM (BPSK / QPSK / 16QAM / 64QAM) | | | |
| | IEEE 802.11 n/ac: see the below table | | | |
| Data Rate (Mbps) | IEEE 802.11a: OFDM (6/9/12/18/24/36/48/54) | | | |
| | IEEE 802.11 n/ac: see the below table | | | |
| Channel Bandwidth | 20/40/80 MHz operating channel bandwidth | | | |
| | | | | |
| Operating Mode | Client with radar detection | | | |
| | Client without radar detection | | | |
| Communication Mode | | | | |
| TPC Function | | | | |
| Weather Band (5600~5650MHz) | | | | |

Report No.: FZ4O0315-01

: 5 of 126

: Rev. 01

: Oct. 19, 2015

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Page No.

Report Version
Issued Date



Max. Con. Power (DFS band) Band 2: For Non-Beamforming Mode 802.11a: 22.16 dBm; 802.11ac MCS0/Nss1 (VHT20): 22.24 dBm; 802.11ac MCS0/Nss1 (VHT40): 22.82 dBm; 802.11ac MCS0/Nss1 (VHT80): 22.09 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 21.81 dBm; 802.11ac MCS0/Nss1 (VHT40): 21.91 dBm; 802.11ac MCS0/Nss1 (VHT80): 21.86 dBm Band 3: For Non-Beamforming Mode 802.11a: 21.60 dBm; 802.11ac MCS0/Nss1 (VHT20): 21.60 dBm; 802.11ac MCS0/Nss1 (VHT40): 23.86 dBm; 802.11ac MCS0/Nss1 (VHT80): 23.93 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 21.30 dBm; 802.11ac MCS0/Nss1 (VHT40): 21.30 dBm; 802.11ac MCS0/Nss1 (VHT80): 21.24 dBm

SPORTON INTERNATIONAL INC. Page No. TEL: 886-3-327-3456 Report Versio

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 6 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Min. Con. Power (DFS band) Band 2: For Non-Beamforming Mode 802.11a: 16.16 dBm; 802.11ac MCS0/Nss1 (VHT20): 16.24 dBm; 802.11ac MCS0/Nss1 (VHT40): 16.82 dBm; 802.11ac MCS0/Nss1 (VHT80): 16.09 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 15.81 dBm; 802.11ac MCS0/Nss1 (VHT40): 15.91 dBm; 802.11ac MCS0/Nss1 (VHT80): 15.86 dBm Band 3: For Non-Beamforming Mode 802.11a: 15.60 dBm; 802.11ac MCS0/Nss1 (VHT20): 15.60 dBm; 802.11ac MCS0/Nss1 (VHT40): 17.86 dBm; 802.11ac MCS0/Nss1 (VHT80): 17.93 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 15.30 dBm; 802.11ac MCS0/Nss1 (VHT40): 15.30 dBm; 802.11ac MCS0/Nss1 (VHT80): 15.24 dBm

Report No.: FZ4O0315-01

: 7 of 126

: Rev. 01

: Oct. 19, 2015

Issued Date

SPORTON INTERNATIONAL INC. Page No.
TEL: 886-3-327-3456 Report Version

FAX: 886-3-327-0973 FCC ID: XCNDVW32C



Max. EIRP Power (DFS band) Band 2: For Non-Beamforming Mode 802.11a: 25.96 dBm; 802.11ac MCS0/Nss1 (VHT20): 26.04 dBm; 802.11ac MCS0/Nss1 (VHT40): 26.62 dBm; 802.11ac MCS0/Nss1 (VHT80): 25.89 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 29.88 dBm; 802.11ac MCS0/Nss1 (VHT40): 29.98 dBm; 802.11ac MCS0/Nss1 (VHT80): 29.93 dBm Band 3: For Non-Beamforming Mode 802.11a: 26.10 dBm; 802.11ac MCS0/Nss1 (VHT20): 26.10 dBm; 802.11ac MCS0/Nss1 (VHT40): 28.36 dBm; 802.11ac MCS0/Nss1 (VHT80): 28.43 dBm For Beamforming Mode 802.11ac MCS0/Nss1 (VHT20): 29.98 dBm; 802.11ac MCS0/Nss1 (VHT40): 29.98 dBm; 802.11ac MCS0/Nss1 (VHT80): 29.92 dBm

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 8 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



| Min. EIRP Power (DFS band) | Band 2: |
|-----------------------------|---|
| | For Non-Beamforming Mode |
| | 802.11a: 19.96 dBm ; |
| | 802.11ac MCS0/Nss1 (VHT20): 20.04 dBm ; |
| | 802.11ac MCS0/Nss1 (VHT40): 20.62 dBm ; |
| | 802.11ac MCS0/Nss1 (VHT80): 19.89 dBm |
| | For Beamforming Mode |
| | 802.11ac MCS0/Nss1 (VHT20): 23.88 dBm; |
| | 802.11ac MCS0/Nss1 (VHT40): 23.98 dBm ; |
| | 802.11ac MCS0/Nss1 (VHT80): 23.93 dBm |
| | Band 3: |
| | For Non-Beamforming Mode |
| | 802.11a: 20.10 dBm ; |
| | 802.11ac MCS0/Nss1 (VHT20): 20.10 dBm; |
| | 802.11ac MCS0/Nss1 (VHT40): 22.36 dBm; |
| | 802.11ac MCS0/Nss1 (VHT80): 22.43 dBm |
| | For Beamforming Mode |
| | 802.11ac MCS0/Nss1 (VHT20): 23.98 dBm; |
| | 802.11ac MCS0/Nss1 (VHT40): 23.98 dBm; |
| | 802.11ac MCS0/Nss1 (VHT80): 23.92 dBm |
| Power-on cycle | 80MHz: Requires 57.60 seconds to complete its power-on cycle. |
| Software / Firmware Version | 9.40.2105DFSv3 |

Report No.: FZ4O0315-01

Antenna & Band width

| Antenna | Three (TX) | | | | |
|-----------------|------------|--------|--------|--|--|
| Band width Mode | 20 MHz | 40 MHz | 80 MHz | | |
| IEEE 802.11a | V | X | X | | |
| IEEE 802.11n | V | V | X | | |
| IEEE 802.11ac | V | V | V | | |

 SPORTON INTERNATIONAL INC.
 Page No.
 : 9 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



IEEE 11n/ac Spec.

| ELE THINGS OPES. | | | | | | | |
|------------------|------------------------------------|-----------------|--|--|--|--|--|
| Protocol | Number of Transmit Chains (NTX) | Data Rate / MCS | | | | | |
| 802.11n (HT20) | 3 | MCS0-23 | | | | | |
| 802.11n (HT40) | 3 | MCS0-23 | | | | | |
| 802.11ac (VHT20) | 3 | MCS 0-9/Nss1-3 | | | | | |
| 802.11ac (VHT40) | 3 | MCS 0-9/Nss1-3 | | | | | |
| 802.11ac (VHT80) | 3 | MCS 0-9/Nss1-3 | | | | | |

Report No.: FZ4O0315-01

Note 1: IEEE Std. 802.11n modulation consists of HT20 and HT40 (HT: High Throughput). Then EUT support HT20 and HT40.

Note 2: IEEE Std. 802.11ac modulation consists of VHT20, VHT40, VHT80 and VHT160 (VHT: Very High Throughput). Then EUT support VHT20, VHT40 and VHT80.

Note 3: Modulation modes consist of below configuration:

11a: IEEE 802.11a, HT20/HT40: IEEE 802.11n, VHT20/VHT40/VHT80: IEEE 802.11ac

 SPORTON INTERNATIONAL INC.
 Page No.
 : 10 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 20

1.1.2 Antenna Information

| Set. | Ant. | Brand Holder | P/N | Antenna Type | Connector |
|------|------|-------------------------------|-----------------|--------------|-----------|
| | 1 | TONGDA COMMUNICATION CO., LTD | T-543-8201046-1 | PCB Antenna | I-PEX |
| 1 | 2 | TONGDA COMMUNICATION CO., LTD | T-543-8201046-1 | PCB Antenna | I-PEX |
| | 3 | TONGDA COMMUNICATION CO., LTD | T-543-8201046-1 | PCB Antenna | I-PEX |
| | 1 | WHA YU INDUSTRIAL CO., LTD. | C107-511155-A | PCB Antenna | I-PEX |
| 2 | 2 | WHA YU INDUSTRIAL CO., LTD. | C107-511155-A | PCB Antenna | I-PEX |
| | 3 | WHA YU INDUSTRIAL CO., LTD. | C107-511155-A | PCB Antenna | I-PEX |

Report No.: FZ4O0315-01

| Antenna Gain (dBi) | | | | | | |
|--------------------|-------|----------------------|-------|--------|-------|-------|
| Eroguenev | An | Ant. 1 Ant. 2 Ant. 3 | | Ant. 2 | | t. 3 |
| Frequency | Set 1 | Set 2 | Set 1 | Set 2 | Set 1 | Set 2 |
| 2400MHz | 4.815 | 5.0 | 5.424 | 5.5 | 4.567 | 4.6 |
| 2450MHz | 4.509 | 4.6 | 4.242 | 4.3 | 3.718 | 3.8 |
| 2500MHz | 4.978 | 5.0 | 4.860 | 5.0 | 4.771 | 4.9 |

| Antenna Gain (dBi) | | | | | | | |
|--------------------|--------|-------|--------|-------|--------|-------|--|
| Dond | Ant. 1 | | Ant. 2 | | Ant. 3 | | |
| Band | Set 1 | Set 2 | Set 1 | Set 2 | Set 1 | Set 2 | |
| Band 1 | 4.518 | 4.7 | 4.228 | 4.4 | 2.785 | 2.8 | |
| Band 2 | 4.518 | 3.8 | 3.342 | 3.5 | 2.326 | 2.5 | |
| Band 3 | 3.812 | 4.1 | 4.386 | 4.5 | 2.843 | 3.0 | |
| Band 4 | 4.301 | 4.5 | 5.217 | 5.4 | 3.469 | 3.6 | |

Note 1: The EUT has two sets of antennas and there are three antennas for each set.

Note 2: Because TONGDA antennas and WHAYU antennas are the same type antennas; only the low gain antennas "TONGDA antennas" was tested and recorded in the report.

For 2.4GHz function (3TX/3RX):

For IEEE 802.11b/g/n/ac mode:

Ant. 1, Ant. 2 and Ant. 3 can be used as transmitting/receiving antenna.

Ant. 1, Ant. 2 and Ant. 3 could transmit/receive simultaneously.

For 5Hz function (3TX/3RX):

For IEEE 802.11a/n/ac mode:

Ant. 1, Ant. 2 and Ant. 3 can be used as transmitting/receiving antenna.

Ant. 1, Ant. 2 and Ant. 3 could transmit/receive simultaneously.

 SPORTON INTERNATIONAL INC.
 Page No.
 : 11 of 126


 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015





Report No.: FZ4O0315-01

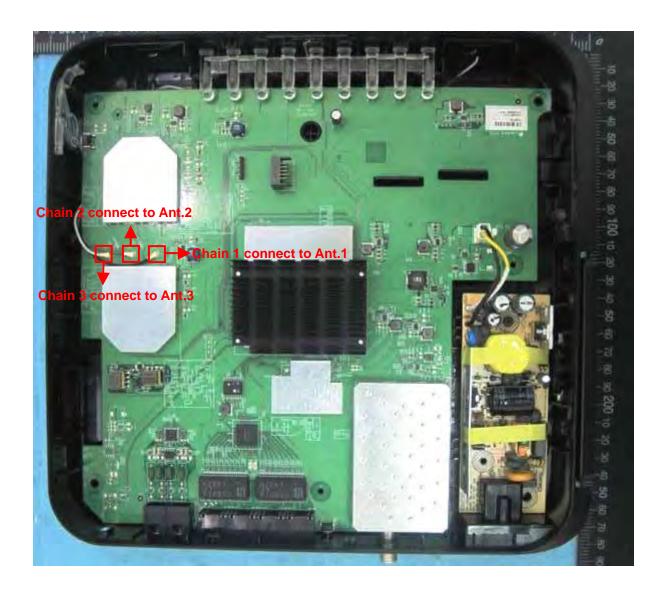

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 12 of 126 Report Version : Rev. 01

Issued Date : Oct. 19, 2015

1.1.3 DFS Band Carrier Frequencies

There are three bandwidth systems.

For 20MHz bandwidth systems, use Channel 52, 56, 60, 64, 100, 104, 108, 112, 116, 120, 124, 128, 132, 136, 140.

Report No.: FZ4O0315-01

For 40MHz bandwidth systems, use Channel 54, 62, 102, 110, 118, 126, 134.

For 80MHz bandwidth systems, use Channel 58, 106, 122.

| Frequency Band | Channel No. | Frequency | Channel No. | Frequency |
|-------------------------|-------------|-----------|-------------|-----------|
| | 52 | 5260 MHz | 60 | 5300 MHz |
| 5250~5350 MHz | 54 | 5270 MHz | 62 | 5310 MHz |
| Band 2 | 56 | 5280 MHz | 64 | 5320 MHz |
| | 58 | 5290 MHz | - | - |
| | 100 | 5500 MHz | 120 | 5600 MHz |
| | 102 | 5510 MHz | 122 | 5610 MHz |
| | 104 | 5520 MHz | 124 | 5620 MHz |
| 5470~5725 MHz | 106 | 5530 MHz | 126 | 5630 MHz |
| 5470~5725 MHZ Band 3 | 108 | 5540 MHz | 128 | 5640 MHz |
| Dallu 3 | 110 | 5550 MHz | 132 | 5660 MHz |
| | 112 | 5560 MHz | 134 | 5670 MHz |
| | 116 | 5580 MHz | 136 | 5680 MHz |
| | 118 | 5590 MHz | 140 | 5700 MHz |

 SPORTON INTERNATIONAL INC.
 Page No.
 : 13 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

1.2 **Accessories**

| Accessories | | | | | |
|---|-----|---------|-----------------------|--|--|
| Equipment Name Brand Name Model Name Rating | | | | | |
| Rechargeable Li-lon Battery | SMP | SMPCM10 | 7.4V, 2.55Ahr 18 87Wh | | |
| Others | | | | | |

Report No.: FZ4O0315-01

AC Power Cable*1, Non-shielded, 1.5m RJ-45 Cable*1, Non-shielded, 1.5m RJ-11 Cable*1, Non-shielded, 1.5m

1.3 **Support Equipment**

| | Support Equipment | | | | | | |
|-----|--|--------|-----------|--------------|--|--|--|
| No. | No. Equipment Brand Name Model Name FCC ID | | | | | | |
| 1 | Notebook | DELL | E4300 | DoC | | | |
| 2 | Notebook | DELL | E4300 | DoC | | | |
| 3 | WLAN Dongle | Belkin | F9L1106v1 | K7SF9L1106V1 | | | |

1.4 **Testing Applied Standards**

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

FCC KDB 905462 D02 UNII DFS Compliance Procedures New Rules v01r02

1.5 **Testing Location Information**

| | Testing Location | | | | | | |
|-------------|--|-----|--|--|--|--|--|
| | HWA YA | ADD | ADD : No. 52, Hwa Ya 1st Rd., Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C. | | | | |
| | TEL: 886-3-327-3456 FAX: 886-3-327-0973 | | | | | | |
| \boxtimes | JHUBEI | ADD |) : No.8, Lane 724, Bo-ai St., Jhubei City, HsinChu County 302, Taiwan, R.O.C. | | | | |
| | TEL: 886-3-656-9065 FAX: 886-3-656-9085 | | | | | | |
| Te | Test Condition Test Site No. Test Engineer Test Environment Test Date | | | | | | |
| | DFS Site DF01-CB Taka Hsu 29.4°C / 57% 07-Jul-15 ~ 23-Sep-15 | | | | | | |

SPORTON INTERNATIONAL INC. : 14 of 126 Page No. TEL: 886-3-327-3456 Report Version : Rev. 01 FAX: 886-3-327-0973 Issued Date : Oct. 19, 2015



2 Test Configuration of EUT

2.1 Test Channel Frequencies Configuration

| Test Channel Frequencies Configuration | | | | |
|--|----------|--|--|--|
| IEEE Std. Test Channel Freq. (MHz) | | | | |
| 802.11ac (VHT20) | 5500 MHz | | | |
| 802.11ac (VHT40) | 5510 MHz | | | |
| 802.11ac (VHT80) | 5530 MHz | | | |

Report No.: FZ4O0315-01

2.2 The Worst Case Measurement Configuration

| Th | The Worst Case Mode for Following Conformance Tests | | | |
|--|--|--|--|--|
| Tests Item Dynamic Frequency Selection (DFS) | | | | |
| Test Condition | Radiated measurement The EUT shall be configured to operate at the highest transmitter output power setting. If more than one antenna assembly is intended for this power setting, the gain of the antenna assembly with the lowest gain shall be used. The DFS radar test signals have been aligned to the direction corresponding to the EUT's maximum antenna gain. | | | |
| Modulation Mode | 802.11ac (VHT20), 802.11ac (VHT40), 802.11ac (VHT80) | | | |

 SPORTON INTERNATIONAL INC.
 Page No.
 : 15 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



3 Dynamic Frequency Selection (DFS) Test Result

3.1 General DFS Information

3.1.1 DFS Parameters

| Table D.1: DFS requirement values | | | | |
|-----------------------------------|---|--|--|--|
| Parameter Value | | | | |
| Non-occupancy period | Minimum 30 minutes | | | |
| Channel Availability Check Time | 60 seconds | | | |
| Channel Move Time | 10 seconds (Note 1). | | | |
| Channel Closing Transmission Time | 200 milliseconds + an aggregate of 60 milliseconds over remaining 10 second periods. (Notes 1 and 2). | | | |
| U-NII Detection Bandwidth | Minimum 100% of the 99% power bandwidth (Note 3). | | | |

Report No.: FZ4O0315-01

- Note 1: Channel Move Time and the Channel Closing Transmission Time should be performed with Radar Type 0. The measurement timing begins at the end of the Radar Type 0 burst.
- Note 2: The Channel Closing Transmission Time is comprised of 200 milliseconds starting at the beginning of the Channel Move Time plus any additional intermittent control signals required to facilitate Channel changes (an aggregate of 60 milliseconds) during the remainder of the 10 second period. The aggregate duration of control signals will not count quiet periods in between transmissions.
- Note 3: During the U-NII Detection Bandwidth detection test, radar type 1 is used and for each frequency step the minimum percentage of detection is 90%. Measurements are performed with no data traffic.

| Table D.2: Interference threshold values | | | | |
|--|---------|--|--|--|
| Maximum Transmit Power Value (see note) | | | | |
| EIRP ≥ 200 mW | -64 dBm | | | |
| EIRP < 200 mW and PSD < 10dBm/MHz | -62 dBm | | | |
| EIRP < 200 mW and PSD >= 10dBm/MHz | -64 dBm | | | |

- Note 1: This is the level at the input of the receiver assuming a 0 dBi receive antenna.
- Note 2: Throughout these test procedures an additional 1 dB has been added to the amplitude of the test transmission waveforms to account for variations in measurement equipment. This will ensure that the test signal is at or above the detection threshold level to trigger a DFS response.

Note3: EIRP is based on the highest antenna gain. For MIMO devices refer to KDB Publication 662911D01.

 SPORTON INTERNATIONAL INC.
 Page No.
 : 16 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

3.1.2 Applicability of DFS Requirements Prior to Use of a Channel

| | DFS Operational mode | | | |
|---------------------------------|----------------------|--------------------------------|-----------------------------|--|
| Requirement | Master | Client without radar detection | Client with radar detection | |
| Non-Occupancy Period | Yes Not required | | Yes | |
| DFS Detection Threshold | Yes | Not required | Yes | |
| Channel Availability Check Time | Yes | Not required | Not required | |
| U-NII Detection Bandwidth | Yes | Not required | Yes | |

3.1.3 Applicability of DFS Requirements during Normal Operation

| | DFS Operational mode | | | |
|-----------------------------------|----------------------|--------------------------------|-----------------------------|--|
| Requirement | Master | Client without radar detection | Client with radar detection | |
| DFS Detection Threshold | Yes | Not required | Yes | |
| Channel Closing Transmission Time | Yes | Yes | Yes | |
| Channel Move Time | Yes | Yes | Yes | |
| U-NII Detection Bandwidth | Yes | Not required | Yes | |

| Additional requirements for devices with multiple bandwidth modes | Master Device or Client with Radar Detection | Client Without Radar Detection | |
|---|--|--|--|
| U-NII Detection Bandwidth and Statistical Performance Check | All BW modes must be tested | Not required | |
| Channel Move Time and Channel Closing Transmission Time | Test using widest BW mode available | Test using the widest BW mode available for the link | |
| All other tests | Any single BW mode | Not required | |

Note: Frequencies selected for statistical performance check (Section 7.8.4) should include several frequencies within the radar detection bandwidth and frequencies near the edge of the radar detection bandwidth. For 802.11 devices it is suggested to select frequencies in each of the bonded 20 MHz channels and the channel center frequency.

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 17 of 126
Report Version : Rev. 01

Issued Date : Oct. 19, 2015



fixed talk/listen ratio, set the ratio to 45%/55%

3.1.4 User Access Restrictions

| | User Access Restrictions | | | | | |
|-------------|--|--|--|--|--|--|
| | DFS controls (hardware or software) related to radar detection are NOT accessible to the user. Manufacturer statement confirming that information regarding the parameters of the detected Radar Waveforms is not available to the end user. | | | | | |
| 3.1. | .5 Channel Loading/Data Streaming | | | | | |
| \boxtimes | IP Based (Load Based) - stream the test file from the Master to the Client. | | | | | |
| | ☐ The data file (MPEG-4) has been transmitting in a streaming mode. | | | | | |
| | ☐ Software to ping the client is permitted to simulate data transfer with random ping intervals. | | | | | |
| | Minimum channel loading of approximately 17%. | | | | | |
| | ☐ Unicast protocol has been used. | | | | | |
| | Frame Based - stream the test file from the Master to the Client. | | | | | |

Report No.: FZ4O0315-01

: 18 of 126

: Oct. 19, 2015

: Rev. 01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Page No.

Report Version
Issued Date



3.2 Radar Test Waveform Calibration

3.2.1 Short Pulse Radar Test Waveforms

| Radar Type | Pulse Width (µsec) | PRI (µsec) | Number of Pulses | Minimum Percentage of Successful Detection | Minimum Trials |
|---------------|-----------------------|---|--|--|-------------------|
| 0 | 1 | 1428 | 18 | See Note 1 | See Note 1 |
| 1A | 1 | 15 unique PRI in KDB 905462 D02 Table 5a | $Roundup \left\{ \left(\frac{1}{360} \right) \times \left(\frac{19 \times 10^6}{PRI} \right) \right\}$ | 60% | 15 |
| 1B | 1 | 15 unique PRI within 518-3066, Excluding 1A PRI | | 60% | 15 |
| 2 | 1-5 | 150-230 | 23-29 | 60% | 30 |
| 3 | 6-10 | 200-500 | 16-18 | 60% | 30 |
| 4 | 11-20 | 200-500 | 12-16 | 60% | 30 |
| Aggrega | ate (Radar Type | 80% | 120 | | |

Report No.: FZ4O0315-01

Note 1: Short Pulse Radar Type 0 should be used for the detection bandwidth test, channel move time, and channel closing time tests.

A minimum of 30 unique waveforms are required for each of the short pulse radar types 2 through 4. For short pulse radar type 1, the same waveform is used a minimum of 30 times. If more than 30 waveforms are used for short pulse radar types 2 through 4, then each additional waveform must also be unique and not repeated from the previous waveforms. The aggregate is the average of the percentage of successful detections of short pulse radar types 1-4.

3.2.2 Long Pulse Radar Test Waveform

| Radar Type | Pulse Width (µsec) | Chirp Width (MHz) | PRI (µsec) | Number of Pulses per <i>Burst</i> | Number of Bursts | Minimum Percentage of Successful Detection | Minimum Trials |
|---------------|--------------------------|-------------------------|------------|---|---------------------|---|-------------------|
| 5 | 50-100 | 5-20 | 1000-2000 | 1-3 | 8-20 | 80% | 30 |

Each waveform is defined as follows:

- The transmission period for the Long Pulse Radar test signal is 12 seconds.
- There are a total of 8 to 20 Bursts in the 12 second period, with the number of Bursts being randomly chosen. This number is Burst Count.
- Each Burst consists of 1 to 3 pulses, with the number of pulses being randomly chosen. Each Burst within the 12 second sequence may have a different number of pulses.
- The pulse width is between 50 and 100 microseconds, with the pulse width being randomly chosen. Each pulse within a Burst will have the same pulse width. Pulses in different Bursts may have different pulse widths.
- Each pulse has a linear FM chirp between 5 and 20 MHz, with the chirp width being randomly chosen. Each pulse within a Burst will have the same chirp width. Pulses in different Bursts may have different chirp widths. The chirp is centered on the pulse. For example, with a radar frequency of 5300 MHz and a 20 MHz chirped signal, the chirp starts at 5290 MHz and ends at 5310 MHz.
- If more than one pulse is present in a Burst, the time between the pulses will be between 1000 and 2000

 SPORTON INTERNATIONAL INC.
 Page No.
 : 19 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



microseconds, with the time being randomly chosen. If three pulses are present in a Burst, the time between the first and second pulses is chosen independently of the time between the second and third pulses.

The 12 second transmission period is divided into even intervals. The number of intervals is equal to Burst_Count. Each interval is of length (12,000,000 / Burst_Count) microseconds. Each interval contains one Burst. The start time for the Burst, relative to the beginning of the interval, is between 1 and [(12,000,000 / Burst_Count) – (Total Burst Length) + (One Random PRI Interval)] microseconds, with the start time being randomly chosen. The step interval for the start time is 1 microsecond. The start time for each Burst is chosen independently.

3.2.3 Frequency Hopping Radar Test Waveform


| Radar Type | Pulse Width (µsec) | PRI (µsec) | Pulses per Hop | Hopping Rate (kHz) | Hopping Sequence Length (ms) | Minimum Percentage of Successful Detection | Minimum Trials |
|---------------|--------------------------|---------------|-------------------|-----------------------|------------------------------------|---|-------------------|
| 6 | 1 | 333 | 9 | 0.333 | 300 | 70% | 30 |

The FCC Type 6 waveform uses a static waveform with 100 bursts in the instruments ARB. In addition, the RF list mode is operated with a list containing 100 frequencies from a randomly generated list and it had be ensured that at least one of the random frequencies falls into the UNII Detection Bandwidth of the DUT. Each burst from the waveform file initiates a trigger pulse at the beginning that switches the RF list from one item to the next one.

3.2.4 DFS Threshold Level

| DFS Threshold Level | | | | | |
|---|--------------------------|--|--|--|--|
| DFS Threshold level: -63 dBm | at the antenna connector | | | | |
| | in front of the antenna | | | | |
| The Interference Radar Detection Threshold Level is is $-64 dBm + 0 [dBi] + 1 dB = -63 dBm$. That had been taken into account the output power range and antenna gain. | | | | | |

3.2.5 Calibration Setup

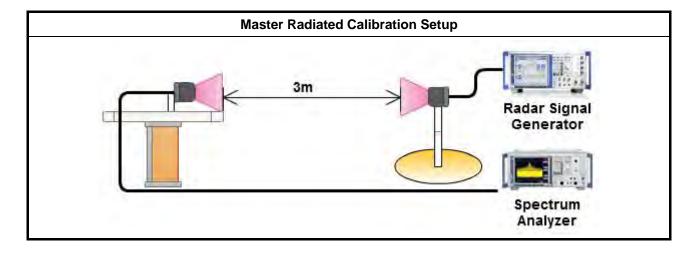

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 20 of 126
Report Version : Rev. 01

Report No.: FZ4O0315-01

Issued Date : Oct. 19, 2015




3.2.6 Radar Waveform calibration Plot

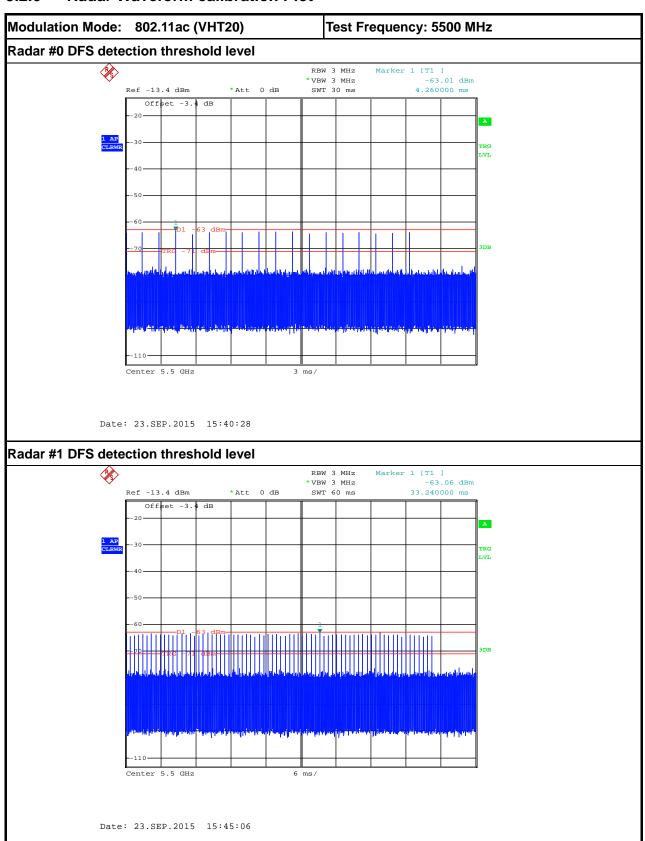

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 21 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



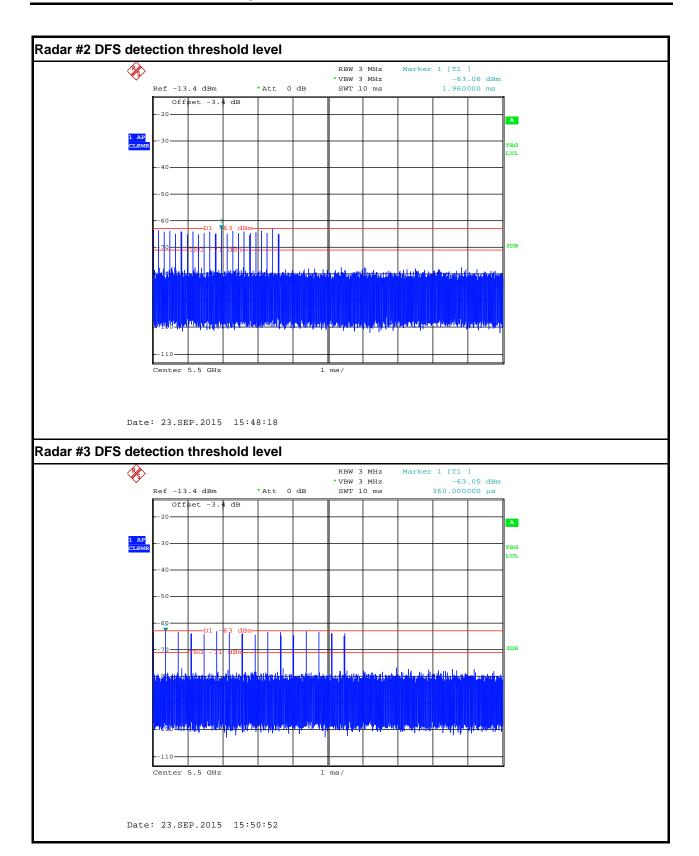

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 22 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



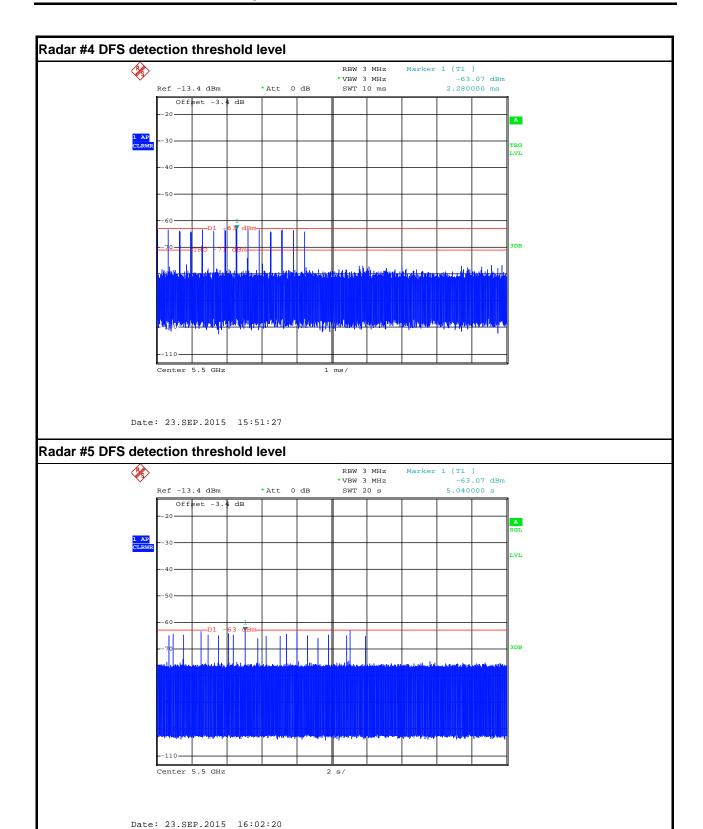


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 23 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015

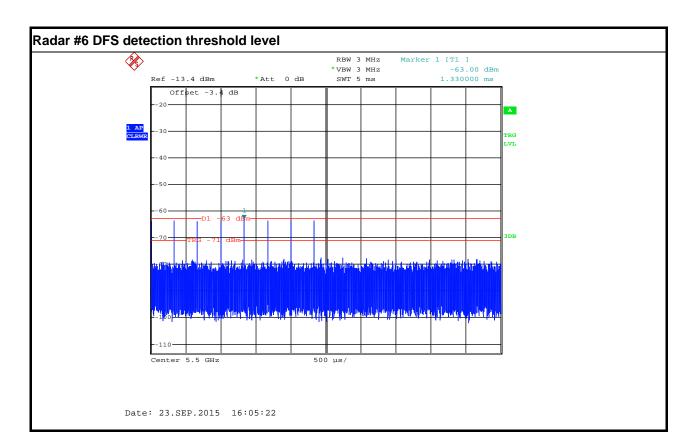

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 24 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015




SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 25 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015






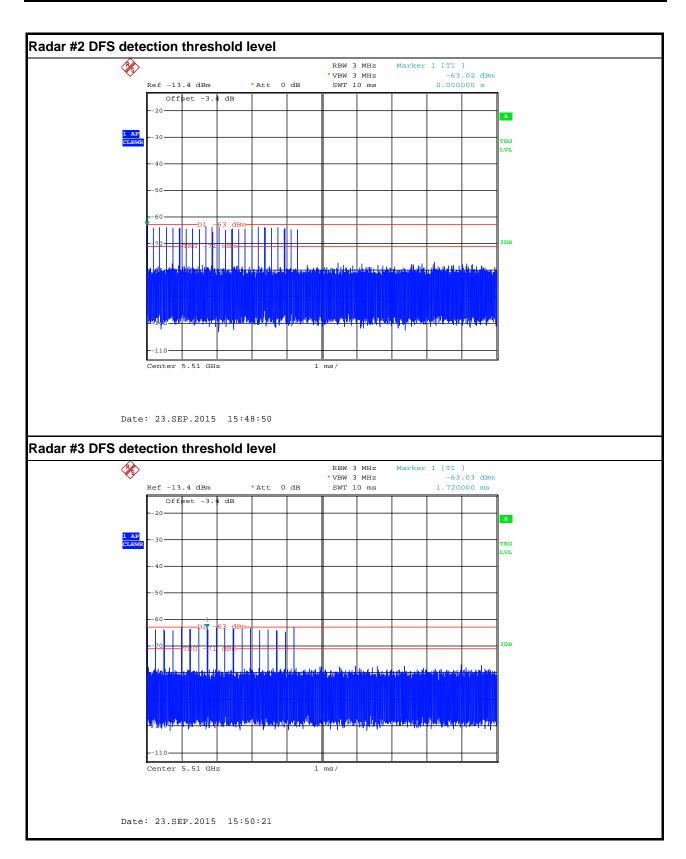

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 26 of 126 Report Version : Rev. 01 Issued Date : Oct. 19, 2015




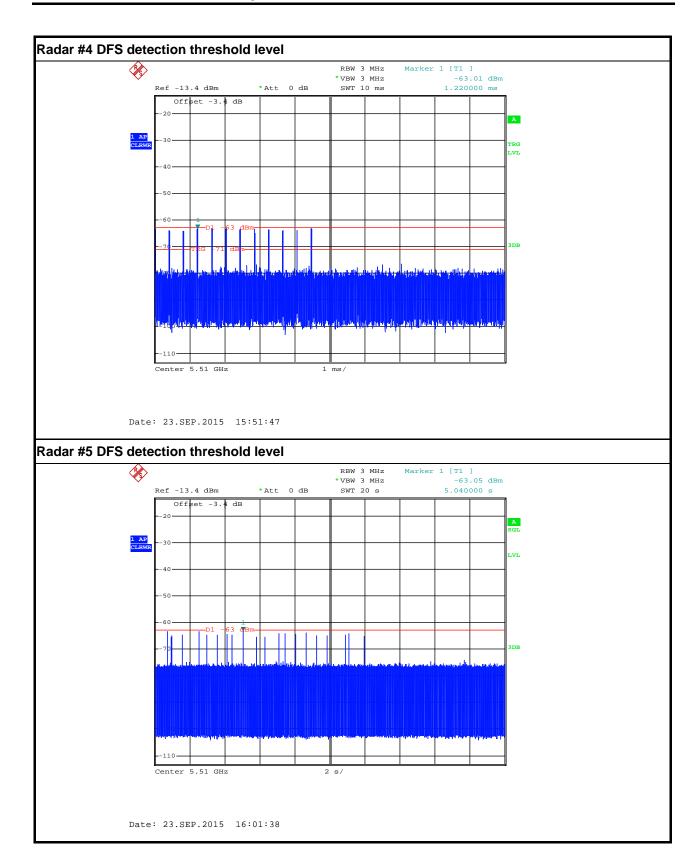

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 27 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015

Date: 23.SEP.2015 16:06:16

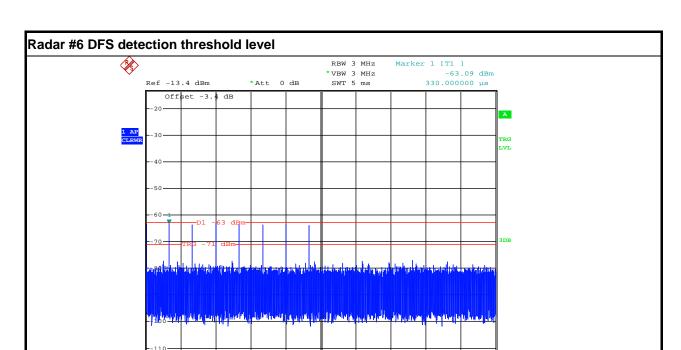

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 28 of 126

 Report Version
 : Rev. 01


 Issued Date
 : Oct. 19, 2015




SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 29 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



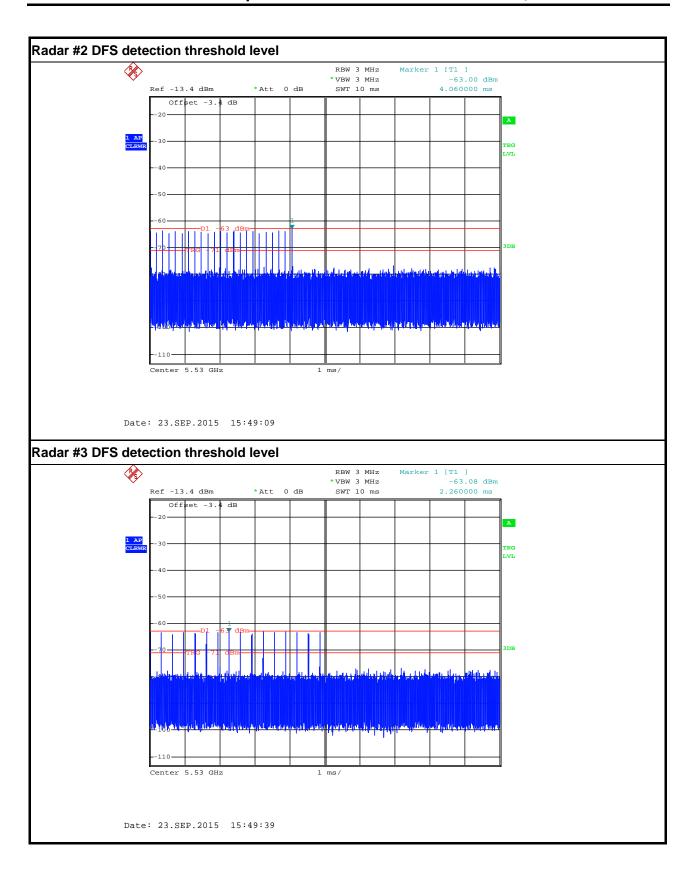


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 30 of 126 Report Version : Rev. 01 Issued Date : Oct. 19, 2015

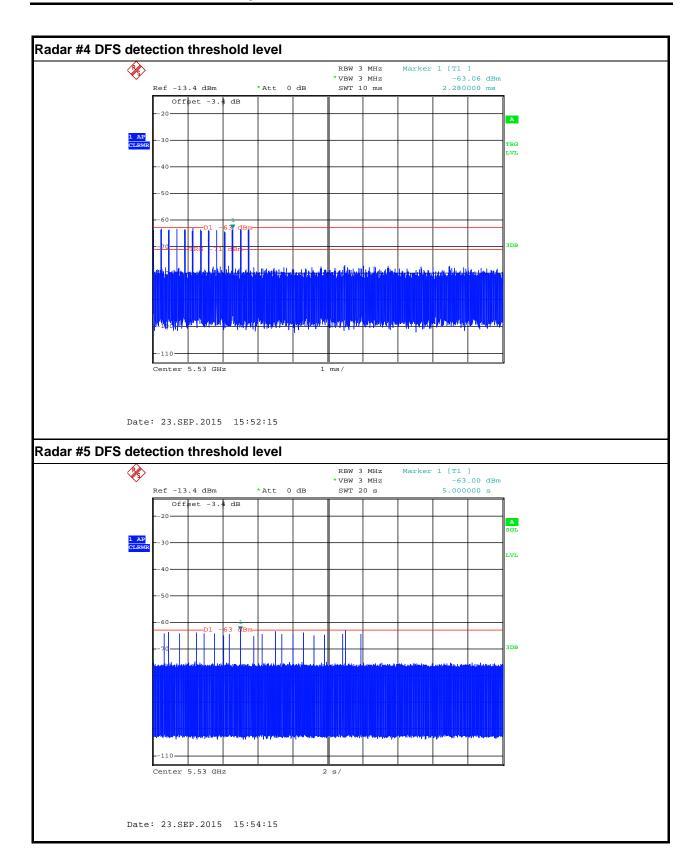

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 31 of 126 Report Version : Rev. 01 : Oct. 19, 2015 Issued Date

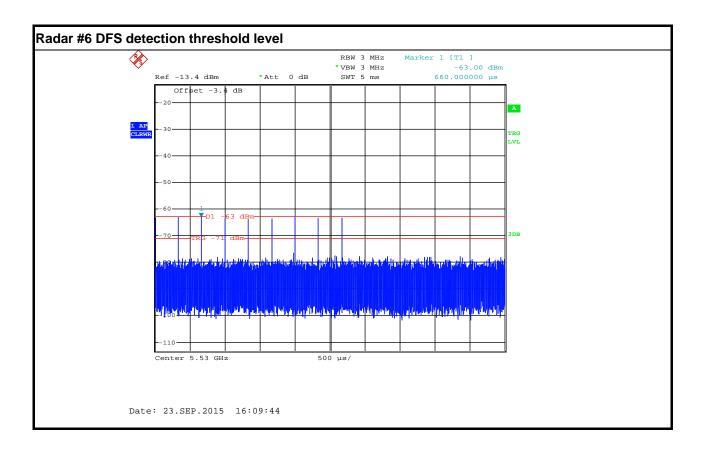


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 32 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



3.2.7 Test Setup

A spectrum analyzer is used as a monitor to verify that the EUT has vacated the Channel within the (Channel Closing Transmission Time and Channel Move Time, and does not transmit on a Channel during the Non-Occupancy Period after the detection and Channel move.

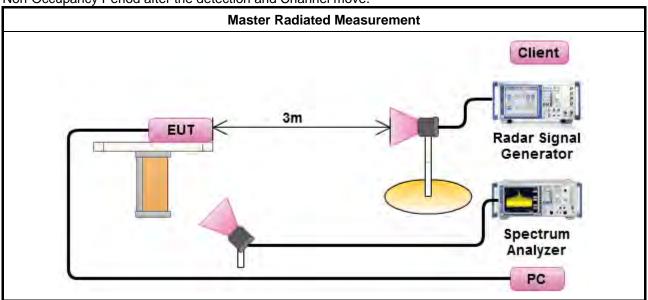


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 33 of 126 Report Version : Rev. 01

Issued Date : Oct. 19, 2015




3.2.8 Data traffic Plot

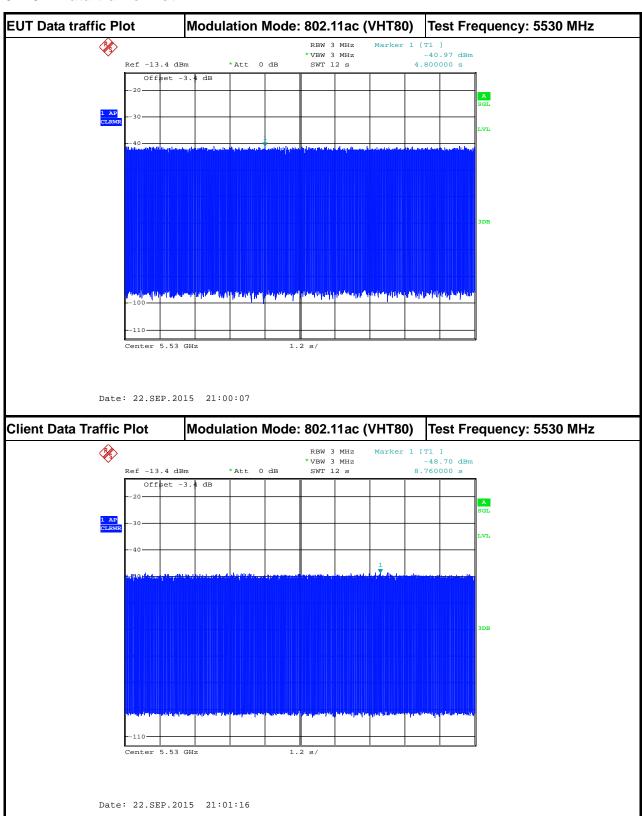

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 34 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



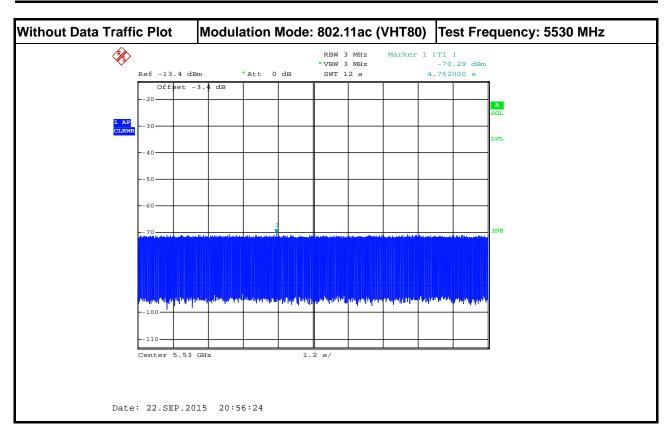

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 35 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015

3.3 UNII Detection Bandwidth

3.3.1 UNII Detection Bandwidth Limit

| Channel Bandwidth (MHz) | 99% Occupied Bandwidth (MHz) | UNII Detection Bandwidth Min. Limit (MHz) | ISM Type 5 Limit (MHz) |
|-------------------------|---------------------------------|--|---------------------------|
| 20 | 17.88 | 18 | 15 |
| 40 | 36.60 | 37 | 30 |
| 80 | 75.60 | 76 | 61 |

Report No.: FZ4O0315-01

UNII Detection Bandwidth is minimum 100% of the 99% power bandwidth. A single radar Burst is generated for a minimum of 10 trials, and the response of the UUT is noted. The UUT must detect the Radar Waveform 90% or more of the time.

The center frequency for each of the 30 trials of the Bin 5 radar shall be randomly selected within 80% of the Occupied Bandwidth.

3.3.2 Measuring Instruments

Refer a test equipment and calibration data table in this test report.

3.3.3 Test Procedures

Test Method

During the U-NII Detection Bandwidth detection test, radar type 1 is used and for each frequency step the minimum percentage of detection is 90 percent. Measurements are performed with no data traffic. The EUT is set up as a standalone device (no associated Client and no traffic). The radar frequency is increased in 1 MHz steps, repeating the above test sequence, until the detection rate falls below 90%. The highest frequency at which detection is greater than or equal to 90% is denoted as F_H. The radar frequency is decreased in 1 MHz steps, repeating the above test sequence, until the detection rate falls below 90%. The lowest frequency at which detection is greater than or equal to 90% is denoted as F_L. UNII Detection Bandwidth = F_H - F_L.

 SPORTON INTERNATIONAL INC.
 Page No.
 : 36 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

3.3.4 Test Result of UNII Detection Bandwidth

| EUT Frequency=5500 MHz | | | | | | | | | | | |
|---|----|--|------|---|---|-------|----|------------|---|----|----------------|
| Channel Bandwidth (MHz) | 20 | | quo. | , | | ····- | | | | | |
| Gramo: Banaman (mile) | | DFS Detection Trials (1=Detection, 0= No Det | | | | | | Detection) | | | |
| Radar Frequency (MHz) | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | Detection Rate |
| F400 | _ | _ | _ | 0 | _ | _ | 0 | _ | _ | _ | (%) |
| 5489 5490 | 0 | 0 | 0 | Ŭ | 0 | 0 | | 0 | 0 | 0 | 0 |
| | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | - | | · |
| 5491 (FL) -Type 0 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5492 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5493 (FL) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5494 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5495 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5496 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5497 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5498 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5499 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5500 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5501 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5502 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5503 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5504 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5506 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5507 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5508 (FH) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5509 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5510 (FH) -Type 0 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 1 | 1 | 1 | 90 |
| Radar Type 0-Detection Bandwidth (MHz) = (FH-FL) = (5510MHz-5491MHz)= | | | | | | | 19 | | | | |
| UNII Detection Bandwidth Min. Limit (MHz) = | | | | | | | 18 | | | | |
| Radar Type 5-Detection Bandwidth (MHz) = (FH-FL) = (5507MHz-5493MHz)= | | | | | | 15 | | | | | |
| ISM Type 5 Limit (MHz) = | | | | | | 15 | | | | | |
| Test Result | | | | | | | | | | | Complied |

Report No.: FZ4O0315-01

: 37 of 126

: Oct. 19, 2015

: Rev. 01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Report Version
Issued Date



| | EU | T Fre | equer | ncy= | 510 | MHz | | | | | |
|---|-------|-------|-------|-------|-------|--------|-------|--------|-------|------|--------------------|
| Channel Bandwidth (MHz) | 40 | | | - | | | | | | | |
| | | DF | S De | tecti | on Tr | ials (| 1=De | etecti | on, 0 | = No | Detection) |
| Radar Frequency (MHz) | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | Detection Rate (%) |
| 5490 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| 5491 (FL) -Type 0 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5492 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5493 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5494 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5495 (FL) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5496 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5497 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5498 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5499 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5500 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5510 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5515 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5520 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5525 (FH) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5526 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5527 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5528 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5529 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5530 (FH) -Type 0 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 1 | 1 | 90 |
| 5531 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| Radar Type 0-Detection Bandwidth (MHz) = (FH-FL) = (5530MHz-5491MHz)= | | | | | | 39 | | | | | |
| UNII Detection Bandwidth Min. Limit (MHz) = | | | | | | 37 | | | | | |
| Radar Type 5-Detection Bandwidth | (MHz) | = (FF | I-FL) | = (55 | 25MI | -lz-54 | 195MI | Hz)= | | | 30 |
| SM Type 5 Limit (MHz) = | | | | | | | | | | | 30 |
| Test Result | | | | | | | | | | | Complied |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 38 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| | FU | T Fre | auer | cv=! | 5530 | MHz | | | | | |
|---|---|-------|------|---------------|---|--------|------|-------|-------|------|----------------|
| Channel Bandwidth (MHz) | 80 | | quoi | . | ,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,, | | | | | | |
| Onamor Banawidan (mile) | | DF | S De | tecti | on Tr | ials (| 1=De | tecti | on. O | = No | Detection) |
| Radar Frequency (MHz) | | | | | | Ι, | | | | | Detection Rate |
| , | 1 | 2 | 3 | 4 | 5 | 6 | 7 | 8 | 9 | 10 | (%) |
| 5491 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | O´ |
| 5492 (FL) -Type 0 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 1 | 1 | 90 |
| 5495 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5496 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5497 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5498 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5499 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5500 (FL) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5505 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5510 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5515 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5520 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5525 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 90 |
| 5530 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 90 |
| 5535 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 0 | 90 |
| 5540 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5545 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5550 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5555 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5560 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5561 (FH) -Type 5 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5562 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5563 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5564 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5565 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 1 | 100 |
| 5568 (FH) -Type 0 | 1 | 1 | 1 | 1 | 0 | 1 | 1 | 1 | 1 | 1 | 90 |
| 5569 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 | 0 |
| Radar Type 0-Detection Bandwidth (MHz) = (FH-FL) = (5569MHz-5491MHz)= | | | | | | 76 | | | | | |
| UNII Detection Bandwidth Min. Limit (MHz) = | | | | | | 76 | | | | | |
| Radar Type 5-Detection Bandwidth (I | Radar Type 5-Detection Bandwidth (MHz) = (FH-FL) = (5568MHz-5492MHz)= | | | | | | 61 | | | | |
| ISM Type 5 Limit (MHz) = | | | | | | | | | | | 61 |
| Test Result | | | | | | | | | | | Complied |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 39 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015

TOO BI O TEST REPORT

3.4 Channel Availability Check (CAC)

3.4.1 Channel Availability Check Limit

Channel Availability Check Limit

Report No.: FZ4O0315-01

The EUT shall perform a Channel Availability Check to ensure that there is no radar operating on the channel. After power-up sequence, receive at least 1 minute (60 sec) on the intended operating frequency.

3.4.2 Measuring Instruments

Refer a test equipment and calibration data table in this test report.

3.4.3 Test Procedures

Test Method

- For Initial Channel Availability Check Time. The EUT does not emit beacon, control, or data signals on the test Channel until the power-up sequence has been completed and the UNII device checks for Radar Waveforms for one minute on the test Channel. This test does not use any Radar Waveforms.
- For Radar Burst at the Beginning of the Channel Availability Check Time. To verify successful radar detection on the selected Channel during a period equal to the Beginning of the Channel Availability Check Time.
- For Radar Burst at the End of the Channel Availability Check Time. To verify successful radar detection on the selected Channel during a period equal to the End of the Channel Availability Check Time.

 SPORTON INTERNATIONAL INC.
 Page No.
 : 40 of 126


 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

3.4.4 Test Result of Initial Channel Availability Check Time

| Modulation Mode | Freq. | Radar Test Signal |
|------------------|----------|-------------------|
| 802.11ac (VHT80) | 5290 MHz | N/A |

The EUT does not transmit any beacon or data transmissions until at least 1 minute after the completion of the power-on cycle (55.20 sec). The initial power up time of the EUT is indicated by marker 1 (55.20 sec). Initial beacons/data transmissions are indicated by marker 2 (115.20 sec).

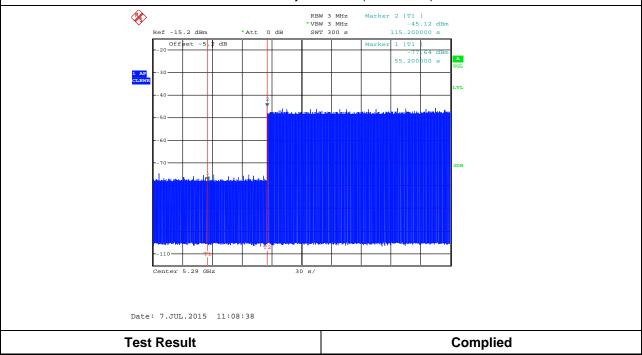

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 41 of 126


 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Modulation Mode | Freq. | Radar Test Signal |
|------------------|----------|-------------------|
| 802.11ac (VHT80) | 5530 MHz | N/A |

The EUT does not transmit any beacon or data transmissions until at least 1 minute after the completion of the power-on cycle (57.60 sec). The initial power up time of the EUT is indicated by marker 1 (57.60 sec). Initial beacons/data transmissions are indicated by marker 2 (117.60 sec).

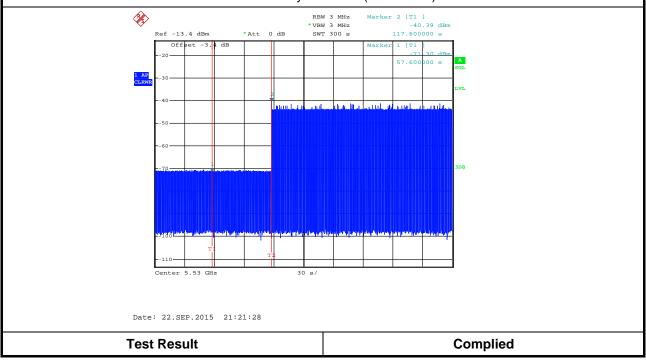

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 42 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



3.4.5 Test Result of Radar Burst at the Beginning of the Channel Availability Check Time

| Modulation Mode | Freq. (MHz) | Radar Type Signal |
|------------------|-------------|-------------------|
| 802.11ac (VHT80) | 5290 MHz | 0 |

Visual indication on the EUT of successful detection of the radar Burst will be recorded and reported. Observation of emissions will continue for 55.80 seconds after the radar Burst has been generated. Verify that during the 244.20 seconds measurement window no EUT transmissions occurred.

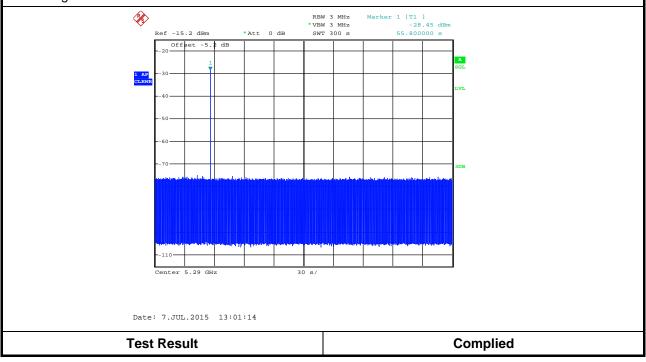


 ${\tt SPORTON\ INTERNATIONAL\ INC.}$

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 43 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Modulation Mode | Freq. (MHz) | Radar Type Signal |
|------------------|-------------|-------------------|
| 802.11ac (VHT80) | 5530 MHz | 0 |

Visual indication on the EUT of successful detection of the radar Burst will be recorded and reported. Observation of emissions will continue for 60.00 seconds after the radar Burst has been generated. Verify that during the 240.00 seconds measurement window no EUT transmissions occurred.

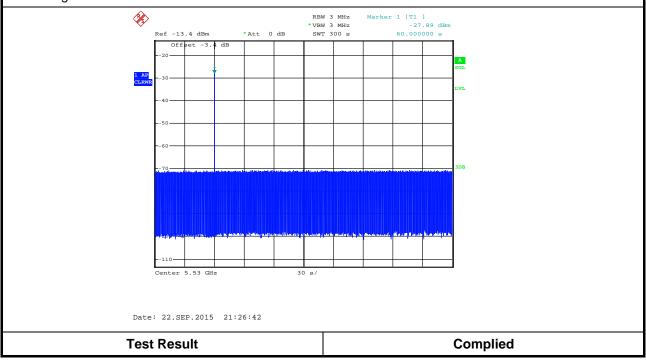

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 44 of 126


 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015

3.4.6 Test Result of Radar Burst at the End of the Channel Availability Check Time

| Modulation Mode | Freq. (MHz) | Radar Type Signal |
|------------------|-------------|-------------------|
| 802.11ac (VHT80) | 5290 MHz | 0 |

Visual indication on the EUT of successful detection of the radar Burst will be recorded and reported. Observation of emissions will continue for 114.00 seconds after the radar Burst has been generated. Verify that during the 186.00 seconds measurement window no EUT transmissions occurred.

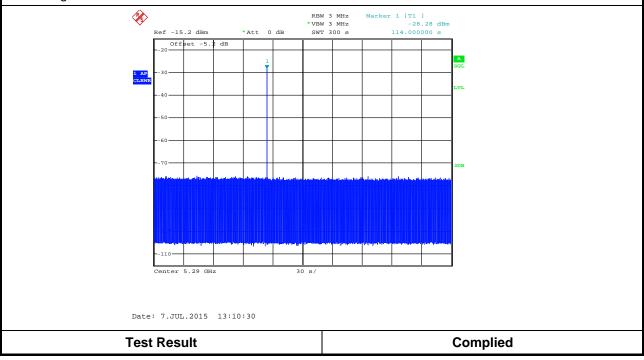


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 45 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Modulation Mode | Freq. (MHz) | Radar Type Signal |
|------------------|-------------|-------------------|
| 802.11ac (VHT80) | 5530 MHz | 0 |

Visual indication on the EUT of successful detection of the radar Burst will be recorded and reported. Observation of emissions will continue for 114.00 seconds after the radar Burst has been generated. Verify that during the 186.00 seconds measurement window no EUT transmissions occurred.

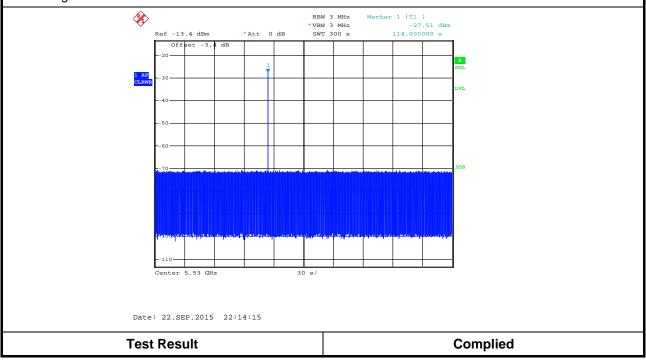

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 46 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015

3.5 In-service Monitoring

3.5.1 In-service Monitoring Limit

| In-service Monitoring Limit | | | | |
|-----------------------------------|---|--|--|--|
| Channel Move Time | 10 sec | | | |
| Channel Closing Transmission Time | 200 ms + an aggregate of 60 ms over remaining 10 sec periods. | | | |
| Non-occupancy period | Minimum 30 minutes | | | |

Report No.: FZ4O0315-01

3.5.2 Measuring Instruments

Refer a test equipment and calibration data table in this test report.

3.5.3 Test Procedures

Test Method

- ✓ Verified during In-Service Monitoring; Channel Closing Transmission Time, Channel Move Time. Client Device will associate with the EUT. Observe the transmissions of the EUT at the end of the radar Burst on the Operating Channel for duration greater than 10 seconds. Measure and record the transmissions from the EUT during the observation time (Channel Move Time). Compare the Channel Move Time and Channel Closing Transmission Time limits.
- ✓ Verified during In-Service Monitoring; Channel Closing Transmission Time, Channel Move Time. One 12 sec plot needs to be reported for the Short Pulse Radar Types 0. And zoom-in a 60 ms plot verified channel closing time for the aggregate transmission time starting from 200ms after the end of the radar signal to the completion of the channel move.
- Verified during In-Service Monitoring; Non-Occupancy Period. Client Device will associate with the EUT. Observe the transmissions of the EUT at the end of the radar Burst on the Operating Channel for duration greater than 10 seconds. Measure and record the transmissions from the EUT during the observation time (Non-Occupancy Period). Compare the Non-Occupancy Period limits.

 SPORTON INTERNATIONAL INC.
 Page No.
 : 47 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



3.5.4 Test Result of In-service Monitoring

Modulation Mode: 802.11ac (VHT80)

| Parameter | Test Result | Limit | |
|---|-------------|----------|--|
| Farameter | Туре 0 | Lillit | |
| Test Channel (MHz) | 5530 MHz | - | |
| Channel Move Time (sec.) | 4.032 | < 10s | |
| Channel Closing Transmission Time (ms) (Note) | 49.375 | < 60ms | |
| Non-Occupancy Period (min.) | ≧30 | ≧ 30 min | |

Report No.: FZ4O0315-01

Note: The Channel Closing Transmission Time is comprised of 200 milliseconds starting at the beginning of the Channel Move Time plus any additional intermittent control signals required to facilitate a Channel move (an aggregate of 60 milliseconds) during the remainder of the 10 seconds period. The aggregate duration of control signals will not count quiet periods in between transmissions.


 SPORTON INTERNATIONAL INC.
 Page No.
 : 48 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



3.5.5 Test Plot of In-Service Monitoring for Channel Move Time

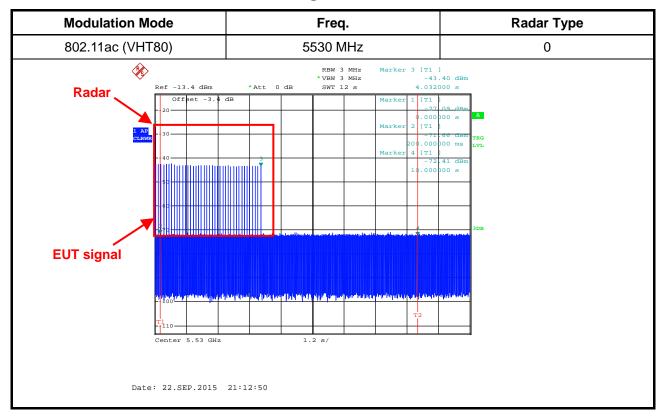

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 49 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



3.5.6 Test Plot of In-Service Monitoring for Channel Closing Transmission Time

| Modulation Mode | Freq. | Radar Type |
|------------------|----------|------------|
| 802.11ac (VHT80) | 5530 MHz | 0 |

Channel Closing Transmission Time is comprised of 200 ms starting at the beginning of the Channel Move Time plus 60ms additional intermittent control signals

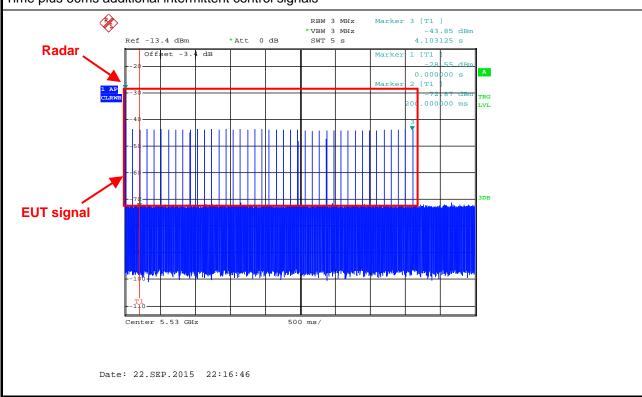

Dwell is the dwell time per spectrum analyzer sampling bin.

S is the sweep time

B is the number of spectrum analyzer sampling bins

C is the intermittent control signals of Channel Closing Transmission Time

N is the number of spectrum analyzer sampling bins (intermittent control signals) showing a U-NII transmission

Dwell (0.63 ms)= S (5000 ms) / B (8000)

C (49.375 ms) = N (79) X Dwell (0.63 ms)

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456


FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 50 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015

3.5.7 Test Plot of In-Service Monitoring for Non-Occupancy Period

| Modulation Mode | Freq. | | |
|------------------|----------|--|--|
| 802.11ac (VHT80) | 5530 MHz | | |

Non-Occupancy Period

During the 30 minutes observation time, UUT did not make any transmissions on a channel after a radar signal was detected on that channel by either the Channel Availability Check or the In-Service Monitoring.

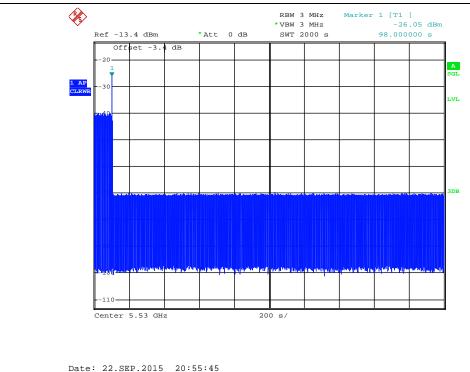

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 51 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015

3.6 **Statistical Performance Check**

3.6.1 **Statistical Performance Check Limit**

| Radar Type | Minimum Percentage of Successful Detection (Pd) | Minimum Trials |
|-----------------------------|--|----------------|
| 1 | 60% | 30 |
| 2 | 60% | 30 |
| 3 | 60% | 30 |
| 4 | 60% | 30 |
| Aggregate (Radar Types 1-4) | 80% | 120 |
| 5 | 80% | 30 |
| 6 | 70% | 30 |

Report No.: FZ4O0315-01

In addition an aggregate minimum percentage of successful detection across all Short Pulse Radar Types 1-4 is required and is calculated as follows:

Pd1 + Pd2 + Pd3 + Pd4

4

3.6.2 **Measuring Instruments**

Refer a test equipment and calibration data table in this test report.

3.6.3 **Test Procedures**

Test Method

For Statistical Performance Check test. Stream the MPEG test file from the Master Device to the Client Device on the test Channel for the entire period of the test. Observe the transmissions of the UUT at the end of the Burst on the Operating Channel for duration greater than 10 seconds for Short Pulse Radar Types 1-4 and 6 to ensure detection occurs. Then Observe the transmissions of the UUT at the end of the Burst on the Operating Channel for duration greater than 22 seconds for Long Pulse Radar Type 5 to ensure detection occurs. The device can utilize a test mode to demonstrate when detection occurs to prevent the need to reset the device between trial runs.

SPORTON INTERNATIONAL INC. Page No. : 52 of 126 TEL: 886-3-327-3456 Report Version : Rev. 01 FAX: 886-3-327-0973 Issued Date : Oct. 19, 2015

The percentage of successful detection is calculated by:

 $[\]frac{TotalWaveformDetections}{-} \times 100 = Probability of Detection Radar Waveform$ TotalWaveformTrails



3.6.4 Test Result of Statistical Performance Check

Modulation Mode: 802.11ac (VHT20)

Type 1 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Repetition Frequency Number | Pulse Repetition Frequency (Pulse Per Second) | PRI (us) | 1=Detection 0=No Detection |
|----------|------------------|--------------------------------------|---|----------|-------------------------------|
| 1 | 5490 | 1 | 1930.5 | 518 | 1 |
| 2 | 5491 | 23 | 326.2 | 3066 | 1 |
| 3 | 5492 | 19 | 1139.0 | 878 | 0 |
| 4 | 5493 | 12 | 1355.0 | 738 | 0 |
| 5 | 5494 | 4 | 1730.1 | 578 | 0 |
| 6 | 5495 | 8 | 1519.8 | 658 | 1 |
| 7 | 5496 | 15 | 1253.1 | 798 | 1 |
| 8 | 5497 | 6 | 1618.1 | 618 | 1 |
| 9 | 5498 | 14 | 1285.3 | 778 | 1 |
| 10 | 5499 | 3 | 1792.1 | 558 | 1 |
| 11 | 5500 | 13 | 1319.3 | 758 | 1 |
| 12 | 5501 | 9 | 1474.9 | 678 | 1 |
| 13 | 5502 | 7 | 1567.4 | 638 | 1 |
| 14 | 5503 | 17 | 1193.3 | 838 | 1 |
| 15 | 5504 | 10 | 1432.7 | 698 | 1 |
| 16 | 5505 | - | 1692.0 | 591 | 1 |
| 17 | 5506 | - | 328.1 | 3048 | 1 |
| 18 | 5507 | - | 373.4 | 2678 | 1 |
| 19 | 5508 | - | 574.4 | 1741 | 0 |
| 20 | 5509 | - | 1216.5 | 822 | 1 |
| 21 | 5508 | - | 801.3 | 1248 | 1 |
| 22 | 5500 | - | 488.5 | 2047 | 1 |
| 23 | 5499 | - | 956.0 | 1046 | 1 |
| 24 | 5498 | - | 517.6 | 1932 | 0 |
| 25 | 5497 | - | 1422.5 | 703 | 1 |
| 26 | 5496 | - | 542.0 | 1845 | 1 |
| 27 | 5495 | - | 741.3 | 1349 | 1 |
| 28 | 5494 | - | 881.8 | 1134 | 1 |
| 29 | 5493 | - | 427.4 | 2340 | 1 |
| 30 | 5491 | - | 628.9 | 1590 | 1 |
| | | etection Percentage (| (%) | | 83.33 |
| Limit | 60% | | | | |
| Test Res | ult | | <u> </u> | | Complied |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 53 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



Type 2 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|-----------------|------------------|------------------|----------|----------------|-------------------------------|
| 1 | 5490 | 2.6 | 221 | 23 | 0 |
| 2 | 5491 | 4.6 | 198 | 27 | 1 |
| 3 | 5492 | 1.1 | 184 | 29 | 1 |
| 4 | 5493 | 4.8 | 203 | 24 | 1 |
| 5 | 5494 | 2.4 | 162 | 25 | 1 |
| 6 | 5495 | 3.4 | 204 | 28 | 1 |
| 7 | 5496 | 2.3 | 170 | 27 | 1 |
| 8 | 5497 | 3.5 | 184 | 23 | 1 |
| 9 | 5498 | 4.9 | 150 | 27 | 0 |
| 10 | 5499 | 4.6 | 211 | 29 | 1 |
| 11 | 5500 | 2.9 | 158 | 23 | 0 |
| 12 | 5501 | 2.6 | 226 | 27 | 1 |
| 13 | 5502 | 1.6 | 204 | 26 | 1 |
| 14 | 5503 | 3.9 | 181 | 25 | 1 |
| 15 | 5504 | 4.6 | 202 | 24 | 1 |
| 16 | 5505 | 4.1 | 194 | 27 | 1 |
| 17 | 5506 | 2.3 | 193 | 28 | 1 |
| 18 | 5507 | 3.9 | 173 | 29 | 1 |
| 19 | 5508 | 4.3 | 188 | 23 | 0 |
| 20 | 5509 | 1.5 | 215 | 26 | 1 |
| 21 | 5508 | 4.9 | 227 | 27 | 1 |
| 22 | 5500 | 1.1 | 199 | 23 | 1 |
| 23 | 5499 | 4.5 | 155 | 29 | 0 |
| 24 | 5498 | 4.0 | 190 | 27 | 1 |
| 25 | 5497 | 2.4 | 151 | 23 | 1 |
| 26 | 5496 | 2.5 | 180 | 28 | 1 |
| 27 | 5495 | 2.5 | 228 | 23 | 1 |
| 28 | 5494 | 2.5 | 203 | 25 | 0 |
| 29 | 5493 | 1.5 | 188 | 25 | 1 |
| 30 | 5491 | 1.9 | 217 | 24 | 1 |
| | 80.00 | | | | |
| Limit | 60% | | | | |
| Test Res | ult | | | | Complied |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 54 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 3 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection ; 0=No Detection |
|-----------------|------------------|------------------|----------|----------------|---------------------------------|
| 1 | 5490 | 8.0 | 205 | 16 | 1 |
| 2 | 5491 | 6.7 | 382 | 18 | 0 |
| 3 | 5492 | 8.6 | 418 | 16 | 1 |
| 4 | 5493 | 9.4 | 351 | 17 | 1 |
| 5 | 5494 | 7.4 | 383 | 18 | 1 |
| 6 | 5495 | 9.8 | 232 | 16 | 1 |
| 7 | 5496 | 9.1 | 377 | 17 | 0 |
| 8 | 5497 | 9.6 | 457 | 16 | 1 |
| 9 | 5498 | 8.0 | 471 | 18 | 1 |
| 10 | 5499 | 9.0 | 304 | 18 | 1 |
| 11 | 5500 | 8.0 | 316 | 17 | 1 |
| 12 | 5501 | 9.8 | 325 | 16 | 1 |
| 13 | 5502 | 8.0 | 409 | 17 | 1 |
| 14 | 5503 | 9.9 | 200 | 17 | 1 |
| 15 | 5504 | 8.8 | 458 | 16 | 1 |
| 16 | 5505 | 8.0 | 232 | 18 | 0 |
| 17 | 5506 | 8.3 | 250 | 16 | 1 |
| 18 | 5507 | 8.7 | 270 | 16 | 0 |
| 19 | 5508 | 7.7 | 350 | 17 | 1 |
| 20 | 5509 | 7.1 | 230 | 16 | 1 |
| 21 | 5508 | 7.3 | 416 | 18 | 1 |
| 22 | 5500 | 7.6 | 498 | 18 | 1 |
| 23 | 5499 | 7.3 | 286 | 17 | 1 |
| 24 | 5498 | 7.3 | 287 | 16 | 1 |
| 25 | 5497 | 7.5 | 462 | 17 | 1 |
| 26 | 5496 | 6.2 | 300 | 17 | 1 |
| 27 | 5495 | 6.4 | 323 | 18 | 1 |
| 28 | 5494 | 7.1 | 420 | 16 | 1 |
| 29 | 5493 | 7.2 | 395 | 18 | 1 |
| 30 | 5491 | 8.4 | 377 | 16 | 0 |
| | 83.33 | | | | |
| Limit | 60% | | | | |
| Test Res | Complied | | | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 55 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 4 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|---------|------------------|-----------------------------|----------|----------------|-------------------------------|
| 1 | 5490 | 18.0 | 242 | 15 | 1 |
| 2 | 5491 | 19.9 | 279 | 12 | 1 |
| 3 | 5492 | 12.9 | 487 | 14 | 1 |
| 4 | 5493 | 15.0 | 452 | 13 | 1 |
| 5 | 5494 | 16.3 | 230 | 12 | 1 |
| 6 | 5495 | 19.8 | 238 | 13 | 1 |
| 7 | 5496 | 18.2 | 420 | 16 | 1 |
| 8 | 5497 | 16.3 | 452 | 15 | 1 |
| 9 | 5498 | 14.2 | 495 | 12 | 1 |
| 10 | 5499 | 17.8 | 228 | 16 | 1 |
| 11 | 5500 | 19.1 | 211 | 16 | 1 |
| 12 | 5501 | 18.4 | 283 | 15 | 1 |
| 13 | 5502 | 11.8 | 411 | 12 | 1 |
| 14 | 5503 | 14.2 | 284 | 13 | 0 |
| 15 | 5504 | 13.9 | 202 | 12 | 1 |
| 16 | 5505 | 17.8 | 340 | 14 | 1 |
| 17 | 5506 | 15.6 | 290 | 16 | 1 |
| 18 | 5507 | 14.6 | 250 | 16 | 1 |
| 19 | 5508 | 14.4 | 484 | 15 | 1 |
| 20 | 5509 | 18.9 | 387 | 13 | 1 |
| 21 | 5508 | 11.1 | 348 | 15 | 1 |
| 22 | 5500 | 13.8 | 291 | 16 | 1 |
| 23 | 5499 | 14.3 | 295 | 12 | 0 |
| 24 | 5498 | 12.5 | 300 | 12 | 1 |
| 25 | 5497 | 12.5 | 322 | 14 | 1 |
| 26 | 5496 | 12.5 | 383 | 13 | 1 |
| 27 | 5495 | 15.7 | 322 | 16 | 1 |
| 28 | 5494 | 19.8 | 469 | 13 | 0 |
| 29 | 5493 | 18.6 | 406 | 15 | 0 |
| 30 | 5491 | 15.9 etection Percentage (% | 238 | 14 | 1 |
| | | 86.67 | | | |
| imit | | | | | 60% |
| est Res | ult | | | | Complied |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 56 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Total Type 1~4 Radar Statistical Performance

| Radar Type # | Detection Percentage (%) |
|-----------------------------|--------------------------|
| 1 | 83.33 |
| 2 | 80.00 |
| 3 | 83.33 |
| 4 | 86.67 |
| Aggregate (Radar Types 1-4) | 88.33 |
| Limit | 80% |
| Test Result | Complied |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Page No.

Report Version
Issued Date

FCC ID: XCNDVW32C

Page No. : 57 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 5 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection |
|--------------------------|---------------------|-------------------------------|---------|---------------------|-------------------------------|---------|---------------------|----------------------------------|
| 1 | 5491 | 0 | 11 | 5502 | 1 | 21 | 5509 | 1 |
| 2 | 5492 | 1 | 12 | 5503 | 1 | 22 | 5495 | 1 |
| 3 | 5493 | 1 | 13 | 5504 | 1 | 23 | 5504 | 1 |
| 4 | 5494 | 0 | 14 | 5505 | 0 | 24 | 5503 | 0 |
| 5 | 5496 | 1 | 15 | 5506 | 1 | 25 | 5502 | 1 |
| 6 | 5497 | 1 | 16 | 5507 | 1 | 26 | 5501 | 1 |
| 7 | 5498 | 1 | 17 | 5508 | 1 | 27 | 5500 | 1 |
| 8 | 5499 | 0 | 18 | 5509 | 1 | 28 | 5499 | 1 |
| 9 | 5500 | 1 | 19 | 5508 | 1 | 29 | 5498 | 1 |
| 10 | 5501 | 1 | 20 | 5507 | 1 | 30 | 5490 | 1 |
| Detection Percentage (%) | | | | | | | | 83.33 |
| Limit | | | | | | | 80% | |
| Test Result | | | | | | | | Complied |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 58 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 1 | | | |
|--------------------------------------|-------------------|----------------|----------------------|------------------------------|------|---|
| Number of Bur | sts in Trial | | | 3 | 3 | |
| Chirp Center F | requency | | | 54 | 91 | |
| Burst No. of Pulses Pulse Width (us) | | | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) |
| 1 | 1 | 62.3 | 8 | - | - | 346 |
| 2 | 2 | 51.2 | 15 | 1745 | - | 1205 |
| 3 | 3 | 93.6 | 5 | 957 | 1634 | 674 |
| 4 | 3 | 68.2 | 12 | 1668 | 1573 | 384 |
| 5 | 3 | 83.1 | 8 | 1188 | 1888 | 876 |
| 6 | 1 | 56.7 | 18 | - | - | 376 |
| 7 | 2 | 60.6 | 18 | 1874 | - | 1409 |
| 8 | 3 | 75.5 | 13 | 1263 | 1683 | 1378 |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 0 |

| Trial Number | , | | 2 | | | | |
|---------------|----------------------|---------------------|-------------------|------|------------------------------|---|--|
| Number of B | of Bursts in Trial 9 | | | 9 | | | |
| Chirp Center | Frequency | | | 54 | 92 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 1 | 99.6 | 13 | - | - | 217 | |
| 2 | 2 | 54.8 | 15 | 1727 | - | 982 | |
| 3 | 3 | 91.1 | 15 | 1120 | 1826 | 941 | |
| 4 | 2 | 76.2 | 7 | 1638 | - | 477 | |
| 5 | 1 | 88.9 | 13 | - | - | 259 | |
| 6 | 1 | 83 | 9 | - | - | 892 | |
| 7 | 1 | 83.9 | 12 | - | - | 320 | |
| 8 | 2 | 55.9 | 15 | 1613 | - | 445 | |
| 9 | 1 | 96.1 | 13 | - | - | 779 | |
| Detection Che | eck (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 59 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | Trial Number Number of Bursts in Trial | | | 3 | | | |
|----------------|--|---------------------|----------------------|---|------|------|--|
| Number of Bu | | | | 10 | | | |
| Chirp Center F | requency | | | 54 | 93 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 2 | 82 | 6 | 1246 | - | 1017 | |
| 2 | 1 | 93.2 | 13 | - | - | 760 | |
| 3 | 2 | 61.3 | 13 | 1175 | - | 327 | |
| 4 | 1 | 52.8 | 8 | - | - | 824 | |
| 5 | 3 | 70.6 | 19 | 929 | 1076 | 115 | |
| 6 | 1 | 80.3 | 17 | - | - | 325 | |
| 7 | 1 | 83.2 | 15 | - | - | 679 | |
| 8 | 2 | 94 | 9 | 1805 | - | 888 | |
| 9 | 2 | 67 | 8 | 1486 | - | 849 | |
| 10 | 1 | 56.4 | 20 | - | - | 813 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 4 | | | | |
|-----------------------|---------------------------|---------------------|----------------------|---|------|------|--|
| Number of Bur | Number of Bursts in Trial | | | 11 | | | |
| Chirp Center F | requency | | | 54 | 94 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 3 | 90.5 | 8 | 1149 | 1612 | 35 | |
| 2 | 3 | 54.5 | 8 | 1094 | 1525 | 1014 | |
| 3 | 1 | 57.1 | 18 | - | - | 827 | |
| 4 | 2 | 98.6 | 20 | 1292 | - | 83 | |
| 5 | 2 | 62.9 | 12 | 1433 | - | 676 | |
| 6 | 1 | 71.1 | 15 | - | - | 708 | |
| 7 | 1 | 96.7 | 5 | - | - | 711 | |
| 8 | 1 | 64.3 | 5 | - | - | 484 | |
| 9 | 3 | 61.2 | 8 | 1075 | 1524 | 444 | |
| 10 | 2 | 79.2 | 13 | 1877 | - | 797 | |
| 11 | 2 | 79.3 | 20 | 1313 | - | 288 | |
| Detection Chec | k (1=Detection; C | =No Detection) | • | | | 0 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 60 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 5 | | | |
|------------------------|-------------------|---------------------|---|------|------|---------------|
| Number of Bur | sts in Trial | | 12 | | | |
| Chirp Center Frequency | | | | 54 | 96 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Spacing (us) Starting Location Spacing (us) Within | | | |
| 1 | 1 | 89.5 | 13 | _ | - | Interval (ms) |
| 2 | 3 | 71.8 | 11 | 1446 | 1549 | 117 |
| 3 | 3 | 53.7 | 15 | 1100 | 1517 | 485 |
| 4 | 2 | 99.3 | 11 | 1571 | - | 334 |
| 5 | 3 | 56.8 | 6 | 1594 | 1280 | 468 |
| 6 | 1 | 97.4 | 11 | - | - | 213 |
| 7 | 2 | 67.6 | 13 | 1831 | - | 14 |
| 8 | 3 | 77.1 | 8 | 1683 | 1337 | 267 |
| 9 | 1 | 98.5 | 17 | - | - | 544 |
| 10 | 3 | 58.3 | 13 | 1924 | 1829 | 159 |
| 11 | 1 | 98.4 | 14 | - | - | 380 |
| 12 | 1 | 79.3 | 11 | - | - | 257 |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 |

| Trial Number | | | 6 | | | | |
|------------------------|-------------------|---------------------|---|------|------|-----|--|
| Number of Bur | rsts in Trial | | | 13 | | | |
| Chirp Center Frequency | | | | 54 | 97 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Spacing (us) Pulse 2-to-3 Loc Spacing (us) W | | | | |
| 1 | 2 | 53.8 | 14 | 1631 | - | 768 | |
| 2 | 1 | 90 | 17 | - | - | 530 | |
| 3 | 3 | 87.2 | 18 | 1115 | 1297 | 157 | |
| 4 | 2 | 82 | 11 | 1728 | ı | 892 | |
| 5 | 3 | 69.8 | 7 | 1641 | 1779 | 196 | |
| 6 | 2 | 63.1 | 20 | 1836 | ı | 331 | |
| 7 | 1 | 59.8 | 6 | - | - | 495 | |
| 8 | 3 | 78.5 | 19 | 941 | 1921 | 546 | |
| 9 | 1 | 85.7 | 6 | - | ı | 219 | |
| 10 | 3 | 67.7 | 9 | 1834 | 1450 | 534 | |
| 11 | 2 | 84.5 | 15 | 1376 | - | 282 | |
| 12 | 2 | 99.3 | 13 | 1570 | - | 486 | |
| 13 | 2 | 80.2 | 8 | 1088 | - | 67 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 61 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | Trial Number | | | 7 | | | | |
|-----------------------|------------------------|---------------------|----------------------|---|------|-----|--|--|
| Number of Bu | rsts in Trial | | 14 | | | | | |
| Chirp Center F | Chirp Center Frequency | | | 54 | 98 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | | |
| 1 | 3 | 80.8 | 10 | 1061 | 1124 | 389 | | |
| 2 | 2 | 81 | 9 | 1479 | - | 234 | | |
| 3 | 2 | 87.6 | 17 | 1247 | - | 577 | | |
| 4 | 2 | 94.7 | 18 | 1041 | - | 572 | | |
| 5 | 2 | 78 | 18 | 1267 | - | 313 | | |
| 6 | 1 | 95.5 | 14 | - | - | 52 | | |
| 7 | 2 | 97.6 | 15 | 1215 | - | 57 | | |
| 8 | 3 | 88 | 9 | 1349 | 1598 | 171 | | |
| 9 | 2 | 69.7 | 17 | 1711 | - | 769 | | |
| 10 | 2 | 96.5 | 17 | 1431 | - | 168 | | |
| 11 | 2 | 96.9 | 6 | 1871 | - | 124 | | |
| 12 | 3 | 66.4 | 10 | 1824 | 1468 | 766 | | |
| 13 | 1 | 78.8 | 10 | - | - | 537 | | |
| 14 | 3 | 87.6 | 6 | 1080 | 1159 | 714 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

Report No.: FZ4O0315-01

: 62 of 126

: Oct. 19, 2015

: Rev. 01

| Trial Number | | | 8 | | | | |
|------------------------|--------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | rsts in Trial | | 15 | | | | |
| Chirp Center Frequency | | | | 54 | 99 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 2 | 71.8 | 14 | 1432 | - | 573 | |
| 2 | 2 | 65.9 | 19 | 1762 | - | 314 | |
| 3 | 2 | 74.7 | 6 | 1754 | - | 377 | |
| 4 | 3 | 81.7 | 5 | 1133 | 974 | 216 | |
| 5 | 3 | 57.8 | 14 | 1176 | 1712 | 129 | |
| 6 | 1 | 80.6 | 6 | - | - | 341 | |
| 7 | 3 | 99.3 | 17 | 1268 | 1876 | 165 | |
| 8 | 1 | 79.8 | 12 | - | • | 618 | |
| 9 | 3 | 83 | 11 | 990 | 1738 | 589 | |
| 10 | 3 | 71.5 | 11 | 1473 | 1255 | 6 | |
| 11 | 1 | 77.4 | 11 | - | • | 127 | |
| 12 | 2 | 84.8 | 12 | 1390 | - | 515 | |
| 13 | 2 | 64.6 | 12 | 1653 | - | 148 | |
| 14 | 2 | 92.9 | 12 | 1881 | - | 519 | |
| 15 | 1 | 71.3 | 6 | - | - | 301 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 0 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Report Version
Issued Date



| Trial Number | Trial Number | | | 9 | | | | |
|-----------------------|------------------------|---------------------|----------------------|------|------------------------------|---|--|--|
| Number of Bu | rsts in Trial | | 16 | | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 00 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 55.4 | 9 | 1318 | - | 383 | | |
| 2 | 2 | 80.8 | 18 | 1710 | - | 534 | | |
| 3 | 1 | 88.8 | 9 | - | - | 495 | | |
| 4 | 2 | 78 | 12 | 1818 | - | 92 | | |
| 5 | 1 | 78.5 | 12 | - | - | 108 | | |
| 6 | 2 | 55 | 13 | 1219 | - | 123 | | |
| 7 | 2 | 75.9 | 20 | 1004 | - | 123 | | |
| 8 | 2 | 70.9 | 7 | 1820 | - | 546 | | |
| 9 | 2 | 71.7 | 18 | 1559 | - | 476 | | |
| 10 | 2 | 73.9 | 19 | 1232 | - | 235 | | |
| 11 | 1 | 59.2 | 20 | - | - | 424 | | |
| 12 | 1 | 55.7 | 9 | - | - | 391 | | |
| 13 | 3 | 60.9 | 12 | 1144 | 1370 | 198 | | |
| 14 | 2 | 60.8 | 14 | 990 | - | 16 | | |
| 15 | 3 | 60.6 | 19 | 1526 | 1326 | 695 | | |
| 16 | 2 | 89 | 5 | 1029 | - | 131 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | | | | 10 | | | | |
|----------------------|------------------------|---------------------|----------------------|------------------------------|------|---|--|--|
| Number of Bu | ırsts in Trial | | 17 | | | | | |
| Chirp Center | Chirp Center Frequency | | | 55 | 01 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | | |
| 1 | 2 | 72.1 | 14 | 1119 | - | 488 | | |
| 2 | 3 | 81.4 | 13 | 1142 | 961 | 451 | | |
| 3 | 3 | 92.9 | 18 | 991 | 1147 | 565 | | |
| 4 | 3 | 81.3 | 18 | 1793 | 1369 | 285 | | |
| 5 | 3 | 76.4 | 20 | 1005 | 1793 | 79 | | |
| 6 | 1 | 61.6 | 18 | - | - | 503 | | |
| 7 | 1 | 66.6 | 19 | - | - | 181 | | |
| 8 | 1 | 53.7 | 12 | - | - | 416 | | |
| 9 | 2 | 58 | 8 | 1477 | - | 107 | | |
| 10 | 2 | 64 | 18 | 1791 | - | 141 | | |
| 11 | 2 | 80.3 | 12 | 1304 | - | 516 | | |
| 12 | 3 | 77.3 | 5 | 1039 | 1668 | 372 | | |
| 13 | 2 | 97.6 | 11 | 1593 | - | 163 | | |
| 14 | 1 | 73 | 6 | - | - | 147 | | |
| 15 | 3 | 65.1 | 8 | 1097 | 1927 | 102 | | |
| 16 | 2 | 59.5 | 13 | 1569 | - | 182 | | |
| 17 | 1 | 88.2 | 19 | - | - | 653 | | |
| Detection Che | ck (1=Detection; C | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 63 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 11 | | | | |
|-----------------------|------------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | rsts in Trial | | 18 | | | | |
| Chirp Center I | Chirp Center Frequency | | | 55 | 02 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 2 | 56.1 | 12 | 1219 | - | 273 | |
| 2 | 1 | 83.3 | 7 | - | - | 298 | |
| 3 | 3 | 79.6 | 17 | 1218 | 1897 | 159 | |
| 4 | 2 | 95.8 | 7 | 1672 | - | 480 | |
| 5 | 2 | 79.6 | 8 | 920 | - | 387 | |
| 6 | 2 | 88.9 | 11 | 1779 | - | 5 | |
| 7 | 2 | 81.4 | 8 | 1645 | - | 201 | |
| 8 | 2 | 92 | 6 | 1454 | - | 80 | |
| 9 | 3 | 96 | 13 | 1518 | 1121 | 192 | |
| 10 | 2 | 65.6 | 11 | 1798 | - | 349 | |
| 11 | 2 | 98.7 | 5 | 1360 | - | 416 | |
| 12 | 2 | 52.9 | 15 | 1140 | - | 652 | |
| 13 | 2 | 76.5 | 8 | 1032 | - | 92 | |
| 14 | 3 | 73.8 | 18 | 1719 | 1383 | 502 | |
| 15 | 3 | 83.7 | 10 | 1270 | 1216 | 343 | |
| 16 | 2 | 89.6 | 10 | 1141 | - | 108 | |
| 17 | 2 | 67.2 | 20 | 1455 | - | 272 | |
| 18 | 3 | 55.7 | 14 | 1444 | 1475 | 566 | |
| Detection Chec | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 64 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | | 1 | 2 | | |
|---------------|--------------------|---------------------|----------------------|------------------------------|------|---|--|
| Number of Bu | ırsts in Trial | | 19 | | | | |
| Chirp Center | Frequency | | | 55 | 03 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 2 | 70.6 | 15 | 1040 | - | 575 | |
| 2 | 2 | 72.9 | 13 | 1460 | - | 178 | |
| 3 | 3 | 88.9 | 5 | 1250 | 1629 | 191 | |
| 4 | 3 | 60.3 | 20 | 1757 | 1822 | 468 | |
| 5 | 3 | 92.1 | 19 | 1845 | 1198 | 476 | |
| 6 | 1 | 73 | 5 | - | - | 532 | |
| 7 | 1 | 50.4 | 15 | - | - | 69 | |
| 8 | 1 | 66.4 | 10 | - | - | 333 | |
| 9 | 1 | 79.1 | 18 | - | - | 437 | |
| 10 | 1 | 71.6 | 20 | - | - | 424 | |
| 11 | 2 | 95.6 | 13 | 1229 | - | 498 | |
| 12 | 1 | 74.4 | 9 | - | - | 363 | |
| 13 | 3 | 55.6 | 17 | 1263 | 1724 | 123 | |
| 14 | 2 | 78.3 | 13 | 1507 | - | 37 | |
| 15 | 3 | 54.1 | 13 | 1325 | 1249 | 192 | |
| 16 | 2 | 67.1 | 18 | 1584 | - | 311 | |
| 17 | 2 | 65.8 | 9 | 1195 | - | 243 | |
| 18 | 2 | 50.1 | 12 | 1755 | - | 48 | |
| 19 | 2 | 87.7 | 18 | 1359 | - | 180 | |
| Detection Che | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 65 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | | 1 | 3 | | |
|-----------------------|--------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 20 | | | | |
| Chirp Center I | Frequency | | | 55 | 04 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 3 | 79.5 | 7 | 1808 | 1550 | 274 | |
| 2 | 2 | 76.7 | 20 | 1632 | - | 573 | |
| 3 | 3 | 85.9 | 12 | 1305 | 1496 | 18 | |
| 4 | 3 | 86.6 | 14 | 968 | 1172 | 133 | |
| 5 | 2 | 74.9 | 14 | 1348 | - | 48 | |
| 6 | 3 | 82.2 | 20 | 1692 | 1310 | 156 | |
| 7 | 2 | 53.9 | 13 | 1342 | - | 45 | |
| 8 | 3 | 62.7 | 15 | 1839 | 1651 | 76 | |
| 9 | 2 | 86.2 | 6 | 1165 | - | 91 | |
| 10 | 1 | 63.1 | 11 | - | - | 391 | |
| 11 | 2 | 82.4 | 6 | 1416 | - | 107 | |
| 12 | 1 | 95.8 | 18 | - | - | 248 | |
| 13 | 2 | 75.7 | 9 | 993 | - | 482 | |
| 14 | 3 | 70.1 | 18 | 1563 | 1020 | 354 | |
| 15 | 3 | 85.8 | 13 | 1420 | 1084 | 446 | |
| 16 | 1 | 63.2 | 7 | - | - | 265 | |
| 17 | 1 | 75.1 | 11 | - | | 147 | |
| 18 | 2 | 69.5 | 5 | 1802 | - | 256 | |
| 19 | 1 | 51.8 | 19 | - | - | 422 | |
| 20 | 2 | 62.3 | 5 | 1449 | - | 304 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 14 | | | | |
|---------------------------|-------------------|---------------------|--|------|------|---------------|--|
| Number of Bursts in Trial | | | | 3 | 3 | | |
| Chirp Center Frequency | | | | 55 | 05 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Locat (MHz) Spacing (us) Spacing (us) With | | | | |
| | | | | | | Interval (ms) | |
| 1 | 3 | 74.9 | 5 | 1314 | 1466 | 1289 | |
| 2 | 2 | 83.9 | 19 | 1442 | - | 1436 | |
| 3 | 2 | 55.8 | 6 | 1147 | - | 240 | |
| 4 | 2 | 59.4 | 6 | 1490 | - | 1455 | |
| 5 | 2 | 78.2 | 15 | 1665 | - | 1312 | |
| 6 | 2 | 57.3 | 15 | 1357 | - | 264 | |
| 7 | 2 | 76.2 | 11 | 1651 | - | 255 | |
| 8 | 3 | 59 | 7 1460 1109 1410 | | | | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 66 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 15 | | | | |
|------------------------|---------------------------|---------------------|----------------------|---|------|------|--|
| Number of Bu | Number of Bursts in Trial | | | ę |) | | |
| Chirp Center Frequency | | | | 55 | 06 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 3 | 77.7 | 19 | 1046 | 1568 | 17 | |
| 2 | 2 | 98.2 | 20 | 1628 | - | 877 | |
| 3 | 2 | 95.3 | 8 | 1540 | - | 1066 | |
| 4 | 2 | 78.8 | 15 | 1341 | - | 822 | |
| 5 | 2 | 52.8 | 20 | 988 | - | 1020 | |
| 6 | 2 | 65.2 | 9 | 1480 | - | 602 | |
| 7 | 2 | 99.5 | 10 | 1867 | - | 884 | |
| 8 | 2 | 79.5 | 13 | 1148 | - | 342 | |
| 9 | 3 | 50.6 | 13 1030 1525 1321 | | | | |
| Detection Chec | ck (1=Detection; C | =No Detection) | | | | 1 | |

| Trial Number | | | 16 | | | | |
|------------------------|---------------------------|---------------------|----------------------|---|----|------|--|
| Number of Bur | Number of Bursts in Trial | | | 10 | | | |
| Chirp Center Frequency | | | | 55 | 07 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 2 | 97.5 | 11 | 1357 | - | 764 | |
| 2 | 2 | 91.8 | 13 | 1896 | ı | 298 | |
| 3 | 1 | 78.5 | 5 | - | ı | 1117 | |
| 4 | 1 | 60.1 | 11 | - | ı | 1069 | |
| 5 | 2 | 96.2 | 10 | 975 | - | 1157 | |
| 6 | 2 | 56.6 | 18 | 1626 | - | 701 | |
| 7 | 1 | 77.1 | 20 | - | - | 323 | |
| 8 | 2 | 96.3 | 8 | 1682 | ı | 307 | |
| 9 | 2 | 52.2 | 13 | 1017 | - | 217 | |
| 10 | 1 | 92.8 | 15 | - | - | 316 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 67 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | Trial Number | | | 17 | | | | |
|----------------|---------------------------|---------------------|--|------|------|-----|--|--|
| Number of Bu | Number of Bursts in Trial | | | 11 | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 08 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Local MHz) Spacing (us) Spacing (us) With Interval | | | | | |
| 1 | 2 | 57.3 | 8 | 1220 | - | 792 | | |
| 2 | 3 | 73.1 | 5 | 1717 | 1679 | 845 | | |
| 3 | 2 | 54.1 | 14 | 967 | - | 112 | | |
| 4 | 2 | 98.8 | 19 | 1137 | - | 715 | | |
| 5 | 3 | 85.5 | 8 | 1068 | 960 | 301 | | |
| 6 | 2 | 78.5 | 7 | 1387 | - | 827 | | |
| 7 | 2 | 77.9 | 12 | 1869 | - | 506 | | |
| 8 | 1 | 81.9 | 10 | - | - | 549 | | |
| 9 | 1 | 50.4 | 9 | - | - | 464 | | |
| 10 | 1 | 75.2 | 8 | - | - | 790 | | |
| 11 | 2 | 92.7 | 7 | 1770 | - | 967 | | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | Trial Number Number of Bursts in Trial Chirp Center Frequency | | | 18 12 5509 | | | |
|-----------------------|---|---------------------|-------------------|---------------------------------------|------|---------------|--|
| Number of Bu | | | | | | | |
| Chirp Center F | | | | | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 | | | |
| | | 70.1 | | 40.40 | | Interval (ms) | |
| 1 | 2 | 79.1 | 6 | 1042 | - | 793 | |
| 2 | 3 | 55.7 | 9 | 1327 | 1744 | 159 | |
| 3 | 1 | 95 | 20 | - | - | 734 | |
| 4 | 1 | 88.4 | 5 | - | - | 523 | |
| 5 | 1 | 92.3 | 15 | - | - | 546 | |
| 6 | 1 | 93.6 | 6 | - | - | 208 | |
| 7 | 2 | 95.1 | 12 | 1044 | - | 894 | |
| 8 | 1 | 59.5 | 17 | - | - | 666 | |
| 9 | 2 | 98.7 | 17 | 1422 | - | 640 | |
| 10 | 2 | 65.1 | 5 | 1104 | - | 320 | |
| 11 | 1 | 60.2 | 5 | - | - | 60 | |
| 12 | 1 | 88.7 | 8 | - | - | 823 | |
| Detection Chec | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 68 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 19 | | | | | |
|-----------------------|---------------------------|---------------------|----------------------|---|------|-----|--|--|
| Number of Bur | Number of Bursts in Trial | | | 13 | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 08 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | | |
| 1 | 1 | 53.9 | 10 | - | - | 226 | | |
| 2 | 2 | 82.6 | 13 | 992 | - | 854 | | |
| 3 | 1 | 87.7 | 8 | - | - | 303 | | |
| 4 | 3 | 69 | 12 | 1696 | 1606 | 528 | | |
| 5 | 1 | 68.6 | 12 | - | - | 220 | | |
| 6 | 3 | 76.5 | 13 | 1333 | 1468 | 389 | | |
| 7 | 2 | 95.8 | 17 | 1380 | - | 57 | | |
| 8 | 2 | 55.6 | 19 | 1147 | - | 334 | | |
| 9 | 2 | 78.6 | 14 | 1268 | - | 128 | | |
| 10 | 2 | 65.4 | 17 | 1231 | - | 913 | | |
| 11 | 2 | 76.6 | 18 | 1883 | - | 518 | | |
| 12 | 1 | 93.2 | 6 | - | - | 596 | | |
| 13 | 2 | 50.2 | 13 | 1836 | - | 61 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | | | 20 | | | | | |
|------------------------|---------------------------|---------------------|----------------------|---|------|-----|--|--|
| Number of Bur | Number of Bursts in Trial | | | 14 | | | | |
| Chirp Center Frequency | | | | 55 | 07 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Spacing (us) | | | | |
| 1 | 1 | 60.9 | 13 | - | - | 142 | | |
| 2 | 2 | 81.7 | 15 | 1831 | - | 522 | | |
| 3 | 2 | 78.5 | 5 | 1396 | - | 790 | | |
| 4 | 2 | 98.2 | 6 | 1652 | - | 3 | | |
| 5 | 1 | 64.1 | 12 | - | - | 414 | | |
| 6 | 3 | 53 | 18 | 1862 | 1902 | 157 | | |
| 7 | 2 | 62.3 | 15 | 1490 | - | 248 | | |
| 8 | 2 | 87 | 11 | 1411 | - | 576 | | |
| 9 | 2 | 78.4 | 8 | 1090 | - | 737 | | |
| 10 | 2 | 87.2 | 7 | 967 | - | 343 | | |
| 11 | 3 | 71 | 13 | 1662 | 1841 | 105 | | |
| 12 | 2 | 77.2 | 5 | 1557 | - | 601 | | |
| 13 | 1 | 94.4 | 15 | - | - | 108 | | |
| 14 | 1 | 90.6 | 13 | - | - | 506 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 69 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 21 | | | | | |
|------------------------|---------------------------|---------------------|----------------------|------|------|-----|--|--|
| Number of Bu | Number of Bursts in Trial | | | 15 | | | | |
| Chirp Center Frequency | | | | 55 | 09 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | | |
| 1 | 3 | 76.5 | 8 | 1870 | 1326 | 385 | | |
| 2 | 2 | 95.3 | 13 | 1162 | - | 73 | | |
| 3 | 3 | 58.9 | 9 | 1586 | 1909 | 742 | | |
| 4 | 2 | 73.1 | 13 | 1460 | - | 330 | | |
| 5 | 2 | 73.1 | 12 | 1488 | - | 25 | | |
| 6 | 2 | 75.1 | 5 | 1331 | - | 418 | | |
| 7 | 3 | 98.5 | 11 | 936 | 1532 | 214 | | |
| 8 | 3 | 72.5 | 13 | 1110 | 1903 | 387 | | |
| 9 | 3 | 67.4 | 12 | 1567 | 1513 | 80 | | |
| 10 | 2 | 76.1 | 12 | 1005 | ı | 277 | | |
| 11 | 2 | 94.3 | 17 | 1413 | ı | 314 | | |
| 12 | 2 | 72.8 | 12 | 1778 | - | 66 | | |
| 13 | 2 | 90.9 | 14 | 1793 | - | 147 | | |
| 14 | 3 | 94.8 | 11 | 1012 | 1742 | 441 | | |
| 15 | 3 | 95 | 12 | 912 | 1641 | 609 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | | | 22 | | | | |
|------------------------|-------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bur | rsts in Trial | | 16 | | | | |
| Chirp Center Frequency | | | | 54 | 95 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 1 | 96.7 | 9 | - | - | 308 | |
| 2 | 2 | 78.3 | 13 | 1045 | - | 27 | |
| 3 | 1 | 56.5 | 12 | - | - | 74 | |
| 4 | 3 | 88.5 | 14 | 1119 | 1020 | 629 | |
| 5 | 2 | 62.4 | 9 | 1436 | - | 548 | |
| 6 | 2 | 78.2 | 5 | 1147 | - | 341 | |
| 7 | 3 | 76.8 | 14 | 1069 | 1575 | 360 | |
| 8 | 2 | 91.6 | 18 | 978 | - | 602 | |
| 9 | 2 | 93.7 | 5 | 1130 | - | 623 | |
| 10 | 2 | 97.4 | 8 | 1100 | - | 256 | |
| 11 | 3 | 90.1 | 6 | 1629 | 1375 | 108 | |
| 12 | 2 | 79.9 | 18 | 1809 | - | 183 | |
| 13 | 2 | 83 | 10 | 1370 | - | 477 | |
| 14 | 2 | 89.1 | 13 | 1239 | - | 484 | |
| 15 | 2 | 58.3 | 8 | 1321 | - | 276 | |
| 16 | 1 | 85.2 | 13 | - | - | 22 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 70 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 23 | | | | |
|-----------------------|------------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | rsts in Trial | | 17 | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 04 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 3 | 60 | 10 | 1097 | 1748 | 56 | |
| 2 | 3 | 66.3 | 13 | 1391 | 1430 | 421 | |
| 3 | 2 | 88.5 | 15 | 1040 | - | 583 | |
| 4 | 2 | 72.1 | 8 | 1526 | - | 161 | |
| 5 | 1 | 72.3 | 8 | - | - | 450 | |
| 6 | 2 | 67.3 | 7 | 1022 | - | 48 | |
| 7 | 2 | 56.1 | 12 | 1325 | - | 661 | |
| 8 | 1 | 83.5 | 11 | - | - | 695 | |
| 9 | 3 | 99.4 | 13 | 1490 | 938 | 405 | |
| 10 | 1 | 54.2 | 12 | - | - | 126 | |
| 11 | 3 | 92.7 | 17 | 1251 | 1631 | 365 | |
| 12 | 3 | 95.1 | 17 | 1741 | 1162 | 57 | |
| 13 | 2 | 84 | 9 | 1597 | - | 167 | |
| 14 | 1 | 68.5 | 18 | - | - | 512 | |
| 15 | 1 | 76.5 | 20 | - | - | 185 | |
| 16 | 3 | 86.6 | 11 | 1774 | 1875 | 457 | |
| 17 | 2 | 62.2 | 9 | 1563 | - | 492 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 24 | | | | |
|------------------------|-------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bur | sts in Trial | | 18 | | | | |
| Chirp Center Frequency | | | | 55 | 03 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 1 | 86.6 | 19 | - | - | 621 | |
| 2 | 2 | 95.3 | 17 | 926 | - | 128 | |
| 3 | 1 | 76.2 | 12 | - | - | 251 | |
| 4 | 3 | 71.4 | 19 | 1287 | 1404 | 269 | |
| 5 | 3 | 51.7 | 12 | 1564 | 1339 | 633 | |
| 6 | 2 | 77 | 5 | 1899 | - | 615 | |
| 7 | 1 | 87.5 | 12 | - | - | 375 | |
| 8 | 3 | 59 | 17 | 1327 | 1615 | 610 | |
| 9 | 2 | 78.3 | 15 | 1551 | - | 548 | |
| 10 | 2 | 89.7 | 5 | 1718 | - | 456 | |
| 11 | 2 | 92.1 | 7 | 1403 | - | 12 | |
| 12 | 2 | 97.3 | 14 | 1338 | - | 596 | |
| 13 | 3 | 80.3 | 20 | 1354 | 1563 | 484 | |
| 14 | 1 | 98.2 | 8 | - | - | 428 | |
| 15 | 3 | 94.4 | 13 | 1795 | 1829 | 512 | |
| 16 | 2 | 90.4 | 13 | 1105 | - | 342 | |
| 17 | 2 | 73.6 | 19 | 1787 | - | 292 | |
| 18 | 1 | 82.9 | 7 | - | - | 618 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 0 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 71 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 25 | | | | |
|------------------------|--------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | ursts in Trial | | 19 | | | | |
| Chirp Center Frequency | | | | 55 | 02 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 1 | 90 | 18 | - | - | 173 | |
| 2 | 1 | 65.3 | 19 | - | - | 245 | |
| 3 | 2 | 82.6 | 10 | 1756 | - | 127 | |
| 4 | 2 | 93.9 | 18 | 1557 | - | 287 | |
| 5 | 2 | 50.5 | 13 | 1479 | - | 282 | |
| 6 | 1 | 68 | 7 | - | - | 176 | |
| 7 | 3 | 88.4 | 11 | 1244 | 1076 | 568 | |
| 8 | 3 | 66.8 | 11 | 1288 | 1909 | 448 | |
| 9 | 2 | 88 | 12 | 1450 | - | 527 | |
| 10 | 3 | 51.1 | 6 | 1797 | 1935 | 195 | |
| 11 | 2 | 93.8 | 13 | 1073 | - | 184 | |
| 12 | 1 | 83.5 | 10 | - | - | 506 | |
| 13 | 2 | 96.9 | 12 | 1047 | - | 267 | |
| 14 | 3 | 87.2 | 18 | 1521 | 1450 | 243 | |
| 15 | 2 | 60.1 | 8 | 1545 | - | 291 | |
| 16 | 3 | 98 | 10 | 1842 | 1402 | 554 | |
| 17 | 3 | 57 | 19 | 1665 | 1732 | 143 | |
| 18 | 1 | 74.3 | 14 | - | - | 31 | |
| 19 | 2 | 57.8 | 10 | 1576 | - | 609 | |
| Detection Che | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 72 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 26 | | | | | |
|----------------|--------------------|----------------|----|------|------------------------------|---|--|--|
| Number of Bu | rsts in Trial | | 20 | | | | | |
| Chirp Center I | Frequency | | | 5501 | | | | |
| Burst | Pulse Width | | | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 92.8 | 9 | 1222 | - | 531 | | |
| 2 | 2 | 52.4 | 8 | 1547 | - | 168 | | |
| 3 | 3 | 56.8 | 7 | 1158 | 1184 | 193 | | |
| 4 | 1 | 91.2 | 7 | - | - | 565 | | |
| 5 | 3 | 61.2 | 10 | 1558 | 1664 | 387 | | |
| 6 | 3 | 62 | 7 | 1518 | 1656 | 391 | | |
| 7 | 2 | 69 | 5 | 1531 | - | 327 | | |
| 8 | 2 | 67.3 | 18 | 1064 | - | 25 | | |
| 9 | 1 | 94.1 | 5 | - | - | 78 | | |
| 10 | 2 | 76 | 17 | 1190 | - | 222 | | |
| 11 | 2 | 81.9 | 12 | 1815 | - | 96 | | |
| 12 | 2 | 57.9 | 8 | 1594 | - | 277 | | |
| 13 | 3 | 68.3 | 19 | 1427 | 1540 | 41 | | |
| 14 | 2 | 53.3 | 7 | 1713 | - | 48 | | |
| 15 | 2 | 85.3 | 15 | 1136 | - | 48 | | |
| 16 | 1 | 65.3 | 20 | - | - | 57 | | |
| 17 | 3 | 79.8 | 20 | 923 | 1259 | 48 | | |
| 18 | 2 | 56.9 | 20 | 1357 | - | 483 | | |
| 19 | 2 | 93 | 9 | 1686 | - | 73 | | |
| 20 | 2 | 82.8 | 10 | 944 | - | 352 | | |
| Detection Ched | ck (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | | | 27 | | | | |
|--------------------------------------|-------------------|----------------|-------------------|------------------------------|------------------------------|--------------------------------|--|
| Number of Bur | sts in Trial | | 8 | | | | |
| Chirp Center F | requency | | | 55 | 00 | | |
| Burst No. of Pulses Pulse Width (us) | | | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within | |
| | | | | | | Interval (ms) | |
| 1 | 3 | 50.9 | 11 | 1106 | 1077 | 1293 | |
| 2 | 2 | 77.8 | 18 | 1836 | - | 1235 | |
| 3 | 3 | 60.7 | 5 | 1069 | 1635 | 1092 | |
| 4 | 2 | 77.2 | 13 | 1916 | - | 1343 | |
| 5 | 2 | 91.6 | 13 | 1465 | - | 1466 | |
| 6 | 2 | 56.8 | 17 | 1783 | - | 376 | |
| 7 | 1 | 59.5 | 20 | - | - | 131 | |
| 8 | 1 | 66.5 | 12 | - | - | 1024 | |
| Detection Chec | k (1=Detection; C | =No Detection) | | • | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 73 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 28 | | | | |
|---------------------------|-------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bursts in Trial | | | 9 | | | | |
| Chirp Center Frequency | | | | 54 | 99 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 2 | 72 | 9 | 1092 | - | 965 | |
| 2 | 2 | 89.2 | 6 | 1550 | - | 1226 | |
| 3 | 1 | 81.2 | 12 | - | - | 277 | |
| 4 | 2 | 80.6 | 15 | 1616 | - | 458 | |
| 5 | 2 | 62.8 | 10 | 1812 | - | 748 | |
| 6 | 1 | 71 | 8 | - | - | 434 | |
| 7 | 2 | 69.3 | 6 | 1027 | - | 1111 | |
| 8 | 2 | 77.2 | 13 | 1076 | - | 638 | |
| 9 | 2 | 65.4 | 5 | 1582 | - | 278 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 29 | | | | |
|---------------------------|-------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bursts in Trial | | | 10 | | | | |
| Chirp Center F | requency | | | 54 | 98 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 1 | 51.5 | 19 | - | - | 151 | |
| 2 | 1 | 82.3 | 13 | - | - | 1071 | |
| 3 | 3 | 78.3 | 8 | 1115 | 1740 | 646 | |
| 4 | 2 | 99 | 14 | 1101 | - | 709 | |
| 5 | 3 | 98.8 | 7 | 1819 | 945 | 556 | |
| 6 | 2 | 80.9 | 19 | 922 | - | 567 | |
| 7 | 2 | 64 | 12 | 953 | - | 581 | |
| 8 | 1 | 79 | 20 | - | - | 798 | |
| 9 1 68 | | | 8 | - | - | 112 | |
| 10 | 2 | 50.4 | 13 | 1587 | - | 26 | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 74 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | ſ | | 30 | | | | | |
|------------------------|---------------------------|---------------------|----------------------|------|------------------------------|---|--|--|
| Number of B | lumber of Bursts in Trial | | | 11 | | | | |
| Chirp Center Frequency | | | | 54 | 90 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 3 | 57.8 | 5 | 1324 | 1716 | 82 | | |
| 2 | 2 | 70.1 | 20 | 1733 | - | 587 | | |
| 3 | 2 | 95.2 | 13 | 1188 | - | 789 | | |
| 4 | 3 | 84.6 | 20 | 1042 | 1259 | 1021 | | |
| 5 | 3 | 96.5 | 7 | 1329 | 1596 | 16 | | |
| 6 | 2 | 84.3 | 15 | 1606 | - | 708 | | |
| 7 | 3 | 53.5 | 19 | 1783 | 1458 | 738 | | |
| 8 | 3 | 74.9 | 5 | 1599 | 1891 | 466 | | |
| 9 | 3 | 53.8 | 7 | 1494 | 1467 | 252 | | |
| 10 | 2 | 60.5 | 14 | 1319 | - | 464 | | |
| 11 | 1 | - | - | 845 | | | | |
| Detection Che | eck (1=Detection; 0 | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 75 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



Type 6 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulses / Hop | Pulse Width (us) | PRI (us) | 1=Detection 0=No Detection |
|----------|------------------|-------------------|------------------|----------|-------------------------------|
| 1 | 5500 | 9 | 1 | 333 | 1 |
| 2 | 5500 | 9 | 1 | 333 | 1 |
| 3 | 5500 | 9 | 1 | 333 | 1 |
| 4 | 5500 | 9 | 1 | 333 | 1 |
| 5 | 5500 | 9 | 1 | 333 | 1 |
| 6 | 5500 | 9 | 1 | 333 | 1 |
| 7 | 5500 | 9 | 1 | 333 | 1 |
| 8 | 5500 | 9 | 1 | 333 | 1 |
| 9 | 5500 | 9 | 1 | 333 | 1 |
| 10 | 5500 | 9 | 1 | 333 | 1 |
| 11 | 5500 | 9 | 1 | 333 | 1 |
| 12 | 5500 | 9 | 1 | 333 | 1 |
| 13 | 5500 | 9 | 1 | 333 | 1 |
| 14 | 5500 | 9 | 1 | 333 | 1 |
| 15 | 5500 | 9 | 1 | 333 | 1 |
| 16 | 5500 | 9 | 1 | 333 | 1 |
| 17 | 5500 | 9 | 1 | 333 | 1 |
| 18 | 5500 | 9 | 1 | 333 | 1 |
| 19 | 5500 | 9 | 1 | 333 | 0 |
| 20 | 5500 | 9 | 1 | 333 | 1 |
| 21 | 5500 | 9 | 1 | 333 | 1 |
| 22 | 5500 | 9 | 1 | 333 | 1 |
| 23 | 5500 | 9 | 1 | 333 | 1 |
| 24 | 5500 | 9 | 1 | 333 | 1 |
| 25 | 5500 | 9 | 1 | 333 | 1 |
| 26 | 5500 | 9 | 1 | 333 | 1 |
| 27 | 5500 | 9 | 1 | 333 | 1 |
| 28 | 5500 | 9 | 11 | 333 | 0 |
| 29 | 5500 | 9 | 1 | 333 | 1 |
| 30 | 5500 | 9 | 1 | 333 | 1 |
| | D | etection Percenta | ge (%) | | 93.33 |
| Limit | 70% | | | | |
| Test Res | Complied | | | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 76 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Modulation Mode: 802.11ac (VHT40)

Type 1 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Repetition Frequency Number | Pulse Repetition Frequency (Pulse Per Second) | PRI (us) | 1=Detection 0=No Detection |
|-----------------|------------------|--------------------------------------|---|---------------|-------------------------------|
| 1 | 5496 | 1 | 1930.5 | 518 | 1 |
| 2 | 5497 | 23 | 326.2 | 3066 | 1 |
| 3 | 5498 | 19 | 1139.0 | 878 | 0 |
| 4 | 5499 | 12 | 1355.0 | 738 | 1 |
| 5 | 5500 | 4 | 1730.1 | 578 | 1 |
| 6 | 5501 | 8 | 1519.8 | 658 | 1 |
| 7 | 5502 | 15 | 1253.1 | 798 | 1 |
| 8 | 5503 | 6 | 1618.1 | 618 | 1 |
| 9 | 5504 | 14 | 1285.3 | 778 | 1 |
| 10 | 5505 | 3 | 1792.1 | 558 | 1 |
| 11 | 5506 | 13 | 1319.3 | 758 | 1 |
| 12 | 5507 | 9 | 1474.9 | 678 | 1 |
| 13 | 5508 | 7 | 1567.4 | 638 | 1 |
| 14 | 5509 | 17 | 1193.3 | 838 | 1 |
| 15 | 5510 | 10 | 1432.7 | 698 | 1 |
| 16 | 5511 | - | 1692.0 | 591 | 1 |
| 17 | 5512 | - | 328.1 | 3048 | 1 |
| 18 | 5513 | - | 373.4 | 2678 | 1 |
| 19 | 5514 | - | 574.4 | 1741 | 1 |
| 20 | 5515 | - | 1216.5 | 822 | 0 |
| 21 | 5516 | - | 801.3 | 1248 | 1 |
| 22 | 5517 | - | 488.5 | 2047 | 1 |
| 23 | 5518 | - | 956.0 | 1046 | 1 |
| 24 | 5519 | - | 517.6 | 1932 | 1 |
| 25 | 5520 | - | 1422.5 | 703 | 1 |
| 26 | 5521 | - | 542.0 | 1845 | 1 |
| 27 | 5522 | - | 741.3 | 1349 | 1 |
| 28 | 5523 | - | 881.8 | 1134 | 0 |
| 29 | 5524 | - | 427.4 | 2340 | 1 |
| 30 | 5525 | - | 628.9 | 1590 | 1 |
| | | Detection Percentage | (%) | | 90.00 |
| Limit | | | | | 60% |
| Test Res | ult | | | - | Complied |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 77 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Type 2 Ra | ndar Statistical Perfo | rmance | | | |
|-----------|------------------------|------------------------|----------|----------------|-------------------------------|
| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
| 1 | 5496 | 2.6 | 221 | 23 | 1 |
| 2 | 5497 | 4.6 | 198 | 27 | 0 |
| 3 | 5498 | 1.1 | 184 | 29 | 1 |
| 4 | 5499 | 4.8 | 203 | 24 | 1 |
| 5 | 5500 | 2.4 | 162 | 25 | 1 |
| 6 | 5501 | 3.4 | 204 | 28 | 1 |
| 7 | 5502 | 2.3 | 170 | 27 | 1 |
| 8 | 5503 | 3.5 | 184 | 23 | 0 |
| 9 | 5504 | 4.9 | 150 | 27 | 1 |
| 10 | 5505 | 4.6 | 211 | 29 | 1 |
| 11 | 5506 | 2.9 | 158 | 23 | 1 |
| 12 | 5507 | 2.6 | 226 | 27 | 1 |
| 13 | 5508 | 1.6 | 204 | 26 | 1 |
| 14 | 5509 | 3.9 | 181 | 25 | 0 |
| 15 | 5510 | 4.6 | 202 | 24 | 1 |
| 16 | 5511 | 4.1 | 194 | 27 | 1 |
| 17 | 5512 | 2.3 | 193 | 28 | 1 |
| 18 | 5513 | 3.9 | 173 | 29 | 1 |
| 19 | 5514 | 4.3 | 188 | 23 | 1 |
| 20 | 5515 | 1.5 | 215 | 26 | 0 |
| 21 | 5516 | 4.9 | 227 | 27 | 1 |
| 22 | 5517 | 1.1 | 199 | 23 | 1 |
| 23 | 5518 | 4.5 | 155 | 29 | 1 |
| 24 | 5519 | 4.0 | 190 | 27 | 1 |
| 25 | 5520 | 2.4 | 151 | 23 | 1 |
| 26 | 5521 | 2.5 | 180 | 28 | 1 |
| 27 | 5522 | 2.5 | 228 | 23 | 1 |
| 28 | 5523 | 2.5 | 203 | 25 | 1 |
| 29 | 5524 | 1.5 | 188 | 25 | 0 |
| 30 | 5525 | 1.9 | 217 | 24 | 1 |
| | D | etection Percentage (9 | %) | | 83.33 |
| Limit | 60% | | | | |
| Test Resu | ult | | | | Complied |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 78 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID : XCNDVW32C



Type 3 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|-----------|------------------|------------------------|-------------|----------------|-------------------------------|
| 1 | 5496 | 8.0 | 205 | 16 | 1 |
| 2 | 5497 | 6.7 | 382 | 18 | 1 |
| 3 | 5498 | 8.6 | 418 | 16 | 0 |
| 4 | 5499 | 9.4 | 351 | 17 | 1 |
| 5 | 5500 | 7.4 | 383 | 18 | 1 |
| 6 | 5501 | 9.8 | 232 | 16 | 1 |
| 7 | 5502 | 9.1 | 377 | 17 | 1 |
| 8 | 5503 | 9.6 | 457 | 16 | 1 |
| 9 | 5504 | 8.0 | 471 | 18 | 1 |
| 10 | 5505 | 9.0 | 304 | 18 | 1 |
| 11 | 5506 | 8.0 | 316 | 17 | 1 |
| 12 | 5507 | 9.8 | 325 | 16 | 1 |
| 13 | 5508 | 8.0 | 409 | 17 | 0 |
| 14 | 5509 | 9.9 | 200 | 17 | 0 |
| 15 | 5510 | 8.8 | 458 | 16 | 1 |
| 16 | 5511 | 8.0 | 232 | 18 | 0 |
| 17 | 5512 | 8.3 | 250 | 16 | 1 |
| 18 | 5529 | 8.7 | 270 | 16 | 1 |
| 19 | 5514 7.7 | 350 | 17 | 1 | |
| 20 | 5515 | 7.1 | 230 | 16 | 1 |
| 21 | 5516 | 7.3 | 416 | 18 | 1 |
| 22 | 5517 | 7.6 | 498 | 18 | 1 |
| 23 | 5492 | 7.3 | 286 | 17 | 1 |
| 24 | 5519 | 7.3 | 287 | 16 | 1 |
| 25 | 5520 | 7.5 | 462 | 17 | 1 |
| 26 | 5521 | 6.2 | 300 | 17 | 1 |
| 27 | 5522 | 6.4 | 323 | 18 | 1 |
| 28 | 5523 | 7.1 | 420 | 16 | 1 |
| 29 | 5524 | 7.2 | 395 | 18 | 0 |
| 30 | 5525 | 8.4 | 377 | 16 | 1 |
| | D | etection Percentage (9 | %) <u> </u> | | 83.33 |
| Limit | 60% | | | | |
| Test Resu | ult | | | | Complied |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 79 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



Type 4 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|-----------|------------------|------------------------|----------|----------------|-------------------------------|
| 1 | 5491 | 18.0 | 242 | 15 | 0 |
| 2 | 5497 | 19.9 | 279 | 12 | 1 |
| 3 | 5498 | 12.9 | 487 | 14 | 1 |
| 4 | 5499 | 15.0 | 452 | 13 | 0 |
| 5 | 5500 | 16.3 | 230 | 12 | 1 |
| 6 | 5501 | 19.8 | 238 | 13 | 1 |
| 7 | 5502 | 18.2 | 420 | 16 | 1 |
| 8 | 5503 | 16.3 | 452 | 15 | 0 |
| 9 | 5504 | 14.2 | 495 | 12 | 1 |
| 10 | 5505 | 17.8 | 228 | 16 | 1 |
| 11 | 5506 | 19.1 | 211 | 16 | 1 |
| 12 | 5507 | 18.4 | 283 | 15 | 1 |
| 13 | 5508 | 11.8 | 411 | 12 | 1 |
| 14 | 5509 | 14.2 | 284 | 13 | 1 |
| 15 | 5510 | 13.9 | 202 | 12 | 1 |
| 16 | 5511 | 17.8 | 340 | 14 | 1 |
| 17 | 5512 | 15.6 | 290 | 16 | 1 |
| 18 | 5513 | 14.6 | 250 | 16 | 0 |
| 19 | 5514 | 14.4 | 484 | 15 | 1 |
| 20 | 5515 | 18.9 | 387 | 13 | 1 |
| 21 | 5516 | 11.1 | 348 | 15 | 1 |
| 22 | 5517 | 13.8 | 291 | 16 | 1 |
| 23 | 5518 | 14.3 | 295 | 12 | 1 |
| 24 | 5519 | 12.5 | 300 | 12 | 0 |
| 25 | 5520 | 12.5 | 322 | 14 | 1 |
| 26 | 5521 | 12.5 | 383 | 13 | 1 |
| 27 | 5522 | 15.7 | 322 | 16 | 0 |
| 28 | 5523 | 19.8 | 469 | 13 | 1 |
| 29 | 5524 | 18.6 | 406 | 15 | 1 |
| 30 | 5493 | 15.9 | 238 | 14 | 0 |
| | D | etection Percentage (9 | %) | | 76.67 |
| _imit | 60% | | | | |
| Test Resu | Complied | | | | |

SPORTON INTERNATIONAL INC. Page TEL: 886-3-327-3456 Repo

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 80 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Total Type 1~4 Radar Statistical Performance

| Radar Type # | Detection Percentage (%) |
|-----------------------------|--------------------------|
| 1 | 90.00 |
| 2 | 83.33 |
| 3 | 83.33 |
| 4 | 76.67 |
| Aggregate (Radar Types 1-4) | 83.33 |
| Limit | 80% |
| Test Result | Complied |

Report No.: FZ4O0315-01

: 81 of 126

: Oct. 19, 2015

: Rev. 01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456

FAX: 886-3-327-0973

Report Version
Issued Date

FCC ID: XCNDVW32C



Type 5 Radar Statistical Performance

| Trial # | Test Freq. | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection |
|--------------------------|------------|-------------------------------|---------|---------------------|-------------------------------|---------|---------------------|----------------------------------|
| 1 | 5496 | 1 | 11 | 5506 | 1 | 21 | 5516 | 1 |
| 2 | 5497 | 0 | 12 | 5507 | 0 | 22 | 5517 | 1 |
| 3 | 5498 | 1 | 13 | 5508 | 1 | 23 | 5518 | 1 |
| 4 | 5499 | 1 | 14 | 5509 | 1 | 24 | 5519 | 1 |
| 5 | 5500 | 1 | 15 | 5510 | 1 | 25 | 5520 | 1 |
| 6 | 5501 | 1 | 16 | 5511 | 1 | 26 | 5521 | 1 |
| 7 | 5502 | 1 | 17 | 5512 | 1 | 27 | 5522 | 0 |
| 8 | 5503 | 1 | 18 | 5513 | 1 | 28 | 5523 | 1 |
| 9 | 5504 | 1 | 19 | 5514 | 1 | 29 | 5525 | 1 |
| 10 | 5505 | 1 | 20 | 5515 | 1 | 30 | 5495 | 1 |
| Detection Percentage (%) | | | | | | | | 90.00 |
| Limit | | | | | | | 80% | |
| Test R | esult | | | | | | | Complied |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 82 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID: XCNDVW32C



| Trial Number | | | 1 | | | |
|---------------------------|-------------------|---------------------|----------------------|---|------|------|
| Number of Bursts in Trial | | | | 3 | 3 | |
| Chirp Center Frequency | | | | 54 | 96 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | |
| 1 | 1 | 62.3 | 8 | - | - | 346 |
| 2 | 2 | 51.2 | 15 | 1745 | - | 1205 |
| 3 | 3 | 93.6 | 5 | 957 | 1634 | 674 |
| 4 | 3 | 68.2 | 12 | 1668 | 1573 | 384 |
| 5 | 3 | 83.1 | 8 | 1188 | 1888 | 876 |
| 6 | 1 | 56.7 | 18 | - | - | 376 |
| 7 | 2 | 60.6 | 18 | 1874 | - | 1409 |
| 8 | 3 | 75.5 | 13 | 1263 | 1683 | 1378 |
| Detection Check | k (1=Detection; C | =No Detection) | | | | 1 |

| Trial Number | | | 2 | | | |
|-----------------------|---------------------------|---------------------|--|------|------|-----|
| Number of Bu | Number of Bursts in Trial | | | Ç |) | |
| Chirp Center F | Chirp Center Frequency | | | 54 | 97 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Location Spacing (us) Spacing (us) Within Interval (| | | |
| 1 | 1 | 99.6 | 13 | - | - | 217 |
| 2 | 2 | 54.8 | 15 | 1727 | - | 982 |
| 3 | 3 | 91.1 | 15 | 1120 | 1826 | 941 |
| 4 | 2 | 76.2 | 7 | 1638 | - | 477 |
| 5 | 1 | 88.9 | 13 | - | - | 259 |
| 6 | 1 | 83 | 9 | - | - | 892 |
| 7 | 1 | 83.9 | 12 | - | - | 320 |
| 8 | 2 | 55.9 | 15 | 1613 | - | 445 |
| 9 | 1 | 96.1 | 13 | - | - | 779 |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 0 |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 83 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 3 | | | | |
|------------------------|---------------------------|---------------------|---|------|------|------|--|
| Number of Bu | Number of Bursts in Trial | | | 10 | | | |
| Chirp Center Frequency | | | | 54 | 98 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Location (MHz) Spacing (us) Spacing (us) Within Interval (in the control of the control | | | | |
| 1 | 2 | 82 | 6 | 1246 | - | 1017 | |
| 2 | 1 | 93.2 | 13 | - | - | 760 | |
| 3 | 2 | 61.3 | 13 | 1175 | - | 327 | |
| 4 | 1 | 52.8 | 8 | - | - | 824 | |
| 5 | 3 | 70.6 | 19 | 929 | 1076 | 115 | |
| 6 | 1 | 80.3 | 17 | - | - | 325 | |
| 7 | 1 | 83.2 | 15 | - | - | 679 | |
| 8 | 2 | 94 | 9 | 1805 | - | 888 | |
| 9 | 2 | 67 | 8 | 1486 | - | 849 | |
| 10 | 1 | 56.4 | 20 | - | - | 813 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 4 | | | | |
|------------------------|-------------------|---------------------|--|------|------|------|--|
| Number of Bu | rsts in Trial | | | 11 | | | |
| Chirp Center Frequency | | | | 54 | 99 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Local Spacing (us) Spacing (us) With Interval Interval Pulse 2-to-3 Cocal Pulse 2-t | | | | |
| 1 | 3 | 90.5 | 8 | 1149 | 1612 | 35 | |
| 2 | 3 | 54.5 | 8 | 1094 | 1525 | 1014 | |
| 3 | 1 | 57.1 | 18 | - | - | 827 | |
| 4 | 2 | 98.6 | 20 | 1292 | - | 83 | |
| 5 | 2 | 62.9 | 12 | 1433 | - | 676 | |
| 6 | 1 | 71.1 | 15 | - | - | 708 | |
| 7 | 1 | 96.7 | 5 | - | - | 711 | |
| 8 | 1 | 64.3 | 5 | - | - | 484 | |
| 9 | 3 | 61.2 | 8 | 1075 | 1524 | 444 | |
| 10 | 2 | 79.2 | 13 | 1877 | - | 797 | |
| 11 | 2 | 79.3 | 20 | 1313 | - | 288 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 84 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 5 | | | |
|-----------------------|------------------------|---------------------|---|------|------|---------------|
| Number of Bu | rsts in Trial | | 12 | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 00 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Location (MHz) Spacing (us) Spacing (us) Within | | | |
| | | | 10 | | | Interval (ms) |
| 1 | 1 | 89.5 | 13 | - | - | 20 |
| 2 | 3 | 71.8 | 11 | 1446 | 1549 | 117 |
| 3 | 3 | 53.7 | 15 | 1100 | 1517 | 485 |
| 4 | 2 | 99.3 | 11 | 1571 | - | 334 |
| 5 | 3 | 56.8 | 6 | 1594 | 1280 | 468 |
| 6 | 1 | 97.4 | 11 | - | - | 213 |
| 7 | 2 | 67.6 | 13 | 1831 | - | 14 |
| 8 | 3 | 77.1 | 8 | 1683 | 1337 | 267 |
| 9 | 1 | 98.5 | 17 | - | - | 544 |
| 10 | 3 | 58.3 | 13 | 1924 | 1829 | 159 |
| 11 | 1 | 98.4 | 14 | - | - | 380 |
| 12 | 1 | 79.3 | 11 | - | - | 257 |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 |

| Trial Number | Trial Number | | | 6 | | | |
|------------------------|--------------------|---------------------|----------------------|------|------|-----|--|
| Number of Bu | rsts in Trial | | 13 | | | | |
| Chirp Center Frequency | | | | 55 | 01 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | |
| 1 | 2 | 53.8 | 14 | 1631 | - | 768 | |
| 2 | 1 | 90 | 17 | - | - | 530 | |
| 3 | 3 | 87.2 | 18 | 1115 | 1297 | 157 | |
| 4 | 2 | 82 | 11 | 1728 | - | 892 | |
| 5 | 3 | 69.8 | 7 | 1641 | 1779 | 196 | |
| 6 | 2 | 63.1 | 20 | 1836 | - | 331 | |
| 7 | 1 | 59.8 | 6 | - | - | 495 | |
| 8 | 3 | 78.5 | 19 | 941 | 1921 | 546 | |
| 9 | 1 | 85.7 | 6 | - | - | 219 | |
| 10 | 3 | 67.7 | 9 | 1834 | 1450 | 534 | |
| 11 | 2 | 84.5 | 15 | 1376 | - | 282 | |
| 12 | 2 | 99.3 | 13 | 1570 | - | 486 | |
| 13 | 2 | 80.2 | 8 | 1088 | - | 67 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 85 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 7 | | | | | |
|------------------------|-------------------|---------------------|----------------------|------|------|-----|--|--|
| Number of Bui | rsts in Trial | | 14 | | | | | |
| Chirp Center Frequency | | | | 55 | 02 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | | |
| 1 | 3 | 80.8 | 10 | 1061 | 1124 | 389 | | |
| 2 | 2 | 81 | 9 | 1479 | 1 | 234 | | |
| 3 | 2 | 87.6 | 17 | 1247 | 1 | 577 | | |
| 4 | 2 | 94.7 | 18 | 1041 | ı | 572 | | |
| 5 | 2 | 78 | 18 | 1267 | ı | 313 | | |
| 6 | 1 | 95.5 | 14 | - | ı | 52 | | |
| 7 | 2 | 97.6 | 15 | 1215 | 1 | 57 | | |
| 8 | 3 | 88 | 9 | 1349 | 1598 | 171 | | |
| 9 | 2 | 69.7 | 17 | 1711 | ı | 769 | | |
| 10 | 2 | 96.5 | 17 | 1431 | ı | 168 | | |
| 11 | 2 | 96.9 | 6 | 1871 | ı | 124 | | |
| 12 | 3 | 66.4 | 10 | 1824 | 1468 | 766 | | |
| 13 | 1 | 78.8 | 10 | - | - | 537 | | |
| 14 | 3 | 87.6 | 6 | 1080 | 1159 | 714 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | Trial Number | | | 8 | | | |
|------------------------|--------------------|---------------------|----------------------|------------------------------|------|---|--|
| Number of Bu | rsts in Trial | | 15 | | | | |
| Chirp Center Frequency | | | | 55 | 03 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 2 | 71.8 | 14 | 1432 | - | 573 | |
| 2 | 2 | 65.9 | 19 | 1762 | - | 314 | |
| 3 | 2 | 74.7 | 6 | 1754 | - | 377 | |
| 4 | 3 | 81.7 | 5 | 1133 | 974 | 216 | |
| 5 | 3 | 57.8 | 14 | 1176 | 1712 | 129 | |
| 6 | 1 | 80.6 | 6 | - | - | 341 | |
| 7 | 3 | 99.3 | 17 | 1268 | 1876 | 165 | |
| 8 | 1 | 79.8 | 12 | - | - | 618 | |
| 9 | 3 | 83 | 11 | 990 | 1738 | 589 | |
| 10 | 3 | 71.5 | 11 | 1473 | 1255 | 6 | |
| 11 | 1 | 77.4 | 11 | - | - | 127 | |
| 12 | 2 | 84.8 | 12 | 1390 | - | 515 | |
| 13 | 2 | 64.6 | 12 | 1653 | - | 148 | |
| 14 | 2 | 92.9 | 12 | 1881 | - | 519 | |
| 15 | 1 | 71.3 | 6 | - | - | 301 | |
| Detection Ched | ck (1=Detection; C | =No Detection) | | | · | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 86 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 9 | | | | |
|------------------------|-------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 16 | | | | |
| Chirp Center Frequency | | | | 55 | 04 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 2 | 55.4 | 9 | 1318 | - | 383 | |
| 2 | 2 | 80.8 | 18 | 1710 | - | 534 | |
| 3 | 1 | 88.8 | 9 | - | - | 495 | |
| 4 | 2 | 78 | 12 | 1818 | - | 92 | |
| 5 | 1 | 78.5 | 12 | - | - | 108 | |
| 6 | 2 | 55 | 13 | 1219 | - | 123 | |
| 7 | 2 | 75.9 | 20 | 1004 | - | 123 | |
| 8 | 2 | 70.9 | 7 | 1820 | - | 546 | |
| 9 | 2 | 71.7 | 18 | 1559 | - | 476 | |
| 10 | 2 | 73.9 | 19 | 1232 | - | 235 | |
| 11 | 1 | 59.2 | 20 | - | - | 424 | |
| 12 | 1 | 55.7 | 9 | - | - | 391 | |
| 13 | 3 | 60.9 | 12 | 1144 | 1370 | 198 | |
| 14 | 2 | 60.8 | 14 | 990 | - | 16 | |
| 15 | 3 | 60.6 | 19 | 1526 | 1326 | 695 | |
| 16 | 2 | 89 | 5 | 1029 | - | 131 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 10 | | | | |
|------------------------|-------------------|---------------------|----------------------|------------------------------|------|---|--|
| Number of Bur | sts in Trial | | 17 | | | | |
| Chirp Center Frequency | | | | 55 | 05 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 2 | 72.1 | 14 | 1119 | - | 488 | |
| 2 | 3 | 81.4 | 13 | 1142 | 961 | 451 | |
| 3 | 3 | 92.9 | 18 | 991 | 1147 | 565 | |
| 4 | 3 | 81.3 | 18 | 1793 | 1369 | 285 | |
| 5 | 3 | 76.4 | 20 | 1005 | 1793 | 79 | |
| 6 | 1 | 61.6 | 18 | - | - | 503 | |
| 7 | 1 | 66.6 | 19 | - | - | 181 | |
| 8 | 1 | 53.7 | 12 | - | - | 416 | |
| 9 | 2 | 58 | 8 | 1477 | - | 107 | |
| 10 | 2 | 64 | 18 | 1791 | - | 141 | |
| 11 | 2 | 80.3 | 12 | 1304 | - | 516 | |
| 12 | 3 | 77.3 | 5 | 1039 | 1668 | 372 | |
| 13 | 2 | 97.6 | 11 | 1593 | - | 163 | |
| 14 | 1 | 73 | 6 | - | - | 147 | |
| 15 | 3 | 65.1 | 8 | 1097 | 1927 | 102 | |
| 16 | 2 | 59.5 | 13 | 1569 | - | 182 | |
| 17 | 1 | 88.2 | 19 | - | - | 653 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 87 of 126 Report Version : Rev. 01

Issued Date : Oct. 19, 2015



| Trial Number | | | 11 | | | | |
|------------------------|--------------------|---------------------|----------------------|------------------------------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 18 | | | | |
| Chirp Center Frequency | | | | 55 | 06 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 2 | 56.1 | 12 | 1219 | - | 273 | |
| 2 | 1 | 83.3 | 7 | - | - | 298 | |
| 3 | 3 | 79.6 | 17 | 1218 | 1897 | 159 | |
| 4 | 2 | 95.8 | 7 | 1672 | - | 480 | |
| 5 | 2 | 79.6 | 8 | 920 | - | 387 | |
| 6 | 2 | 88.9 | 11 | 1779 | - | 5 | |
| 7 | 2 | 81.4 | 8 | 1645 | - | 201 | |
| 8 | 2 | 92 | 6 | 1454 | - | 80 | |
| 9 | 3 | 96 | 13 | 1518 | 1121 | 192 | |
| 10 | 2 | 65.6 | 11 | 1798 | - | 349 | |
| 11 | 2 | 98.7 | 5 | 1360 | - | 416 | |
| 12 | 2 | 52.9 | 15 | 1140 | - | 652 | |
| 13 | 2 | 76.5 | 8 | 1032 | - | 92 | |
| 14 | 3 | 73.8 | 18 | 1719 | 1383 | 502 | |
| 15 | 3 | 83.7 | 10 | 1270 | 1216 | 343 | |
| 16 | 2 | 89.6 | 10 | 1141 | - | 108 | |
| 17 | 2 | 67.2 | 20 | 1455 | - | 272 | |
| 18 | 3 | 55.7 | 14 | 1444 | 1475 | 566 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 88 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 12 | | | | | |
|------------------------|---------------------|---------------------|----------------------|------------------------------|------------------------------|---|--|--|
| Number of B | ursts in Trial | | 19 | | | | | |
| Chirp Center Frequency | | | | 55 | 07 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 70.6 | 15 | 1040 | - | 575 | | |
| 2 | 2 | 72.9 | 13 | 1460 | - | 178 | | |
| 3 | 3 | 88.9 | 5 | 1250 | 1629 | 191 | | |
| 4 | 3 | 60.3 | 20 | 1757 | 1822 | 468 | | |
| 5 | 3 | 92.1 | 19 | 1845 | 1198 | 476 | | |
| 6 | 1 | 73 | 5 | - | - | 532 | | |
| 7 | 1 | 50.4 | 15 | - | - | 69 | | |
| 8 | 1 | 66.4 | 10 | - | - | 333 | | |
| 9 | 1 | 79.1 | 18 | - | - | 437 | | |
| 10 | 1 | 71.6 | 20 | - | - | 424 | | |
| 11 | 2 | 95.6 | 13 | 1229 | - | 498 | | |
| 12 | 1 | 74.4 | 9 | - | - | 363 | | |
| 13 | 3 | 55.6 | 17 | 1263 | 1724 | 123 | | |
| 14 | 2 | 78.3 | 13 | 1507 | - | 37 | | |
| 15 | 3 | 54.1 | 13 | 1325 | 1249 | 192 | | |
| 16 | 2 | 67.1 | 18 | 1584 | - | 311 | | |
| 17 | 2 | 65.8 | 9 | 1195 | - | 243 | | |
| 18 | 2 | 50.1 | 12 | 1755 | - | 48 | | |
| 19 | 2 | 87.7 | 18 | 1359 | - | 180 | | |
| Detection Che | eck (1=Detection; C | =No Detection) | · | <u> </u> | · | 0 | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 89 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 13 | | | | | |
|----------------------|--------------------|---------------------|----------------------|------|------|-----|--|--|
| Number of Bu | ırsts in Trial | | 20 | | | | | |
| Chirp Center | Frequency | | | 55 | 08 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | | |
| 1 | 3 | 79.5 | 7 | 1808 | 1550 | 274 | | |
| 2 | 2 | 76.7 | 20 | 1632 | - | 573 | | |
| 3 | 3 | 85.9 | 12 | 1305 | 1496 | 18 | | |
| 4 | 3 | 86.6 | 14 | 968 | 1172 | 133 | | |
| 5 | 2 | 74.9 | 14 | 1348 | - | 48 | | |
| 6 | 3 | 82.2 | 20 | 1692 | 1310 | 156 | | |
| 7 | 2 | 53.9 | 13 | 1342 | - | 45 | | |
| 8 | 3 | 62.7 | 15 | 1839 | 1651 | 76 | | |
| 9 | 2 | 86.2 | 6 | 1165 | - | 91 | | |
| 10 | 1 | 63.1 | 11 | - | - | 391 | | |
| 11 | 2 | 82.4 | 6 | 1416 | - | 107 | | |
| 12 | 1 | 95.8 | 18 | - | - | 248 | | |
| 13 | 2 | 75.7 | 9 | 993 | - | 482 | | |
| 14 | 3 | 70.1 | 18 | 1563 | 1020 | 354 | | |
| 15 | 3 | 85.8 | 13 | 1420 | 1084 | 446 | | |
| 16 | 1 | 63.2 | 7 | - | - | 265 | | |
| 17 | 1 | 75.1 | 11 | - | | 147 | | |
| 18 | 2 | 69.5 | 5 | 1802 | - | 256 | | |
| 19 | 1 | 51.8 | 19 | - | - | 422 | | |
| 20 | 2 | 62.3 | 5 | 1449 | - | 304 | | |
| Detection Che | ck (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | Trial Number | | | 14 | | | | |
|---------------------------|-------------------|---------------------|--|------|------|---------------|--|--|
| Number of Bursts in Trial | | | | 3 | 3 | | | |
| Chirp Center F | requency | | | 55 | 09 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Locat (MHz) Spacing (us) Spacing (us) With | | | | | |
| | | | | | | Interval (ms) | | |
| 1 | 3 | 74.9 | 5 | 1314 | 1466 | 1289 | | |
| 2 | 2 | 83.9 | 19 | 1442 | - | 1436 | | |
| 3 | 2 | 55.8 | 6 | 1147 | - | 240 | | |
| 4 | 2 | 59.4 | 6 | 1490 | - | 1455 | | |
| 5 | 2 | 78.2 | 15 | 1665 | - | 1312 | | |
| 6 | 2 | 57.3 | 15 | 1357 | - | 264 | | |
| 7 | 2 | 76.2 | 11 | 1651 | | 255 | | |
| 8 | 3 | 59 | 7 1460 1109 1410 | | | | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 90 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 15 | | | | |
|---------------------------|-------------------|---------------------|---|------|------|------|--|
| Number of Bursts in Trial | | | | ę | 9 | | |
| Chirp Center F | requency | | | 55 | 10 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Locat Spacing (us) Spacing (us) With Interval | | | | |
| 1 | 3 | 77.7 | 19 | 1046 | 1568 | 17 | |
| 2 | 2 | 98.2 | 20 | 1628 | - | 877 | |
| 3 | 2 | 95.3 | 8 | 1540 | - | 1066 | |
| 4 | 2 | 78.8 | 15 | 1341 | - | 822 | |
| 5 | 2 | 52.8 | 20 | 988 | - | 1020 | |
| 6 | 2 | 65.2 | 9 | 1480 | - | 602 | |
| 7 | 2 | 99.5 | 10 | 1867 | - | 884 | |
| 8 | 2 | 79.5 | 13 | 1148 | - | 342 | |
| 9 | 3 | 50.6 | 13 1030 1525 1321 | | | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | Trial Number | | | 16 | | | |
|------------------------|--------------------|---------------------|----------------------|------------------------------|----|---|--|
| Number of Bu | rsts in Trial | | | 10 | | | |
| Chirp Center Frequency | | | | 55 | 11 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 2 | 97.5 | 11 | 1357 | - | 764 | |
| 2 | 2 | 91.8 | 13 | 1896 | - | 298 | |
| 3 | 1 | 78.5 | 5 | - | - | 1117 | |
| 4 | 1 | 60.1 | 11 | - | - | 1069 | |
| 5 | 2 | 96.2 | 10 | 975 | - | 1157 | |
| 6 | 2 | 56.6 | 18 | 1626 | - | 701 | |
| 7 | 1 | 77.1 | 20 | - | - | 323 | |
| 8 | 2 | 96.3 | 8 | 1682 | - | 307 | |
| 9 | 2 | 52.2 | 13 | 1017 | - | 217 | |
| 10 | 1 | 92.8 | 15 | - | - | 316 | |
| Detection Ched | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 91 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 17 | | | | |
|------------------------|-------------------|---------------------|---|------|------|-----|--|
| Number of Bur | sts in Trial | | | 11 | | | |
| Chirp Center Frequency | | | | 55 | 12 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Spacing (us) Pulse 2-to-3 Location Spacing (us) Within Interval (n | | | | |
| 1 | 2 | 57.3 | 8 | 1220 | - | 792 | |
| 2 | 3 | 73.1 | 5 | 1717 | 1679 | 845 | |
| 3 | 2 | 54.1 | 14 | 967 | - | 112 | |
| 4 | 2 | 98.8 | 19 | 1137 | - | 715 | |
| 5 | 3 | 85.5 | 8 | 1068 | 960 | 301 | |
| 6 | 2 | 78.5 | 7 | 1387 | - | 827 | |
| 7 | 2 | 77.9 | 12 | 1869 | - | 506 | |
| 8 | 1 | 81.9 | 10 | - | - | 549 | |
| 9 | 1 | 50.4 | 9 | - | - | 464 | |
| 10 | 1 | 75.2 | 8 | - | - | 790 | |
| 11 | 2 | 92.7 | 7 | 1770 | - | 967 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 18 | | | |
|-----------------------|------------------------|---------------------|--|------|------|---------------|
| Number of Bu | rsts in Trial | | 12 | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 13 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Loc (MHz) Spacing (us) Spacing (us) Wi | | | |
| | | | | | | Interval (ms) |
| 1 | 2 | 79.1 | 6 | 1042 | - | 793 |
| 2 | 3 | 55.7 | 9 | 1327 | 1744 | 159 |
| 3 | 1 | 95 | 20 | - | - | 734 |
| 4 | 1 | 88.4 | 5 | - | - | 523 |
| 5 | 1 | 92.3 | 15 | - | - | 546 |
| 6 | 1 | 93.6 | 6 | - | - | 208 |
| 7 | 2 | 95.1 | 12 | 1044 | - | 894 |
| 8 | 1 | 59.5 | 17 | - | - | 666 |
| 9 | 2 | 98.7 | 17 | 1422 | - | 640 |
| 10 | 2 | 65.1 | 5 | 1104 | - | 320 |
| 11 | 1 | 60.2 | 5 | - | - | 60 |
| 12 | 1 | 88.7 | 8 | - | - | 823 |
| Detection Chec | k (1=Detection; C | =No Detection) | • | • | • | 1 |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 92 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | Trial Number | | | 19 | | | | |
|------------------------|-------------------|---------------------|----------------------|------------------------------|------|---|--|--|
| Number of Bui | rsts in Trial | | 13 | | | | | |
| Chirp Center Frequency | | | | 55 | 14 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | | |
| 1 | 1 | 53.9 | 10 | - | - | 226 | | |
| 2 | 2 | 82.6 | 13 | 992 | - | 854 | | |
| 3 | 1 | 87.7 | 8 | - | - | 303 | | |
| 4 | 3 | 69 | 12 | 1696 | 1606 | 528 | | |
| 5 | 1 | 68.6 | 12 | - | - | 220 | | |
| 6 | 3 | 76.5 | 13 | 1333 | 1468 | 389 | | |
| 7 | 2 | 95.8 | 17 | 1380 | - | 57 | | |
| 8 | 2 | 55.6 | 19 | 1147 | - | 334 | | |
| 9 | 2 | 78.6 | 14 | 1268 | - | 128 | | |
| 10 | 2 | 65.4 | 17 | 1231 | - | 913 | | |
| 11 | 2 | 76.6 | 18 | 1883 | - | 518 | | |
| 12 | 1 | 93.2 | 6 | - | - | 596 | | |
| 13 | 2 | 50.2 | 13 | 1836 | - | 61 | | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | | |

| Trial Number | | | 20 | | | | |
|-----------------------|------------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bur | rsts in Trial | | 14 | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 15 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 1 | 60.9 | 13 | - | - | 142 | |
| 2 | 2 | 81.7 | 15 | 1831 | - | 522 | |
| 3 | 2 | 78.5 | 5 | 1396 | - | 790 | |
| 4 | 2 | 98.2 | 6 | 1652 | - | 3 | |
| 5 | 1 | 64.1 | 12 | - | - | 414 | |
| 6 | 3 | 53 | 18 | 1862 | 1902 | 157 | |
| 7 | 2 | 62.3 | 15 | 1490 | - | 248 | |
| 8 | 2 | 87 | 11 | 1411 | - | 576 | |
| 9 | 2 | 78.4 | 8 | 1090 | - | 737 | |
| 10 | 2 | 87.2 | 7 | 967 | - | 343 | |
| 11 | 3 | 71 | 13 | 1662 | 1841 | 105 | |
| 12 | 2 | 77.2 | 5 | 1557 | - | 601 | |
| 13 | 1 | 94.4 | 15 | - | - | 108 | |
| 14 | 1 | 90.6 | 13 | - | - | 506 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 93 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | Trial Number | | | 21 | | | | |
|-----------------------|------------------------|---------------------|----------------------|------------------------------|------|---|--|--|
| Number of Bu | rsts in Trial | | 15 | | | | | |
| Chirp Center I | Chirp Center Frequency | | | 55 | 16 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | | |
| 1 | 3 | 76.5 | 8 | 1870 | 1326 | 385 | | |
| 2 | 2 | 95.3 | 13 | 1162 | 1 | 73 | | |
| 3 | 3 | 58.9 | 9 | 1586 | 1909 | 742 | | |
| 4 | 2 | 73.1 | 13 | 1460 | - | 330 | | |
| 5 | 2 | 73.1 | 12 | 1488 | - | 25 | | |
| 6 | 2 | 75.1 | 5 | 1331 | - | 418 | | |
| 7 | 3 | 98.5 | 11 | 936 | 1532 | 214 | | |
| 8 | 3 | 72.5 | 13 | 1110 | 1903 | 387 | | |
| 9 | 3 | 67.4 | 12 | 1567 | 1513 | 80 | | |
| 10 | 2 | 76.1 | 12 | 1005 | - | 277 | | |
| 11 | 2 | 94.3 | 17 | 1413 | - | 314 | | |
| 12 | 2 | 72.8 | 12 | 1778 | - | 66 | | |
| 13 | 2 | 90.9 | 14 | 1793 | - | 147 | | |
| 14 | 3 | 94.8 | 11 | 1012 | 1742 | 441 | | |
| 15 | 3 | 95 | 12 | 912 | 1641 | 609 | | |
| Detection Ched | ck (1=Detection; 0 | =No Detection) | | | | 1 | | |

Report No.: FZ4O0315-01

| Trial Number | | | 22 | | | |
|-----------------------|------------------------|---------------------|----------------------|------------------------------|------|---|
| Number of Bur | rsts in Trial | | 16 | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 17 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) |
| 1 | 1 | 96.7 | 9 | - | - | 308 |
| 2 | 2 | 78.3 | 13 | 1045 | - | 27 |
| 3 | 1 | 56.5 | 12 | - | - | 74 |
| 4 | 3 | 88.5 | 14 | 1119 | 1020 | 629 |
| 5 | 2 | 62.4 | 9 | 1436 | - | 548 |
| 6 | 2 | 78.2 | 5 | 1147 | - | 341 |
| 7 | 3 | 76.8 | 14 | 1069 | 1575 | 360 |
| 8 | 2 | 91.6 | 18 | 978 | - | 602 |
| 9 | 2 | 93.7 | 5 | 1130 | - | 623 |
| 10 | 2 | 97.4 | 8 | 1100 | - | 256 |
| 11 | 3 | 90.1 | 6 | 1629 | 1375 | 108 |
| 12 | 2 | 79.9 | 18 | 1809 | - | 183 |
| 13 | 2 | 83 | 10 | 1370 | - | 477 |
| 14 | 2 | 89.1 | 13 | 1239 | - | 484 |
| 15 | 2 | 58.3 | 8 | 1321 | - | 276 |
| 16 | 1 | 85.2 | 13 | - | - | 22 |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 |

 SPORTON INTERNATIONAL INC.
 Page No.
 : 94 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID : XCNDVW32C



| Trial Number | | | 23 | | | | |
|------------------------|-------------------|---------------------|--|------|------|-----|--|
| Number of Bur | sts in Trial | | 17 | | | | |
| Chirp Center Frequency | | | | 55 | 18 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Loca (MHz) Spacing (us) Spacing (us) Interva | | | | |
| 1 | 3 | 60 | 10 | 1097 | 1748 | 56 | |
| 2 | 3 | 66.3 | 13 | 1391 | 1430 | 421 | |
| 3 | 2 | 88.5 | 15 | 1040 | - | 583 | |
| 4 | 2 | 72.1 | 8 | 1526 | - | 161 | |
| 5 | 1 | 72.3 | 8 | - | - | 450 | |
| 6 | 2 | 67.3 | 7 | 1022 | - | 48 | |
| 7 | 2 | 56.1 | 12 | 1325 | - | 661 | |
| 8 | 1 | 83.5 | 11 | - | - | 695 | |
| 9 | 3 | 99.4 | 13 | 1490 | 938 | 405 | |
| 10 | 1 | 54.2 | 12 | - | - | 126 | |
| 11 | 3 | 92.7 | 17 | 1251 | 1631 | 365 | |
| 12 | 3 | 95.1 | 17 | 1741 | 1162 | 57 | |
| 13 | 2 | 84 | 9 | 1597 | - | 167 | |
| 14 | 1 | 68.5 | 18 | - | - | 512 | |
| 15 | 1 | 76.5 | 20 | - | - | 185 | |
| 16 | 3 | 86.6 | 11 | 1774 | 1875 | 457 | |
| 17 | 2 | 62.2 | 9 | 1563 | - | 492 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | Trial Number | | | 24 | | | | |
|-----------------------|------------------------|---------------------|----------------------|---|------|-----|--|--|
| Number of Bui | rsts in Trial | | 18 | | | | | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 19 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | | |
| 1 | 1 | 86.6 | 19 | - | - | 621 | | |
| 2 | 2 | 95.3 | 17 | 926 | - | 128 | | |
| 3 | 1 | 76.2 | 12 | - | 1 | 251 | | |
| 4 | 3 | 71.4 | 19 | 1287 | 1404 | 269 | | |
| 5 | 3 | 51.7 | 12 | 1564 | 1339 | 633 | | |
| 6 | 2 | 77 | 5 | 1899 | ı | 615 | | |
| 7 | 1 | 87.5 | 12 | - | ı | 375 | | |
| 8 | 3 | 59 | 17 | 1327 | 1615 | 610 | | |
| 9 | 2 | 78.3 | 15 | 1551 | ı | 548 | | |
| 10 | 2 | 89.7 | 5 | 1718 | ı | 456 | | |
| 11 | 2 | 92.1 | 7 | 1403 | ı | 12 | | |
| 12 | 2 | 97.3 | 14 | 1338 | ı | 596 | | |
| 13 | 3 | 80.3 | 20 | 1354 | 1563 | 484 | | |
| 14 | 1 | 98.2 | 8 | - | ı | 428 | | |
| 15 | 3 | 94.4 | 13 | 1795 | 1829 | 512 | | |
| 16 | 2 | 90.4 | 13 | 1105 | 1 | 342 | | |
| 17 | 2 | 73.6 | 19 | 1787 | - | 292 | | |
| 18 | 1 | 82.9 | 7 | - | - | 618 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 95 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | 25 | | | | | |
|----------------------|---------------------------|---------------------|----------------------|------|------------------------------|---|--|--|
| Number of Bu | Number of Bursts in Trial | | | 19 | | | | |
| Chirp Center | Frequency | | | 55 | 20 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 1 | 90 | 18 | - | - | 173 | | |
| 2 | 1 | 65.3 | 19 | - | - | 245 | | |
| 3 | 2 | 82.6 | 10 | 1756 | - | 127 | | |
| 4 | 2 | 93.9 | 18 | 1557 | - | 287 | | |
| 5 | 2 | 50.5 | 13 | 1479 | - | 282 | | |
| 6 | 1 | 68 | 7 | - | - | 176 | | |
| 7 | 3 | 88.4 | 11 | 1244 | 1076 | 568 | | |
| 8 | 3 | 66.8 | 11 | 1288 | 1909 | 448 | | |
| 9 | 2 | 88 | 12 | 1450 | - | 527 | | |
| 10 | 3 | 51.1 | 6 | 1797 | 1935 | 195 | | |
| 11 | 2 | 93.8 | 13 | 1073 | - | 184 | | |
| 12 | 1 | 83.5 | 10 | - | - | 506 | | |
| 13 | 2 | 96.9 | 12 | 1047 | - | 267 | | |
| 14 | 3 | 87.2 | 18 | 1521 | 1450 | 243 | | |
| 15 | 2 | 60.1 | 8 | 1545 | - | 291 | | |
| 16 | 3 | 98 | 10 | 1842 | 1402 | 554 | | |
| 17 | 3 | 57 | 19 | 1665 | 1732 | 143 | | |
| 18 | 1 | 74.3 | 14 | - | - | 31 | | |
| 19 | 2 | 57.8 | 10 | 1576 | - | 609 | | |
| Detection Che | ck (1=Detection; C | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 96 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 26 | | | | | |
|-----------------------|---------------------------|---------------------|----------------------|--------------|------------------------------|---|--|--|
| Number of Bu | Number of Bursts in Trial | | | 20 | | | | |
| Chirp Center F | requency | | | 55 | 21 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 92.8 | 9 | 1222 | - | 531 | | |
| 2 | 2 | 52.4 | 8 | 1547 | - | 168 | | |
| 3 | 3 | 56.8 | 7 | 1158 | 1184 | 193 | | |
| 4 | 1 | 91.2 | 7 | - | - | 565 | | |
| 5 | 3 | 61.2 | 10 | 1558 | 1664 | 387 | | |
| 6 | 3 | 62 | 7 | 1518 | 1656 | 391 | | |
| 7 | 2 | 69 | 5 | 1531 | - | 327 | | |
| 8 | 2 | 67.3 | 18 | 1064 | - | 25 | | |
| 9 | 1 | 94.1 | 5 | - | - | 78 | | |
| 10 | 2 | 76 | 17 | 1190 | - | 222 | | |
| 11 | 2 | 81.9 | 12 | 1815 | - | 96 | | |
| 12 | 2 | 57.9 | 8 | 1594 | - | 277 | | |
| 13 | 3 | 68.3 | 19 | 1427 | 1540 | 41 | | |
| 14 | 2 | 53.3 | 7 | 1713 | - | 48 | | |
| 15 | 2 | 85.3 | 15 | 1136 | - | 48 | | |
| 16 | 1 | 65.3 | 20 | - | - | 57 | | |
| 17 | 3 | 79.8 | 20 | 923 | 1259 | 48 | | |
| 18 | 2 | 56.9 | 20 | 1357 | - | 483 | | |
| 19 | 2 | 93 | 9 | 1686 | - | 73 | | |
| 20 | 2 | 82.8 | 10 | 944 | - | 352 | | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | Trial Number | | | 27 | | | |
|--------------------------------------|-------------------|----------------|-------------------|------------------------------|------------------------------|--------------------------------|--|
| Number of Bur | sts in Trial | | | 3 | 3 | | |
| Chirp Center F | requency | | | 55 | 22 | | |
| Burst No. of Pulses Pulse Width (us) | | | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within | |
| | | | | | | Interval (ms) | |
| 1 | 3 | 50.9 | 11 | 1106 | 1077 | 1293 | |
| 2 | 2 | 77.8 | 18 | 1836 | - | 1235 | |
| 3 | 3 | 60.7 | 5 | 1069 | 1635 | 1092 | |
| 4 | 2 | 77.2 | 13 | 1916 | - | 1343 | |
| 5 | 2 | 91.6 | 13 | 1465 | - | 1466 | |
| 6 | 2 | 56.8 | 17 | 1783 | - | 376 | |
| 7 | 1 | 59.5 | 20 | - | - | 131 | |
| 8 | 1 | 66.5 | 12 - 10 | | | 1024 | |
| Detection Chec | k (1=Detection; C | =No Detection) | | • | | 0 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 97 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | Trial Number | | | 2 | 8 | | |
|--------------------------------------|---------------------------|----------------------|--------------|------------------------------|---|------|--|
| Number of Bu | Number of Bursts in Trial | | | 9 | | | |
| Chirp Center | Frequency | | | 55 | 23 | | |
| Burst No. of Pulses Pulse Width (us) | | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 72 | 9 | 1092 | - | 965 | |
| 2 | 2 | 89.2 | 6 | 1550 | - | 1226 | |
| 3 | 1 | 81.2 | 12 | - | - | 277 | |
| 4 | 2 | 80.6 | 15 | 1616 | - | 458 | |
| 5 | 2 | 62.8 | 10 | 1812 | - | 748 | |
| 6 | 1 | 71 | 8 | - | - | 434 | |
| 7 | 2 | 69.3 | 6 | 1027 | - | 1111 | |
| 8 | 2 | 77.2 | 13 | 1076 | - | 638 | |
| 9 | 2 | 65.4 | 5 1582 - 278 | | | | |
| Detection Che | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | | 2 | 9 | | |
|-----------------------|---------------------------|---------------------|---|------|------|---|--|
| Number of Bur | Number of Bursts in Trial | | | 10 | | | |
| Chirp Center F | requency | | | 55 | 25 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Location (MHz) Spacing (us) Spacing (us) Within | | | Starting Location Within Interval (ms) | |
| 1 | 1 | 51.5 | 19 | - | - | 151 | |
| 2 | 1 | 82.3 | 13 | - | - | 1071 | |
| 3 | 3 | 78.3 | 8 | 1115 | 1740 | 646 | |
| 4 | 2 | 99 | 14 | 1101 | - | 709 | |
| 5 | 3 | 98.8 | 7 | 1819 | 945 | 556 | |
| 6 | 2 | 80.9 | 19 | 922 | - | 567 | |
| 7 | 2 | 64 | 12 | 953 | - | 581 | |
| 8 | 1 | 79 | 20 | - | - | 798 | |
| 9 | 1 | 68 | 8 | - | - | 112 | |
| 10 | 2 | 50.4 | 13 | 1587 | - | 26 | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 98 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | Trial Number | | | 3 | 0 | |
|----------------------|---------------------|---------------------|----------------------|------|------------------------------|---|
| Number of B | ursts in Trial | | 11 | | | |
| Chirp Center | Frequency | | | 54 | 95 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) |
| 1 | 3 | 57.8 | 5 | 1324 | 1716 | 82 |
| 2 | 2 | 70.1 | 20 | 1733 | - | 587 |
| 3 | 2 | 95.2 | 13 | 1188 | - | 789 |
| 4 | 3 | 84.6 | 20 | 1042 | 1259 | 1021 |
| 5 | 3 | 96.5 | 7 | 1329 | 1596 | 16 |
| 6 | 2 | 84.3 | 15 | 1606 | - | 708 |
| 7 | 3 | 53.5 | 19 | 1783 | 1458 | 738 |
| 8 | 3 | 74.9 | 5 | 1599 | 1891 | 466 |
| 9 | 3 | 53.8 | 7 | 1494 | 1467 | 252 |
| 10 | 2 | 60.5 | 14 | 1319 | - | 464 |
| 11 | 1 | 73.3 | 10 | - | - | 845 |
| Detection Che | eck (1=Detection; 0 | =No Detection) | • | • | • | 1 |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 99 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



Type 6 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulses / Hop | Pulse Width (us) | PRI (us) | 1=Detection 0=No Detection |
|---------|------------------|-------------------|------------------|----------|-------------------------------|
| 1 | 5510 | 9 | 1 | 333 | 1 |
| 2 | 5510 | 9 | 1 | 333 | 1 |
| 3 | 5510 | 9 | 1 | 333 | 1 |
| 4 | 5510 | 9 | 1 | 333 | 1 |
| 5 | 5510 | 9 | 1 | 333 | 1 |
| 6 | 5510 | 9 | 1 | 333 | 1 |
| 7 | 5510 | 9 | 1 | 333 | 1 |
| 8 | 5510 | 9 | 1 | 333 | 1 |
| 9 | 5510 | 9 | 1 | 333 | 1 |
| 10 | 5510 | 9 | 1 | 333 | 1 |
| 11 | 5510 | 9 | 1 | 333 | 1 |
| 12 | 5510 | 9 | 1 | 333 | 1 |
| 13 | 5510 | 9 | 1 | 333 | 1 |
| 14 | 5510 | 9 | 1 | 333 | 1 |
| 15 | 5510 | 9 | 1 | 333 | 1 |
| 16 | 5510 | 9 | 1 | 333 | 1 |
| 17 | 5510 | 9 | 1 | 333 | 1 |
| 18 | 5510 | 9 | 1 | 333 | 1 |
| 19 | 5510 | 9 | 1 | 333 | 1 |
| 20 | 5510 | 9 | 1 | 333 | 1 |
| 21 | 5510 | 9 | 1 | 333 | 1 |
| 22 | 5510 | 9 | 1 | 333 | 1 |
| 23 | 5510 | 9 | 1 | 333 | 1 |
| 24 | 5510 | 9 | 1 | 333 | 1 |
| 25 | 5510 | 9 | 1 | 333 | 1 |
| 26 | 5510 | 9 | 1 | 333 | 1 |
| 27 | 5510 | 9 | 1 | 333 | 1 |
| 28 | 5510 | 9 | 1 | 333 | 1 |
| 29 | 5510 | 9 | 1 | 333 | 1 |
| 30 | 5510 | 9 | 1 | 333 | 1 |
| | | etection Percenta | age (%) | | 100.00 |
| imit | 70% | | | | |
| est Res | Complied | | | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 100 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Modulation Mode: 802.11ac (VHT80)

Type 1 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Repetition Frequency Number | Pulse Repetition Frequency (Pulse Per Second) | PRI (us) | 1=Detection 0=No Detection |
|-----------------|------------------|--------------------------------------|---|----------|-------------------------------|
| 1 | 5516 | 1 | 1930.5 | 518 | 1 |
| 2 | 5517 | 23 | 326.2 | 3066 | 1 |
| 3 | 5518 | 19 | 1139.0 | 878 | 1 |
| 4 | 5519 | 12 | 1355.0 | 738 | 0 |
| 5 | 5520 | 4 | 1730.1 | 578 | 1 |
| 6 | 5521 | 8 | 1519.8 | 658 | 1 |
| 7 | 5522 | 15 | 1253.1 | 798 | 1 |
| 8 | 5523 | 6 | 1618.1 | 618 | 1 |
| 9 | 5524 | 14 | 1285.3 | 778 | 1 |
| 10 | 5525 | 3 | 1792.1 | 558 | 1 |
| 11 | 5526 | 13 | 1319.3 | 758 | 1 |
| 12 | 5527 | 9 | 1474.9 | 678 | 1 |
| 13 | 5528 | 7 | 1567.4 | 638 | 1 |
| 14 | 5529 | 17 | 1193.3 | 838 | 1 |
| 15 | 5530 | 10 | 1432.7 | 698 | 1 |
| 16 | 5531 | - | 1692.0 | 591 | 1 |
| 17 | 5532 | - | 328.1 | 3048 | 1 |
| 18 | 5533 | - | 373.4 | 2678 | 1 |
| 19 | 5534 | - | 574.4 | 1741 | 1 |
| 20 | 5535 | - | 1216.5 | 822 | 1 |
| 21 | 5536 | - | 801.3 | 1248 | 1 |
| 22 | 5537 | - | 488.5 | 2047 | 0 |
| 23 | 5538 | - | 956.0 | 1046 | 1 |
| 24 | 5539 | - | 517.6 | 1932 | 1 |
| 25 | 5540 | - | 1422.5 | 703 | 1 |
| 26 | 5541 | - | 542.0 | 1845 | 1 |
| 27 | 5542 | - | 741.3 | 1349 | 0 |
| 28 | 5543 | - | 881.8 | 1134 | 1 |
| 29 | 5544 | - | 427.4 | 2340 | 1 |
| 30 | 5545 | - | 628.9 | 1590 | 1 |
| | | etection Percentage | (%) | | 90.00 |
| Limit | | | | | 60% |
| Test Res | ult | | | | Complied |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 101 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 2 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|-------------|------------------|------------------|----------|----------------|-------------------------------|
| 1 | 5516 | 2.6 | 221 | 23 | 1 |
| 2 | 5517 | 4.6 | 198 | 27 | 1 |
| 3 | 5518 | 1.1 | 184 | 29 | 1 |
| 4 | 5519 | 4.8 | 203 | 24 | 0 |
| 5 | 5520 | 2.4 | 162 | 25 | 1 |
| 6 | 5521 | 3.4 | 204 | 28 | 1 |
| 7 | 5522 | 2.3 | 170 | 27 | 1 |
| 8 | 5523 | 3.5 | 184 | 23 | 0 |
| 9 | 5524 | 4.9 | 150 | 27 | 1 |
| 10 | 5525 | 4.6 | 211 | 29 | 1 |
| 11 | 5526 | 2.9 | 158 | 23 | 1 |
| 12 | 5527 | 2.6 | 226 | 27 | 1 |
| 13 | 5528 | 1.6 | 204 | 26 | 1 |
| 14 | 5529 | 3.9 | 181 | 25 | 1 |
| 15 | 5530 | 4.6 | 202 | 24 | 1 |
| 16 | 5531 | 4.1 | 194 | 27 | 1 |
| 17 | 5532 | 2.3 | 193 | 28 | 1 |
| 18 | 5533 | 3.9 | 173 | 29 | 1 |
| 19 | 5534 | 4.3 | 188 | 23 | 0 |
| 20 | 5535 | 1.5 | 215 | 26 | 1 |
| 21 | 5536 | 4.9 | 227 | 27 | 1 |
| 22 | 5537 | 1.1 | 199 | 23 | 1 |
| 23 | 5538 | 4.5 | 155 | 29 | 1 |
| 24 | 5539 | 4.0 | 190 | 27 | 1 |
| 25 | 5540 | 2.4 | 151 | 23 | 1 |
| 26 | 5541 | 2.5 | 180 | 28 | 1 |
| 27 | 5542 | 2.5 | 228 | 23 | 1 |
| 28 | 5543 | 2.5 | 203 | 25 | 0 |
| 29 | 5544 | 1.5 | 188 | 25 | 1 |
| 30 | 5545 | 1.9 | 217 | 24 | 1 |
| | 86.67 | | | | |
| Limit | | | | | 60% |
| Test Result | | | | | Complied |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 102 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 3 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|-------------|------------------|------------------------|----------|----------------|-------------------------------|
| 1 | 5516 | 8.0 | 205 | 16 | 1 |
| 2 | 5517 | 6.7 | 382 | 18 | 1 |
| 3 | 5518 | 8.6 | 418 | 16 | 0 |
| 4 | 5519 | 9.4 | 351 | 17 | 1 |
| 5 | 5520 | 7.4 | 383 | 18 | 1 |
| 6 | 5521 | 9.8 | 232 | 16 | 1 |
| 7 | 5522 | 9.1 | 377 | 17 | 1 |
| 8 | 5523 | 9.6 | 457 | 16 | 0 |
| 9 | 5524 | 8.0 | 471 | 18 | 1 |
| 10 | 5525 | 9.0 | 304 | 18 | 1 |
| 11 | 5526 | 8.0 | 316 | 17 | 1 |
| 12 | 5527 | 9.8 | 325 | 16 | 1 |
| 13 | 5528 | 8.0 | 409 | 17 | 1 |
| 14 | 5529 | 9.9 | 200 | 17 | 1 |
| 15 | 5530 | 8.8 | 458 | 16 | 1 |
| 16 | 5531 | 8.0 | 232 | 18 | 1 |
| 17 | 5532 | 8.3 | 250 | 16 | 1 |
| 18 | 5533 | 8.7 | 270 | 16 | 1 |
| 19 | 5534 | 7.7 | 350 | 17 | 1 |
| 20 | 5535 | 7.1 | 230 | 16 | 1 |
| 21 | 5536 | 7.3 | 416 | 18 | 1 |
| 22 | 5537 | 7.6 | 498 | 18 | 0 |
| 23 | 5538 | 7.3 | 286 | 17 | 1 |
| 24 | 5539 | 7.3 | 287 | 16 | 1 |
| 25 | 5540 | 7.5 | 462 | 17 | 1 |
| 26 | 5541 | 6.2 | 300 | 17 | 1 |
| 27 | 5542 | 6.4 | 323 | 18 | 0 |
| 28 | 5543 | 7.1 | 420 | 16 | 1 |
| 29 | 5544 | 7.2 | 395 | 18 | 1 |
| 30 | 5545 | 8.4 | 377 | 16 | 1 |
| | D | etection Percentage (9 | %) | | 86.67 |
| Limit | | | | | 60% |
| Test Result | | | | | Complied |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 103 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 4 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulse Width (us) | PRI (us) | Pulses / Burst | 1=Detection 0=No Detection |
|--------------------------|------------------|------------------|----------|----------------|-------------------------------|
| 1 | 5516 | 18.0 | 242 | 15 | 1 |
| 2 | 5517 | 19.9 | 279 | 12 | 0 |
| 3 | 5518 | 12.9 | 487 | 14 | 1 |
| 4 | 5519 | 15.0 | 452 | 13 | 1 |
| 5 | 5520 | 16.3 | 230 | 12 | 0 |
| 6 | 5521 | 19.8 | 238 | 13 | 1 |
| 7 | 5522 | 18.2 | 420 | 16 | 1 |
| 8 | 5523 | 16.3 | 452 | 15 | 1 |
| 9 | 5524 | 14.2 | 495 | 12 | 1 |
| 10 | 5525 | 17.8 | 228 | 16 | 1 |
| 11 | 5526 | 19.1 | 211 | 16 | 1 |
| 12 | 5527 | 18.4 | 283 | 15 | 1 |
| 13 | 5528 | 11.8 | 411 | 12 | 1 |
| 14 | 5529 | 14.2 | 284 | 13 | 1 |
| 15 | 5530 | 13.9 | 202 | 12 | 1 |
| 16 | 5531 | 17.8 | 340 | 14 | 0 |
| 17 | 5532 | 15.6 | 290 | 16 | 1 |
| 18 | 5533 | 14.6 | 250 | 16 | 1 |
| 19 | 5534 | 14.4 | 484 | 15 | 0 |
| 20 | 5535 | 18.9 | 387 | 13 | 1 |
| 21 | 5536 | 11.1 | 348 | 15 | 1 |
| 22 | 5537 | 13.8 | 291 | 16 | 1 |
| 23 | 5538 | 14.3 | 295 | 12 | 1 |
| 24 | 5539 | 12.5 | 300 | 12 | 0 |
| 25 | 5540 | 12.5 | 322 | 14 | 1 |
| 26 | 5541 | 12.5 | 383 | 13 | 1 |
| 27 | 5542 | 15.7 | 322 | 16 | 1 |
| 28 | 5543 | 19.8 | 469 | 13 | 1 |
| 29 | 5544 | 18.6 | 406 | 15 | 1 |
| 30 | 5545 | 15.9 | 238 | 14 | 0 |
| Detection Percentage (%) | | | | | 80.00 |
| Limit | | | | | 60% |
| Test Result | | | | | Complied |

SPORTON INTERNATIONAL INC. Page No. TEL: 886-3-327-3456 Report Ve

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 104 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Total Type 1~4 Radar Statistical Performance

| Radar Type # | Detection Percentage (%) |
|-----------------------------|--------------------------|
| 1 | 90.00 |
| 2 | 86.67 |
| 3 | 86.67 |
| 4 | 80.00 |
| Aggregate (Radar Types 1-4) | 85.83 |
| Limit | 80% |
| Test Result | Complied |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 105 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID: XCNDVW32C



Type 5 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection | Trial # | Test Freq. (MHz) | 1=Detection 0=No Detection |
|--------------------------|---------------------|-------------------------------|---------|---------------------|-------------------------------|---------|---------------------|----------------------------------|
| 1 | 5561 | 1 | 11 | 5520 | 1 | 21 | 5550 | 1 |
| 2 | 5500 | 1 | 12 | 5525 | 1 | 22 | 5553 | 1 |
| 3 | 5503 | 1 | 13 | 5528 | 1 | 23 | 5555 | 1 |
| 4 | 5505 | 1 | 14 | 5529 | 1 | 24 | 5524 | 1 |
| 5 | 5507 | 0 | 15 | 5514 | 1 | 25 | 5541 | 1 |
| 6 | 5508 | 1 | 16 | 5529 | 0 | 26 | 5530 | 1 |
| 7 | 5509 | 1 | 17 | 5532 | 1 | 27 | 5531 | 1 |
| 8 | 5505 | 1 | 18 | 5535 | 1 | 28 | 5527 | 1 |
| 9 | 5510 | 1 | 19 | 5540 | 1 | 29 | 5560 | 0 |
| 10 | 5515 | 1 | 20 | 5545 | 1 | 30 | 5561 | 1 |
| Detection Percentage (%) | | | | | | | | 90.00 |
| Limit | | | | | | | | 80% |
| Test Result | | | | | | | Complied | |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 106 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID: XCNDVW32C



| Trial Number | | | 1 | | | | |
|---|---------------|---------------------|----------------------|------------------------------|------|---|--|
| Number of Bur | rsts in Trial | | 8 | | | | |
| Chirp Center F | requency | | 5561 | | | | |
| Burst No. of Pulses | | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 1 | 62.3 | 8 | - | - | 346 | |
| 2 | 2 | 51.2 | 15 | 1745 | - | 1205 | |
| 3 | 3 | 93.6 | 5 | 957 | 1634 | 674 | |
| 4 | 3 | 68.2 | 12 | 1668 | 1573 | 384 | |
| 5 | 3 | 83.1 | 8 | 1188 | 1888 | 876 | |
| 6 | 1 | 56.7 | 18 | - | - | 376 | |
| 7 | 2 | 60.6 | 18 | 1874 | - | 1409 | |
| 8 | 3 | 75.5 | 13 | 1263 | 1683 | 1378 | |
| Detection Check (1=Detection; 0=No Detection) | | | | | | | |

| Trial Number | | | 2 | | | | |
|---|---------------|---------------------|----------------------|------------------------------|------|---|--|
| Number of Bu | rsts in Trial | | 9 | | | | |
| Chirp Center F | requency | | 5500 | | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | |
| 1 | 1 | 99.6 | 13 | - | - | 217 | |
| 2 | 2 | 54.8 | 15 | 1727 | - | 982 | |
| 3 | 3 | 91.1 | 15 | 1120 | 1826 | 941 | |
| 4 | 2 | 76.2 | 7 | 1638 | - | 477 | |
| 5 | 1 | 88.9 | 13 | - | - | 259 | |
| 6 | 1 | 83 | 9 | - | - | 892 | |
| 7 | 1 | 83.9 | 12 | - | - | 320 | |
| 8 | 2 | 55.9 | 15 | 1613 | - | 445 | |
| 9 | 1 | 96.1 | 13 | - | - | 779 | |
| Detection Check (1=Detection; 0=No Detection) | | | | | | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 107 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 3 | | | | | |
|---|---------------|---------------------|----------------------|------------------------------|------|---|--|--|
| Number of Bui | rsts in Trial | | 10 | | | | | |
| Chirp Center F | requency | | 5503 | | | | | |
| Burst No. of Pulses | | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | | |
| 1 | 2 | 82 | 6 | 1246 | - | 1017 | | |
| 2 | 1 | 93.2 | 13 | - | - | 760 | | |
| 3 | 2 | 61.3 | 13 | 1175 | - | 327 | | |
| 4 | 1 | 52.8 | 8 | - | - | 824 | | |
| 5 | 3 | 70.6 | 19 | 929 | 1076 | 115 | | |
| 6 | 1 | 80.3 | 17 | - | - | 325 | | |
| 7 | 1 | 83.2 | 15 | - | - | 679 | | |
| 8 | 2 | 94 | 9 | 1805 | - | 888 | | |
| 9 | 2 | 67 | 8 | 1486 | - | 849 | | |
| 10 | 1 | 56.4 | 20 | - | - | 813 | | |
| Detection Check (1=Detection; 0=No Detection) | | | | | | | | |

| Trial Number | | | 4 | | | | | |
|---|----------------|---------------------|----------------------|------------------------------|------------------------------|---|--|--|
| Number of Bu | ırsts in Trial | | 11 | | | | | |
| Chirp Center | Frequency | | 5505 | | | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 3 | 90.5 | 8 | 1149 | 1612 | 35 | | |
| 2 | 3 | 54.5 | 8 | 1094 | 1525 | 1014 | | |
| 3 | 1 | 57.1 | 18 | - | - | 827 | | |
| 4 | 2 | 98.6 | 20 | 1292 | - | 83 | | |
| 5 | 2 | 62.9 | 12 | 1433 | - | 676 | | |
| 6 | 1 | 71.1 | 15 | - | - | 708 | | |
| 7 | 1 | 96.7 | 5 | - | - | 711 | | |
| 8 | 1 | 64.3 | 5 | - | - | 484 | | |
| 9 | 3 | 61.2 | 8 | 1075 | 1524 | 444 | | |
| 10 | 2 | 79.2 | 13 | 1877 | - | 797 | | |
| 11 | 2 | 79.3 | 20 | 1313 | - | 288 | | |
| Detection Check (1=Detection; 0=No Detection) | | | | | | | | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 108 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 5 | | | |
|------------------------|-------------------|---------------------|---|------|------|---------------|
| Number of Bur | sts in Trial | | 12 | | | |
| Chirp Center Frequency | | | | 55 | 07 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Location (MHz) Spacing (us) Spacing (us) Within | | | |
| 1 | 1 | 89.5 | 13 | _ | _ | Interval (ms) |
| 2 | 3 | 71.8 | 11 | 1446 | 1549 | 117 |
| 3 | 3 | 53.7 | 15 | 1100 | 1517 | 485 |
| 4 | 2 | 99.3 | 11 | 1571 | - | 334 |
| 5 | 3 | 56.8 | 6 | 1594 | 1280 | 468 |
| 6 | 1 | 97.4 | 11 | - | - | 213 |
| 7 | 2 | 67.6 | 13 | 1831 | - | 14 |
| 8 | 3 | 77.1 | 8 | 1683 | 1337 | 267 |
| 9 | 1 | 98.5 | 17 | - | - | 544 |
| 10 | 3 | 58.3 | 13 | 1924 | 1829 | 159 |
| 11 | 1 | 98.4 | 14 | - | - | 380 |
| 12 | 1 | 79.3 | 11 | - | - | 257 |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 0 |

| Trial Number | Trial Number | | | 6 | | | |
|------------------------|-------------------|---------------------|--|------|------|-----|--|
| Number of Bur | rsts in Trial | | | 1 | 3 | | |
| Chirp Center Frequency | | | | 55 | 08 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Location (MHz) Spacing (us) Spacing (us) With Interval | | | | |
| 1 | 2 | 53.8 | 14 | 1631 | - | 768 | |
| 2 | 1 | 90 | 17 | - | - | 530 | |
| 3 | 3 | 87.2 | 18 | 1115 | 1297 | 157 | |
| 4 | 2 | 82 | 11 | 1728 | - | 892 | |
| 5 | 3 | 69.8 | 7 | 1641 | 1779 | 196 | |
| 6 | 2 | 63.1 | 20 | 1836 | - | 331 | |
| 7 | 1 | 59.8 | 6 | - | - | 495 | |
| 8 | 3 | 78.5 | 19 | 941 | 1921 | 546 | |
| 9 | 1 | 85.7 | 6 | - | - | 219 | |
| 10 | 3 | 67.7 | 9 | 1834 | 1450 | 534 | |
| 11 | 2 | 84.5 | 15 | 1376 | - | 282 | |
| 12 | 2 | 99.3 | 13 | 1570 | - | 486 | |
| 13 | 2 | 80.2 | 8 | 1088 | - | 67 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 109 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 7 | | | | |
|------------------------|-------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bur | rsts in Trial | | | 14 | | | |
| Chirp Center Frequency | | | | 55 | 09 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 3 | 80.8 | 10 | 1061 | 1124 | 389 | |
| 2 | 2 | 81 | 9 | 1479 | - | 234 | |
| 3 | 2 | 87.6 | 17 | 1247 | - | 577 | |
| 4 | 2 | 94.7 | 18 | 1041 | - | 572 | |
| 5 | 2 | 78 | 18 | 1267 | - | 313 | |
| 6 | 1 | 95.5 | 14 | - | - | 52 | |
| 7 | 2 | 97.6 | 15 | 1215 | - | 57 | |
| 8 | 3 | 88 | 9 | 1349 | 1598 | 171 | |
| 9 | 2 | 69.7 | 17 | 1711 | - | 769 | |
| 10 | 2 | 96.5 | 17 | 1431 | - | 168 | |
| 11 | 2 | 96.9 | 6 | 1871 | - | 124 | |
| 12 | 3 | 66.4 | 10 | 1824 | 1468 | 766 | |
| 13 | 1 | 78.8 | 10 | - | - | 537 | |
| 14 | 3 | 87.6 | 6 | 1080 | 1159 | 714 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | · | | 1 | |

| Trial Number | | | 8 | | | | |
|------------------------|-------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | rsts in Trial | | 15 | | | | |
| Chirp Center Frequency | | | | 55 | 05 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Chirp Width (MHz) Pulse 1-to-2 Spacing (us) Pulse 2-to-3 Spacing (us) | | | |
| 1 | 2 | 71.8 | 14 | 1432 | - | 573 | |
| 2 | 2 | 65.9 | 19 | 1762 | - | 314 | |
| 3 | 2 | 74.7 | 6 | 1754 | - | 377 | |
| 4 | 3 | 81.7 | 5 | 1133 | 974 | 216 | |
| 5 | 3 | 57.8 | 14 | 1176 | 1712 | 129 | |
| 6 | 1 | 80.6 | 6 | - | - | 341 | |
| 7 | 3 | 99.3 | 17 | 1268 | 1876 | 165 | |
| 8 | 1 | 79.8 | 12 | - | - | 618 | |
| 9 | 3 | 83 | 11 | 990 | 1738 | 589 | |
| 10 | 3 | 71.5 | 11 | 1473 | 1255 | 6 | |
| 11 | 1 | 77.4 | 11 | - | - | 127 | |
| 12 | 2 | 84.8 | 12 | 1390 | - | 515 | |
| 13 | 2 | 64.6 | 12 | 1653 | - | 148 | |
| 14 | 2 | 92.9 | 12 | 1881 | - | 519 | |
| 15 | 1 | 71.3 | 6 | - | - | 301 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 110 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 9 | | | | |
|------------------------|-------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 16 | | | | |
| Chirp Center Frequency | | | | 55 | 10 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 2 | 55.4 | 9 | 1318 | - | 383 | |
| 2 | 2 | 80.8 | 18 | 1710 | - | 534 | |
| 3 | 1 | 88.8 | 9 | - | - | 495 | |
| 4 | 2 | 78 | 12 | 1818 | - | 92 | |
| 5 | 1 | 78.5 | 12 | - | - | 108 | |
| 6 | 2 | 55 | 13 | 1219 | - | 123 | |
| 7 | 2 | 75.9 | 20 | 1004 | - | 123 | |
| 8 | 2 | 70.9 | 7 | 1820 | - | 546 | |
| 9 | 2 | 71.7 | 18 | 1559 | - | 476 | |
| 10 | 2 | 73.9 | 19 | 1232 | - | 235 | |
| 11 | 1 | 59.2 | 20 | - | - | 424 | |
| 12 | 1 | 55.7 | 9 | - | - | 391 | |
| 13 | 3 | 60.9 | 12 | 1144 | 1370 | 198 | |
| 14 | 2 | 60.8 | 14 | 990 | - | 16 | |
| 15 | 3 | 60.6 | 19 | 1526 | 1326 | 695 | |
| 16 | 2 | 89 | 5 | 1029 | - | 131 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | | 10 | | | | |
|------------------------|-------------------|---------------------|----------------------|------------------------------|------|---|--|--|
| Number of Bur | rsts in Trial | | | 1 | 7 | | | |
| Chirp Center Frequency | | | | 55 | 15 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) | | |
| 1 | 2 | 72.1 | 14 | 1119 | - | 488 | | |
| 2 | 3 | 81.4 | 13 | 1142 | 961 | 451 | | |
| 3 | 3 | 92.9 | 18 | 991 | 1147 | 565 | | |
| 4 | 3 | 81.3 | 18 | 1793 | 1369 | 285 | | |
| 5 | 3 | 76.4 | 20 | 1005 | 1793 | 79 | | |
| 6 | 1 | 61.6 | 18 | - | - | 503 | | |
| 7 | 1 | 66.6 | 19 | - | - | 181 | | |
| 8 | 1 | 53.7 | 12 | - | - | 416 | | |
| 9 | 2 | 58 | 8 | 1477 | - | 107 | | |
| 10 | 2 | 64 | 18 | 1791 | - | 141 | | |
| 11 | 2 | 80.3 | 12 | 1304 | - | 516 | | |
| 12 | 3 | 77.3 | 5 | 1039 | 1668 | 372 | | |
| 13 | 2 | 97.6 | 11 | 1593 | - | 163 | | |
| 14 | 1 | 73 | 6 | - | - | 147 | | |
| 15 | 3 | 65.1 | 8 | 1097 | 1927 | 102 | | |
| 16 | 2 | 59.5 | 13 | 1569 | - | 182 | | |
| 17 | 1 | 88.2 | 19 | - | - | 653 | | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 111 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 11 | | | | |
|------------------------|--------------------|---------------------|----------------------|------------------------------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 18 | | | | |
| Chirp Center Frequency | | | | 55 | 20 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 2 | 56.1 | 12 | 1219 | - | 273 | |
| 2 | 1 | 83.3 | 7 | - | - | 298 | |
| 3 | 3 | 79.6 | 17 | 1218 | 1897 | 159 | |
| 4 | 2 | 95.8 | 7 | 1672 | - | 480 | |
| 5 | 2 | 79.6 | 8 | 920 | - | 387 | |
| 6 | 2 | 88.9 | 11 | 1779 | - | 5 | |
| 7 | 2 | 81.4 | 8 | 1645 | - | 201 | |
| 8 | 2 | 92 | 6 | 1454 | - | 80 | |
| 9 | 3 | 96 | 13 | 1518 | 1121 | 192 | |
| 10 | 2 | 65.6 | 11 | 1798 | - | 349 | |
| 11 | 2 | 98.7 | 5 | 1360 | - | 416 | |
| 12 | 2 | 52.9 | 15 | 1140 | - | 652 | |
| 13 | 2 | 76.5 | 8 | 1032 | - | 92 | |
| 14 | 3 | 73.8 | 18 | 1719 | 1383 | 502 | |
| 15 | 3 | 83.7 | 10 | 1270 | 1216 | 343 | |
| 16 | 2 | 89.6 | 10 | 1141 | - | 108 | |
| 17 | 2 | 67.2 | 20 | 1455 | - | 272 | |
| 18 | 3 | 55.7 | 14 | 1444 | 1475 | 566 | |
| Detection Ched | ck (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 112 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | | 1 | 2 | |
|------------------------|--------------------|---------------------|----------------------|------------------------------|------|---|
| Number of Bu | ırsts in Trial | | | 1 | 9 | |
| Chirp Center Frequency | | | | 55 | 25 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) |
| 1 | 2 | 70.6 | 15 | 1040 | - | 575 |
| 2 | 2 | 72.9 | 13 | 1460 | - | 178 |
| 3 | 3 | 88.9 | 5 | 1250 | 1629 | 191 |
| 4 | 3 | 60.3 | 20 | 1757 | 1822 | 468 |
| 5 | 3 | 92.1 | 19 | 1845 | 1198 | 476 |
| 6 | 1 | 73 | 5 | - | - | 532 |
| 7 | 1 | 50.4 | 15 | - | - | 69 |
| 8 | 1 | 66.4 | 10 | - | - | 333 |
| 9 | 1 | 79.1 | 18 | - | - | 437 |
| 10 | 1 | 71.6 | 20 | - | - | 424 |
| 11 | 2 | 95.6 | 13 | 1229 | - | 498 |
| 12 | 1 | 74.4 | 9 | - | - | 363 |
| 13 | 3 | 55.6 | 17 | 1263 | 1724 | 123 |
| 14 | 2 | 78.3 | 13 | 1507 | - | 37 |
| 15 | 3 | 54.1 | 13 | 1325 | 1249 | 192 |
| 16 | 2 | 67.1 | 18 | 1584 | - | 311 |
| 17 | 2 | 65.8 | 9 | 1195 | - | 243 |
| 18 | 2 | 50.1 | 12 | 1755 | - | 48 |
| 19 | 2 | 87.7 | 18 | 1359 | - | 180 |
| Detection Che | ck (1=Detection; 0 | =No Detection) | | | | 1 |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 113 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number | | | | 1 | 3 | | |
|-----------------------|------------------------|---------------------|----------------------|------|------------------------------|---|--|
| Number of Bu | rsts in Trial | | 20 | | | | |
| Chirp Center I | Chirp Center Frequency | | | 55 | 28 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | |
| 1 | 3 | 79.5 | 7 | 1808 | 1550 | 274 | |
| 2 | 2 | 76.7 | 20 | 1632 | - | 573 | |
| 3 | 3 | 85.9 | 12 | 1305 | 1496 | 18 | |
| 4 | 3 | 86.6 | 14 | 968 | 1172 | 133 | |
| 5 | 2 | 74.9 | 14 | 1348 | - | 48 | |
| 6 | 3 | 82.2 | 20 | 1692 | 1310 | 156 | |
| 7 | 2 | 53.9 | 13 | 1342 | - | 45 | |
| 8 | 3 | 62.7 | 15 | 1839 | 1651 | 76 | |
| 9 | 2 | 86.2 | 6 | 1165 | - | 91 | |
| 10 | 1 | 63.1 | 11 | - | - | 391 | |
| 11 | 2 | 82.4 | 6 | 1416 | - | 107 | |
| 12 | 1 | 95.8 | 18 | - | - | 248 | |
| 13 | 2 | 75.7 | 9 | 993 | - | 482 | |
| 14 | 3 | 70.1 | 18 | 1563 | 1020 | 354 | |
| 15 | 3 | 85.8 | 13 | 1420 | 1084 | 446 | |
| 16 | 1 | 63.2 | 7 | - | - | 265 | |
| 17 | 1 | 75.1 | 11 | - | | 147 | |
| 18 | 2 | 69.5 | 5 | 1802 | - | 256 | |
| 19 | 1 | 51.8 | 19 | - | - | 422 | |
| 20 | 2 | 62.3 | 5 | 1449 | - | 304 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 14 | | | | |
|---------------------------|-------------------|---------------------|---|------|------|---------------|--|
| Number of Bursts in Trial | | | | 3 | 3 | | |
| Chirp Center Frequency | | | | 55 | 29 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Locati (MHz) Spacing (us) Spacing (us) Within | | | | |
| | | | | | | Interval (ms) | |
| 1 | 3 | 74.9 | 5 | 1314 | 1466 | 1289 | |
| 2 | 2 | 83.9 | 19 | 1442 | - | 1436 | |
| 3 | 2 | 55.8 | 6 | 1147 | - | 240 | |
| 4 | 2 | 59.4 | 6 | 1490 | - | 1455 | |
| 5 | 2 | 78.2 | 15 | 1665 | - | 1312 | |
| 6 | 2 | 57.3 | 15 | 1357 | - | 264 | |
| 7 | 2 | 76.2 | 11 | 1651 | - | 255 | |
| 8 | 3 | 59 | 7 1460 1109 1410 | | | | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 114 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 15 | | | |
|---------------------------|--------------------|---------------------|----------------------|------|------------------------------|---|
| Number of Bursts in Trial | | | | (|) | |
| Chirp Center Frequency | | | | 55 | 14 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) |
| 1 | 3 | 77.7 | 19 | 1046 | 1568 | 17 |
| 2 | 2 | 98.2 | 20 | 1628 | - | 877 |
| 3 | 2 | 95.3 | 8 | 1540 | - | 1066 |
| 4 | 2 | 78.8 | 15 | 1341 | - | 822 |
| 5 | 2 | 52.8 | 20 | 988 | - | 1020 |
| 6 | 2 | 65.2 | 9 | 1480 | - | 602 |
| 7 | 2 | 99.5 | 10 | 1867 | - | 884 |
| 8 | 2 | 79.5 | 13 | 1148 | - | 342 |
| 9 | 3 | 50.6 | 13 | 1030 | 1525 | 1321 |
| Detection Che | ck (1=Detection; 0 | =No Detection) | | | | 1 |

| Trial Number | | | 16 | | | | |
|------------------------|---------------------------|---------------------|----------------------|------|----|---|--|
| Number of Bui | Number of Bursts in Trial | | | 10 | | | |
| Chirp Center Frequency | | | | 55 | 29 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | Starting Location Within Interval (ms) | |
| 1 | 2 | 97.5 | 11 | 1357 | - | 764 | |
| 2 | 2 | 91.8 | 13 | 1896 | ı | 298 | |
| 3 | 1 | 78.5 | 5 | - | ı | 1117 | |
| 4 | 1 | 60.1 | 11 | - | ı | 1069 | |
| 5 | 2 | 96.2 | 10 | 975 | - | 1157 | |
| 6 | 2 | 56.6 | 18 | 1626 | - | 701 | |
| 7 | 1 | 77.1 | 20 | - | ı | 323 | |
| 8 | 2 | 96.3 | 8 | 1682 | - | 307 | |
| 9 | 2 | 52.2 | 13 | 1017 | - | 217 | |
| 10 | 1 | 92.8 | 15 | - | - | 316 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 0 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 115 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 17 | | | | |
|------------------------|--------------------|---------------------|---|------|------|-----|--|
| Number of Bu | ırsts in Trial | | | 11 | | | |
| Chirp Center Frequency | | | | 55 | 32 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Location Spacing (us) Spacing (us) Within Interval (m | | | | |
| 1 | 2 | 57.3 | 8 | 1220 | - | 792 | |
| 2 | 3 | 73.1 | 5 | 1717 | 1679 | 845 | |
| 3 | 2 | 54.1 | 14 | 967 | - | 112 | |
| 4 | 2 | 98.8 | 19 | 1137 | - | 715 | |
| 5 | 3 | 85.5 | 8 | 1068 | 960 | 301 | |
| 6 | 2 | 78.5 | 7 | 1387 | - | 827 | |
| 7 | 2 | 77.9 | 12 | 1869 | - | 506 | |
| 8 | 1 | 81.9 | 10 | - | - | 549 | |
| 9 | 1 | 50.4 | 9 | - | - | 464 | |
| 10 | 1 | 75.2 | 8 | - | - | 790 | |
| 11 | 2 | 92.7 | 7 | 1770 | - | 967 | |
| Detection Che | ck (1=Detection; C | =No Detection) | • | • | | 1 | |

| Trial Number | | | 18 12 | | | | |
|------------------------|-------------------|---------------------|---|------|------|----------------------|--|
| Number of Bu | rsts in Trial | | | | | | |
| Chirp Center Frequency | | | | 55 | 35 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Loca (MHz) Spacing (us) Spacing (us) With | | | | |
| 1 | 2 | 79.1 | 6 | 1042 | _ | Interval (ms) 793 | |
| 2 | 3 | 55.7 | 9 | 1327 | 1744 | 159 | |
| 3 | 1 | 95 | 20 | - | - | 734 | |
| 4 | 1 | 88.4 | 5 | - | - | 523 | |
| 5 | 1 | 92.3 | 15 | - | - | 546 | |
| 6 | 1 | 93.6 | 6 | - | - | 208 | |
| 7 | 2 | 95.1 | 12 | 1044 | - | 894 | |
| 8 | 1 | 59.5 | 17 | - | - | 666 | |
| 9 | 2 | 98.7 | 17 | 1422 | - | 640 | |
| 10 | 2 | 65.1 | 5 | 1104 | - | 320 | |
| 11 | 1 | 60.2 | 5 | - | - | 60 | |
| 12 | 1 | 88.7 | 8 | - | - | 823 | |
| Detection Chec | k (1=Detection; C | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 116 of 126 Report Version : Rev. 01

Issued Date : Oct. 19, 2015



| Trial Number | | | 19 | | | | |
|------------------------|-------------------|---------------------|---|------|------|-----|--|
| Number of Bur | sts in Trial | | 13 | | | | |
| Chirp Center Frequency | | | | 55 | 40 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Location Within Interval (m | | | | |
| 1 | 1 | 53.9 | 10 | - | - | 226 | |
| 2 | 2 | 82.6 | 13 | 992 | - | 854 | |
| 3 | 1 | 87.7 | 8 | - | - | 303 | |
| 4 | 3 | 69 | 12 | 1696 | 1606 | 528 | |
| 5 | 1 | 68.6 | 12 | - | - | 220 | |
| 6 | 3 | 76.5 | 13 | 1333 | 1468 | 389 | |
| 7 | 2 | 95.8 | 17 | 1380 | - | 57 | |
| 8 | 2 | 55.6 | 19 | 1147 | - | 334 | |
| 9 | 2 | 78.6 | 14 | 1268 | - | 128 | |
| 10 | 2 | 65.4 | 17 | 1231 | - | 913 | |
| 11 | 2 | 76.6 | 18 | 1883 | - | 518 | |
| 12 | 1 | 93.2 | 6 | - | - | 596 | |
| 13 | 2 | 50.2 | 13 | 1836 | - | 61 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 20 | | | | |
|-----------------------|-------------------|---------------------|---|------|------|-----|--|
| Number of Bur | rsts in Trial | | 14 | | | | |
| Chirp Center F | requency | | | 55 | 45 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Local Spacing (us) Spacing (us) With Interval | | | | |
| 1 | 1 | 60.9 | 13 | - | - | 142 | |
| 2 | 2 | 81.7 | 15 | 1831 | - | 522 | |
| 3 | 2 | 78.5 | 5 | 1396 | - | 790 | |
| 4 | 2 | 98.2 | 6 | 1652 | - | 3 | |
| 5 | 1 | 64.1 | 12 | - | - | 414 | |
| 6 | 3 | 53 | 18 | 1862 | 1902 | 157 | |
| 7 | 2 | 62.3 | 15 | 1490 | - | 248 | |
| 8 | 2 | 87 | 11 | 1411 | - | 576 | |
| 9 | 2 | 78.4 | 8 | 1090 | - | 737 | |
| 10 | 2 | 87.2 | 7 | 967 | - | 343 | |
| 11 | 3 | 71 | 13 | 1662 | 1841 | 105 | |
| 12 | 2 | 77.2 | 5 | 1557 | - | 601 | |
| 13 | 1 | 94.4 | 15 | - | - | 108 | |
| 14 | 1 | 90.6 | 13 | - | - | 506 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 117 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 21 | | | | | |
|------------------------|-------------------|---------------------|----------------------|------|------|-----|--|--|
| Number of Bu | rsts in Trial | | 15 | | | | | |
| Chirp Center Frequency | | | | 55 | 50 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | | |
| 1 | 3 | 76.5 | 8 | 1870 | 1326 | 385 | | |
| 2 | 2 | 95.3 | 13 | 1162 | - | 73 | | |
| 3 | 3 | 58.9 | 9 | 1586 | 1909 | 742 | | |
| 4 | 2 | 73.1 | 13 | 1460 | - | 330 | | |
| 5 | 2 | 73.1 | 12 | 1488 | - | 25 | | |
| 6 | 2 | 75.1 | 5 | 1331 | - | 418 | | |
| 7 | 3 | 98.5 | 11 | 936 | 1532 | 214 | | |
| 8 | 3 | 72.5 | 13 | 1110 | 1903 | 387 | | |
| 9 | 3 | 67.4 | 12 | 1567 | 1513 | 80 | | |
| 10 | 2 | 76.1 | 12 | 1005 | 1 | 277 | | |
| 11 | 2 | 94.3 | 17 | 1413 | 1 | 314 | | |
| 12 | 2 | 72.8 | 12 | 1778 | - | 66 | | |
| 13 | 2 | 90.9 | 14 | 1793 | - | 147 | | |
| 14 | 3 | 94.8 | 11 | 1012 | 1742 | 441 | | |
| 15 | 3 | 95 | 12 | 912 | 1641 | 609 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

| Trial Number | | | 22 | | | |
|------------------------|------------------------|---------------------|----------------------|------------------------------|------|---|
| Number of Bur | sts in Trial | | | 1 | 6 | |
| Chirp Center F | Chirp Center Frequency | | | 55 | 53 | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Pulse 1-to-2 Spacing (us) | | Starting Location Within Interval (ms) |
| 1 | 1 | 96.7 | 9 | - | - | 308 |
| 2 | 2 | 78.3 | 13 | 1045 | - | 27 |
| 3 | 1 | 56.5 | 12 | - | - | 74 |
| 4 | 3 | 88.5 | 14 | 1119 | 1020 | 629 |
| 5 | 2 | 62.4 | 9 | 1436 | - | 548 |
| 6 | 2 | 78.2 | 5 | 1147 | - | 341 |
| 7 | 3 | 76.8 | 14 | 1069 | 1575 | 360 |
| 8 | 2 | 91.6 | 18 | 978 | - | 602 |
| 9 | 2 | 93.7 | 5 | 1130 | - | 623 |
| 10 | 2 | 97.4 | 8 | 1100 | - | 256 |
| 11 | 3 | 90.1 | 6 | 1629 | 1375 | 108 |
| 12 | 2 | 79.9 | 18 | 1809 | - | 183 |
| 13 | 2 | 83 | 10 | 1370 | - | 477 |
| 14 | 2 | 89.1 | 13 | 1239 | - | 484 |
| 15 | 2 | 58.3 | 8 | 1321 | - | 276 |
| 16 | 1 | 85.2 | 13 | - | - | 22 |
| Detection Check | k (1=Detection; 0 | =No Detection) | | | | 1 |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 118 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | | 2 | 3 | | |
|------------------------|--------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bu | rsts in Trial | | 17 | | | | |
| Chirp Center Frequency | | | | 55 | 55 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 3 | 60 | 10 | 1097 | 1748 | 56 | |
| 2 | 3 | 66.3 | 13 | 1391 | 1430 | 421 | |
| 3 | 2 | 88.5 | 15 | 1040 | - | 583 | |
| 4 | 2 | 72.1 | 8 | 1526 | - | 161 | |
| 5 | 1 | 72.3 | 8 | - | - | 450 | |
| 6 | 2 | 67.3 | 7 | 1022 | - | 48 | |
| 7 | 2 | 56.1 | 12 | 1325 | - | 661 | |
| 8 | 1 | 83.5 | 11 | - | - | 695 | |
| 9 | 3 | 99.4 | 13 | 1490 | 938 | 405 | |
| 10 | 1 | 54.2 | 12 | - | - | 126 | |
| 11 | 3 | 92.7 | 17 | 1251 | 1631 | 365 | |
| 12 | 3 | 95.1 | 17 | 1741 | 1162 | 57 | |
| 13 | 2 | 84 | 9 | 1597 | - | 167 | |
| 14 | 1 | 68.5 | 18 | - | - | 512 | |
| 15 | 1 | 76.5 | 20 | - | - | 185 | |
| 16 | 3 | 86.6 | 11 | 1774 | 1875 | 457 | |
| 17 | 2 | 62.2 | 9 | 1563 | - | 492 | |
| Detection Chec | ck (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 24 | | | | | |
|-----------------------|-------------------|---------------------|----------------------|------|------|-----|--|--|
| Number of Bur | sts in Trial | | | 1 | 8 | | | |
| Chirp Center F | requency | | | 55 | 24 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | | | | |
| 1 | 1 | 86.6 | 19 | - | - | 621 | | |
| 2 | 2 | 95.3 | 17 | 926 | - | 128 | | |
| 3 | 1 | 76.2 | 12 | - | - | 251 | | |
| 4 | 3 | 71.4 | 19 | 1287 | 1404 | 269 | | |
| 5 | 3 | 51.7 | 12 | 1564 | 1339 | 633 | | |
| 6 | 2 | 77 | 5 | 1899 | - | 615 | | |
| 7 | 1 | 87.5 | 12 | - | - | 375 | | |
| 8 | 3 | 59 | 17 | 1327 | 1615 | 610 | | |
| 9 | 2 | 78.3 | 15 | 1551 | - | 548 | | |
| 10 | 2 | 89.7 | 5 | 1718 | - | 456 | | |
| 11 | 2 | 92.1 | 7 | 1403 | - | 12 | | |
| 12 | 2 | 97.3 | 14 | 1338 | - | 596 | | |
| 13 | 3 | 80.3 | 20 | 1354 | 1563 | 484 | | |
| 14 | 1 | 98.2 | 8 | - | - | 428 | | |
| 15 | 3 | 94.4 | 13 | 1795 | 1829 | 512 | | |
| 16 | 2 | 90.4 | 13 | 1105 | - | 342 | | |
| 17 | 2 | 73.6 | 19 | 1787 | - | 292 | | |
| 18 | 1 | 82.9 | 7 | - | - | 618 | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 119 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 25 | | | | |
|-----------------------|-------------------|---------------------|----------------------|---|------|-----|--|
| Number of Bui | rsts in Trial | | 19 | | | | |
| Chirp Center F | requency | | 5541 | | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | Starting Location Within Interval (ms) | | | |
| 1 | 1 | 90 | 18 | - | - | 173 | |
| 2 | 1 | 65.3 | 19 | - | - | 245 | |
| 3 | 2 | 82.6 | 10 | 1756 | - | 127 | |
| 4 | 2 | 93.9 | 18 | 1557 | - | 287 | |
| 5 | 2 | 50.5 | 13 | 1479 | - | 282 | |
| 6 | 1 | 68 | 7 | - | - | 176 | |
| 7 | 3 | 88.4 | 11 | 1244 | 1076 | 568 | |
| 8 | 3 | 66.8 | 11 | 1288 | 1909 | 448 | |
| 9 | 2 | 88 | 12 | 1450 | - | 527 | |
| 10 | 3 | 51.1 | 6 | 1797 | 1935 | 195 | |
| 11 | 2 | 93.8 | 13 | 1073 | - | 184 | |
| 12 | 1 | 83.5 | 10 | - | - | 506 | |
| 13 | 2 | 96.9 | 12 | 1047 | - | 267 | |
| 14 | 3 | 87.2 | 18 | 1521 | 1450 | 243 | |
| 15 | 2 | 60.1 | 8 | 1545 | - | 291 | |
| 16 | 3 | 98 | 10 | 1842 | 1402 | 554 | |
| 17 | 3 | 57 | 19 | 1665 | 1732 | 143 | |
| 18 | 1 | 74.3 | 14 | - | - | 31 | |
| 19 | 2 | 57.8 | 10 | 1576 | - | 609 | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 120 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | | 26 | | | | |
|-----------------------|--------------------|---------------------|----------------------|------|------------------------------|---|--|--|
| Number of Bu | ırsts in Trial | | | 20 | | | | |
| Chirp Center | Frequency | | | 55 | 30 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) | | |
| 1 | 2 | 92.8 | 9 | 1222 | - | 531 | | |
| 2 | 2 | 52.4 | 8 | 1547 | - | 168 | | |
| 3 | 3 | 56.8 | 7 | 1158 | 1184 | 193 | | |
| 4 | 1 | 91.2 | 7 | - | - | 565 | | |
| 5 | 3 | 61.2 | 10 | 1558 | 1664 | 387 | | |
| 6 | 3 | 62 | 7 | 1518 | 1656 | 391 | | |
| 7 | 2 | 69 | 5 | 1531 | - | 327 | | |
| 8 | 2 | 67.3 | 18 | 1064 | - | 25 | | |
| 9 | 1 | 94.1 | 5 | - | - | 78 | | |
| 10 | 2 | 76 | 17 | 1190 | - | 222 | | |
| 11 | 2 | 81.9 | 12 | 1815 | - | 96 | | |
| 12 | 2 | 57.9 | 8 | 1594 | - | 277 | | |
| 13 | 3 | 68.3 | 19 | 1427 | 1540 | 41 | | |
| 14 | 2 | 53.3 | 7 | 1713 | - | 48 | | |
| 15 | 2 | 85.3 | 15 | 1136 | - | 48 | | |
| 16 | 1 | 65.3 | 20 | - | - | 57 | | |
| 17 | 3 | 79.8 | 20 | 923 | 1259 | 48 | | |
| 18 | 2 | 56.9 | 20 | 1357 | - | 483 | | |
| 19 | 2 | 93 | 9 | 1686 | - | 73 | | |
| 20 | 2 | 82.8 | 10 | 944 | - | 352 | | |
| Detection Chee | ck (1=Detection; C | =No Detection) | | | | 1 | | |

| Trial Number | | | 27 | | | | |
|---------------------------|-------------------|---------------------|--|------|------|---------------|--|
| Number of Bursts in Trial | | | | 3 | 3 | | |
| Chirp Center Frequency | | | | 55 | 31 | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width Pulse 1-to-2 Pulse 2-to-3 Loca (MHz) Spacing (us) Spacing (us) Wit | | | | |
| | | | | | | Interval (ms) | |
| 1 | 3 | 50.9 | 11 | 1106 | 1077 | 1293 | |
| 2 | 2 | 77.8 | 18 | 1836 | - | 1235 | |
| 3 | 3 | 60.7 | 5 | 1069 | 1635 | 1092 | |
| 4 | 2 | 77.2 | 13 | 1916 | - | 1343 | |
| 5 | 2 | 91.6 | 13 | 1465 | - | 1466 | |
| 6 | 2 | 56.8 | 17 | 1783 | - | 376 | |
| 7 | 1 | 59.5 | 20 | - | - | 131 | |
| 8 | 1 | 66.5 | 12 - 1024 | | | | |
| Detection Chec | k (1=Detection; C | =No Detection) | • | • | | 1 | |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 121 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



| Trial Number | | | 28 | | | | |
|------------------------|---------------------------|---------------------|---|------|---|------|--|
| Number of Bur | Number of Bursts in Trial | | | 9 | | | |
| Chirp Center Frequency | | | 55 | 27 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) Pulse 1-to-2 Pulse 2-to-3 Location Spacing (us) Spacing (us) Within Interval (m | | | | |
| 1 | 2 | 72 | 9 | 1092 | - | 965 | |
| 2 | 2 | 89.2 | 6 | 1550 | - | 1226 | |
| 3 | 1 | 81.2 | 12 | - | - | 277 | |
| 4 | 2 | 80.6 | 15 | 1616 | - | 458 | |
| 5 | 2 | 62.8 | 10 | 1812 | - | 748 | |
| 6 | 1 | 71 | 8 | - | - | 434 | |
| 7 | 2 | 69.3 | 6 | 1027 | - | 1111 | |
| 8 | 2 | 77.2 | 13 | 1076 | - | 638 | |
| 9 | 2 | 65.4 | 5 1582 - 278 | | | | |
| Detection Chec | k (1=Detection; 0 | =No Detection) | | | | 1 | |

| Trial Number | | | 29 | | | |
|---|---------------|---------------------|----------------------|------|------------------------------|---|
| Number of Bursts in Trial | | | 10 | | | |
| Chirp Center Frequency | | | 5560 | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) |
| 1 | 1 | 51.5 | 19 | - | - | 151 |
| 2 | 1 | 82.3 | 13 | - | - | 1071 |
| 3 | 3 | 78.3 | 8 | 1115 | 1740 | 646 |
| 4 | 2 | 99 | 14 | 1101 | - | 709 |
| 5 | 3 | 98.8 | 7 | 1819 | 945 | 556 |
| 6 | 2 | 80.9 | 19 | 922 | - | 567 |
| 7 | 2 | 64 | 12 | 953 | - | 581 |
| 8 | 1 | 79 | 20 | - | ı | 798 |
| 9 | 1 | 68 | 8 | - | - | 112 |
| 10 | 2 | 50.4 | 13 | 1587 | - | 26 |
| Detection Check (1=Detection; 0=No Detection) | | | | | | 0 |

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 122 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



| Trial Number Number of Bursts in Trial | | | 30 11 | | | |
|---|---------------|---------------------|----------------------|------|------------------------------|---|
| | | | | | | |
| Burst | No. of Pulses | Pulse Width (us) | Chirp Width (MHz) | | Pulse 2-to-3 Spacing (us) | Starting Location Within Interval (ms) |
| 1 | 3 | 57.8 | 5 | 1324 | 1716 | 82 |
| 2 | 2 | 70.1 | 20 | 1733 | - | 587 |
| 3 | 2 | 95.2 | 13 | 1188 | - | 789 |
| 4 | 3 | 84.6 | 20 | 1042 | 1259 | 1021 |
| 5 | 3 | 96.5 | 7 | 1329 | 1596 | 16 |
| 6 | 2 | 84.3 | 15 | 1606 | - | 708 |
| 7 | 3 | 53.5 | 19 | 1783 | 1458 | 738 |
| 8 | 3 | 74.9 | 5 | 1599 | 1891 | 466 |
| 9 | 3 | 53.8 | 7 | 1494 | 1467 | 252 |
| 10 | 2 | 60.5 | 14 | 1319 | - | 464 |
| 11 | 1 | 73.3 | 10 | - | - | 845 |
| Detection Check (1=Detection; 0=No Detection) | | | | | | 1 |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C Page No. : 123 of 126
Report Version : Rev. 01
Issued Date : Oct. 19, 2015



Type 6 Radar Statistical Performance

| Trial # | Test Freq. (MHz) | Pulses / Hop | Pulse Width (us) | PRI (us) | 1=Detection 0=No Detection |
|--------------------------|------------------|--------------|------------------|----------|-------------------------------|
| 1 | 5530 | 9 | 1 | 333 | 1 |
| 2 | 5530 | 9 | 1 | 333 | 1 |
| 3 | 5530 | 9 | 1 | 333 | 1 |
| 4 | 5530 | 9 | 1 | 333 | 1 |
| 5 | 5530 | 9 | 1 | 333 | 1 |
| 6 | 5530 | 9 | 1 | 333 | 1 |
| 7 | 5530 | 9 | 1 | 333 | 1 |
| 8 | 5530 | 9 | 1 | 333 | 1 |
| 9 | 5530 | 9 | 1 | 333 | 1 |
| 10 | 5530 | 9 | 1 | 333 | 1 |
| 11 | 5530 | 9 | 1 | 333 | 1 |
| 12 | 5530 | 9 | 1 | 333 | 1 |
| 13 | 5530 | 9 | 1 | 333 | 1 |
| 14 | 5530 | 9 | 1 | 333 | 1 |
| 15 | 5530 | 9 | 1 | 333 | 1 |
| 16 | 5530 | 9 | 1 | 333 | 1 |
| 17 | 5530 | 9 | 1 | 333 | 1 |
| 18 | 5530 | 9 | 1 | 333 | 1 |
| 19 | 5530 | 9 | 1 | 333 | 1 |
| 20 | 5530 | 9 | 1 | 333 | 1 |
| 21 | 5530 | 9 | 1 | 333 | 1 |
| 22 | 5530 | 9 | 1 | 333 | 1 |
| 23 | 5530 | 9 | 1 | 333 | 1 |
| 24 | 5530 | 9 | 1 | 333 | 1 |
| 25 | 5530 | 9 | 1 | 333 | 1 |
| 26 | 5530 | 9 | 1 | 333 | 1 |
| 27 | 5530 | 9 | 1 | 333 | 1 |
| 28 | 5530 | 9 | 1 | 333 | 1 |
| 29 | 5530 | 9 | 1 | 333 | 1 |
| 30 | 5530 | 9 | 1 | 333 | 1 |
| Detection Percentage (%) | | | | | 100.00 |
| Limit | | | | | 70% |
| Test Result | | | | | Complied |

SPORTON INTERNATIONAL INC. TEL: 886-3-327-3456

FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 124 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



4 Test Equipment and Calibration Data

| Instrument | Manufacturer | Model No. | Serial No. | Characteristics | Calibration Date | Remark |
|----------------------|--------------|-----------|---------------|-----------------|------------------|------------------------|
| Spectrum analyzer | R&S | FSP40 | 100142 | 9kHz~40GHz | Oct. 15, 2014 | Conducted (DF01-CB) |
| Signal generator | R&S | SMU200A | 102782 | 25MHz-6GHz | Nov. 29, 2014 | Conducted (DF01-CB) |
| RF Power Divider | ANAREN | 2 Way | DFS-01-DV-02 | 1GHz ~ 6GHz | Jan. 10, 2015 | Conducted (DF01-CB) |
| RF Power Divider | MTJ | 2Way | DFS-01-DV-03 | 1GHz ~ 6GHz | Jan. 10, 2015 | Conducted (DF01-CB) |
| RF Power Divider | ANAREN | 4 Way | DFS-01-DV-01 | 1GHz ~ 6GHz | Jan. 10, 2015 | Conducted (DF01-CB) |
| Horn Antenna | COM-POWER | AH-118 | 071187 | 1GHz – 18GHz | Jul. 24, 2015 | Conducted (DF01-CB) |
| Horn Antenna | COM-POWER | AH-118 | 071042 | 1GHz – 18GHz | Dec. 03, 2014 | Conducted (DF01-CB) |
| RF Cable-high | Woken | RG402 | High Cable-57 | 1 GHz –18 GHz | Nov. 15, 2014 | Conducted (DF01-CB) |
| RF Cable-high | Woken | RG402 | High Cable-58 | 1 GHz –18 GHz | Nov. 15, 2014 | Conducted (DF01-CB) |

Note: Calibration Interval of instruments listed above is one year.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-327-0973 FCC ID: XCNDVW32C

 Page No.
 : 125 of 126

 Report Version
 : Rev. 01

 Issued Date
 : Oct. 19, 2015



5

Measurement Uncertainty

| Test Items | Uncertainty | Remark |
|-------------------|-------------|--------------------------|
| Radiated Emission | 2.9 dB | Confidence levels of 95% |

Report No.: FZ4O0315-01

 SPORTON INTERNATIONAL INC.
 Page No.
 : 126 of 126

 TEL: 886-3-327-3456
 Report Version
 : Rev. 01

 FAX: 886-3-327-0973
 Issued Date
 : Oct. 19, 2015

FCC ID: XCNDVW32C