FCC RF Test Report

APPLICANT : Fitbit, Inc.

EQUIPMENT: Wireless Fitness Headphone

BRAND NAME : Fitbit
MODEL NAME : FB205
MARKETING NAME : FLYER

FCC ID : XRAFB205

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Apr. 17, 2017 and testing was completed on Jul. 11, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 1 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

1190

Report No.: FR741718

TABLE OF CONTENTS

RE\	/ISIOI	N HISTORY	3
SU	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Applicable Standards	6
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	9
	2.4	EUT Operation Test Setup	9
	2.5	Measurement Results Explanation Example	9
3	TEST	RESULT	10
	3.1	Number of Channel Measurement	10
	3.2	Hopping Channel Separation Measurement	12
	3.3	Dwell Time Measurement	18
	3.4	20dB and 99% Bandwidth Measurement	20
	3.5	Peak Output Power Measurement	30
	3.6	Conducted Band Edges Measurement	31
	3.7	Conducted Spurious Emission Measurement	38
	3.8	Radiated Band Edges and Spurious Emission Measurement	48
	3.9	Antenna Requirements	52
4	LIST	OF MEASURING EQUIPMENT	53
5	UNCE	ERTAINTY OF EVALUATION	54
APF	PENDI	X A. CONDUCTED TEST RESULTS	
APF	PENDI	X B. RADIATED SPURIOUS EMISSION	
APF	PENDI	X C. RADIATED SPURIOUS EMISSION PLOTS	
APF	PENDI	X D. DUTY CYCLE PLOTS	
APF	PENDI	X E. SETUP PHOTOGRAPHS	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 2 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR741718	Rev. 01	Initial issue of report	Jul. 19, 2017
FR741718	Rev. 02	Updating FCC designation Number of test site	Aug. 04, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 3 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

SUMMARY OF TEST RESULT

Report Section	FCC Rule	FCC Rule Description Limit		Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-
3.4	-	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	3.8 15.247(d) Radiated Band Edges and Radiated Spurious Emission		15.209(a) & 15.247(d)	Pass	Under limit 2.85 dB at 7440.000 MHz
-	- 15.207 AC Conducted Emission		15.207(a)	Not Required	-
3.9	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

Note: Not required means after assessing, test items are not necessary to carry out.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 4 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

1 General Description

1.1 Applicant

Fitbit, Inc.

405 Howard Street Suite 550, San Francisco, California, United States, 94105

1.2 Manufacturer

Fitbit, Inc.

405 Howard Street Suite 550, San Francisco, California, United States, 94105

1.3 Product Feature of Equipment Under Test

Bluetooth

Product Specification subjective to this standard					
Antenna Type	Bluetooth: Stamping Antenna				

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 5 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW0007 nder the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.
rest Site Location	TEL: +886-3-327-3456
	FAX: +886-3-328-4978
Took Site No	Sporton Site No.
Test Site No.	TH05-HY

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site	SPORTON INTERNATIONAL INC.
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,
Test Site Location	Taoyuan City, Taiwan (R.O.C.)
lest Site Location	TEL: +886-3-327-0868
	FAX: +886-3-327-0855
Test Site No.	Sporton Site No.
Test Site NO.	03CH11-HY

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 6 of 54

Report Issued Date : Aug. 04, 2017

Report Version : Rev. 02

Report No.: FR741718

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 7 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

2.2 Test Mode

a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Y plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 3Mbps mode, and recorded in this report.

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Summary table of Test Cases						
	Data Rate / Modulation					
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps			
	GFSK	π/4-DQPSK	8-DPSK			
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz			
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz			
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz			
	Bluetooth EDR 3Mbps 8-DPSK					
Radiated		Mode 1: CH00_2402 MHz				
Test Cases	Mode 2: CH39_2441 MHz					
		Mode 3: CH78_2480 MHz				

Remark: For radiated test cases, the worst mode data rate 3Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and the conducted spurious emissions and conducted band edge measurement for each data rate are no worse than 3Mbps, and no other significantly frequencies found in conducted spurious emission.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 8 of 54

Report Issued Date : Aug. 04, 2017

Report Version : Rev. 02

Report No.: FR741718

2.3 Connection Diagram of Test System

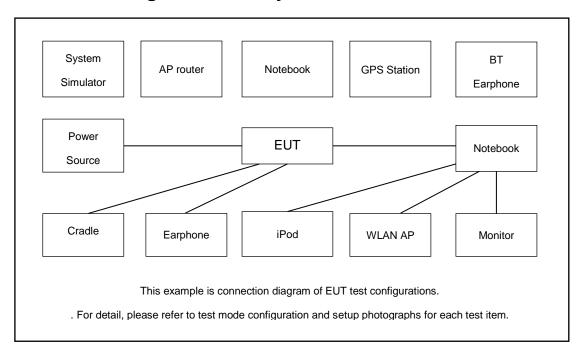

2.4 EUT Operation Test Setup

The RF test items, programmed RF utility, "Blue Test3" installed in the notebook make the EUT provide functions like channel selection and power level for continuous transmitting and receiving signals.

2.5 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

Offset(dB) = RF cable loss(dB) + attenuator factor(dB). = 4.2 + 10 = 14.2 (dB)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 9 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings: Span = the frequency band of operation;
 RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup



SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 10 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718


3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.

Number of Hopping Channel Plot on Channel 00 - 78

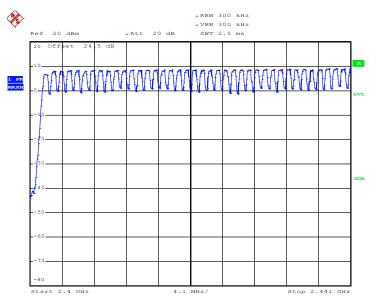

Date: 10.JUL.2017 22:48:30

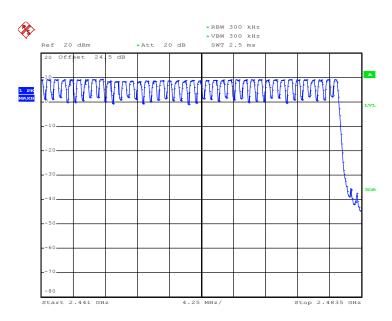

Date: 10.JUL.2017 22:49:29

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 11 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures


- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:

Span = wide enough to capture the peaks of two adjacent channels;

RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.

6. Measure and record the results in the test report.

3.2.4 Test Setup

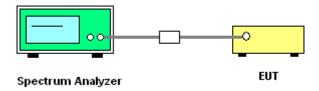

3.2.5 Test Result of Hopping Channel Separation


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 12 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<1Mbps>

Channel Separation Plot on Channel 00 - 01

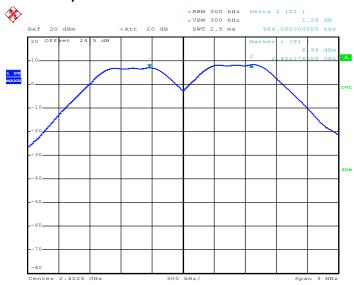

Date: 10.JUL.2017 22:18:57

Channel Separation Plot on Channel 39 - 40

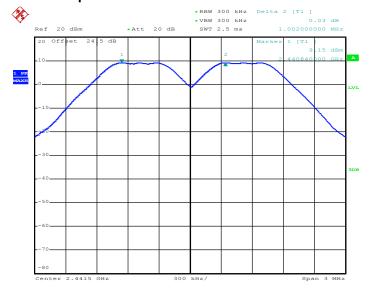


Date: 10.JUL.2017 22:17:28

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 13 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


Channel Separation Plot on Channel 77 - 78

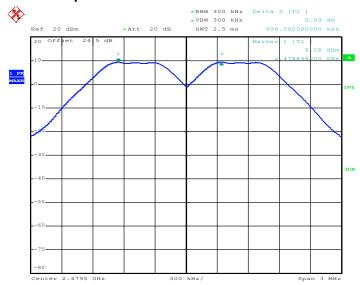

Date: 10.JUL.2017 22:19:59

<2Mbps>

Channel Separation Plot on Channel 00 - 01

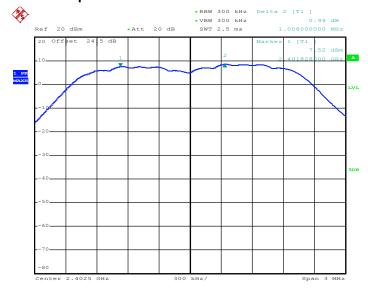


Date: 10.JUL.2017 23:25:51

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 14 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

Channel Separation Plot on Channel 39 - 40

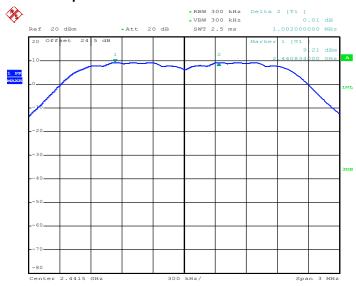

Date: 10.JUL.2017 23:01:47

Channel Separation Plot on Channel 77 - 78

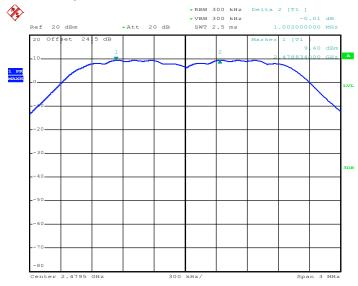

Date: 10.JUL.2017 23:00:23


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 15 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<3Mbps>

Channel Separation Plot on Channel 00 - 01

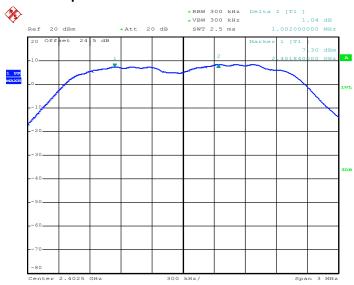

Date: 10.JUL.2017 23:40:13

Channel Separation Plot on Channel 39 - 40

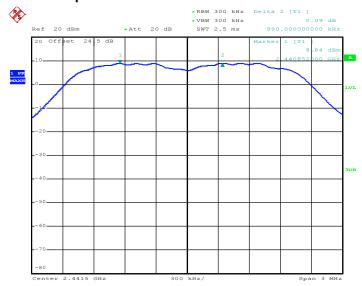


Date: 10.JUL.2017 23:44:32

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 16 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

Channel Separation Plot on Channel 77 - 78

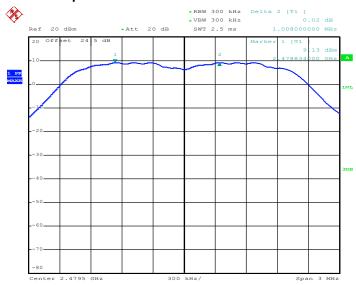

Date: 10.JUL.2017 23:46:03

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 17 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup



3.3.5 Test Result of Dwell Time


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 18 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

Package Transfer Time Plot

Report No. : FR741718

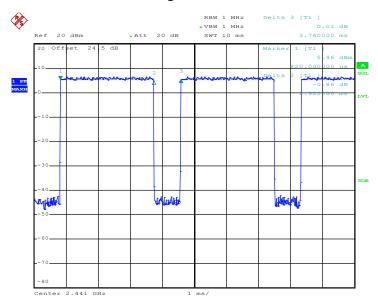

Date: 4.JUL.2017 19:00:33

Remark:

- 1. In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels. With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4×79) (s), Hops Over Occupancy Time comes to $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$ hops.
- **2.** In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4×20) (s), Hops Over Occupancy Time comes to $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$ hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 19 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
 - $RBW \geq 1\% \ of \ the \ 20 \ dB \ bandwidth; \ VBW \geq RBW; \ Sweep = auto; \ Detector \ function = peak;$


Trace = \max hold.

- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
 - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;

Trace = max hold.

6. Measure and record the results in the test report.

3.4.4 Test Setup

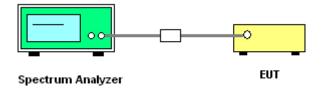

3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 20 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718


<1Mbps>

20 dB Bandwidth Plot on Channel 00

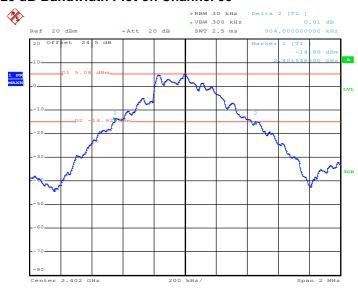

Date: 10.JUL.2017 22:39:49

20 dB Bandwidth Plot on Channel 39

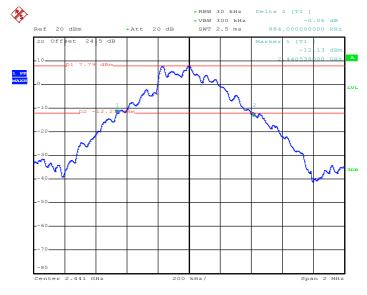


Date: 10.JUL.2017 22:37:34

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 21 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


20 dB Bandwidth Plot on Channel 78

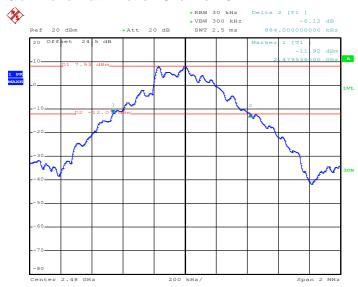

Date: 10.JUL.2017 22:35:15

<2Mbps>

20 dB Bandwidth Plot on Channel 00

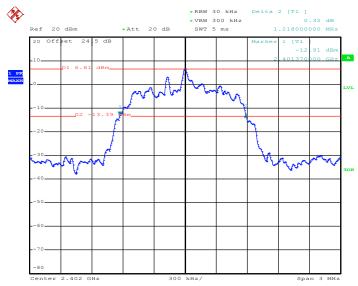


Date: 10.JUL.2017 23:28:18

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 22 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

20 dB Bandwidth Plot on Channel 39

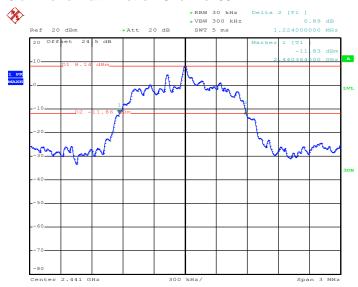

Date: 10.JUL.2017 23:30:05

20 dB Bandwidth Plot on Channel 78

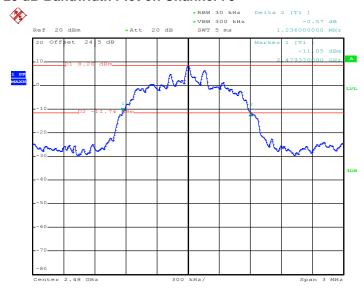

Date: 11.JUL.2017 00:05:37


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 23 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<3Mbps>

20 dB Bandwidth Plot on Channel 00

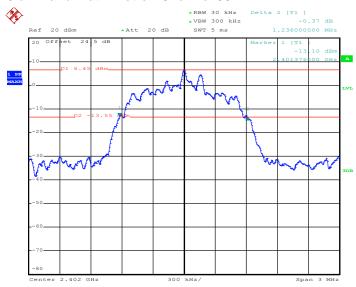

Date: 10.JUL.2017 23:52:51

20 dB Bandwidth Plot on Channel 39

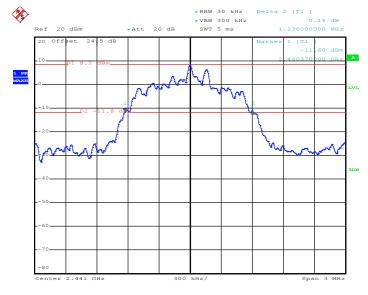


Date: 10.JUL.2017 23:54:24

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 24 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

20 dB Bandwidth Plot on Channel 78

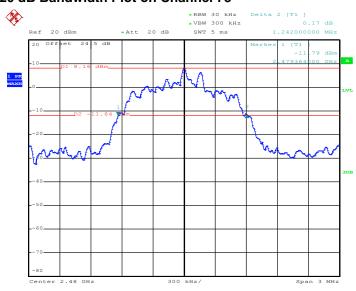


Date: 10.JUL.2017 23:55:56

3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

<1Mbps>

99% Occupied Bandwidth Plot on Channel 00

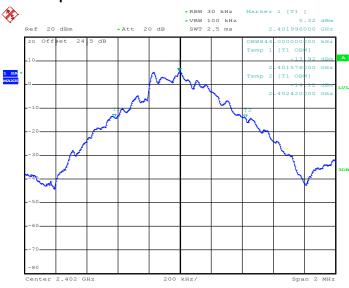


Date: 10.JUL.2017 22:09:25

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 25 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

99% Occupied Bandwidth Plot on Channel 39

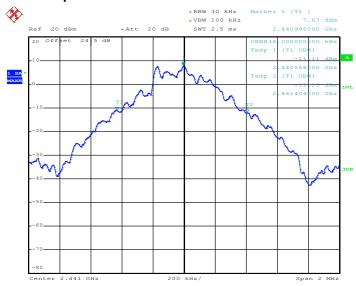

Date: 10.JUL.2017 22:14:04

99% Occupied Bandwidth Plot on Channel 78

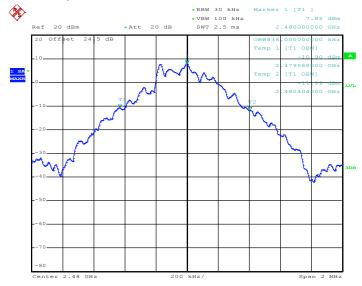

Date: 10.JUL.2017 22:21:01


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 26 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<2Mbps>

99% Occupied Bandwidth Plot on Channel 00

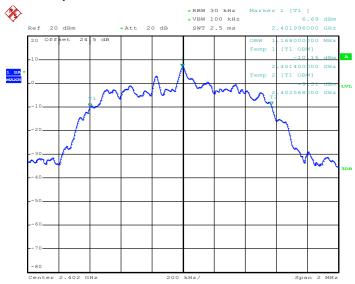

Date: 10.JUL.2017 23:19:28

99% Occupied Bandwidth Plot on Channel 39

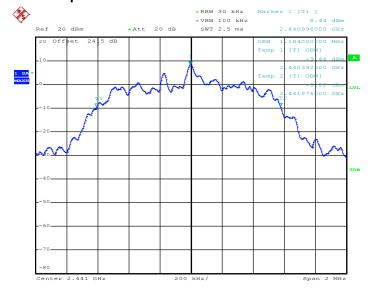


Date: 10.JUL.2017 23:03:28

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 27 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


99% Occupied Bandwidth Plot on Channel 78

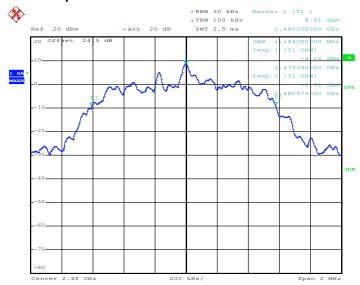

Date: 10.JUL.2017 22:56:03

<3Mbps>

99% Occupied Bandwidth Plot on Channel 00

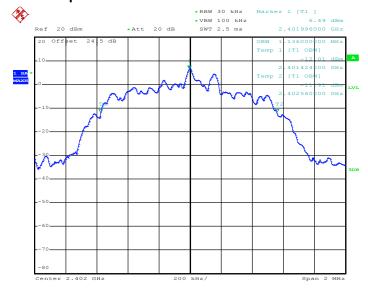


Date: 10.JUL.2017 23:37:32

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 28 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

99% Occupied Bandwidth Plot on Channel 39

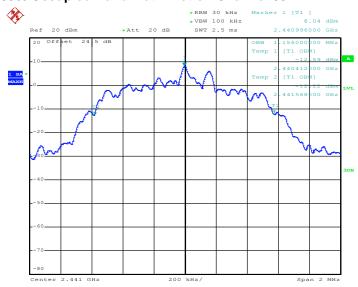

Date: 10.JUL.2017 23:41:28

99% Occupied Bandwidth Plot on Channel 78

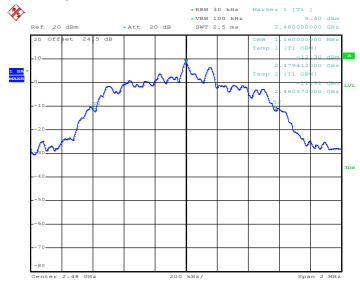

Date: 10.JUL.2017 23:47:20

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 29 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.


3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 30 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup



3.6.5 Test Result of Conducted Band Edges


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 31 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<1Mbps>

Low Band Edge Plot on Channel 00

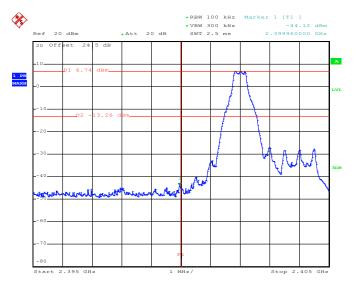

Date: 10.JUL.2017 22:08:46

High Band Edge Plot on Channel 78

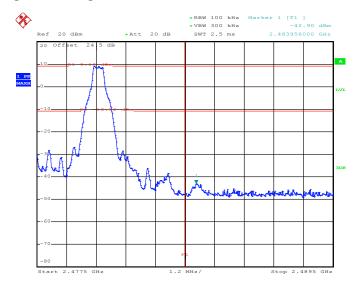


Date: 10.JUL.2017 22:20:26

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 32 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718


<2Mbps>

Low Band Edge Plot on Channel 00

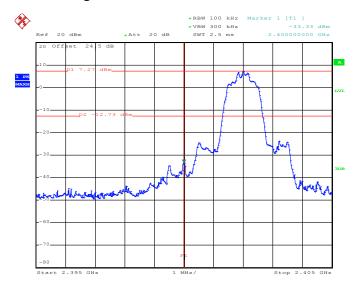

Date: 10.JUL.2017 23:24:32

High Band Edge Plot on Channel 78

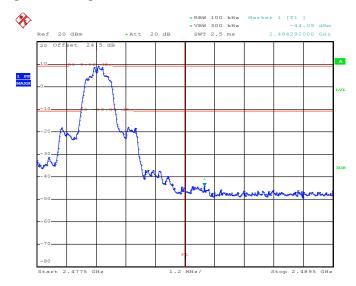


Date: 10.JUL.2017 22:54:18

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 33 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718


<3Mbps>

Low Band Edge Plot on Channel 00

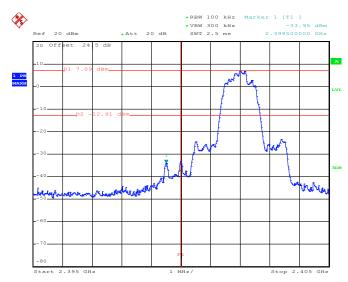

Date: 10.JUL.2017 23:38:24

High Band Edge Plot on Channel 78

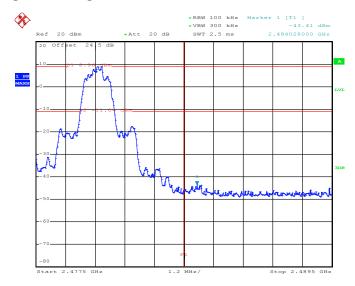

Date: 10.JUL.2017 23:46:42

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 34 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No.: FR741718

3.6.6 Test Result of Conducted Hopping Mode Band Edges

Please refer to Appendix A.


<1Mbps>

Hopping Mode Low Band Edge Plot

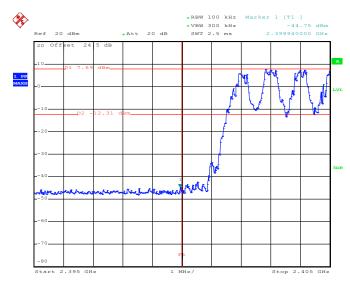

Date: 10.JUL.2017 22:43:25

Hopping Mode High Band Edge Plot

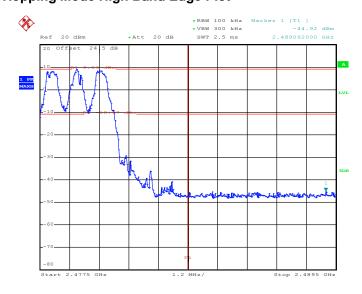

Date: 10.JUL.2017 22:44:30


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 35 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<2Mbps>

Hopping Mode Low Band Edge Plot

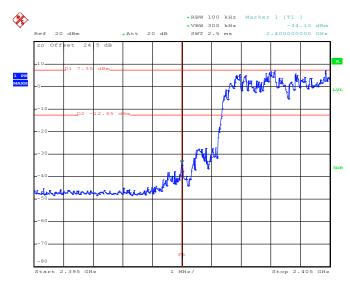

Date: 10.JUL.2017 22:52:05

Hopping Mode High Band Edge Plot

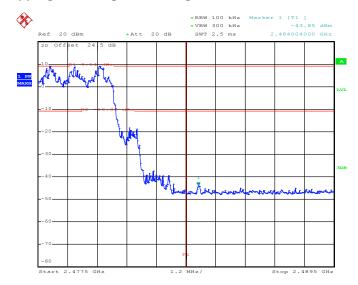


Date: 10.JUL.2017 22:53:30

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 36 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<3Mbps>

Hopping Mode Low Band Edge Plot

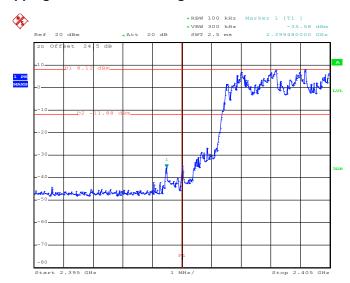

Date: 10.JUL.2017 23:50:43

Hopping Mode High Band Edge Plot

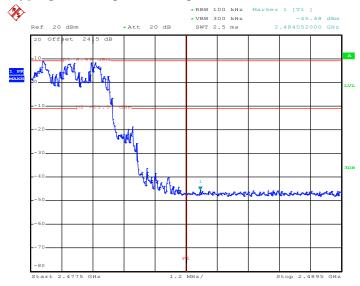

Date: 10.JUL.2017 23:49:15

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 37 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup

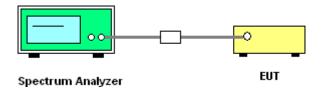

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 38 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No.: FR741718

3.7.5 Test Result of Conducted Spurious Emission

Please refer to Appendix A.


<1Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

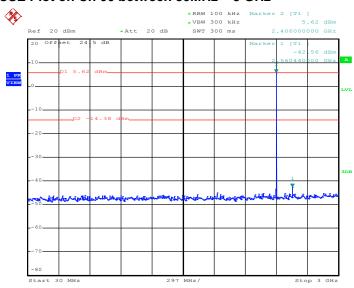

Date: 10.JUL.2017 22:11:32

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

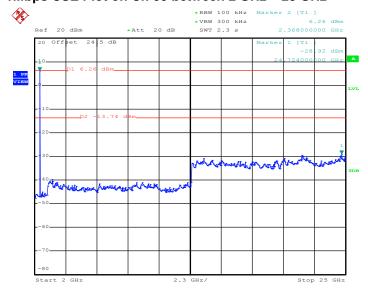


Date: 10.JUL.2017 22:11:53

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 39 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

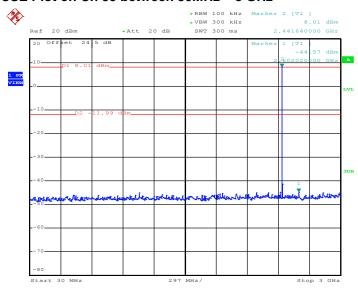

Date: 10.JUL.2017 22:14:35

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

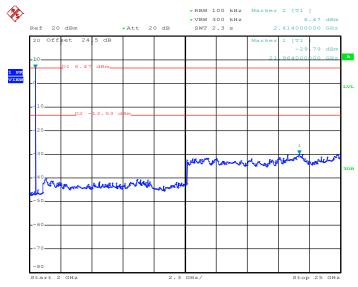


Date: 10.JUL.2017 22:15:57

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 40 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

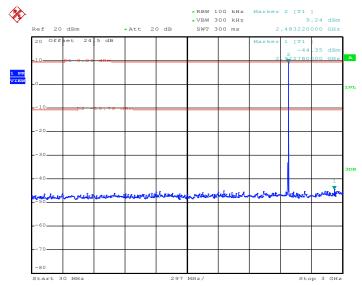

Date: 10.JUL.2017 22:21:33

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

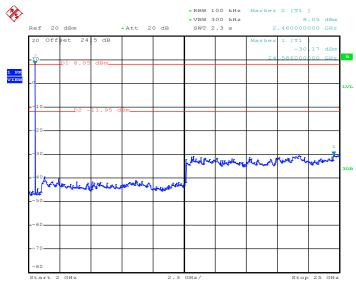


Date: 10.JUL.2017 22:21:55

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 41 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<2Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

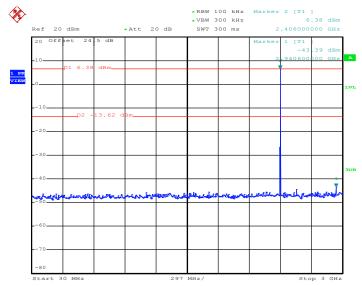

Date: 10.JUL.2017 23:23:28

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

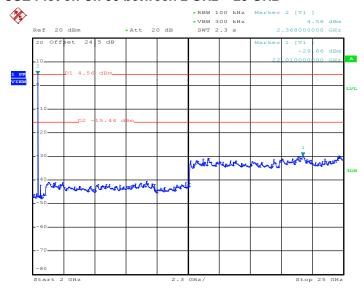


Date: 10.JUL.2017 23:23:50

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 42 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

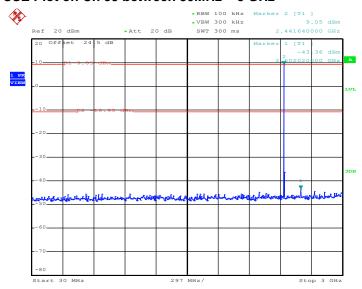

Date: 10.JUL.2017 23:08:54

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

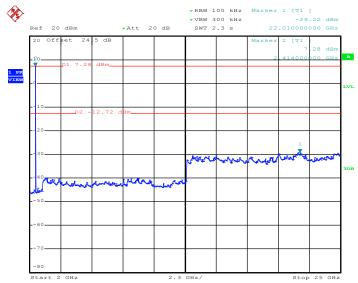


Date: 10.JUL.2017 23:17:49

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 43 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

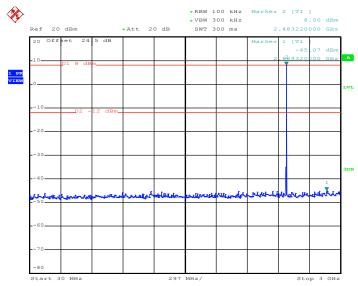

Date: 10.JUL.2017 22:57:42

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

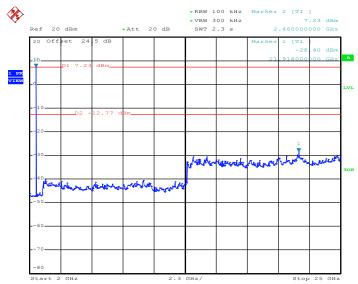

Date: 10.JUL.2017 22:58:04


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 44 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718


<3Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

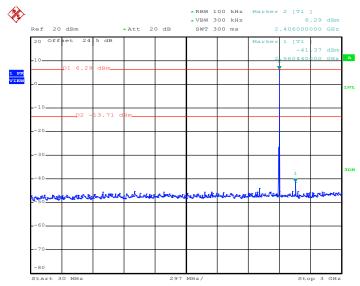

Date: 10.JUL.2017 23:36:25

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

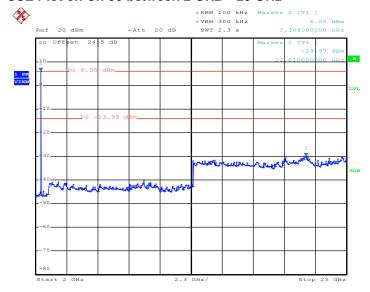


Date: 10.JUL.2017 23:36:47

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 45 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

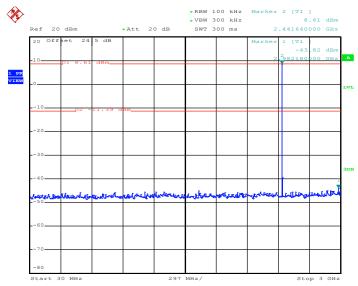

Date: 10.JUL.2017 23:42:56

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

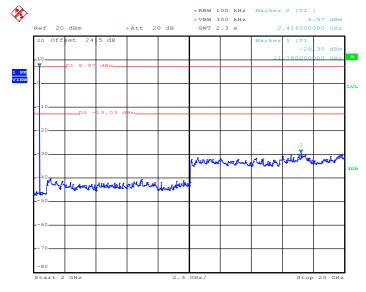


Date: 10.JUL.2017 23:43:18

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 46 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

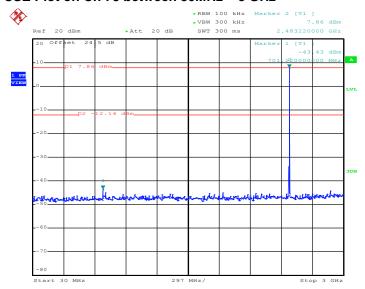

Date: 10.JUL.2017 23:47:47

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

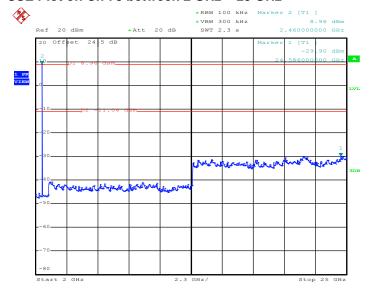

Date: 10.JUL.2017 23:48:09

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 47 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 48 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement:

VBW = 10 Hz, when duty cycle is no less than 98 percent.

VBW ≥ 1/T, when duty cycle is less than 98 percent where T is the minimum transmission duration over which the transmitter is on and is transmitting at its maximum power control level for the tested mode of operation.


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 49 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02


Report No. : FR741718

3.8.4 Test Setup

For radiated emissions below 30MHz

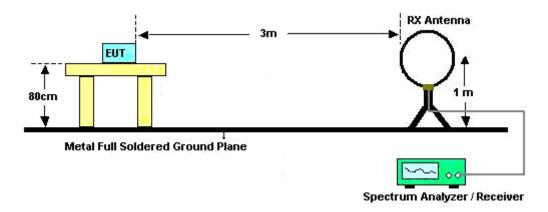

For radiated emissions from 30MHz to 1GHz

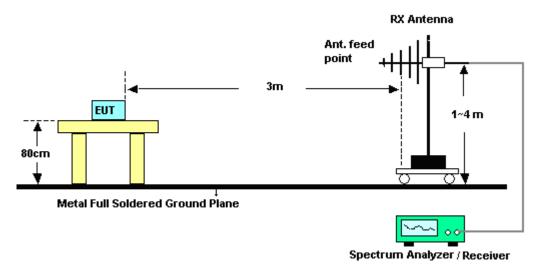


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 50 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

For radiated emissions above 1GHz

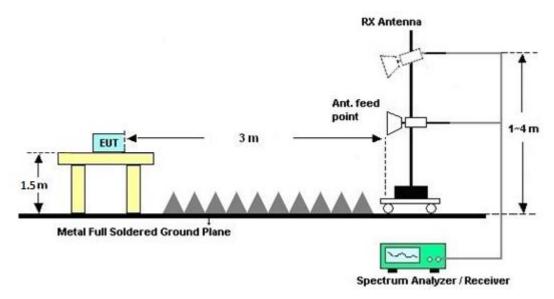

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix B and C.

3.8.7 Duty Cycle

Please refer to Appendix D.

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix B and C.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 51 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

3.9 Antenna Requirements

3.9.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.9.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.9.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 52 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Power Meter	Agilent	E4416A	GB412923 44	NA	Dec. 26, 2016	Jun. 30, 2017 ~ Jul. 11, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Power Sensor	Agilent	E9327A	US404415 48	50MHz~18GHz	Dec. 26, 2016	Jun. 30, 2017 ~ Jul. 11, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz-40GHz	Jul. 17, 2016	Jun. 30, 2017 ~ Jul. 11, 2017	Jul. 16, 2017	Conducted (TH05-HY)
Amplifier	SONOMA	310N	187312	9kHz~1GHz	Nov. 10, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Bilog Antenna	TESEQ	CBL 6111D&N-6-0 6	35414&AT- N0602	30MHz~1GHz	Oct. 15, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Oct. 14, 2017	Radiation (03CH11-HY)
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-132 6	1GHz ~ 18GHz	Oct. 07, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Oct. 06, 2017	Radiation (03CH11-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100488	9 kHz~30 MHz	Oct. 20, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Oct. 19, 2018	Radiation (03CH11-HY)
Preamplifier	Keysight	83017A	MY532700 80	1GHz~26.5GHz	Nov. 10, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Spectrum Analyzer	Keysight	N9010A	MY542004 86	10Hz ~ 44GHz	Oct. 12, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Oct. 11, 2017	Radiation (03CH11-HY)
Antenna Mast	EMEC	AM-BS-4500- B	N/A	1~4m	N/A	Jul. 07, 2017 ~ Jul. 08, 2017	N/A	Radiation (03CH11-HY)
Turn Table	EMEC	TT 2000	N/A	0~360 Degree	N/A	Jul. 07, 2017 ~ Jul. 08, 2017	N/A	Radiation (03CH11-HY)
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1902247	1GHz~18GHz	Jun. 23, 2017	Jul. 07, 2017 ~ Jul. 08, 2017	Jun. 22, 2018	Radiation (03CH11-HY)
Preamplifier	MITEQ	TTA 1840-35-HG	1871923	18GHz ~ 40GHz	Jul. 16, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Jul. 15, 2017	Radiation (03CH11-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170 584	18GHz- 40GHz	Nov. 08, 2016	Jul. 07, 2017 ~ Jul. 08, 2017	Nov. 07, 2017	Radiation (03CH11-HY)
EMI Test Receiver	Agilent	N9038A (MXE)	MY532900 53	20Hz to 26.5GHz	Jan. 12, 2017	Jul. 07, 2017 ~ Jul. 08, 2017	Jan. 11, 2018	Radiation (03CH11-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 53 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No.: FR741718

5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of Confidence	2.70
of 95% (U = 2Uc(y))	2.70

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	F 2
of 95% (U = 2Uc(y))	5.2

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.5
of 95% (U = 2Uc(y))	5.5

<u>Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	5.0
of 95% (U = 2Uc(y))	5.2

SPORTON INTERNATIONAL INC.
TEL: 886-3-327-3456

FAX: 886-3-328-4978 FCC ID: XRAFB205 Page Number : 54 of 54
Report Issued Date : Aug. 04, 2017
Report Version : Rev. 02

Report No. : FR741718

Appendix A. Conducted Test Results

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Report Number : FR741718

Appendix A. Test Result of Conducted Test Items

Test Engineer:	Kai Liao	Temperature:	21~25	°C
Test Date:	2017/6/30 ~ 7/10	Relative Humidity:	51~54	%

Report Number : FR741718

Bluetooth

Test Engineer:	Kai Liao	Temperature:	21~25	°C
Test Date:	2017/6/30 ~ 7/10	Relative Humidity:	51~54	%

<u>TEST RESULTS DATA</u> 20dB and Hopping Channel Separation

Mod.	Data Rate	ХТИ	CH.	Freq. (MHz)	20db BW (MHz)	Hopping Channel Separation Measurement (MHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.90	0.98	0.6027	Pass
DH	1Mbps	1	39	2441	0.88	1.00	0.5893	Pass
DH	1Mbps	1	78	2480	0.88	1.00	0.5893	Pass
2DH	2Mbps	1	0	2402	1.22	1.01	0.8120	Pass
2DH	2Mbps	1	39	2441	1.22	1.00	0.8160	Pass
2DH	2Mbps	1	78	2480	1.24	1.00	0.8240	Pass
3DH	3Mbps	1	0	2402	1.24	1.00	0.8240	Pass
3DH	3Mbps	1	39	2441	1.24	0.99	0.8240	Pass
3DH	3Mbps	1	78	2480	1.24	1.01	0.8280	Pass

TEST RESULTS DATA 99% Bandwidth

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	99% Bandwidth (MHz)
DH	1Mbps	1	0	2402	0.84
DH	1Mbps	1	39	2441	0.84
DH	1Mbps	1	78	2480	0.84
2DH	2Mbps	1	0	2402	1.17
2DH	2Mbps	1	39	2441	1.18
2DH	2Mbps	1	78	2480	1.18
3DH	3Mbps	1	0	2402	1.14
3DH	3Mbps	1	39	2441	1.16
3DH	3Mbps	1	78	2480	1.16

TEST RESULTS DATA Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.92	0.31	0.4	Pass
AFH	20	53.33	2.92	0.16	0.4	Pass

TEST RESULTS DATA Peak Power Table

DH	chann		Peak Power	Power Limit	Test
υп	el		(dBm)	(dBm)	Result
	0	1	7.23	20.97	Pass
DH1	39	1	9.15	20.97	Pass
	78	1	9.47	20.97	Pass

2DH	chann		Peak Power	Power Limit	Test
200	el		(dBm)	(dBm)	Result
	0	1	8.26	20.97	Pass
2DH1	39	1	9.49	20.97	Pass
	78	1	9.85	20.97	Pass

3DH	chann		Peak Power	Power Limit	Test
el			(dBm)	(dBm)	Result
	0	1	8.39	20.97	Pass
3DH1	39	1	9.57	20.97	Pass
	78	1	9.95	20.97	Pass

TEST RESULTS DATA Avg Power Table

DH	chann el		Avg Power (dBm)
	0	1	6.81
DH1	39	1	8.91
	78	1	9.23

2DH	chann		Avg Power
2011	el		(dBm)
	0	1	6.60
2DH5	39	1	8.32
	78	1	8.67

3DH	chann el		Avg Power (dBm)
	0	1	6.57
3DH5	39	1	8.31
	78	1	8.69

<u>TEST RESULTS DATA</u> Number of Hoppina Freauency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

Appendix B. Radiated Spurious Emission

Test Engineer :	Jacky Hung	Temperature :	21~24°C
	Jacky Hung	Relative Humidity :	51~55%

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2376.05	42.64	-31.36	74	43.14	26.81	6.29	33.6	102	233	Р	Н
		2349.8	32.04	-21.96	54	32.72	26.7	6.22	33.6	102	233	Α	Н
		2402	94.76	-	-	95.12	26.87	6.36	33.59	102	233	Р	Н
		2402	94.43	-	-	94.79	26.87	6.36	33.59	102	233	Α	Н
ВТ													Н
CH00													Н
2402MHz		2332.26	42.06	-31.94	74	42.8	26.65	6.22	33.61	123	181	Р	V
2402141112		2375.94	32.44	-21.56	54	32.94	26.81	6.29	33.6	123	181	Α	V
		2402	98.8	-	-	99.16	26.87	6.36	33.59	123	181	Р	V
		2402	98.54	-	-	98.9	26.87	6.36	33.59	123	181	Α	V
													V
													V
		2313.22	41.84	-32.16	74	42.71	26.59	6.15	33.61	239	118	Р	Н
		2388.96	32.44	-21.56	54	32.81	26.87	6.36	33.6	239	118	Α	Н
		2441	97.29	-	-	97.46	27.03	6.38	33.58	239	118	Р	Н
		2441	97.01	-	-	97.18	27.03	6.38	33.58	239	118	Α	Н
DT		2491.18	42.19	-31.81	74	42.18	27.2	6.39	33.58	239	118	Р	Н
BT CH 39		2492.93	33.53	-20.47	54	33.51	27.2	6.39	33.57	239	118	Α	Н
2441MHz		2381.82	41.67	-32.33	74	42.1	26.81	6.36	33.6	114	170	Р	V
244 HVII 12		2310.98	34.19	-19.81	54	35.06	26.59	6.15	33.61	114	170	Α	V
		2441	98.47	-	-	98.64	27.03	6.38	33.58	114	170	Р	V
		2441	98.19	-	-	98.36	27.03	6.38	33.58	114	170	Α	V
		2492.86	42.99	-31.01	74	42.97	27.2	6.39	33.57	114	170	Р	V
		2492.93	34.19	-19.81	54	34.17	27.2	6.39	33.57	114	170	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number : B1 of B6



FCC RF Test Report Report No.: FR741718

	2480	97.12	-	-	97.18	27.14	6.38	33.58	108	110	Р	Н
	2480	96.84	-	-	96.9	27.14	6.38	33.58	108	110	Α	Н
	2484	46.31	-27.69	74	46.37	27.14	6.38	33.58	108	110	Р	Н
	2484.04	41.11	-12.89	54	41.17	27.14	6.38	33.58	108	110	Α	Н
												Н
BT												Н
CH 78	2480	99.54	-	-	99.6	27.14	6.38	33.58	121	168	Р	V
400WITZ	2480	99.12	-	-	99.18	27.14	6.38	33.58	121	168	Α	V
	2484.08	47.12	-26.88	74	47.18	27.14	6.38	33.58	121	168	Р	V
	2484.04	42.04	-11.96	54	42.1	27.14	6.38	33.58	121	168	Α	V
												V
												V

Remark

No other spurious found.

^{2.} All results are PASS against Peak and Average limit line.

2.4GHz 2400~2483.5MHz

Report No. : FR741718

BT (Harmonic @ 3m)

ВТ	Note	Frequency (MHz)	Level	Over Limit (dB)	Limit Line (dBµV/m)	Read Level (dBµV)	Antenna Factor (dB/m)	Cable Loss (dB)	Preamp Factor (dB)	Ant Pos (cm)	Table Pos (deg)	Peak Avg. (P/A)	
		4804	45.24	-28.76	74	66.63	31.6	9.6	63.02	100	0	P	Н
													Н
DT													Н
BT CH 00													Н
2402MHz		4804	42.68	-31.32	74	64.5	31.6	9.6	63.02	100	0	Р	V
2402111112													V
													V
													V
		4882	45.79	-28.21	74	66.96	31.71	9.56	62.87	100	0	Р	Н
		7323	55.44	-18.56	74	68.88	37.51	11.31	62.7	100	105	Р	Н
ВТ		7323	51.08	-2.92	54	64.52	37.51	11.31	62.7	100	105	Α	Н
CH 39													Н
Сп 39 2441MHz		4882	45.29	-28.71	74	66.89	31.71	9.56	62.87	100	0	Р	V
244111112		7323	44.73	-29.27	74	58.61	37.51	11.31	62.7	100	0	Α	V
													V
													V
		4960	47.53	-26.47	74	68.4	31.84	9.53	62.68	100	0	Р	Н
		7440	55.59	-18.41	74	68.58	38.06	11.34	62.77	100	118	Р	Н
ВТ		7440	51.15	-2.85	54	64.14	38.06	11.34	62.77	100	118	Α	Н
CH 78													Н
2480MHz		4960	46.51	-27.49	74	67.82	31.84	9.53	62.68	100	0	Р	V
		7440	44.44	-29.56	74	57.81	38.06	11.34	62.77	100	0	Α	V
													V
													V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number : B3 of B6

Emission below 1GHz

2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V
		30.81	21.07	-18.93	40	28.88	23.84	0.82	32.49	-	-	Р	Н
		159.87	16.49	-27.01	43.5	30.79	16.42	1.61	32.43	-	-	Р	Н
		264.36	18.85	-27.15	46	29.52	19.54	2.09	32.38	-	-	Р	Н
		787.9	30.37	-15.63	46	30.63	28.31	3.49	32.21	-	-	Р	Н
		862.1	31.75	-14.25	46	30.39	29.4	3.67	31.86	-	-	Р	Н
		955.2	32.95	-13.05	46	29.01	31.02	3.9	31.15	100	0	Р	Н
													Н
													Н
													Н
													Н
2.4GHz													Н
BT													Н
LF		30.81	27.41	-12.59	40	35.22	23.84	0.82	32.49	100	0	Р	V
		63.48	26.6	-13.4	40	46.25	11.81	1.02	32.49	-	-	Р	V
		148.53	20.99	-22.51	43.5	34.62	17.12	1.61	32.44	-	-	Р	V
		562.5	27.32	-18.68	46	30.43	26.2	3.03	32.43	-	-	Р	V
		729.1	31.19	-14.81	46	32.46	27.59	3.4	32.39	-	-	Р	V
		909	32.71	-13.29	46	31.01	29.33	3.79	31.58	-	-	Р	V
													V
													V
													V
													V
													V
													V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number : B4 of B6

Note symbol

Report No.: FR741718

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions shall not
	exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

SPORTON INTERNATIONAL INC. Page Number : B5 of B6

A calculation example for radiated spurious emission is shown as below:

Report No.: FR741718

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : B6 of B6



Appendix C. Radiated Spurious Emission Plots

Test Engineer :	Jacky Hung	Temperature :	21~24°C
rest Engineer:		Relative Humidity :	51~55%


Report No.: FR741718


Note symbol

-L	Low channel location
-R	High channel location

SPORTON INTERNATIONAL INC. Page Number : C1 of C13

2.4GHz 2400~2483.5MHz BT (Band Edge @ 3m)

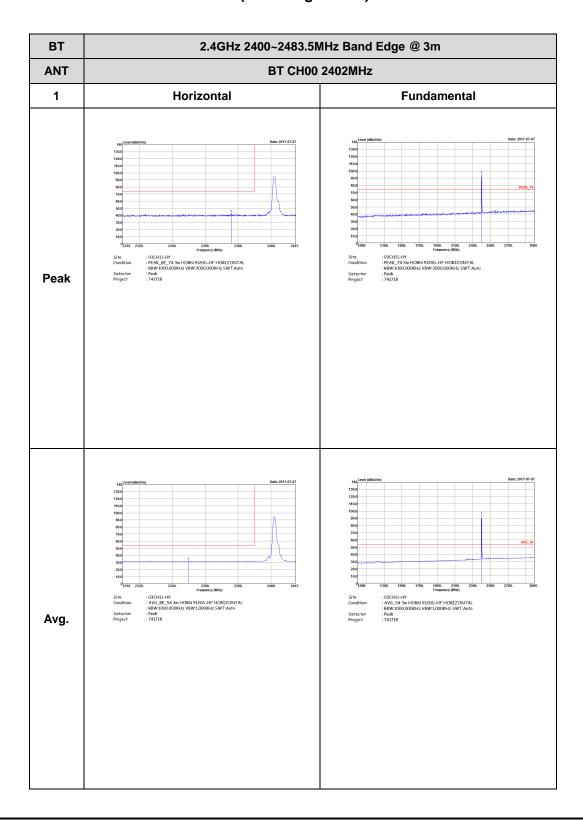

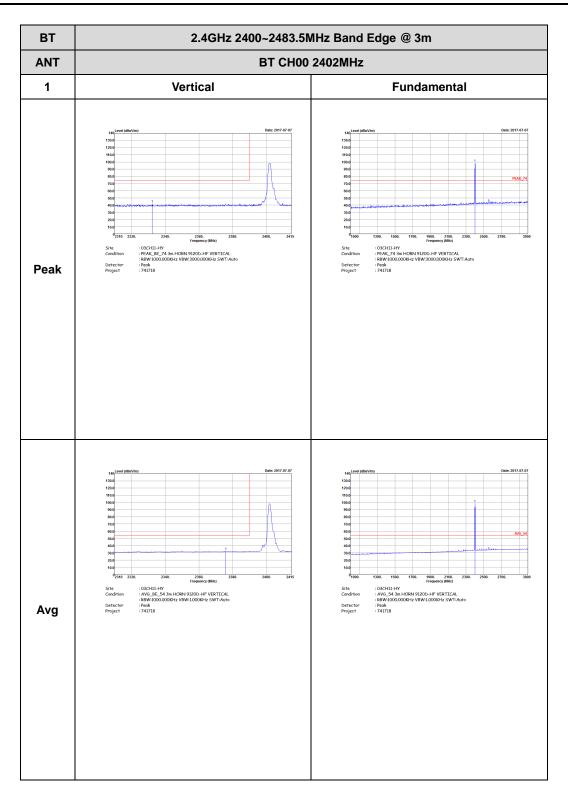

вт 2.4GHz 2400~2483.5MHz Band Edge @ 3m **ANT** BT CH39 2441MHz - L 1 Horizontal **Fundamental Peak** : 03CH11-HY : AV6_BE_54 3m HORN 91200-HF HORIZONTAL : RBW:1000000KHz VBW:1000KHz SWT:Auto : Peak : 741718 Avg.


TEL: 886-3-327-3456 FAX: 886-3-328-4978


вт 2.4GHz 2400~2483.5MHz Band Edge @ 3m ANT BT CH39 2441MHz - R 1 Horizontal **Fundamental** Peak Left blank Left blank Avg.

BT 2.4GHz 2400~2483.5MHz Band Edge @ 3m $\,$ **ANT** BT CH39 2441MHz - L Vertical 1 **Fundamental** Peak Avg.

BT 2.4GHz 2400~2483.5MHz Band Edge @ 3m $\,$ ANT BT CH39 2441MHz - R 1 Vertical **Fundamental** Peak Left blank Left blank Avg.


TEL: 886-3-327-3456 FAX: 886-3-328-4978

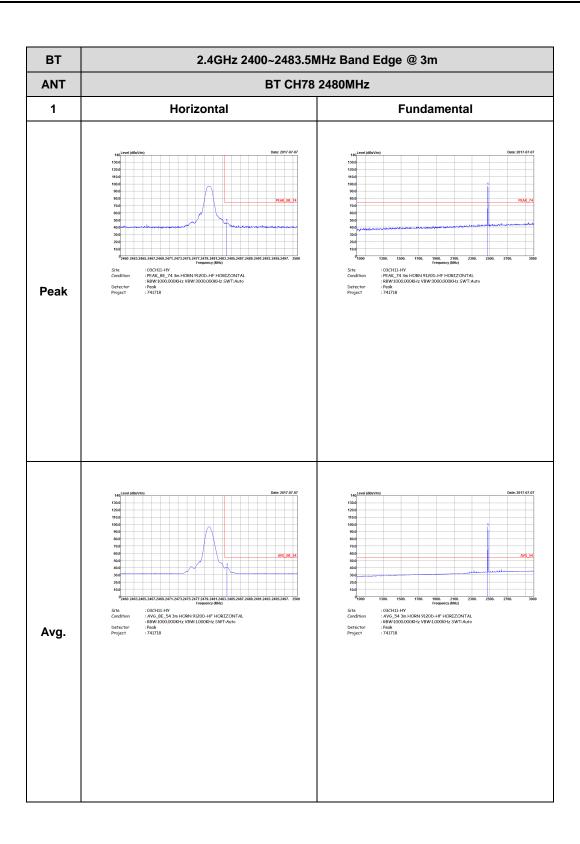

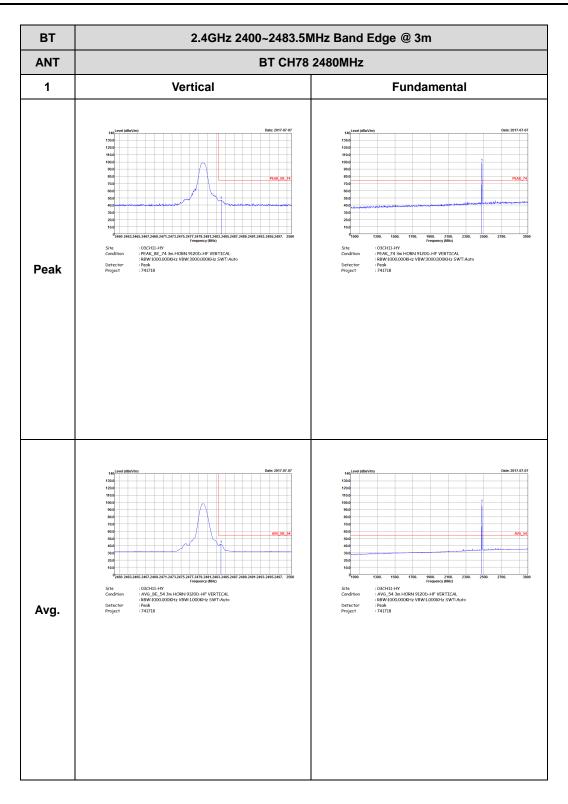



2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

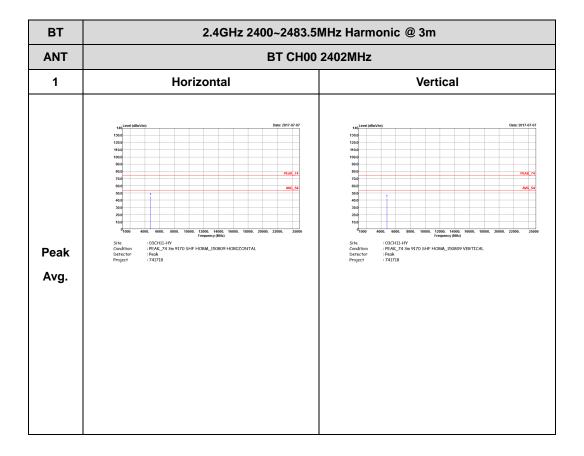




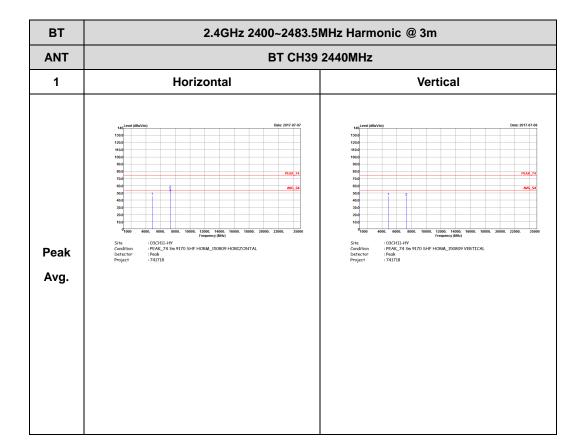

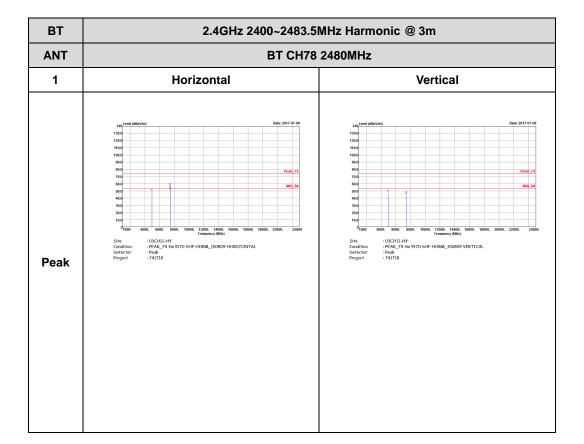

Emission below 1GHz 2.4GHz BT (LF)

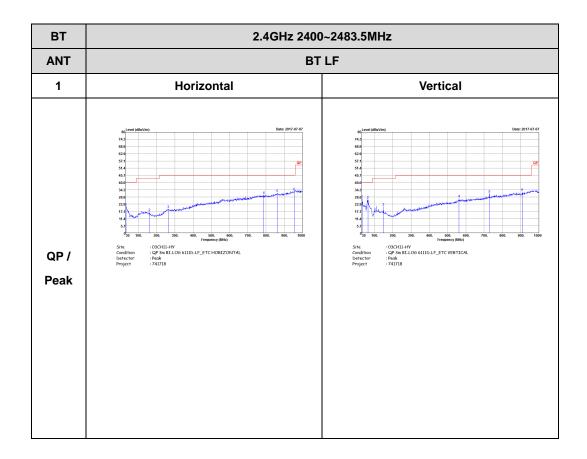




Appendix D. Duty Cycle Plots

Band	Duty Cycle(%)	T(us)	1/T(kHz)	VBW Setting
Bluetooth	77.66	2920.00	0.34	1kHz

Bluetooth

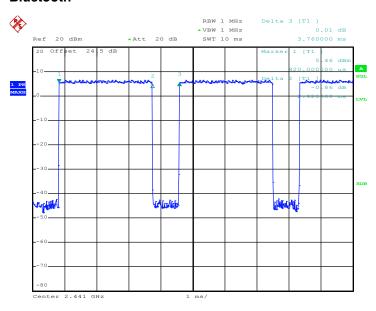

Date: 4.JUL.2017 19:00:33

TEL: 886-3-327-3456 FAX: 886-3-328-4978