# Tune UP

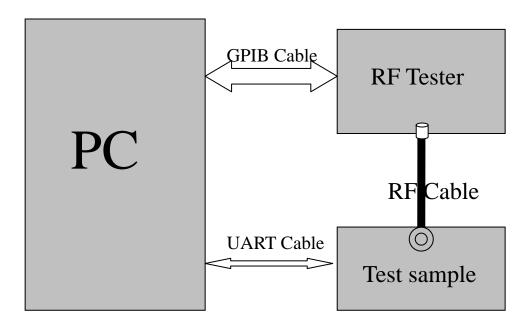


Figure 1

## 1 Adjustment of RF Output Power:

- (1) The equipment setup as shown in Figure 1.
- (2) Operation of PC adjusts equipment.
- (3) Use RF Engineering Tools at PC side.

## Select GSM850 Band:

- 1) Set GSM850 Band.
- 2) Set ARFCN: 190
- 3) TX ON.
- 4) Adjust the power to 32.4dBm (Power control level: PCL=5) by PA DAC value.
- 5) Repeat 4) for 15 times, and adjust the power level to 30.5, 28.8, 27, 25, 23, 21, 19, 17, 15, 13, 11, 9, 7, 5.
- 6) Make 16 Ramp-Up/Ramp-Down data from the adjustment value of (5) and (6).

7) Data of 5) and 6) is writen to flash memory.

Select PCS1900 Band:

- 1) Set PCS Band.
- 2) Set ARFCN: 661.
- 3) TX ON.
- 4) Adjust the power to 29.0 dBm (Power control level: PCL=0) by PA DAC value.
- 5) Repeat 4) for 15 times, and adjust the power level to 27.5, 26, 24, 22, 20, 18, 16, 14, 12, 10, 8, 6, 4, 2, 0.
- 6) Make 16 Ramp-Up/Ramp-Down data from the adjustment value of (5) and (6).
- 7) Data of 5) and 6) is writen to flash memory.

## 2 Adjustment of oscillation frequency of VCXO:

- (1) The equipment setup as shown in Figure 1.
- (2) Use Crystal AFC Control Tools to Set CapID and AFC DAC value.
- (3) Set Band=GSM850,Set ARFCN=190,Set PCL=12.
  - 1) Set AFC DAC=4096, fixed. (Check that Vafc=1.4V).
  - 2) Set CapID=0, and verify that frequency error >>10KHz.
  - 3) Set CapID=63, and verify that frequency error <<-10KHz.
  - 4) If the above 3 items are verified, then change CapID value to make frequency error be closed to 0 Hz as possible, record this CapID value.
  - 5) Set CapID value got from step 4), then change AFC DAC value to make frequency error be closed to 0 Hz as possible, record this AFC DAC value.
  - 6) Download the CapID value and AFC DAC value to flash memory.

#### 3 Adjustment of RX Sensitivity:

- (1) Select GSM850 Band:
  - 1) Set BCCH level:-85dBm;ARFCN:128.
  - 2) Test sample make a call to connect RF Tester..
  - 3) Set TCH level:-106dBm.
  - 4) Measure BER II error at TCH ARFCN:128, 190, 251.
  - 5) Tuen up the RX matching cricuit to make sure BER II <2% at each ARFCN.

#### (2) Select PCS Band:

- 1) Set BCCH level:-85dBm;ARFCN:512.
- 2) Test sample make a call to connect RF Tester..
- 3) Set TCH level:-106dBm.
- 4) Measure BER II error at TCH ARFCN:512, 661, 810.
- 5) Tuen up the RX matching cricuit to make sure BER II <2% at each ARFCN.
- 4. Connect to a Computer USB Port
  - 1) Turn on the power and set the test sample normal working.
  - 2) Connect the USB cable with the USB port.
  - 3) Wait for the PC auto-search the flash disk and load the software.
  - 4) Normal use the USB function after the software is finished.

#### 5. Connect to Bluetooth device

- 1) Turn on the power of the bluetooth function.
- 2) Turn on the power of the bluetooth earphone.
- 3) Make the mobile phone sample to seach the buletooth device.
- 4) Input the password and make the two bluetooth device to connectted and work normally.
- 5) Normal use the Bluetooth function with the bluetooth earphone.