

FCC Test Report

APPLICANT : CT Asia

EQUIPMENT: **GSM** mobile phone

BRAND NAME : BLU

MODEL NAME : Samba Q

FCC ID : YHLBLUSAMBAQ

STANDARD : FCC 47 CFR FCC Part 15 Subpart B

CLASSIFICATION: Certification

The product was received on Mar. 19, 2011 and completely tested on Apr. 15, 2011. We, SPORTON INTERNATIONAL (KUNSHAN) INC., would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI C63.4-2003 and shown the compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL (KUNSHAN) INC., the test report shall not be reproduced except in full.

Reviewed by:

Jones Tsai / Manager

IIAC-MRA



SPORTON INTERNATIONAL (KUNSHAN) INC. No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 1 of 20 Report Issued Date : May 12, 2011

Report Version : Rev. 02



TABLE OF CONTENTS

| RE | VISIO | N HISTORY | 3 |
|----|-------|---|----|
| SU | MMAF | RY OF TEST RESULT | 4 |
| 1. | GEN | ERAL DESCRIPTION | 5 |
| | 1.1. | Applicant | 5 |
| | 1.2. | Manufacturer | 5 |
| | 1.3. | Feature of Equipment Under Test | 5 |
| | 1.4. | Test Site | 6 |
| | 1.5. | Applied Standards | 6 |
| | 1.6. | Ancillary Equipment List | 6 |
| 2. | TEST | CONFIGURATION OF EQUIPMENT UNDER TEST | 7 |
| | 2.1. | Test Mode | 7 |
| | 2.2. | Connection Diagram of Test System | |
| | 2.3. | Test Software | 9 |
| 3. | TEST | 「RESULT | 10 |
| | 3.1. | Test of AC Conducted Emission Measurement | 10 |
| | | Test of Radiated Emission Measurement | |
| 4. | LIST | OF MEASURING EQUIPMENT | 18 |
| 5. | UNC | ERTAINTY OF EVALUATION | 19 |
| ΑP | PEND | OIX A. PHOTOGRAPHS OF EUT | |
| ΔΡ | PEND | NX B SETUP PHOTOGRAPHS | |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 2 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



REVISION HISTORY

| REPORT NO. | VERSION | DESCRIPTION | ISSUED DATE |
|-------------|---------|---------------------------------------|---------------|
| FD090827-02 | Rev. 01 | Initial issue of report | Apr. 25, 2011 |
| FD090827-02 | Rev. 02 | Update report for revising model name | May 12, 2011 |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |
| | | | |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 3 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



SUMMARY OF TEST RESULT

| Report Section | FCC Rule | IC Rule | Description | Limit | Result | Remark |
|-------------------|----------|---------|-----------------------|---|--------|--|
| 3.1 | 15.107 | 7.2.2 | AC Conducted Emission | < 15.107 limits < RSS-Gen table 2 limits | PASS | Under limit 14.50 dB at 1.59 MHz |
| 3.2 | 15.109 | 7.2.3.2 | Radiated Emission | < 15.109 limits or < RSS-Gen table 1 limits (Section 6) | PASS | Under limit 1.41 dB at 45.32 MHz |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 4 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



1. General Description

1.1. Applicant

CT Asia

RMA 2011, 20/F., GOLDEN CENTRAL TOWER, NO. 3037# JINTIAN ROAD, FUTIAN DISTRICT

1.2. Manufacturer

CT Asia

RMA 2011, 20/F., GOLDEN CENTRAL TOWER, NO. 3037# JINTIAN ROAD, FUTIAN DISTRICT

1.3. Feature of Equipment Under Test

| Product F | eature & Specification |
|--------------------|---|
| Equipment | GSM mobile phone |
| Brand Name | BLU |
| Model Name | Samba Q |
| FCC ID | YHLBLUSAMBAQ |
| Tx Frequency Range | GSM850 : 824 MHz ~ 849 MHz GSM1900 : 1850 MHz ~ 1910 MHz |
| Rx Frequency Range | GSM850 : 869 MHz ~ 894 MHz GSM1900 : 1930 MHz ~ 1990 MHz |
| Antenna Type | Fixed Internal Antenna |
| HW Version | V3.1 |
| SW Version | V013 |
| Type of Modulation | GMSK |
| EUT Stage | Production Unit |

Remark:

The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 5 of 20 Report Issued Date: May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02



1.4. Test Site

| Test Site | HAN) INC. | | | | |
|--------------------|--|----------|--|--|--|
| | No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C. | | | | |
| Test Site Location | TEL: +86-0512-5790-0158 | | | | |
| | FAX: +86-0512-5790-0958 | | | | |
| Took Cita No | Sporton | Site No. | | | |
| Test Site No. | CO01-KS 03CH01-KS | | | | |

1.5. Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC 47 CFR FCC Part 15 Subpart B
- ANSI C63.4-2003
- IC RSS-Gen Issue 3

Remark: All test items were verified and recorded according to the standards and without any deviation during the test.

1.6. Ancillary Equipment List

| Item | Equipment | Trade Name | Model Name | FCC ID | Data Cable | Power Cord |
|------|------------------|------------|----------------|---------|---------------------------|-------------------|
| 1. | System Simulator | R&S | CMU 200 | N/A | N/A | Unshielded, 1.8 m |
| 2. | LCD Monitor | QBELL | LC99 | FCC DoC | Shielded, 1.2 m | Unshielded, 1.8 m |
| 3. | iPod | Apple | A1199 | FCC DoC | Unshielded, 1.2 m | N/A |
| 4. | PC | DELL | MT320 | FCC DoC | N/A | Unshielded, 1.8 m |
| 5. | (USB)Mouse | DELL | MO56UC | FCC DoC | Shielded, 1.8 m | N/A |
| 6. | (USB)Keyboard | DELL | L100 | FCC DoC | Shielded, 1.8 m with core | N/A |
| 7. | Printer | HP | Laser Jet 1018 | FCC DoC | Shielded, 1.8 m | Unshielded, 1.8 m |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 6 of 20 Report Issued Date: May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02



2. Test Configuration of Equipment Under Test

2.1. Test Mode

The EUT has been associated with peripherals pursuant to ANSI C63.4-2003 and configuration operated in a manner tended to maximize its emission characteristics in a typical application.

Frequency range investigated: conduction (150 kHz to 30 MHz), radiation (30MHz to the 5th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower).

The following tables are showing the test modes as the worst cases and recorded in this report.

| | | Test Condition | | | | |
|------|------------------------------------|----------------|--------------|--------------|--|--|
| Item | EUT Configuration | EMI AC | EMI RE<1G | EMI RE≥1G | | |
| 1. | Operating Mode (EUT with earphone) | Note 1 | | Note 1 | | |
| 2. | Charging Mode (EUT with adapter) | \boxtimes | | \boxtimes | | |
| 3. | Charging Mode (EUT with PC) | \boxtimes | | Note 1 | | |

Abbreviations:

EMI AC: AC conducted emissions

EMI RE ≥ 1G: EUT radiated emissions ≥ 1GHz

EMI RE < 1G: EUT radiated emissions < 1GHz

Note 1: Testing for this mode is not required or not the worst case.

| Test Items | EUT Configure Mode | Function Type |
|------------------------------|--------------------------|--|
| AC Conducted | | Mode 1: GSM850 Idle + Adapter + Camera |
| Emission | 2/3 | Mode 2: GSM850 Idle + USB Cable (Link with PC) |
| | | Mode 3: GSM1900 Idle + Adapter + Camera |
| | | Mode 1: GSM850 Idle + Adapter + Camera |
| Radiated | | Mode 2: GSM850 Idle + USB Cable (Link with PC) |
| Emissions < 1GHz | | Mode 3: GSM850 Idle + Earphone + MPEG4 |
| | | Mode 4: GSM1900 Idle + Adapter + Camera |
| Radiated Emissions ≥ 1GHz | 2 | Mode 1: GSM1900 Idle + Adapter + Camera |

Remark:

1. The worst case of AC is mode 2; only the test data of this mode was reported.

2. The worst case of RE < 1G is mode 4; only the test data of this mode was reported.


SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 7 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02




2.2. Connection Diagram of Test System

<EUT with Adapter Mode>

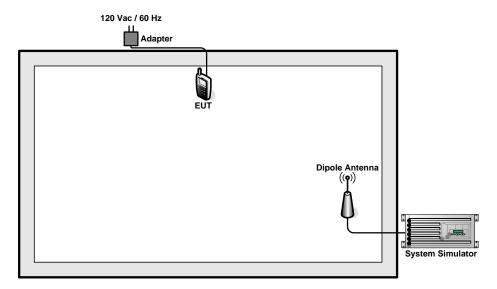


<EUT with Earphone Mode>

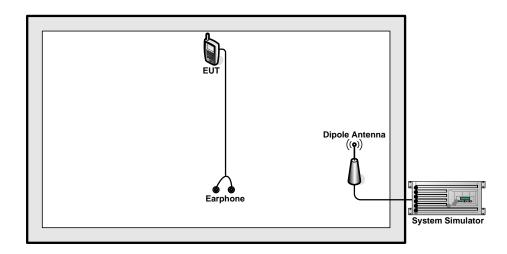

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 8 of 20 Report Issued Date: May 12, 2011 Report Version : Rev. 02



<EUT with USB Cable (Link with PC) Mode>

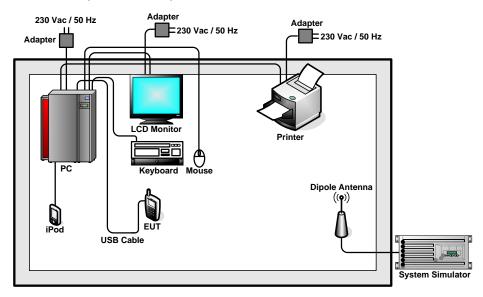

2.3. Test Software

The EUT was in GSM idle mode during the testing. The EUT was synchronized to the BCCH, and is in continuous receiving mode by setting system simulator's paging reorganization.

At the same time, the following programs installed in the EUT were programmed during the test.

- 1. Execute the program, "Winthrax", installed in PC for active sync files transfer with EUT via USB cable.
- 2. Execute "Video Player" to play MPEG4 files.
- 3. Turn on camera to capture images.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 9 of 20 Report Issued Date: May 12, 2011 Report Version : Rev. 02

3. Test Result

3.1. Test of AC Conducted Emission Measurement

3.1.1 Limits of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

| Frequency of emission | Conducted limit (dBuV) | | | | |
|-----------------------|------------------------|-----------|--|--|--|
| (MHz) | Quasi-peak | Average | | | |
| 0.15-0.5 | 66 to 56* | 56 to 46* | | | |
| 0.5-5 | 56 | 46 | | | |
| 5-30 | 60 | 50 | | | |

^{*}Decreases with the logarithm of the frequency.

3.1.2 Measuring Instruments

See list of measuring instruments of this test report.

3.1.3 Test Procedure

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth with Maximum Hold Mode.

SPORTON INTERNATIONAL (KUNSHAN) INC.


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 10 of 20
Report Issued Date : May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02




3.1.4 Test Setup

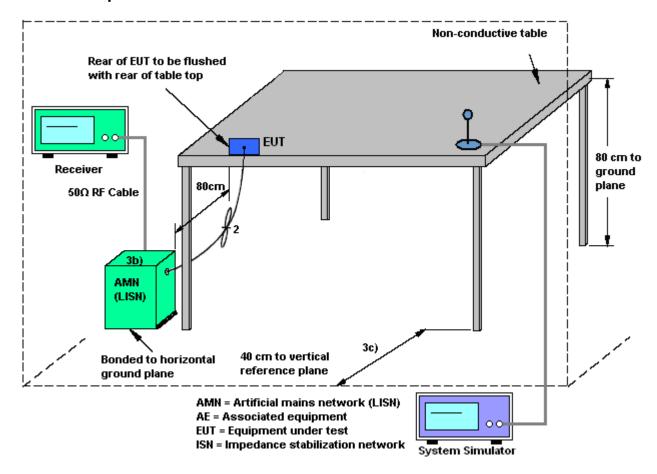

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 11 of 20 Report Issued Date: May 12, 2011 Report Version : Rev. 02



3.1.5 Test Result of AC Conducted Emission

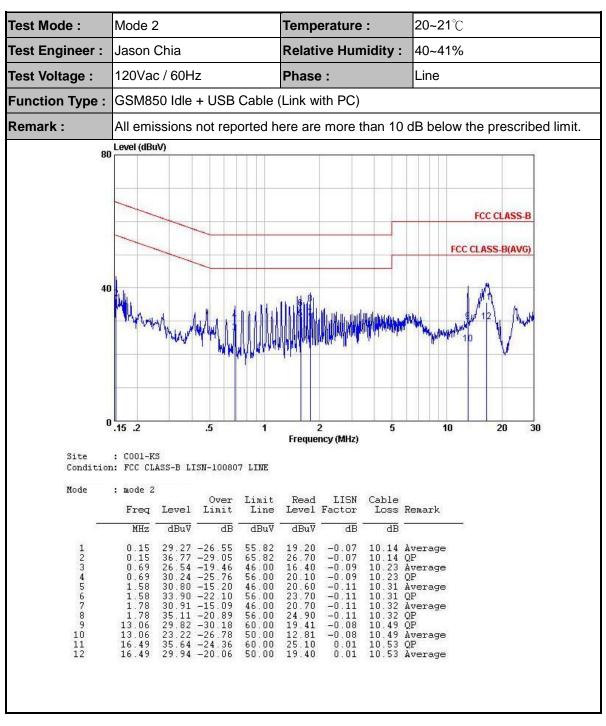

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 12 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



| | Mode 2 | | Temperature : | | 20~21℃ | |
|-------------------|---|---|---|----------------|-------------------|----------------|
| Test Engineer : | Jason Chia | | Relative Humi | idity : | 40~41% | |
| Test Voltage : | 120Vac / 60H | z | Phase : | | Neutral | |
| Function Type : | GSM850 Idle | + USB Cable | (Link with PC) | | | |
| Remark : | All emissions | not reported I | nere are more th | nan 10 | dB below the pres | scribed limit. |
| 40 | | Www.1111111 | | | FCC CLASS-B(| |
| 0 | 15 2 | *************************************** | WWw.Www. | | 1b V | 30 |
| 0.000.000 | .15 .2 | .5 1 | 2 Frequency (MHz) | 5 | 10 20 | 30 |
| Site | : COO1-KS : FCC CLASS-B LI : mode 2 Freq Level | ISN-100807 NEUTR Over Limit | Frequency (MHz) AL Read LISN (| 5 Cable Loss F | 10 20 | 30 |
| Site Condition | : COO1-KS : FCC CLASS-B LI | ISN-100807 NEUTR Over Limit | Frequency (MHz) AL Read LISN (Level Factor | Cable | 10 20 | 30 |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 13 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



3.2. Test of Radiated Emission Measurement

3.2.1. Limit of Radiated Emission

The emissions from an intentional radiator shall not exceed the field strength levels specified in the following table:

| Frequency | Field Strength | Measurement Distance | | |
|---------------|--------------------|----------------------|--|--|
| (MHz) | (microvolts/meter) | (meters) | | |
| 0.009 – 0.490 | 2400/F(kHz) | 300 | | |
| 0.490 – 1.705 | 24000/F(kHz) | 30 | | |
| 1.705 – 30.0 | 30 | 30 | | |
| 30 – 88 | 100 | 3 | | |
| 88 – 216 | 150 | 3 | | |
| 216 - 960 | 200 | 3 | | |
| Above 960 | 500 | 3 | | |

3.2.2. Measuring Instruments

See list of measuring instruments of this test report.

SPORTON INTERNATIONAL (KUNSHAN) INC.


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 14 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



3.2.3. Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- The table was rotated 360 degrees to determine the position of the highest radiation. 3.
- 4. The antenna is a Bi-Log antenna and its height is adjusted between one meter and four meters above ground to find the maximum value of the field strength for both horizontal polarization and vertical polarization of the antenna.
- 5. For each suspected emission, the EUT was arranged to its worst case and then tune the antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading.
- 6. Set the test-receiver system to Peak Detect Function and specified bandwidth with Maximum Hold Mode.
- 7. If the emission level of the EUT in peak mode was 3 dB lower than the limit specified, then testing will be stopped and peak values of EUT will be reported, otherwise, the emissions will be repeated one by one using the quasi-peak method and reported
- 8. Emission level $(dBuV/m) = 20 \log Emission level (uV/m)$
- 9. Corrected Reading: Antenna Factor + Cable Loss + Read Level - Preamp Factor = Level

3.2.4. Test Setup of Radiated Emission

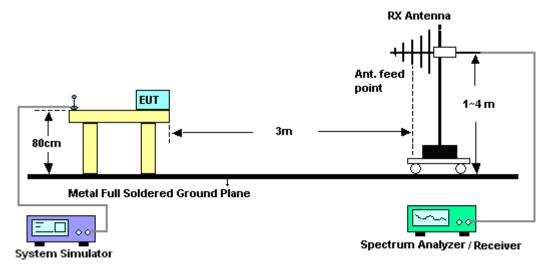

SPORTON INTERNATIONAL (KUNSHAN) INC.


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 15 of 20 Report Issued Date: May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02



3.2.5. Test Result of Radiated Emission

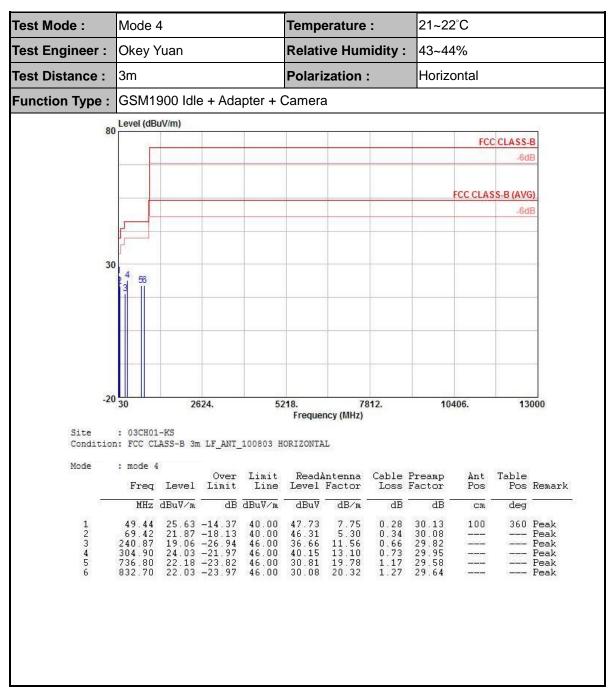

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 16 of 20 Report Issued Date: May 12, 2011 Report Version : Rev. 02

Test Engineer:



Test Mode : Mode 4 Temperature : 21~22°C


Relative Humidity:

43~44%

Test Distance : 3m Polarization : Vertical

Function Type: |GSM1900 | Idle + Adapter + Camera

Okey Yuan

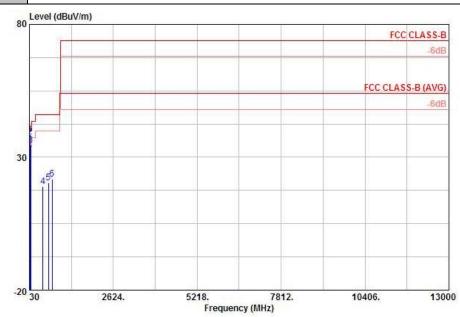

Site : 03CH01-KS

Condition: FCC CLASS-B 3m LF_ANT_100803 VERTICAL

Mode : mode 4

| | | Freq | Level | Over Limit | 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 | | Antenna Factor | | Preamp Factor | Ant Pos | Table Pos | Remark |
|---|----|--------|------------------------------|---------------|---------------------------------------|-------|-------------------|------|------------------|------------|--------------|--------|
| | - | MHz | $\overline{\mathtt{dBuV/m}}$ | dB | $\overline{\mathtt{dBuV/m}}$ | dBuV | dB/m | dB | dB | cm | deg | |
| 1 | | 45.32 | 38.59 | -1.41 | 40.00 | 59.20 | 9.25 | 0.27 | 30.13 | 100 | 204 | QP |
| | Į. | 49.43 | 37.80 | -2.20 | 40.00 | 59.90 | 7.75 | 0.28 | 30.13 | 100 | 233 | QP |
| 3 | | 66.45 | 34.48 | -5.52 | 40.00 | 59.00 | 5.25 | 0.33 | 30.10 | 100 | 192 | QP |
| 4 | | 450.50 | 19.11 | -26.89 | 46.00 | 31.69 | 16.31 | 0.90 | 29.79 | | | Peak |
| 5 | | 622.70 | 20.48 | -25.52 | 46.00 | 30.31 | 18.72 | 1.08 | 29.63 | | | Peak |
| 6 | | 728.40 | 21.70 | -24.30 | 46.00 | 30.48 | 19.67 | 1.16 | 29.61 | | | Peak |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 17 of 20
Report Issued Date : May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02



4. List of Measuring Equipment

| Instrument | Manufacturer | Model No. | Serial No. | Characteristics | Calibration Date | Due Date | Remark |
|------------------------------|--------------|-----------|------------------|-----------------|---------------------|---------------|--------------------------|
| EMI Receiver | R&S | ESCI7 | 100768 | 9kHz~7GHz | Jun. 22, 2010 | Jun. 21, 2011 | Conduction (CO01-KS) |
| LISN | MessTec | AN3016 | 60103 | 9kHz~30MHz | Jan. 07, 2011 | Jan. 06, 2012 | Conduction (CO01-KS) |
| LISN | MessTec | AN3016 | 60105 | 9kHz~30MHz | Jan. 07, 2011 | Jan. 06, 2012 | Conduction (CO01-KS) |
| AC Power Source | Chroma | 61602 | ABP0000008 11 | N/A | Nov. 10, 2010 | Nov. 09, 2011 | Conduction (CO01-KS) |
| EMI Test Receiver | R&S | ESCI | 100534 | 9kHz~3GHz | Nov. 16, 2010 | Nov. 15, 2011 | Radiation (03CH01-KS) |
| Spectrum Analyzer | R&S | FSP40 | 100319 | 9kHz~40GHz | Jan. 07, 2011 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Bilog Antenna | SCHAFFNER | CBL6112D | 23182 | 25MHz~2GHz | Dec. 07, 2010 | Dec. 06, 2011 | Radiation (03CH01-KS) |
| Double Ridge Horn Antenna | EMCO | 3117 | 00075959 | 1GHz~18GHz | Jan. 07, 2011 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Amplifier | Wireless | FPA-6592G | 060004 | 30MHz~2GHz | Dec. 09, 2010 | Dec. 08, 2011 | Radiation (03CH01-KS) |
| Amplifier | Agilent | 8449B | 3008A02370 | 1GHz~26.5GHz | Jan. 07, 2011 | Jan. 06, 2012 | Radiation (03CH01-KS) |
| Actice hore antenna | com-power | AHA-118 | 701023 | 1G-18GHz | Nov. 09, 2010 | Nov. 08, 2011 | Radiation (03CH01-KS) |
| Signal Generator | R&S | SMR40 | 100455 | 10MHz~40GHz | Jan. 06, 2011 | Jan. 05, 2012 | Radiation (03CH01-KS) |
| SHF-EHF Horn | Schwarzbeck | BBHA 9170 | BBHA170249 | 15-40GHz | Oct. 15, 2010 | Oct. 14, 2011 | Radiation (03CH01-KS) |
| Loop Antenna | R&S | HFH2-Z2 | 860004/001 | 9 kHz~30 MHz | Jul. 29, 2010 | Jul. 28, 2011 | Radiation (03CH01-KS) |
| System Simulator | R&S | CMU200 | 837587/066 | Full-Band | Jan. 07, 2011 | Jan. 06, 2012 | Radiation (03CH01-KS) |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ

: 18 of 20 Page Number Report Issued Date: May 12, 2011 Report Version : Rev. 02



5. Uncertainty of Evaluation

<u>Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)</u>

| | Uncerta | | | |
|---|---------------|-----------------------------|--------------------|--|
| Contribution | dB | Probability Distribution | u(X _i) | |
| Receiver Reading | 0.10 | Normal (k=2) | 0.05 | |
| Cable Loss | 0.10 | Normal (k=2) | 0.05 | |
| AMN Insertion Loss | 2.50 | Rectangular | 0.63 | |
| Receiver Specification | 1.50 | Rectangular | 0.43 | |
| Site Imperfection | 1.39 | Rectangular | 0.80 | |
| Mismatch | +0.34 / -0.35 | U-Shape | 0.24 | |
| Combined Standard Uncertainty Uc(y) | 1.13 | | | |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) | 2.26 | | | |

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

| | Uncerta | | | |
|---|---------------|-----------------------------|--------------------|--|
| Contribution | dB | Probability Distribution | u(X _i) | |
| Receiver Reading | 0.41 | Normal (k=2) | 0.21 | |
| Antenna Factor Calibration | 0.83 | Normal (k=2) | 0.42 | |
| Cable Loss Calibration | 0.25 | Normal (k=2) | 0.13 | |
| Pre-Amplifier Gain Calibration | 0.27 | Normal (k=2) | 0.14 | |
| RCV/SPA Specification | 2.50 | Rectangular | 0.72 | |
| Antenna Factor Interpolation for Frequency | 1.00 | Rectangular | 0.29 | |
| Site Imperfection | 1.43 | Rectangular | 0.83 | |
| Mismatch | +0.39 / -0.41 | U-Shape | 0.28 | |
| Combined Standard Uncertainty Uc(y) | 1.27 | | | |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) | 2.54 | | | |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 19 of 20 Report Issued Date: May 12, 2011

Report No.: FD090827-02

Report Version : Rev. 02



Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)

| | Uncertai | | | | |
|--|---------------|-----------------------------|--------------------|----------------|-------------------------------------|
| Contribution | dB | Probability Distribution | u(X _i) | C _i | C _i * u(X _i) |
| Receiver Reading | ±0.10 | Normal (k=2) | 0.10 | 1 | 0.10 |
| Antenna Factor Calibration | ±1.70 | Normal (k=2) | 0.85 | 1 | 0.85 |
| Cable Loss Calibration | ±0.50 | Normal (k=2) | 0.25 | 1 | 0.25 |
| Receiver Correction | ±2.00 | Rectangular | 1.15 | 1 | 1.15 |
| Antenna Factor Directional | ±1.50 | Rectangular | 0.87 | 1 | 0.87 |
| Site Imperfection | ±2.80 | Triangular | 1.14 | 1 | 1.14 |
| Mismatch Receiver VSWR Γ 1 = 0.197 Antenna VSWR Γ 2 = 0.194 Uncertainty = 20Log(1- Γ 1* Γ 2) | +0.34 / -0.35 | U-Shape | 0.244 | 1 | 0.244 |
| Combined Standard Uncertainty Uc(y) | 2.36 | | | | |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) | 4.72 | | | | |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : 20 of 20
Report Issued Date : May 12, 2011
Report Version : Rev. 02



Appendix A. Photographs of EUT

Please refer to Sporton report number EP090827-02 as below.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUSAMBAQ Page Number : A1 of A1
Report Issued Date : May 12, 2011
Report Version : Rev. 02