

**FCC RF Test Report** 

APPLICANT : CT Asia

**EQUIPMENT** : **GSM** mobile phone

BRAND NAME : BLU
MODEL NAME : Hero

FCC ID : YHLBLUHERO

STANDARD : FCC 47 CFR Part 2, 22(H), 24(E)

CLASSIFICATION : PCS Licensed Transmitter Held to Ear (PCE)

Tx/Rx FREQUENCY RANGE : GSM850 : 824.2 ~ 848.8 MHz /

869.2 ~ 893.8 MHz

GSM1900 : 1850.2 ~ 1909.8 MHz / 1930.2 ~ 1989.8 MHz

MAX. ERP/EIRP POWER : GSM850 (GSM) : 0.58 W

GSM1900 (GSM): 1.23 W

EMISSION DESIGNATOR : 246KGXW

The product was received on Dec. 21, 2011 and completely tested on Jan. 07, 2012. We, SPORTON INTERNATIONAL (KUNSHAN) INC., would like to declare that the tested sample has been evaluated in accordance with the procedures given in ANSI / TIA / EIA-603-C-2004 and shown compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL (KUNSHAN) INC., the test report shall not be reproduced except in full.

Reviewed by:

Jones Tsai / Manager

lac-MRA



Report No.: FG1D2103

SPORTON INTERNATIONAL (KUNSHAN) INC. No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 1 of 37
Report Issued Date : Jan. 16, 2012

Report Version : Rev. 01



# **TABLE OF CONTENTS**

| RE | VISION HIST  | ORY  | 3        |
|----|--|--|----------|
| SU | MMARY OF   | TEST RESULT  | 4        |
| 1  |  | DESCRIPTION  |          |
|    | 1.2 Manu<br>1.3 Featu  | cantfacturerre of Equipment Under Testre               | 5<br>5   |
|    | 1.5 Applie   | ng Siteed Standardsary Equipment List                  | 6        |
| 2  | TEST CONF  | IGURATION OF EQUIPMENT UNDER TEST                      | 7        |
|    |  | Modeection Diagram of Test System                      |          |
| 3  | TEST RESU  | LT   | 9        |
|    | <ul> <li>3.2 Effect</li> <li>3.3 Occup</li> <li>3.4 Band</li> <li>3.5 Condo</li> <li>3.6 Field</li> <li>3.7 Frequence</li> </ul> | ucted Output Power Measurement                         | 11142026 |
| 4  | LIST OF ME   | ASURING EQUIPMENTS                                     | 36       |
|    | PENDIX A. P  | NTY OF EVALUATION  HOTOGRAPHS OF EUT  ETUP PHOTOGRAPHS | 37       |
| ME | FLINDIA D. 3   | LIUF FIIOTOGNAFAS                                      |          |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 2 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



**REVISION HISTORY** 

| REPORT NO. | VERSION | DESCRIPTION             | ISSUED DATE   |
|------------|---------|-------------------------|---------------|
| FG1D2103   | Rev. 01 | Initial issue of report | Jan. 16, 2012 |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |
|            |         |                         |               |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 3 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



**SUMMARY OF TEST RESULT** 

| Report<br>Section | FCC Rule                            | Description                                   | Limit                               | Result | Remark                                 |
|-------------------|-------------------------------------|---|-------------------------------------|--------|--|
| 3.1               | §2.1046                             | Conducted Output<br>Power                     | N/A                                 | PASS   | -                                      |
| 3.2               | §22.913(a)(2)                       | Effective Radiated Power                      | < 7 Watts                           | PASS   | -                                      |
| 3.2               | §24.232(c)                          | Equivalent Isotropic Radiated Power           | < 2 Watts                           | PASS   | -                                      |
| 3.3               | §2.1049<br>§22.917(a)<br>§24.238(a) | Occupied Bandwidth                            | N/A                                 | PASS   | -                                      |
| 3.4               | §2.1051<br>§22.917(a)<br>§24.238(a) | Band Edge<br>Measurement                      | < 43+10log <sub>10</sub> (P[Watts]) | PASS   | -                                      |
| 3.5               | §2.1051<br>§22.917(a)<br>§24.238(a) | Conducted Emission                            | < 43+10log <sub>10</sub> (P[Watts]) | PASS   | -                                      |
| 3.6               | §2.1053<br>§22.917(a)<br>§24.238(a) | Field Strength of<br>Spurious Radiation       | < 43+10log <sub>10</sub> (P[Watts]) | PASS   | Under limit<br>25.95 dB at<br>1672 MHz |
| 3.7               | §2.1055<br>§22.355<br>§24.235       | Frequency Stability for Temperature & Voltage | < 2.5 ppm                           | PASS   | -                                      |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 4 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



# 1 General Description

## 1.1 Applicant

#### **CT** Asia

RMA2011, 20/F, GOLDEN CENTRAL TOWER, NO.3037# JINTIAN ROAD, FUTIAN DISTRICT

#### 1.2 Manufacturer

#### SHENZHEN TINNO MOBILE TECHNOLOGY CORP.

4/F., H-3 Building, OCT Eastern Industrial Park. NO.1 Xiangshan East

## 1.3 Feature of Equipment Under Test

| Product Feature & Specification |   |  |  |  |  |
|---------------------------------|---|--|--|--|--|
| Equipment                       | GSM mobile phone  |  |  |  |  |
| Brand Name                      | BLU   |  |  |  |  |
| Model Name                      | Hero  |  |  |  |  |
| FCC ID                          | YHLBLUHERO  |  |  |  |  |
| Tx Frequency                    | GSM850 : 824 MHz ~ 849 MHz<br>GSM1900 : 1850 MHz ~ 1910 MHz             |  |  |  |  |
| Rx Frequency                    | GSM850 : 869 MHz ~ 894 MHz<br>GSM1900 : 1930 MHz ~ 1990 MHz             |  |  |  |  |
| Maximum Output Power to Antenna | GSM850 : 32.19 dBm<br>GSM1900 : 28.46 dBm                               |  |  |  |  |
| Maximum ERP/EIRP                | GSM850 (GSM) : 0.58 W (27.65 dBm)<br>GSM1900 (GSM) : 1.23 W (30.90 dBm) |  |  |  |  |
| Antenna Type                    | Fixed Internal Antenna  |  |  |  |  |
| HW Version                      | F7010-01_V1.1   |  |  |  |  |
| SW Version                      | F7010A_MP_F1_05   |  |  |  |  |
| Type of Modulation              | GMSK  |  |  |  |  |
| Type of Emission                | 246KGXW   |  |  |  |  |
| EUT Stage                       | Identical Prototype   |  |  |  |  |

#### Remark

- 1. For other wireless features of this EUT, the test report will be issued separately.
- This test report recorded only product characteristics and test results of PCS Licensed Transmitter Held to Ear (PCE).
- The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.
- 4. There are two SIM cards for EUT. They are SIM1 card and SIM2 card. After pre-scan two SIM cards, we found test result with SIM1 card was the worst, so we choose SIM1 card to perform all test

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 5 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



## 1.4 Testing Site

| Test Site          | SPORTON INTERNATIONAL (KUNSHAN) INC.                       |           |                      |  |  |
|--------------------|--|-----------|----------------------|--|--|
|                    | No. 3-2, PingXiang Road, Kunshan, Jiangsu Province, P.R.C. |           |                      |  |  |
| Test Site Location | TEL: +86-0512-5790-0158                                    |           |                      |  |  |
|                    | FAX: +86-0512-5790-0958                                    |           |                      |  |  |
| Toot Site No       | Sporton Site No.   |           | FCC Registration No. |  |  |
| Test Site No.      | TH01-KS  | 03CH01-KS | 149928               |  |  |

## 1.5 Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- 47 CFR Part 2, 22(H), 24(E)
- ANSI / TIA / EIA-603-C-2004

#### Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B (Certification), recorded in a separate test report.

## 1.6 Ancillary Equipment List

| ltem | Equipment        | Trade Name | Model No. | FCC ID | Data Cable | Power Cord        |
|------|------------------|------------|-----------|--------|------------|-------------------|
| 1.   | System Simulator | R&S        | CMU200    | N/A    | N/A        | Unshielded, 1.8 m |
| 2.   | DC Power Supply  | GW         | GPS-3030D | N/A    | N/A        | Unshielded, 1.8 m |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO

Page Number : 6 of 37 Report Issued Date: Jan. 16, 2012

Report No.: FG1D2103

Report Version : Rev. 01



# 2 Test Configuration of Equipment Under Test

### 2.1 Test Mode

During all testing, EUT is in link mode with base station emulator at maximum power level. The spurious emission measurements were carried out in semi-anechoic chamber with 3-meter test range, and EUT is rotated on three test planes to find out the worst emission.

Frequency range investigated for radiated emission is as follows:

- 1. 30 MHz to 9000 MHz for GSM850.
- 30 MHz to 19000 MHz for GSM1900.

| Test Modes |              |               |  |  |  |  |
|------------|--------------|---------------|--|--|--|--|
| Band       | Radiated TCs | Conducted TCs |  |  |  |  |
| GSM 850    | ■ GSM Link   | ■ GSM Link    |  |  |  |  |
| GSM 1900   | ■ GSM Link   | ■ GSM Link    |  |  |  |  |

#### Note:

The maximum power level is GSM mode for GMSK link, only this mode was used for all tests.

#### The conducted power tables are as follows:


| Conducted Power (*Unit: dBm) |                    |             |       |         |       |              |  |
|------------------------------|--------------------|-------------|-------|---------|-------|--------------|--|
| Band                         |                    | GSM850      |       | GSM1900 |       |              |  |
| Channel                      | 128                | 128 189 251 |       |         | 661   | 810          |  |
| Frequency                    | 824.2              | 836.4       | 848.8 | 1850.2  | 1880  | 1909.8       |  |
| GSM (1 Uplink)               | <mark>32.19</mark> | 32.11       | 32.04 | 28.10   | 28.28 | <b>28.46</b> |  |
| GPRS 8 (1 Uplink) – CS1      | 32.08              | 32.00       | 31.93 | 28.04   | 28.23 | 28.41        |  |
| GPRS 10 (2 Uplink) - CS1     | 31.28              | 31.19       | 31.12 | 27.22   | 27.42 | 27.63        |  |
| GPRS 11 (3 Uplink) - CS1     | 29.62              | 29.54       | 29.49 | 25.59   | 25.83 | 26.02        |  |
| GPRS 12 (4 Uplink) – CS1     | 28.80              | 28.70       | 28.62 | 24.74   | 24.97 | 25.24        |  |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 7 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



Report No.: FG1D2103

# 2.2 Connection Diagram of Test System

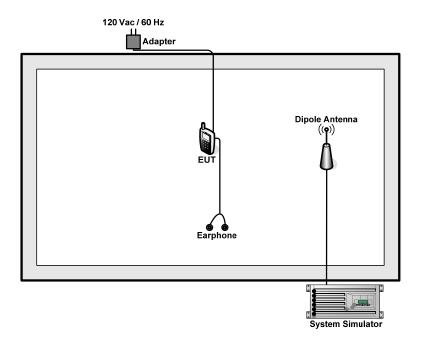

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 8 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



3 Test Result

## 3.1 Conducted Output Power Measurement

#### 3.1.1 Description of the Conducted Output Power Measurement

A base station simulator was used to establish communication with the EUT. Its parameters were set to transmit the maximum power on the EUT. The measured power in the radio frequency on the transmitter output terminals shall be reported.

### 3.1.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.1.3 Test Procedures

- 1. The transmitter output port was connected to base station.
- 2. Set EUT at maximum power through base station.
- 3. Select lowest, middle, and highest channels for each band and different modulation.

### 3.1.4 Test Setup



TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 9 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01

# ·

3.1.5 Test Result of Conducted Output Power

| Cellular Band |            |                    |                             |                               |  |  |  |
|---------------|------------|--------------------|-----------------------------|-------------------------------|--|--|--|
| Modes         | Channel    | Frequency<br>(MHz) | Conducted<br>Power<br>(dBm) | Conducted<br>Power<br>(Watts) |  |  |  |
|               | 128 (Low)  | 824.2              | 32.19                       | 1.66                          |  |  |  |
| GSM850 (GSM)  | 189 (Mid)  | 836.4              | 32.11                       | 1.63                          |  |  |  |
|               | 251 (High) | 848.8              | 32.04                       | 1.60                          |  |  |  |

| PCS Band      |            |                    |                             |                               |  |  |  |
|---------------|------------|--------------------|-----------------------------|-------------------------------|--|--|--|
| Modes         | Channel    | Frequency<br>(MHz) | Conducted<br>Power<br>(dBm) | Conducted<br>Power<br>(Watts) |  |  |  |
|               | 512 (Low)  | 1850.2             | 28.10                       | 0.65                          |  |  |  |
| GSM1900 (GSM) | 661 (Mid)  | 1880.0             | 28.28                       | 0.67                          |  |  |  |
|               | 810 (High) | 1909.8             | 28.46                       | 0.70                          |  |  |  |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 10 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01

### 3.2 Effective Radiated Power and Effective Isotropic Radiated Power Measurement

### 3.2.1 Description of the ERP/EIRP Measurement

ERP/EIRP is measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The ERP of mobile transmitters must not exceed 7 Watts for 824 MHz ~ 849 MHz. The EIRP of mobile transmitters are limited to 2 Watts for 1850~1910 MHz.

### 3.2.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.2.3 Test Procedures

- 1. The EUT was placed on a turntable with 1.0 meter height in a fully anechoic chamber.
- 2. The EUT was set at 1.2 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest radiated power.
- 4. The height of the receiving antenna is adjusted to look for the maximum ERP/EIRP.
- Taking the record of maximum ERP/EIRP. 5.
- A dipole antenna was substituted in place of the EUT and was driven by a signal generator. 6.
- 7. The conducted power at the terminal of the dipole antenna is measured.
- 8. Repeat step 3 to step 5 to get the maximum ERP/EIRP of the substitution antenna.
- 9. ERP/EIRP = Ps + Et - Es + Gs = Ps + Rt - Rs + Gs

Ps (dBm): Input power to substitution antenna.

Gs (dBi or dBd): Substitution antenna Gain.

Et = Rt + AF

Es = Rs + AF

AF (dB/m): Receive antenna factor

Rt: The highest received signal in spectrum analyzer for EUT.

Rs: The highest received signal in spectrum analyzer for substitution antenna.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO

Page Number : 11 of 37 Report Issued Date: Jan. 16, 2012


Report No.: FG1D2103

Report Version : Rev. 01



Report No.: FG1D2103

## 3.2.4 Test Setup

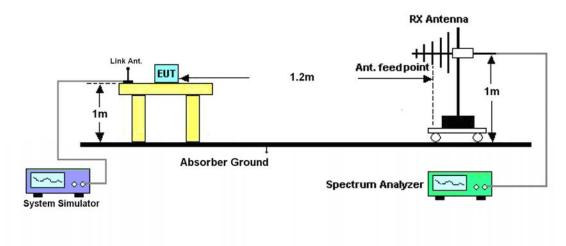

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 12 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



3.2.5 Test Result of ERP

| GSM850 (GSM) Radiated Power ERP |             |             |                    |             |              |            |
|---------------------------------|-------------|-------------|--------------------|-------------|--------------|------------|
|                                 |             | Hoi         | rizontal Polariza  | tion        |              |            |
| Frequency<br>(MHz)              | Rt<br>(dBm) | Rs<br>(dBm) | Ps<br>(dBm)        | Gs<br>(dBd) | ERP<br>(dBm) | ERP<br>(W) |
| 824.20                          | -20.02      | -48.12      | 0.00               | -1.08       | 27.02        | 0.50       |
| 836.40                          | -20.13      | -48.28      | 0.00               | -0.93       | 27.22        | 0.53       |
| 848.80                          | -19.94      | -48.35      | 0.00               | -0.76       | 27.65        | 0.58       |
|                                 |             | Ve          | ertical Polarizati | on          |              |            |
| Frequency<br>(MHz)              | Rt<br>(dBm) | Rs<br>(dBm) | Ps<br>(dBm)        | Gs<br>(dBd) | ERP<br>(dBm) | ERP<br>(W) |
| 824.20                          | -31.03      | -47.97      | 0.00               | -1.08       | 15.86        | 0.04       |
| 836.40                          | -30.87      | -48.01      | 0.00               | -0.93       | 16.21        | 0.04       |
| 848.80                          | -30.74      | -48.05      | 0.00               | -0.76       | 16.55        | 0.05       |

### 3.2.6 Test Result of EIRP

|                    | GSM1900 (GSM) Radiated Power EIRP |             |                    |             |               |             |  |  |
|--------------------|-----------------------------------|-------------|--------------------|-------------|---------------|-------------|--|--|
|                    |                                   | Hoi         | rizontal Polariza  | tion        |               |             |  |  |
| Frequency<br>(MHz) | Rt<br>(dBm)                       | Rs<br>(dBm) | Ps<br>(dBm)        | Gs<br>(dBi) | EIRP<br>(dBm) | EIRP<br>(W) |  |  |
| 1850.20            | -23.74                            | -51.88      | 0.00               | 1.96        | 30.10         | 1.02        |  |  |
| 1880.00            | -24.27                            | -52.99      | 0.00               | 2.00        | 30.72         | 1.18        |  |  |
| 1909.80            | -25.36                            | -54.28      | 0.00               | 1.98        | 30.90         | 1.23        |  |  |
|                    |                                   | Ve          | ertical Polarizati | on          |               |             |  |  |
| Frequency<br>(MHz) | Rt<br>(dBm)                       | Rs<br>(dBm) | Ps<br>(dBm)        | Gs<br>(dBi) | EIRP<br>(dBm) | EIRP<br>(W) |  |  |
| 1850.20            | -23.76                            | -52.13      | 0.00               | 1.96        | 30.33         | 1.08        |  |  |
| 1880.00            | -24.53                            | -53.17      | 0.00               | 2.00        | 30.64         | 1.16        |  |  |
| 1909.80            | -25.21                            | -54.13      | 0.00               | 1.98        | 30.90         | 1.23        |  |  |

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 13 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



3.3 Occupied Bandwidth Measurement

#### 3.3.1 Description of Occupied Bandwidth Measurement

The emission bandwidth is defined as the width of the signal between two points, located at the 2 sides of the carrier frequency, outside of which all emissions are attenuated at least 26 dB below the transmitter power.


### 3.3.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.3.3 Test Procedures

- 1. The EUT was connected to Spectrum Analyzer and Base Station via power divider.
- 2. The 99% and 26 dB occupied bandwidth (BW) of the middle channel for the highest RF powers were measured.

### 3.3.4 Test Setup

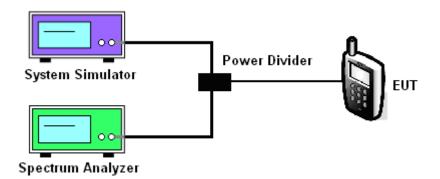

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 14 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




Report No.: FG1D2103

### 3.3.5 Test Result (Plots) of Occupied Bandwidth


| Band :      | GSM 850  | Power Stage : | High |
|-------------|----------|---------------|------|
| Test Mode : | GSM Link |               |      |

#### 99% Occupied Bandwidth Plot on Channel 189

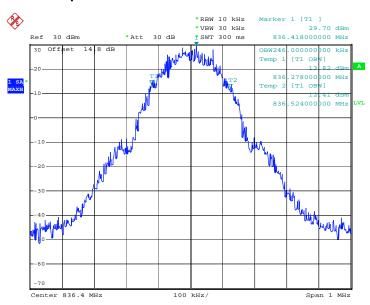

Date: 6.JAN.2012 23:18:29

#### 26dB Bandwidth Plot on Channel 189

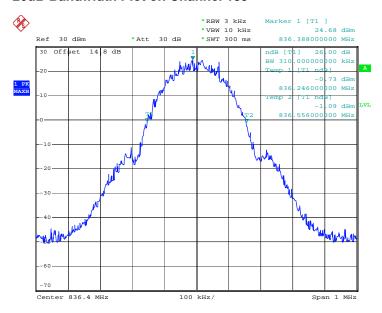


Date: 6.JAN.2012 23:17:12

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 15 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




| Band :      | GSM 1900 | Power Stage : | High |
|-------------|----------|---------------|------|
| Test Mode : | GSM Link |               |      |

#### 99% Occupied Bandwidth Plot on Channel 661

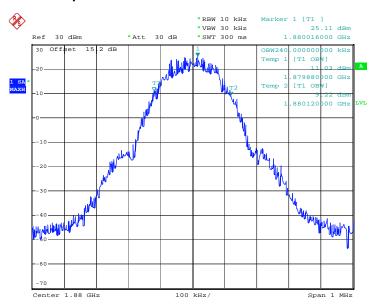

Date: 6.JAN.2012 23:48:23

#### 26dB Bandwidth Plot on Channel 661

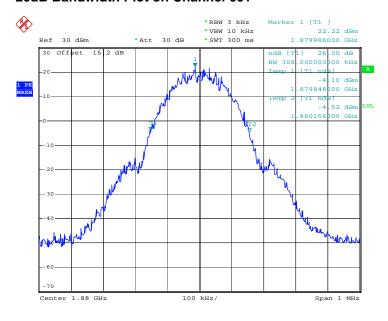

Date: 6.JAN.2012 23:47:05

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 16 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



## 3.4 Band Edge Measurement

#### 3.4.1 Description of Band Edge Measurement

The power of any emission outside of the authorized operating frequency ranges must be lower than the transmitter power (P) by a factor of at least 43 + 10 log (P) dB.


### 3.4.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.4.3 Test Procedures

- 1. The EUT was connected to Spectrum Analyzer and Base Station via power divider.
- 2. The band edges of low and high channels for the highest RF powers were measured. Setting RBW 3kHz for GSM / EDGE, Setting RBW 100kHz for WCDMA.

### 3.4.4 Test Setup

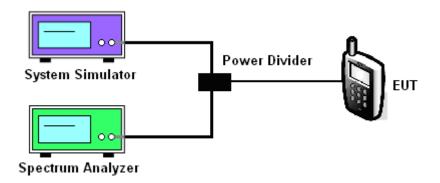

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 17 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




t Report No. : FG1D2103

### 3.4.5 Test Result (Plots) of Conducted Band Edge


| Band :      | GSM850   | Power Stage : | High |
|-------------|----------|---------------|------|
| Test Mode : | GSM Link |               |      |

#### **Lower Band Edge Plot on Channel 128**

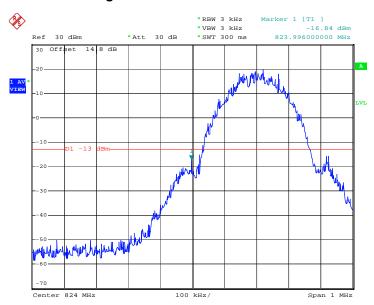

Date: 6.JAN.2012 23:20:20

#### **Higher Band Edge Plot on Channel 251**

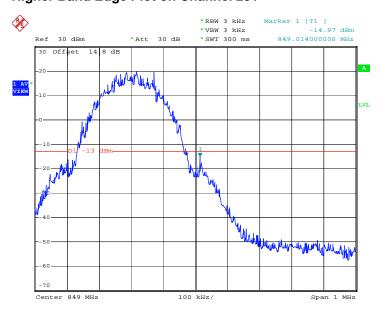


Date: 6.JAN.2012 23:20:47

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 18 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




| Band :      | GSM1900  | Power Stage : | High |
|-------------|----------|---------------|------|
| Test Mode : | GSM Link |               |      |

#### **Lower Band Edge Plot on Channel 512**

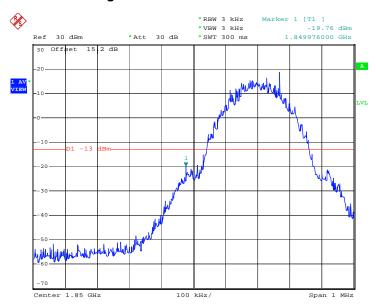

Date: 6.JAN.2012 23:50:13

#### **Higher Band Edge Plot on Channel 810**

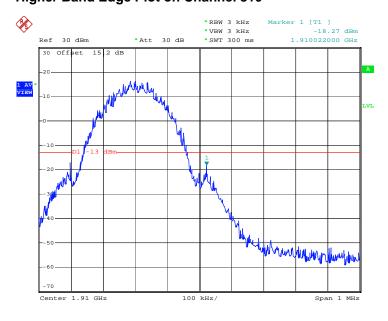

Date: 6.JAN.2012 23:50:39

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 19 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



3.5 Conducted Emission Measurement

#### 3.5.1 Description of Conducted Emission Measurement

The power of any emission outside of the authorized operating frequency ranges must be lower than the transmitter power (P) by a factor of at least 43 + 10 log (P) dB.

It is measured by means of a calibrated spectrum analyzer and scanned from 30 MHz up to a frequency including its 10<sup>th</sup> harmonic.

### 3.5.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.5.3 Test Procedures

- 3. The EUT was connected to spectrum analyzer and base station via power divider.
- 4. The middle channel for the highest RF power within the transmitting frequency was measured.
- 5. The conducted spurious emission for the whole frequency range was taken.

#### 3.5.4 Test Setup




TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 20 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



## 3.5.5 Test Result (Plots) of Conducted Emission


| Band :      | GSM850   | Channel: | CH189 |
|-------------|----------|----------|-------|
| Test Mode : | GSM Link |          |       |

#### Conducted Emission Plot between 30MHz ~ 1GHz

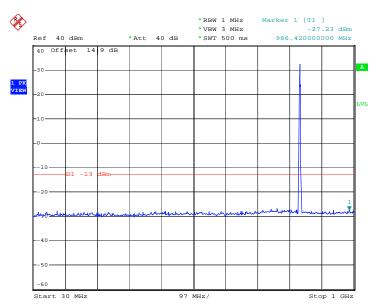

Date: 7.JAN.2012 00:38:41

#### Conducted Emission Plot between 1GHz ~ 3GHz

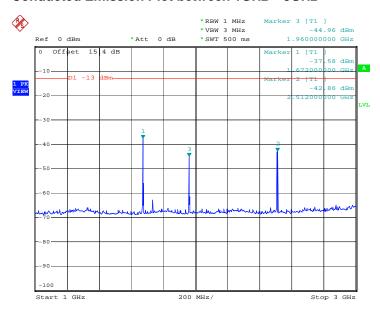


Date: 7.JAN.2012 00:39:56

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 21 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




Report No.: FG1D2103

#### Conducted Emission Plot between 3GHz ~ 7GHz

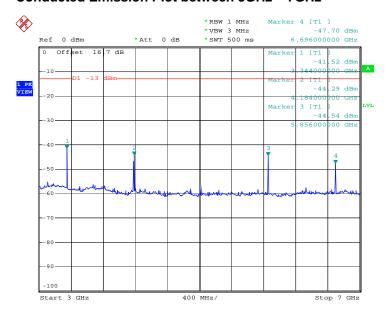

Date: 7.JAN.2012 00:40:46

#### Conducted Emission Plot between 7GHz ~ 9GHz

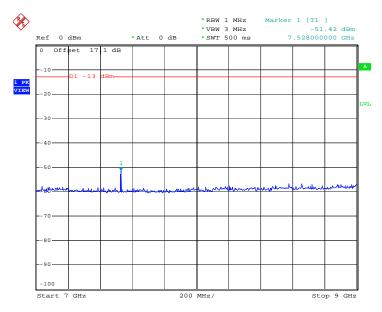

Date: 7.JAN.2012 00:41:32


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 22 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



 Band :
 GSM1900
 Channel :
 CH661


 Test Mode :
 GSM Link

#### Conducted Emission Plot between 30MHz ~ 1GHz

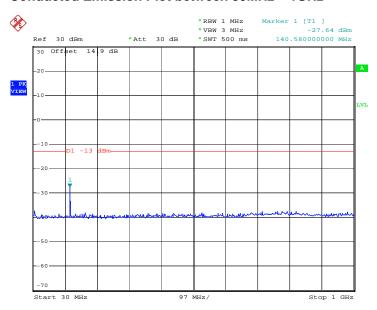

Date: 7.JAN.2012 00:30:49

#### Conducted Emission Plot between 1GHz ~ 3GHz

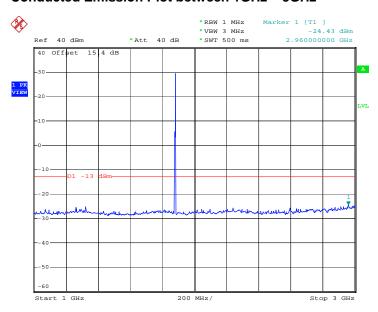


Date: 7.JAN.2012 00:22:48

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 23 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




### Report No. : FG1D2103

#### Conducted Emission Plot between 3GHz ~ 7GHz

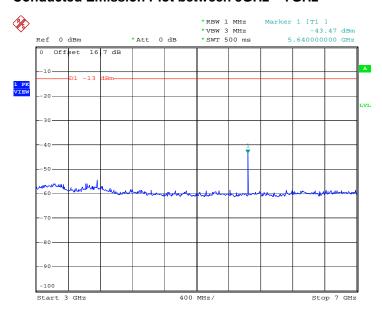

Date: 7.JAN.2012 00:32:44

#### Conducted Emission Plot between 7GHz ~ 13.6G

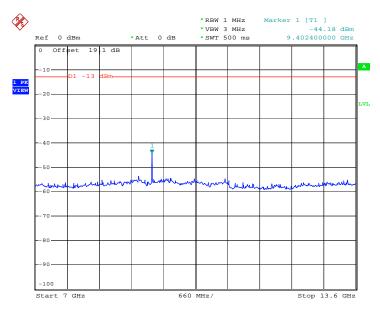


Date: 7.JAN.2012 00:34:07

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 24 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



Report No.: FG1D2103

#### Conducted Emission Plot between 13.6GHz ~ 19.1GHz

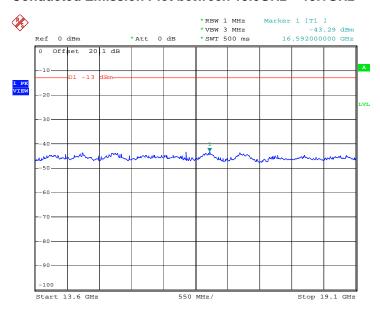

Date: 7.JAN.2012 00:35:33

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 25 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01

## 3.6 Field Strength of Spurious Radiation Measurement

#### 3.6.1 Description of Field Strength of Spurious Radiated Measurement

The radiated spurious emission was measured by substitution method according to ANSI / TIA / EIA-603-C-2004. The power of any emission outside of the authorized operating frequency ranges must be attenuated below the transmitter power (P) by a factor of at least 43 + 10 log (P) dB. The spectrum is scanned from 30 MHz up to a frequency including its 10th harmonic.

### 3.6.2 Measuring Instruments

See list of measuring instruments of this test report.

#### 3.6.3 Test Procedures

- 1. The EUT was placed on a rotatable wooden table with 0.8 meter about ground.
- 2. The EUT was set 3 meters from the receiving antenna, which was mounted on the antenna tower.
- 3. The table was rotated 360 degrees to determine the position of the highest spurious emission.
- 4. The height of the receiving antenna is varied between one meter and four meters to search the maximum spurious emission for both horizontal and vertical polarizations.
- 5. Taking the record of maximum spurious emission.
- 6. A horn antenna was substituted in place of the EUT and was driven by a signal generator.
- 7. Tune the output power of signal generator to the same emission level with EUT maximum spurious emission.
- 8. Taking the record of output power at antenna port.
- Repeat step 7 to step 8 for another polarization.
- 10. EIRP (dBm) = S.G. Power Tx Cable Loss + Tx Antenna Gain
- 11. ERP (dBm) = EIRP 2.15

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO

Page Number : 26 of 37 Report Issued Date: Jan. 16, 2012


Report No.: FG1D2103

Report Version : Rev. 01



Report No.: FG1D2103

## 3.6.4 Test Setup

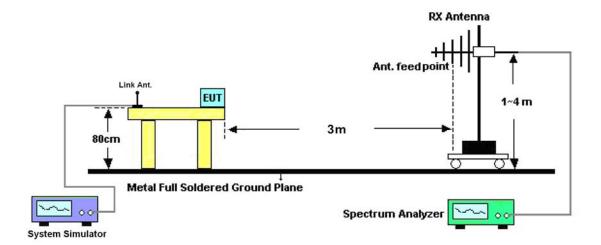


TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 27 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



3.6.5 Test Result of Field Strength of Spurious Radiated

| Band :          | GSM850   | Temperature :       | 20~21°C    |  |  |  |  |
|-----------------|--|---------------------|------------|--|--|--|--|
| Test Mode :     | GSM Link   | Relative Humidity : | 42~43%     |  |  |  |  |
| Test Engineer : | Jack Li  | Polarization :      | Horizontal |  |  |  |  |
| Damanla         | Description and a second secon |                     |            |  |  |  |  |

**Remark:** Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

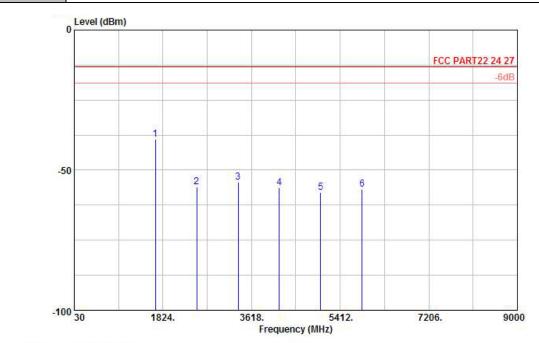

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 HORIZONTAL

Project : (FG) 1D2103

| Frequency | ERP    | Limit | Over   | SPA     | S.G.   | TX Cable | TX Antenna | Polarization | Result |
|-----------|--------|-------|--------|---------|--------|----------|------------|--------------|--------|
|           |        |       | Limit  | Reading | Power  | loss     | Gain       |              |        |
| (MHz)     | (dBm)  | (dBm) | ( dB ) | (dBm)   | (dBm)  | ( dB )   | (dBi)      | (H/V)        |        |
| 1672      | -38.95 | -13   | -25.95 | -39.24  | -39.60 | 0.57     | 3.37       | Н            | Pass   |
| 2510      | -56.09 | -13   | -43.09 | -58.34  | -58.32 | 0.78     | 5.16       | Н            | Pass   |
| 3346      | -54.35 | -13   | -41.35 | -56.29  | -57.99 | 0.87     | 6.66       | Н            | Pass   |
| 4182      | -56.28 | -13   | -43.28 | -59.02  | -60.87 | 0.97     | 7.71       | Н            | Pass   |
| 5018      | -57.84 | -13   | -44.84 | -64.04  | -63.51 | 1.09     | 8.91       | Н            | Pass   |
| 5854      | -56.77 | -13   | -43.77 | -65.48  | -63.21 | 1.22     | 9.81       | Н            | Pass   |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 28 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




Band: GSM850 Temperature: 20~21°C

Test Mode: GSM Link Relative Humidity: 42~43%

Test Engineer: Jack Li Polarization: Vertical

Remark: Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

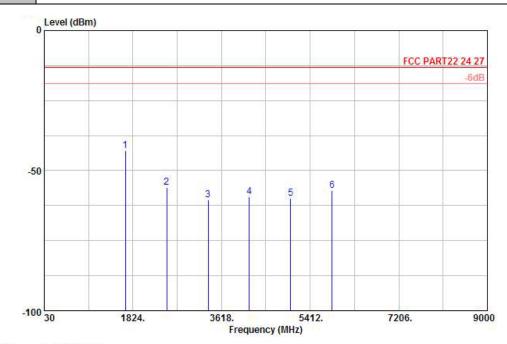

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 VERTICAL

Project : (FG) 1D2103

| Frequency | ERP    | Limit | Over<br>Limit | SPA<br>Reading | S.G.<br>Power | TX Cable loss | TX Antenna<br>Gain | Polarization | Result |
|-----------|--------|-------|---------------|----------------|---------------|---------------|--------------------|--------------|--------|
| (MHz)     | (dBm)  | (dBm) | ( dB )        | (dBm)          | (dBm)         | ( dB )        | (dBi)              | (H/V)        |        |
| 1672      | -42.89 | -13   | -29.89        | -46.77         | -43.54        | 0.57          | 3.37               | V            | Pass   |
| 2510      | -55.88 | -13   | -42.88        | -58.99         | -58.11        | 0.78          | 5.16               | V            | Pass   |
| 3346      | -60.56 | -13   | -47.56        | -62.54         | -64.20        | 0.87          | 6.66               | V            | Pass   |
| 4182      | -59.38 | -13   | -46.38        | -63.22         | -63.97        | 0.97          | 7.71               | V            | Pass   |
| 5018      | -59.77 | -13   | -46.77        | -64.71         | -65.44        | 1.09          | 8.91               | V            | Pass   |
| 5854      | -57.19 | -13   | -44.19        | -65.18         | -63.63        | 1.22          | 9.81               | V            | Pass   |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 29 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01




Band: GSM1900 Temperature: 20~21°C

Test Mode: GSM Link Relative Humidity: 42~43%

Test Engineer: Jack Li Polarization: Horizontal

**Remark:** Spurious emissions within 30-1000MHz were found more than 20dB below limit line.

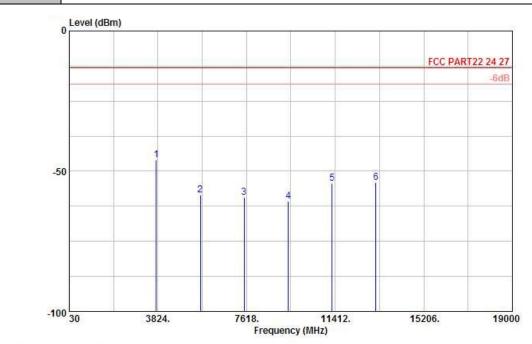

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 HORIZONTAL

Project : (FG) 1D2103


| Frequency | EIRP   | Limit | Over   | SPA     | S.G.   | TX Cable | TX Antenna | Polarization | Result |
|-----------|--------|-------|--------|---------|--------|----------|------------|--------------|--------|
|           |        |       | Limit  | Reading | Power  | loss     | Gain       |              |        |
| (MHz)     | (dBm)  | (dBm) | ( dB ) | (dBm)   | (dBm)  | ( dB )   | (dBi)      | (H/V)        |        |
| 3760      | -45.84 | -13   | -32.84 | -50.34  | -52.22 | 0.78     | 7.16       | Н            | Pass   |
| 5640      | -58.50 | -13   | -45.50 | -62.68  | -67.04 | 1.04     | 9.58       | Н            | Pass   |
| 7520      | -59.28 | -13   | -46.28 | -64.41  | -69.39 | 1.35     | 11.46      | Н            | Pass   |
| 9400      | -60.59 | -13   | -47.59 | -63.85  | -71.65 | 1.75     | 12.81      | Н            | Pass   |
| 11280     | -53.31 | -13   | -40.31 | -64.80  | -64.40 | 2        | 13.09      | Н            | Pass   |
| 13160     | -54.04 | -13   | -41.04 | -65.34  | -65.75 | 2.04     | 13.75      | Н            | Pass   |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 30 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



| Band :          | GSM1900   | Temperature :       | 20~21°C  |  |  |  |  |
|-----------------|---|---------------------|----------|--|--|--|--|
| Test Mode :     | GSM Link  | Relative Humidity : | 42~43%   |  |  |  |  |
| Test Engineer : | Jack Li   | Polarization :      | Vertical |  |  |  |  |
| Pomark :        | Spurious emissions within 30-1000MHz were found more than 20dB below limit line |                     |          |  |  |  |  |



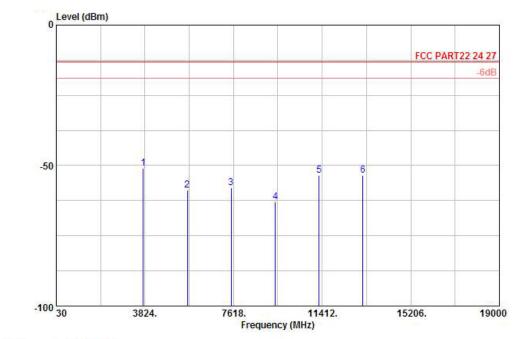

Site : 03CH01-KS

Condition: FCC PART22 24 27 HF EIRP FACTOR-09020 VERTICAL Project : (FG) 1D2103

| Frequency | EIRP   | Limit | Over   | SPA     | S.G.   | TX Cable | TX Antenna | Polarization | Result |
|-----------|--------|-------|--------|---------|--------|----------|------------|--------------|--------|
|           |        |       | Limit  | Reading | Power  | loss     | Gain       | 4.50         |        |
| (MHz)     | (dBm)  | (dBm) | ( dB ) | (dBm)   | (dBm)  | ( dB )   | (dBi)      | (H/V)        |        |
| 3760      | -51.06 | -13   | -38.06 | -54.57  | -57.44 | 0.78     | 7.16       | V            | Pass   |
| 5640      | -58.74 | -13   | -45.74 | -61.96  | -67.28 | 1.04     | 9.58       | V            | Pass   |
| 7520      | -57.93 | -13   | -44.93 | -62.42  | -68.04 | 1.35     | 11.46      | V            | Pass   |
| 9400      | -62.92 | -13   | -49.92 | -64.14  | -73.98 | 1.75     | 12.81      | V            | Pass   |
| 11280     | -53.61 | -13   | -40.61 | -64.85  | -64.70 | 2        | 13.09      | V            | Pass   |
| 13160     | -53.50 | -13   | -40.50 | -64.69  | -65.21 | 2.04     | 13.75      | V            | Pass   |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO

Page Number : 31 of 37 Report Issued Date: Jan. 16, 2012 : Rev. 01 Report Version



3.7 Frequency Stability Measurement

3.7.1 Description of Frequency Stability Measurement

The frequency stability shall be measured by variation of ambient temperature and variation of primary supply voltage to ensure that the fundamental emission stays within the authorized frequency block. The frequency stability of the transmitter shall be maintained within ±0.00025% (±2.5ppm) of

the center frequency.

3.7.2 Measuring Instruments

See list of measuring instruments of this test report.

3.7.3 Test Procedures for Temperature Variation

1. The EUT was set up in the thermal chamber and connected with the base station.

2. With power OFF, the temperature was decreased to -30°C and the EUT was stabilized for three hours. Power was applied and the maximum change in frequency was recorded within one

minute.

3. With power OFF, the temperature was raised in 10°C step up to 50°C. The EUT was stabilized at each step for at least half an hour. Power was applied and the maximum frequency change

was recorded within one minute.

4. If the EUT cannot be turned on at -30°C, the testing lowest temperature will be raised in 10°C

step until the EUT can be turned on.

3.7.4 Test Procedures for Voltage Variation

1. The EUT was placed in a temperature chamber at 25±5° C and connected with the base

station.

2. The power supply voltage to the EUT was varied from BEP to 115% of the nominal value

measured at the input to the EUT.

3. The variation in frequency was measured for the worst case.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 32 of 37
Report Issued Date : Jan. 16, 2012

Report No.: FG1D2103

Report Version : Rev. 01



Report No.: FG1D2103

## 3.7.5 Test Setup



TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 33 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01

### 3.7.6 Test Result of Temperature Variation

| Band :       | GSM 850 | Channel: | 189 |
|--------------|---------|----------|-----|
| Limit (ppm): | 2.5     |          |     |

|                  | GSM                |                    |        |  |
|------------------|--------------------|--------------------|--------|--|
| Temperature (°C) | Freq. Dev.<br>(Hz) | Deviation<br>(ppm) | Result |  |
| -30              | NA                 | NA                 |        |  |
| -20              | NA                 | NA                 |        |  |
| -10              | -16                | -0.02              |        |  |
| 0                | 18                 | 0.02               |        |  |
| 10               | 12                 | 0.01               | PASS   |  |
| 20               | 23                 | 0.03               |        |  |
| 30               | 20                 | 0.02               |        |  |
| 40               | 17                 | 0.02               |        |  |
| 50               | NA                 | NA                 |        |  |

**Note:** The manufacturer declared that the EUT could work properly between temperatures -10°C~40°C.

| Band :        | GSM 1900 | Channel: | 661 |
|---------------|----------|----------|-----|
| Limit (ppm) : | 2.5      |          |     |

|                  | GSM                |                    |        |  |
|------------------|--------------------|--------------------|--------|--|
| Temperature (°C) | Freq. Dev.<br>(Hz) | Deviation<br>(ppm) | Result |  |
| -30              | NA                 | NA                 |        |  |
| -20              | NA                 | NA                 |        |  |
| -10              | 46                 | 0.02               |        |  |
| 0                | 26                 | 0.01               |        |  |
| 10               | 54                 | 0.03               | PASS   |  |
| 20               | 28                 | 0.01               |        |  |
| 30               | 36                 | 0.02               |        |  |
| 40               | 29                 | 0.02               |        |  |
| 50               | NA                 | NA                 |        |  |

**Note:** The manufacturer declared that the EUT could work properly between temperatures  $-10^{\circ}\text{C}\sim40^{\circ}\text{C}$ .

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 34 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



## 3.7.7 Test Result of Voltage Variation

| Band & Channel    | Mode | Voltage<br>(Volt) | Freq. Dev.<br>(Hz) | Deviation (ppm) | Limit<br>(ppm) | Result |
|-------------------|------|-------------------|--------------------|-----------------|----------------|--------|
| GSM 850<br>CH189  | GSM  | 3.7               | 9                  | 0.01            |                | D4.00  |
|                   |      | BEP               | 21                 | 0.02            | 0.5            |        |
|                   |      | 4.2               | 11                 | 0.01            |                |        |
| GSM 1900<br>CH661 | GSM  | 3.7               | 22                 | 0.01            | 2.5            | PASS   |
|                   |      | BEP               | 51                 | 0.03            | ]              |        |
|                   |      | 4.2               | -30                | -0.02           |                |        |

#### Note:

- 1. Normal Voltage = 3.7V.
- 2. Battery End Point (BEP) = 3.5 V.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 35 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



4 List of Measuring Equipments

| Instrument                   | Manufacturer | Model No. | Serial No.     | Characteristics | Calibration<br>Date | Test Date                       | Due Date      | Remark                   |
|------------------------------|--------------|-----------|----------------|-----------------|---------------------|---------------------------------|---------------|--------------------------|
| Spectrum<br>Analyzer         | R&S          | FSP40     | 100319         | 9kHz~40GHz      | Dec. 30, 2011       | Jan. 06, 2012~<br>Jan. 07, 2012 | Dec. 29, 2012 | Conducted<br>(TH01-KS)   |
| System<br>Simulator          | R&S          | CMU200    | 837587/066     | 2G Full-Band    | Dec. 30, 2011       | Jan. 06, 2012~<br>Jan. 07, 2012 | Dec. 29, 2012 | Conducted<br>(TH01-KS)   |
| DC Power<br>Supply           | TOPWARD      | GPS-3030D | E1884515       | N/A             | Aug. 23, 2011       | Jan. 06, 2012~<br>Jan. 07, 2012 | Aug. 22, 2012 | Conducted<br>(TH01-KS)   |
| Thermal<br>Chamber           | Ten Billion  | TTC-B3S   | TBN-96050      | N/A             | Dec. 30, 2011       | Jan. 06, 2012~<br>Jan. 07, 2012 | Dec. 29, 2012 | Conducted<br>(TH01-KS)   |
| EMI Test<br>Receiver         | R&S          | ESCI      | 100534         | 9kHz~3GHz       | Nov. 09, 2011       | Jan. 04, 2012                   | Nov. 08, 2012 | Radiation (03CH01-KS)    |
| Spectrum<br>Analyzer         | R&S          | FSP40     | 100319         | 9kHz~40GHz      | Dec. 30, 2011       | Jan. 04, 2012                   | Dec. 29, 2012 | Radiation<br>(03CH01-KS) |
| Bilog Antenna                | SCHAFFNER    | CBL6112D  | 23182          | 25MHz~2GHz      | Dec. 08, 2011       | Jan. 04, 2012                   | Dec. 07, 2012 | Radiation<br>(03CH01-KS) |
| Loop Antenna                 | R&S          | HFH2-Z2   | 860004/00      | 9 kHz~30 MHz    | Jul. 28, 2011       | Jan. 04, 2012                   | Jul. 27, 2012 | Radiation (03CH01-KS)    |
| Double Ridge<br>Horn Antenna | EMCO         | 3117      | 00075959       | 1GHz~18GHz      | Jan. 07, 2011       | Jan. 04, 2012                   | Jan. 06, 2012 | Radiation<br>(03CH01-KS) |
| Amplifier                    | Wireless     | FPA-6592G | 060007         | 30MHz~2GHz      | Dec. 30, 2011       | Jan. 04, 2012                   | Dec. 29, 2012 | Radiation<br>(03CH01-KS) |
| Active Horn<br>Antenna       | com-power    | AHA-118   | 701023         | 1GHz~18GHz      | Nov. 07, 2011       | Jan. 04, 2012                   | Nov. 06, 2012 | Radiation (03CH01-KS)    |
| SHE-EHF<br>Horn              | Schwarzbeck  | BBHA9170  | BBHA1702<br>49 | 15GHz~40GHz     | Oct. 11, 2011       | Jan. 04, 2012                   | Oct. 10, 2012 | Radiation<br>(03CH01-KS) |
| System<br>Simulator          | R&S          | CMU200    | 837587/066     | 2G Full-Band    | Jan. 07, 2011       | Jan. 04, 2012                   | Jan. 06, 2012 | -                        |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 36 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01



# 5 Uncertainty of Evaluation

#### Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

|   | Uncerta       |                             |                    |
|---|---------------|-----------------------------|--------------------|
| Contribution  | dB            | Probability<br>Distribution | u(X <sub>i</sub> ) |
| Receiver Reading  | 0.41          | Normal (k=2)                | 0.21               |
| Antenna Factor Calibration  | 0.83          | Normal (k=2)                | 0.42               |
| Cable Loss Calibration  | 0.25          | Normal (k=2)                | 0.13               |
| Pre-Amplifier Gain Calibration                                      | 0.27          | Normal (k=2)                | 0.14               |
| RCV/SPA Specification   | 2.50          | Rectangular                 | 0.72               |
| Antenna Factor Interpolation for Frequency                          | 1.00          | Rectangular                 | 0.29               |
| Site Imperfection   | 1.43          | Rectangular                 | 0.83               |
| Mismatch  | +0.39 / -0.41 | U-Shape                     | 0.28               |
| Combined Standard Uncertainty Uc(y)                                 | 1.27          |                             |                    |
| Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y)) |               | 2.54                        |                    |

### **Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)**

|  | Uncertainty of X <sub>i</sub> |                          |                    |                |                                     |
|--|-------------------------------|--------------------------|--------------------|----------------|-------------------------------------|
| Contribution   | dB                            | Probability Distribution | u(X <sub>i</sub> ) | C <sub>i</sub> | C <sub>i</sub> * u(X <sub>i</sub> ) |
| Receiver Reading   | ±0.10                         | Normal (k=2)             | 0.10               | 1              | 0.10                                |
| Antenna Factor Calibration   | ±1.70                         | Normal (k=2)             | 0.85               | 1              | 0.85                                |
| Cable Loss Calibration   | ±0.50                         | Normal (k=2)             | 0.25               | 1              | 0.25                                |
| Receiver Correction  | ±2.00                         | Rectangular              | 1.15               | 1              | 1.15                                |
| Antenna Factor Directional   | ±1.50                         | Rectangular              | 0.87               | 1              | 0.87                                |
| Site Imperfection  | ±2.80                         | Triangular               | 1.14               | 1              | 1.14                                |
| Mismatch Receiver VSWR $\Gamma$ 1 = 0.197 Antenna VSWR $\Gamma$ 2 = 0.194 Uncertainty = 20Log(1- $\Gamma$ 1* $\Gamma$ 2) | +0.34 / -0.35                 | U-Shape                  | 0.244              | 1              | 0.244                               |
| Combined Standard Uncertainty Uc(y)  | 2.36                          |                          |                    |                |                                     |
| Measuring Uncertainty for a<br>Level of Confidence of 95%<br>(U = 2Uc(y))  | 4.72                          |                          |                    |                |                                     |

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : 37 of 37
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01

# Appendix A. Photographs of EUT

Please refer to Sporton report number EP1D2103 as below.

SPORTON INTERNATIONAL (KUNSHAN) INC.

TEL: 86-0512-5790-0158 FAX: 86-0512-5790-0958 FCC ID: YHLBLUHERO Page Number : A1 of A1
Report Issued Date : Jan. 16, 2012
Report Version : Rev. 01