



1.Emission Bandwidth Measurement


11A	5180				Verdict
	0.00	Ant1	27.760		PASS
11A	5200	Ant1	25.320		PASS
11A	5240	Ant1	24.480		PASS
11A	5260	Ant1	24.280		PASS
11A	5280	Ant1	21.880		PASS
11A	5320	Ant1	22.200		PASS
11A	5500	Ant1	26.560		PASS
11A	5580	Ant1	23.840		PASS
11A	5700	Ant1	20.720		PASS
11A	5720	Ant1	23.200		PASS
11A	5745	Ant1	15.360	0.5	PASS
11A	5785	Ant1	16.000	0.5	PASS
11A	5825	Ant1	15.680	0.5	PASS
11N20	5180	Ant1	28.120		PASS
11N20	5200	Ant1	26.640		PASS
11N20	5240	Ant1	27.120		PASS
11N20	5260	Ant1	22.600		PASS
11N20	5280	Ant1	23.120		PASS
11N20	5320	Ant1	21.560		PASS
11N20	5500	Ant1	28.880		PASS
11N20	5580	Ant1	24.960		PASS
11N20	5700	Ant1	23.920		PASS
11N20	5720	Ant1	21.960		PASS
11N20	5745	Ant1	15.920	0.5	PASS
11N20	5785	Ant1	16.160	0.5	PASS
11N20	5825	Ant1	15.200	0.5	PASS
11N40	5190	Ant1	62.160		PASS
11N40	5230	Ant1	58.880		PASS
11N40	5270	Ant1	55.200		PASS
11N40	5310	Ant1	47.200		PASS
11N40	5510	Ant1	60.480		PASS
11N40	5550	Ant1	58.880		PASS
11N40	5670	Ant1	48.800		PASS
11N40	5755	Ant1	35.280	0.5	PASS
11N40	5795	Ant1	35.520	0.5	PASS

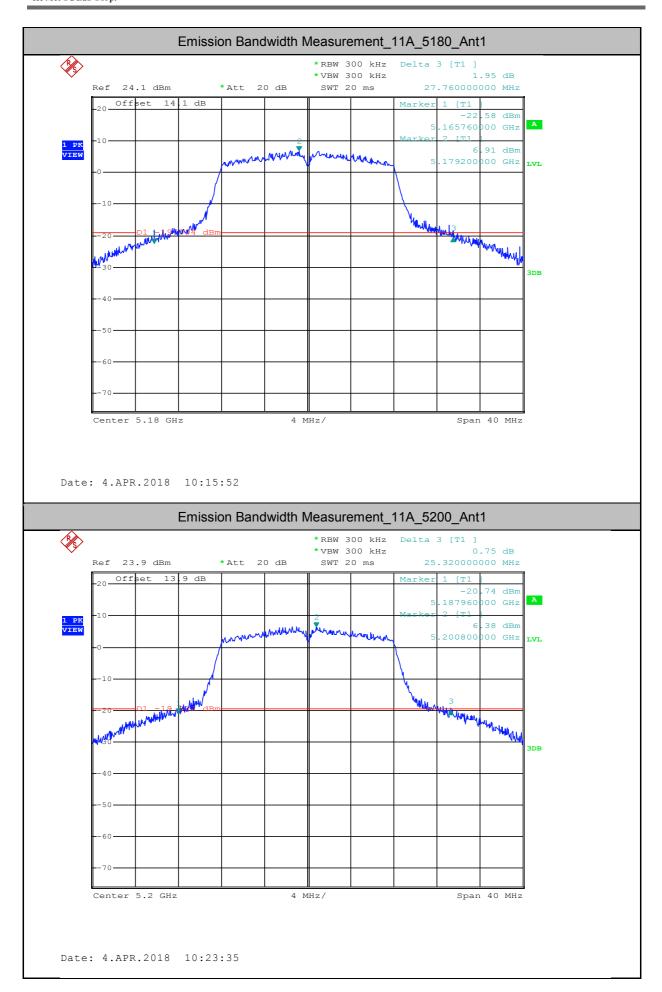


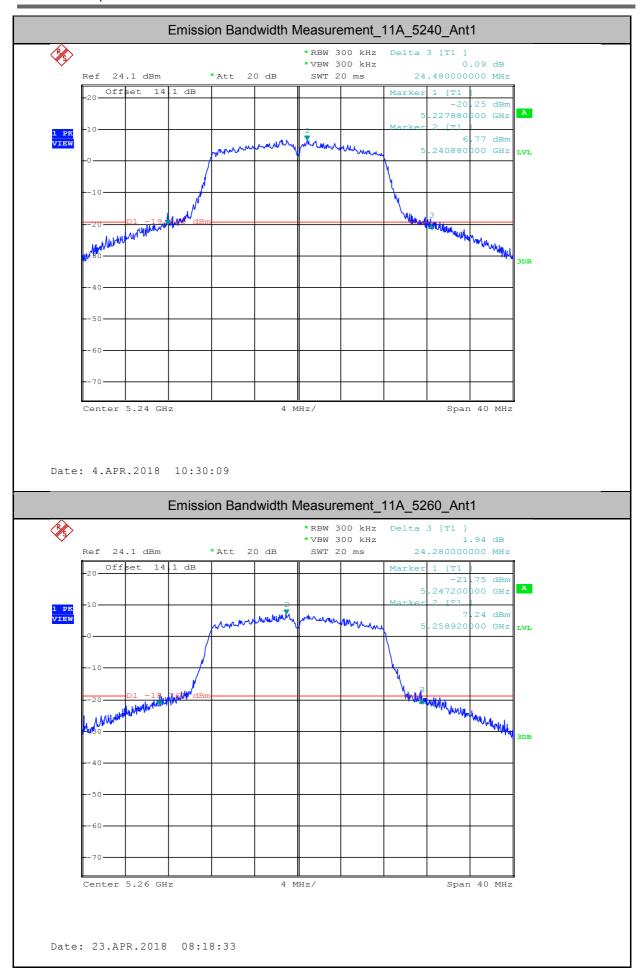


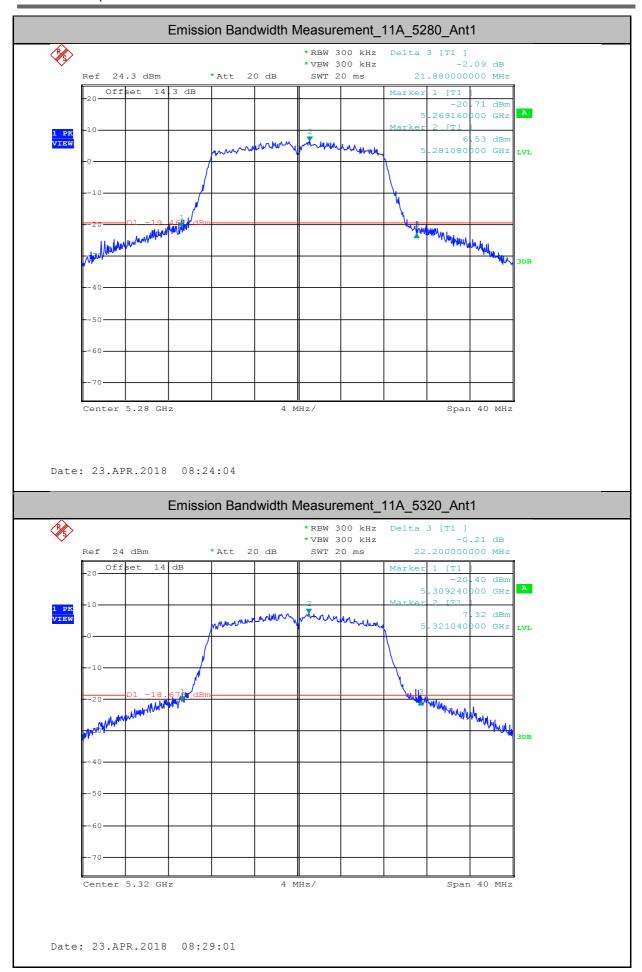


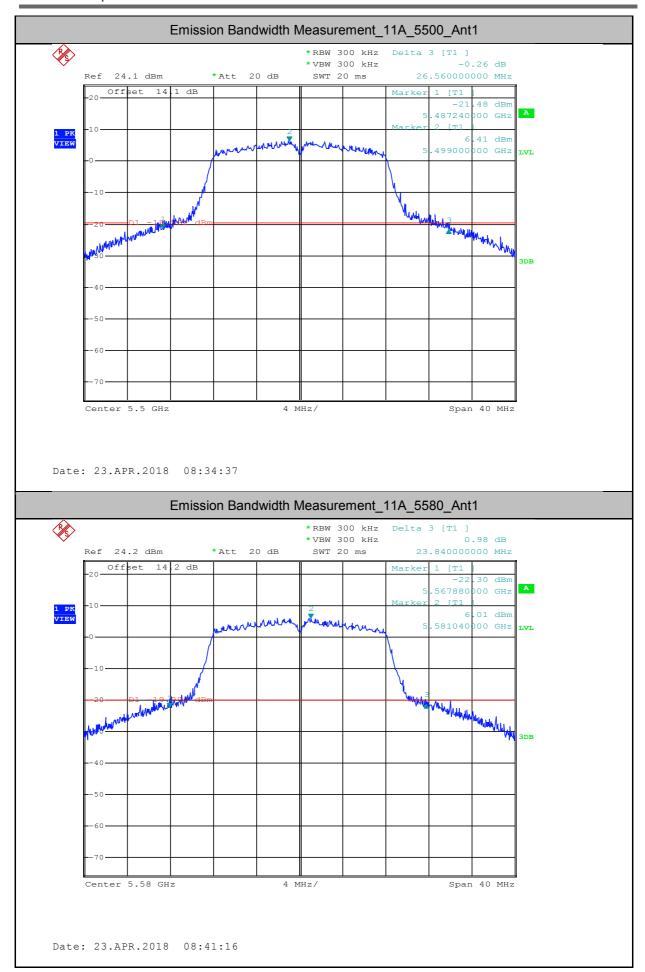


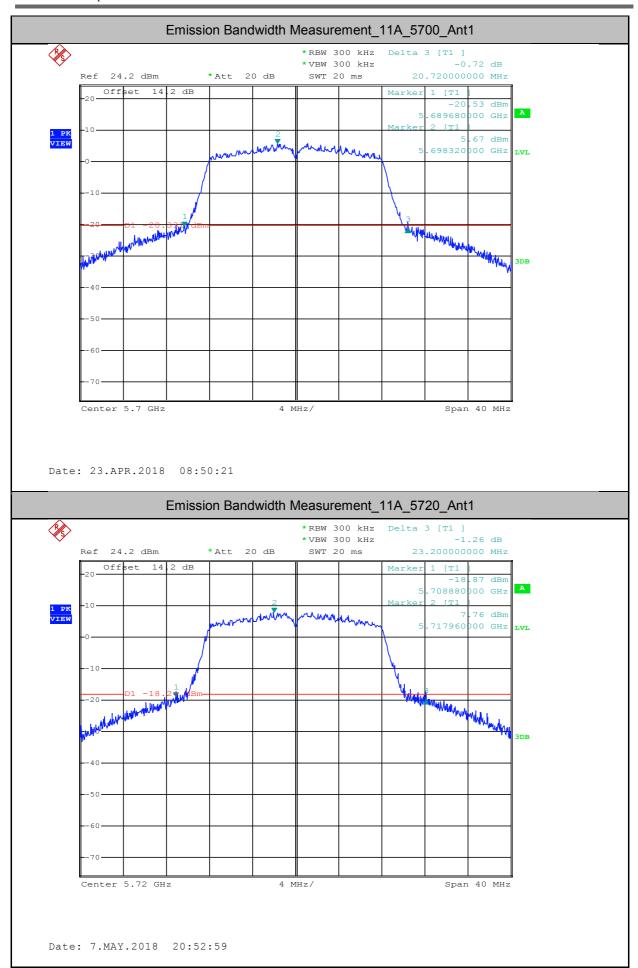


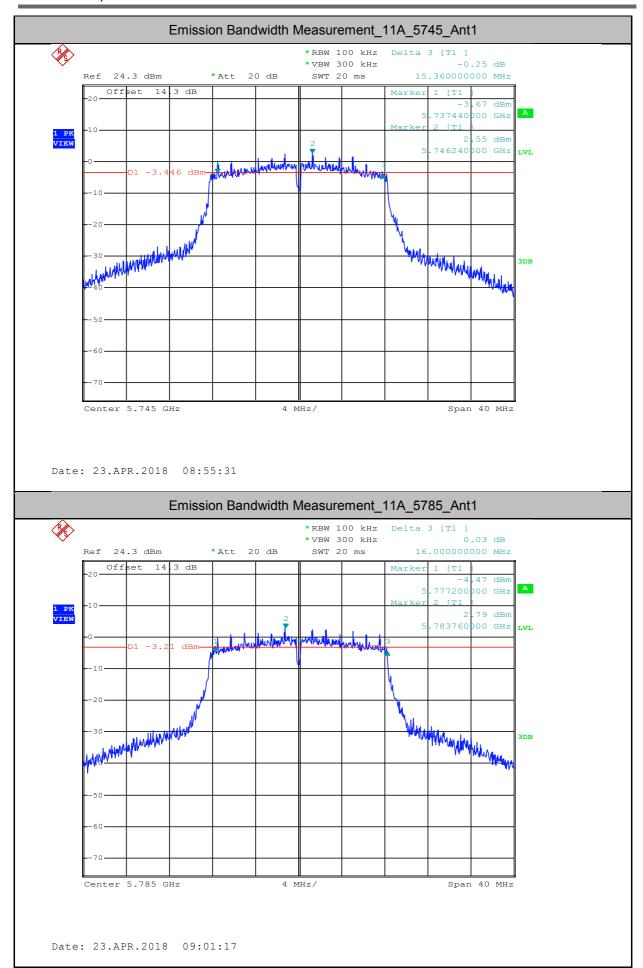


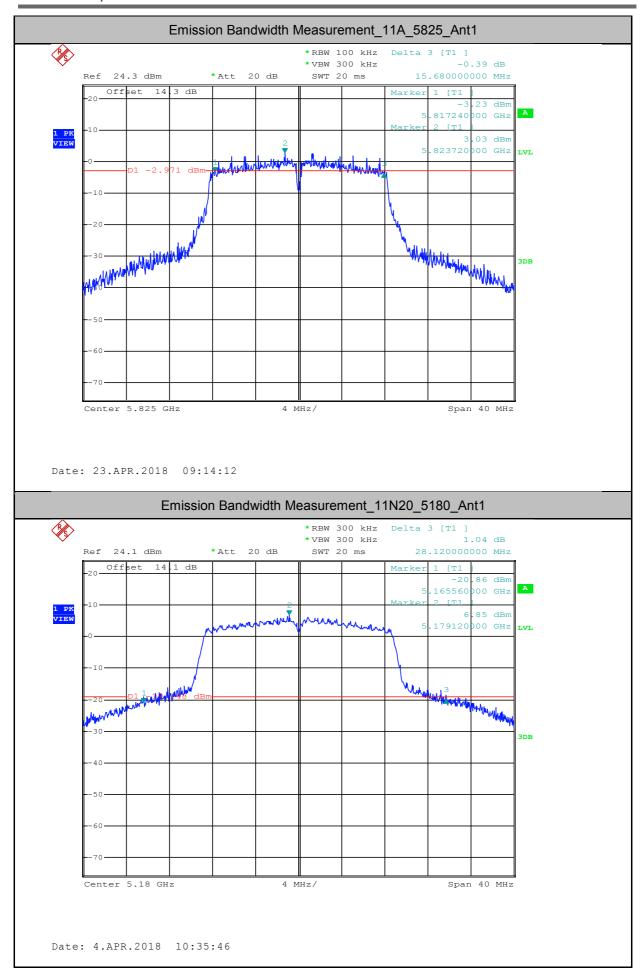


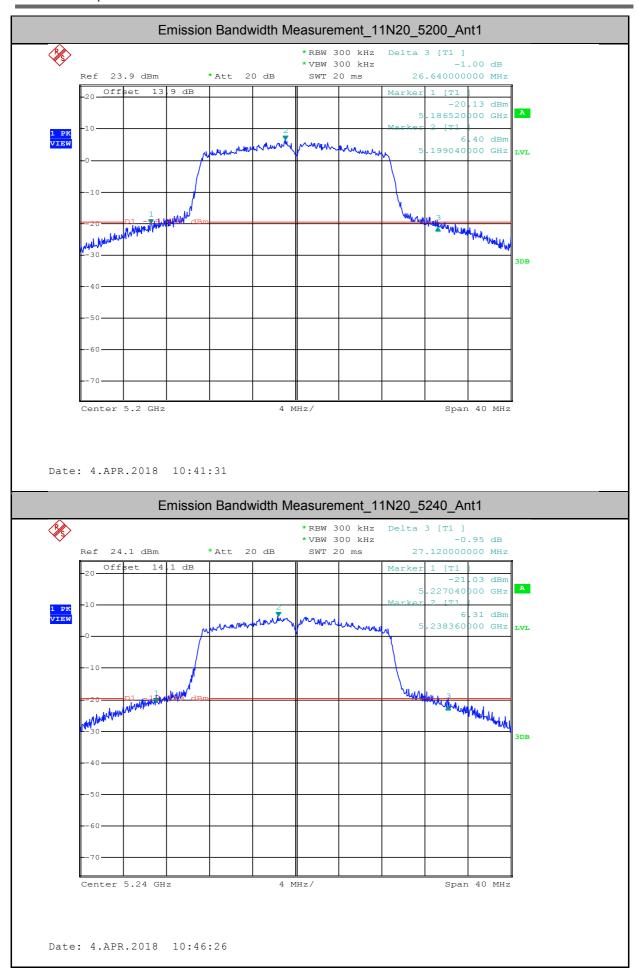


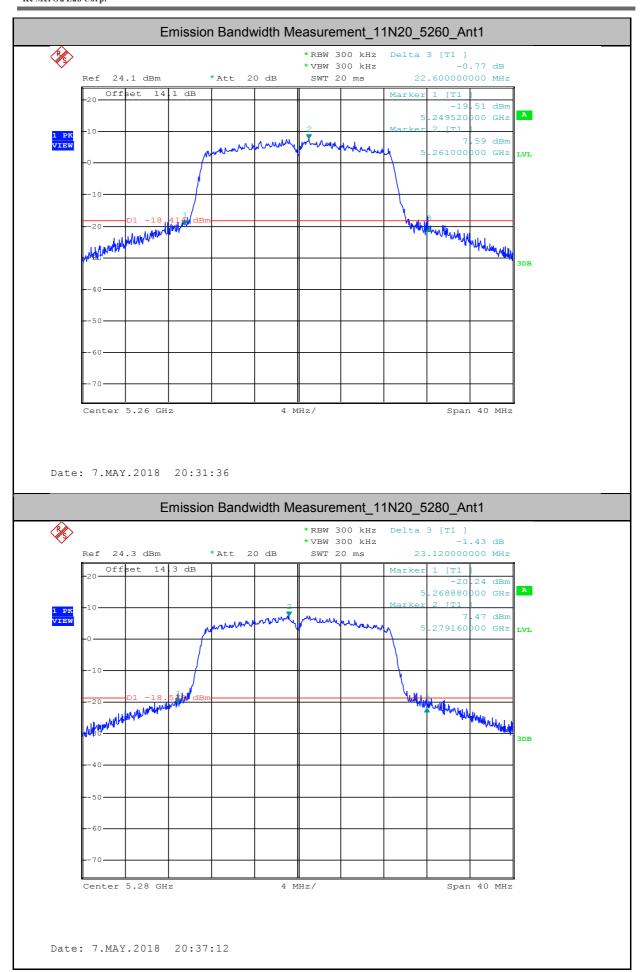


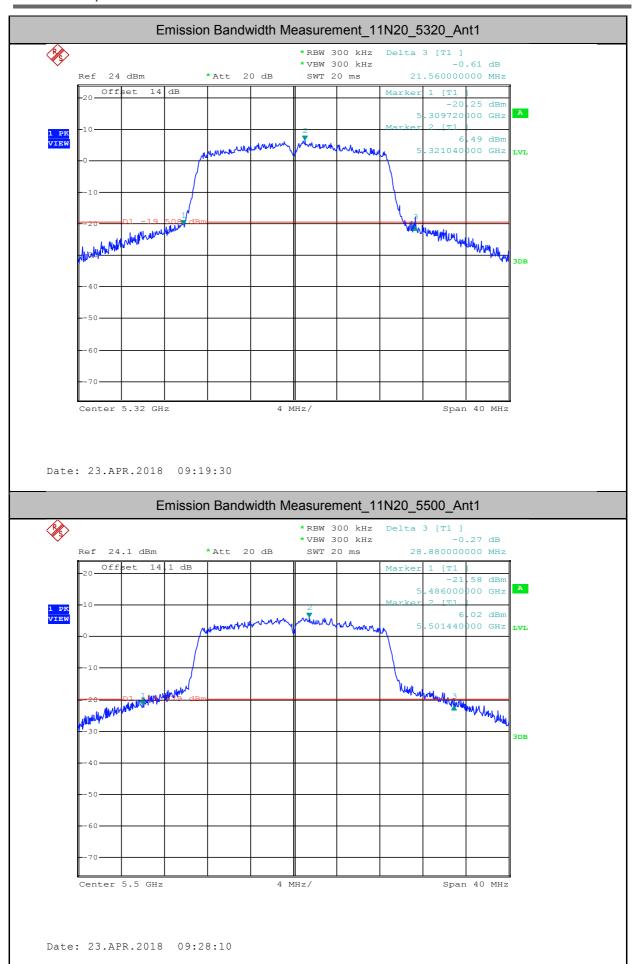


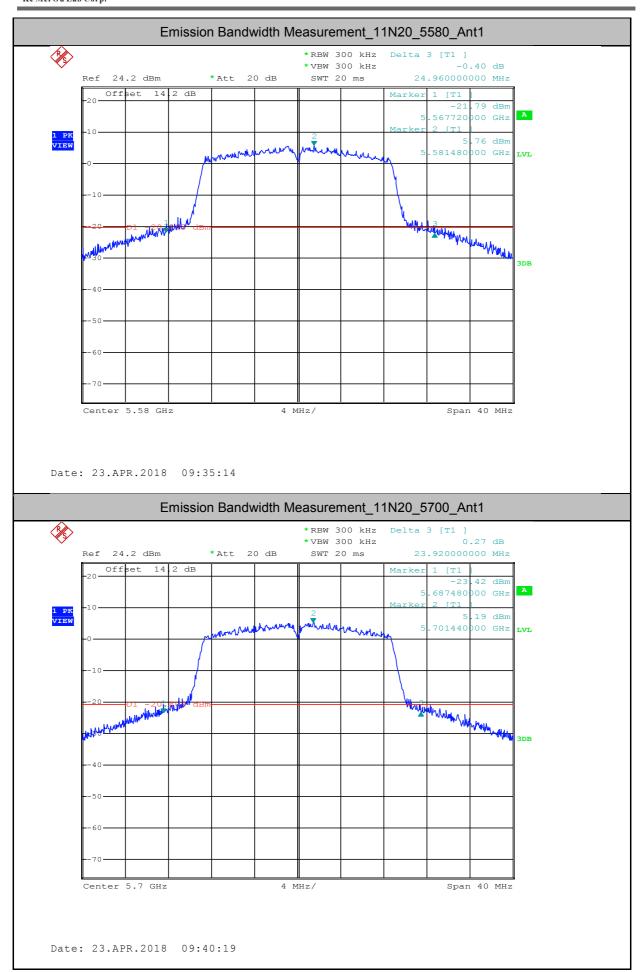


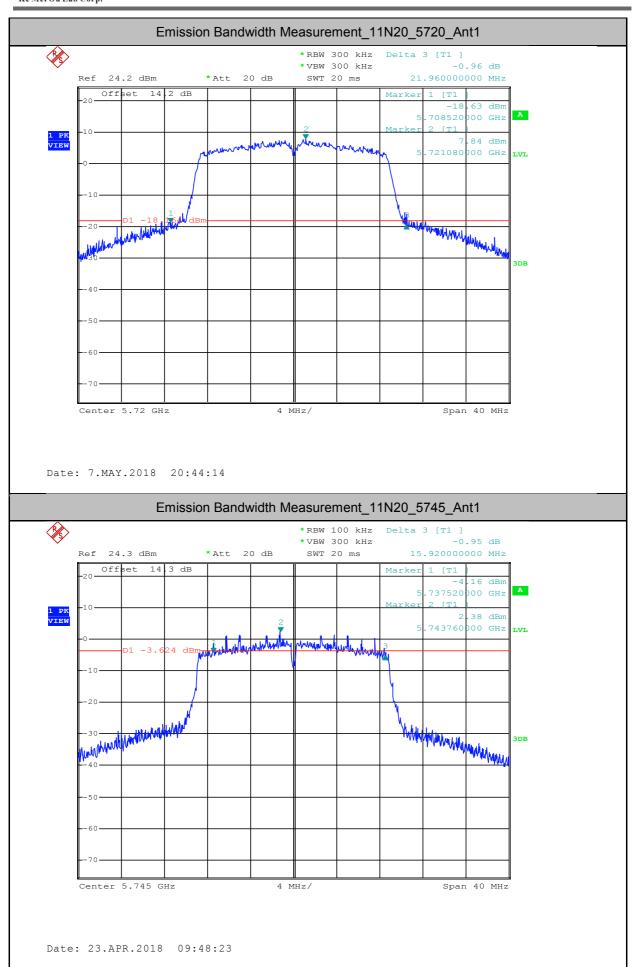


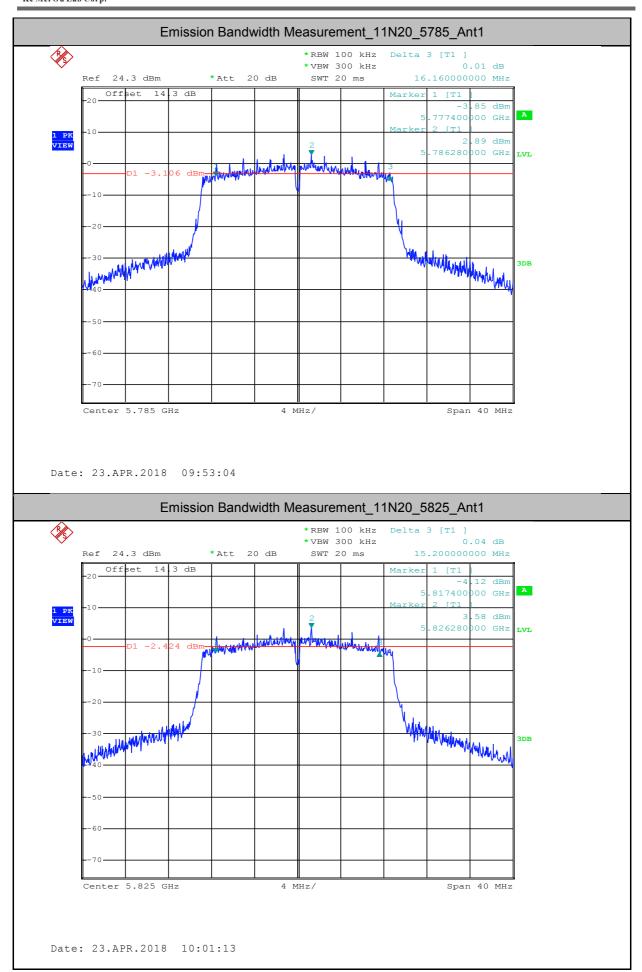


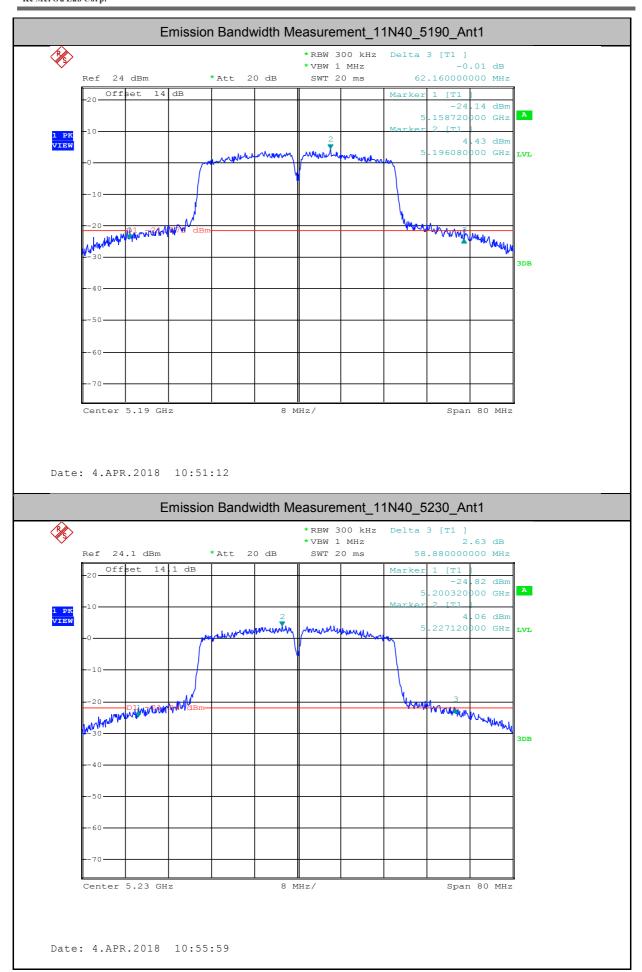

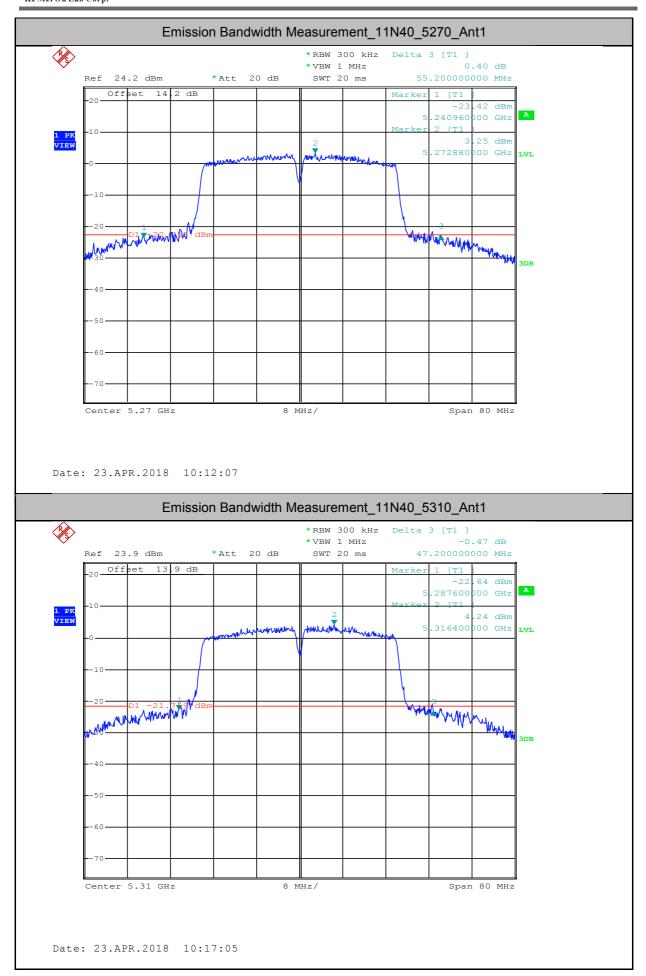

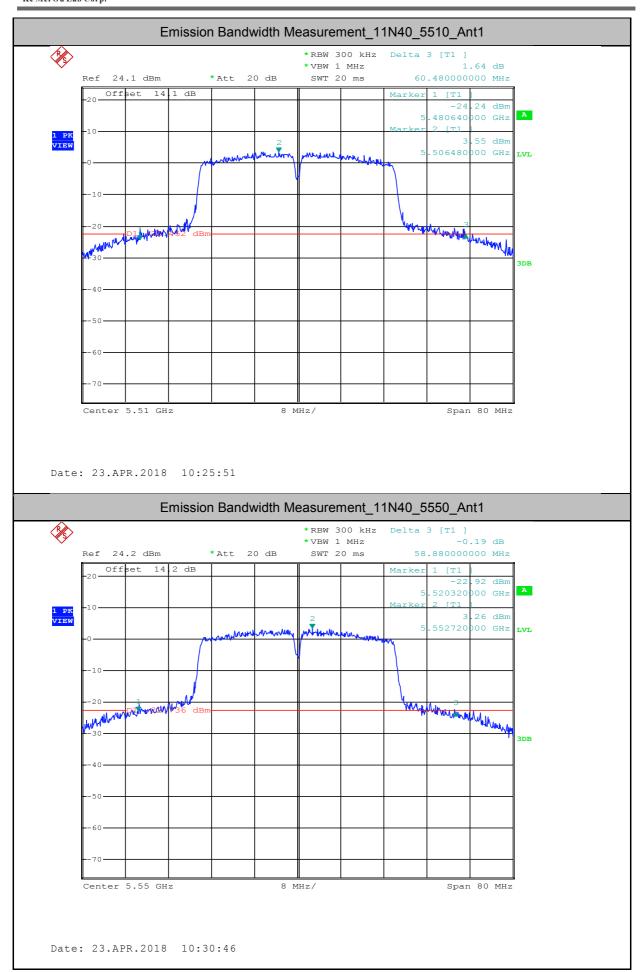


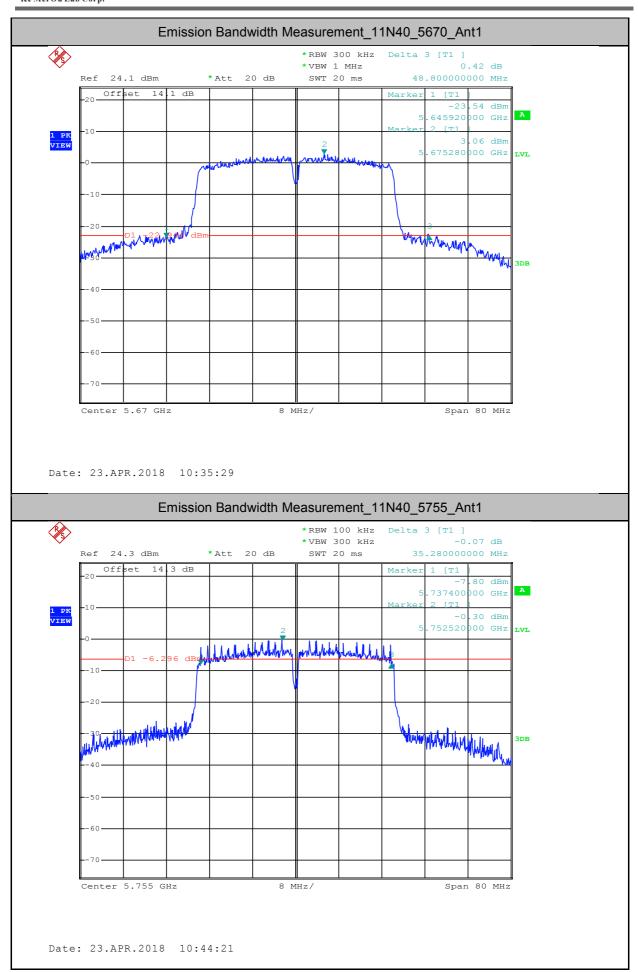


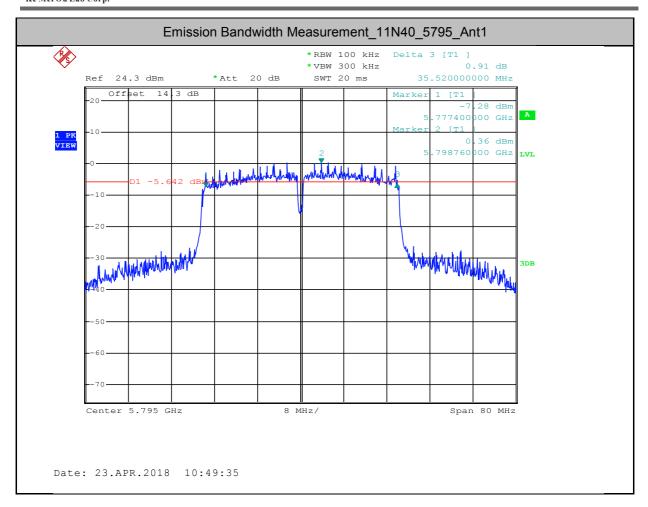



2.Occupied Bandwidth Measurement


Test Mode	Test Channel	Ant	OBW[MHz]	Limit[MHz]	Verdict
11A	5180	Ant1	16.865		PASS
11A	5200	Ant1	16.770		PASS
11A	5240	Ant1	16.725		PASS
11A	5260	Ant1	16.705		PASS
11A	5280	Ant1	16.665		PASS
11A	5320	Ant1	16.650		PASS
11A	5500	Ant1	16.775		PASS
11A	5580	Ant1	16.710		PASS
11A	5700	Ant1	16.660		PASS
11A	5720	Ant1	16.635		PASS
11A	5745	Ant1	16.435		PASS
11A	5785	Ant1	16.415		PASS
11A	5825	Ant1	16.405		PASS
11N20	5180	Ant1	17.820		PASS
11N20	5200	Ant1	17.795		PASS
11N20	5240	Ant1	17.775		PASS
11N20	5260	Ant1	17.695		PASS
11N20	5280	Ant1	17.705		PASS
11N20	5320	Ant1	17.695		PASS
11N20	5500	Ant1	17.800		PASS
11N20	5580	Ant1	17.765		PASS
11N20	5700	Ant1	17.715		PASS
11N20	5720	Ant1	17.700		PASS
11N20	5745	Ant1	17.600		PASS
11N20	5785	Ant1	17.585		PASS
11N20	5825	Ant1	17.575		PASS
11N40	5190	Ant1	36.230		PASS
11N40	5230	Ant1	36.130		PASS
11N40	5270	Ant1	36.140		PASS
11N40	5310	Ant1	36.050		PASS
11N40	5510	Ant1	36.190		PASS
11N40	5550	Ant1	36.240		PASS
11N40	5670	Ant1	36.150		PASS
11N40	5755	Ant1	36.060		PASS
11N40	5795	Ant1	35.940		PASS

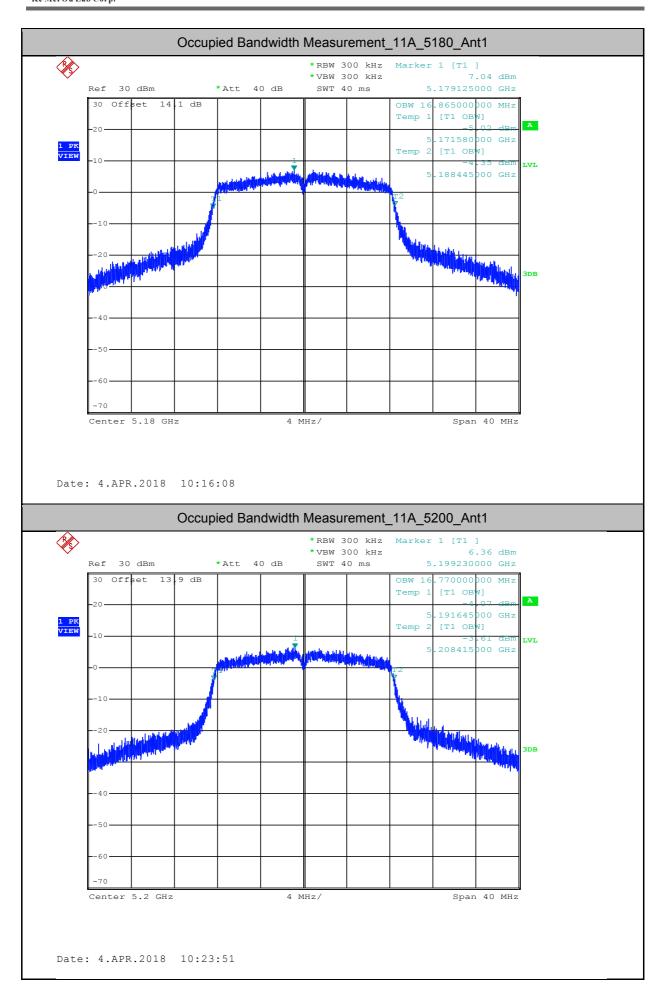


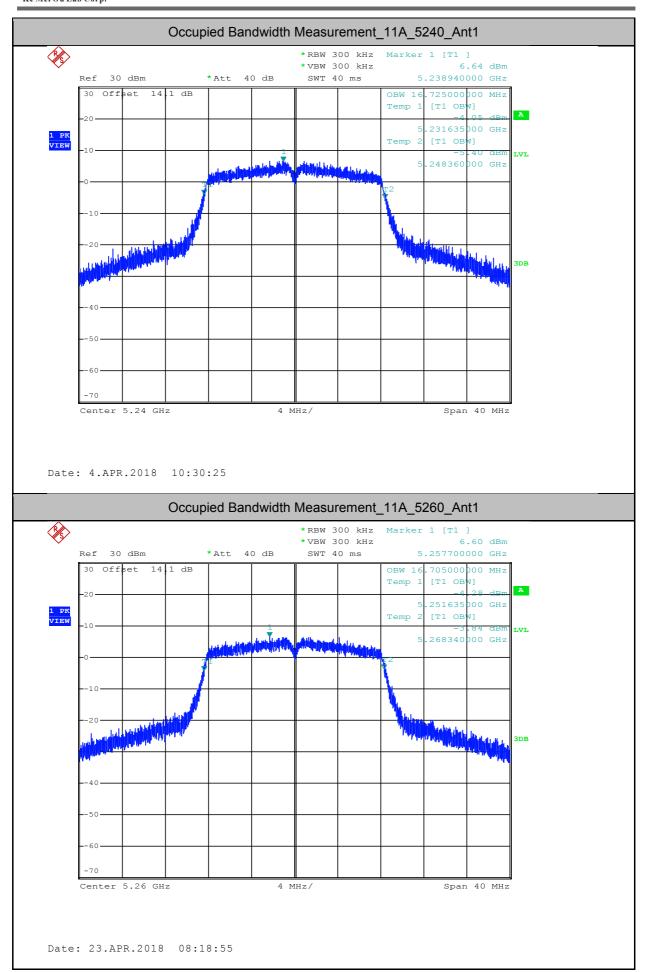


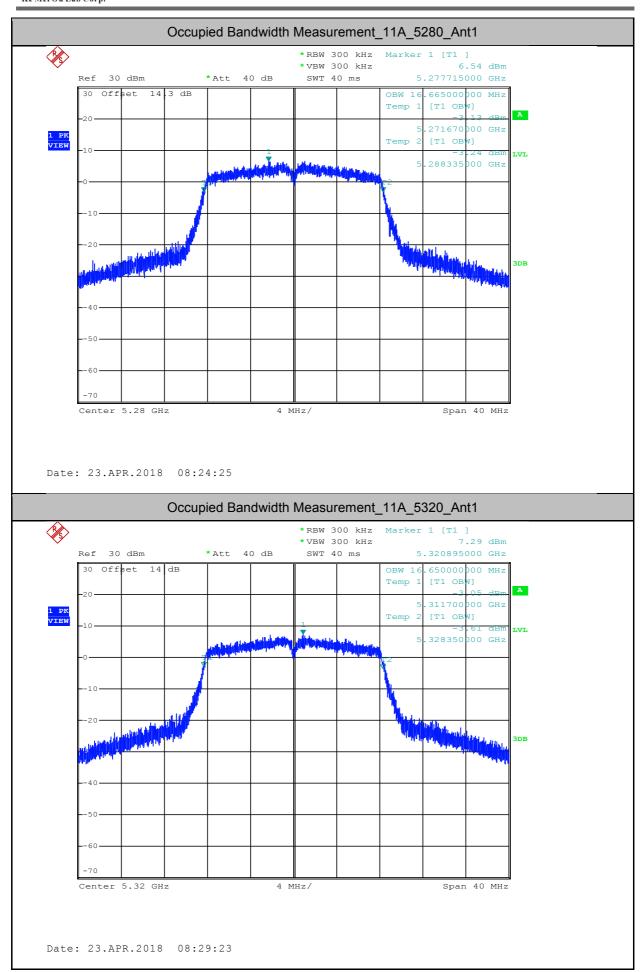


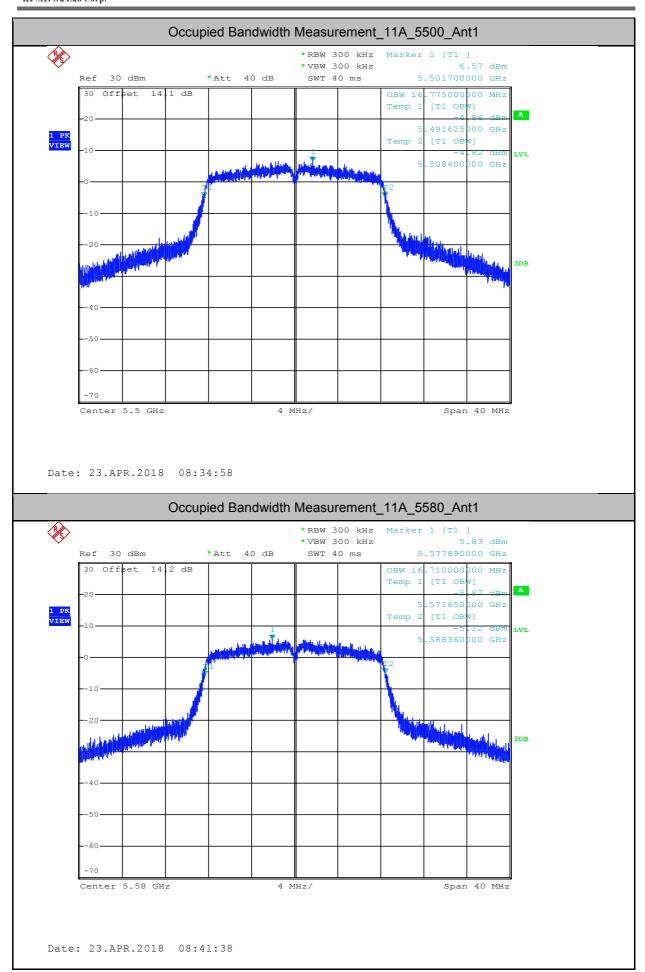


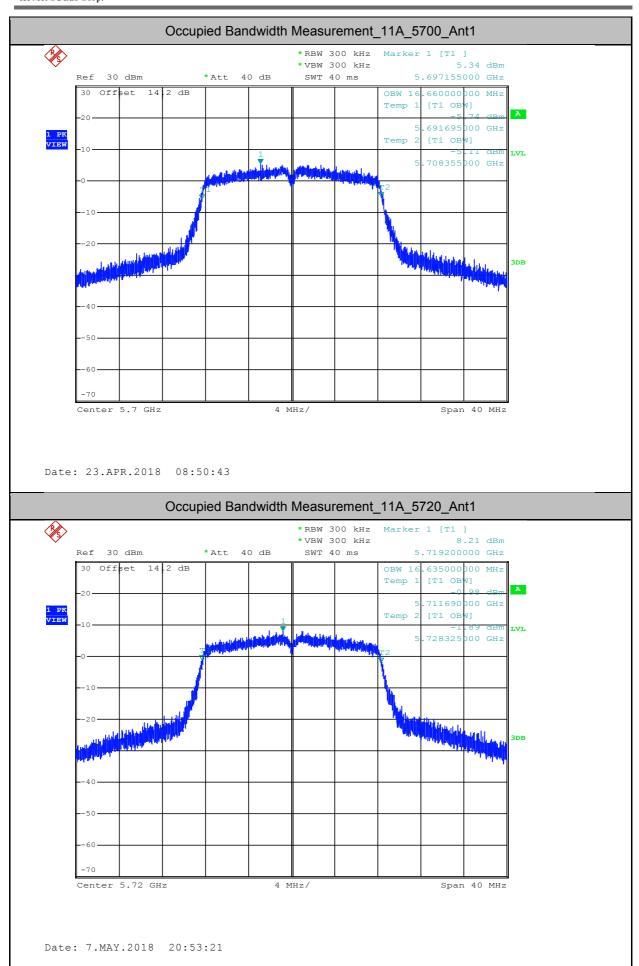


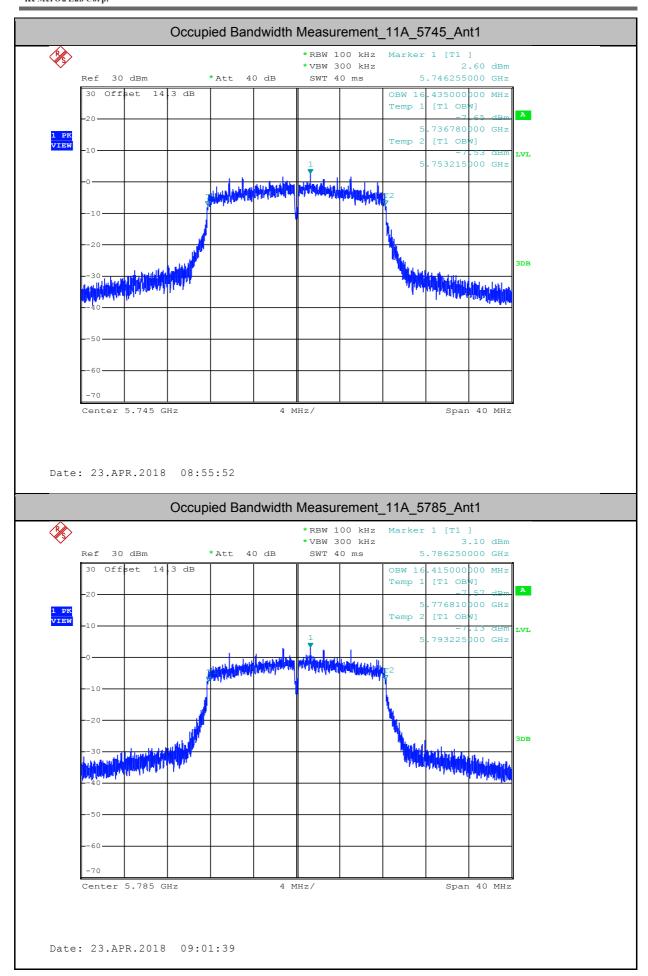


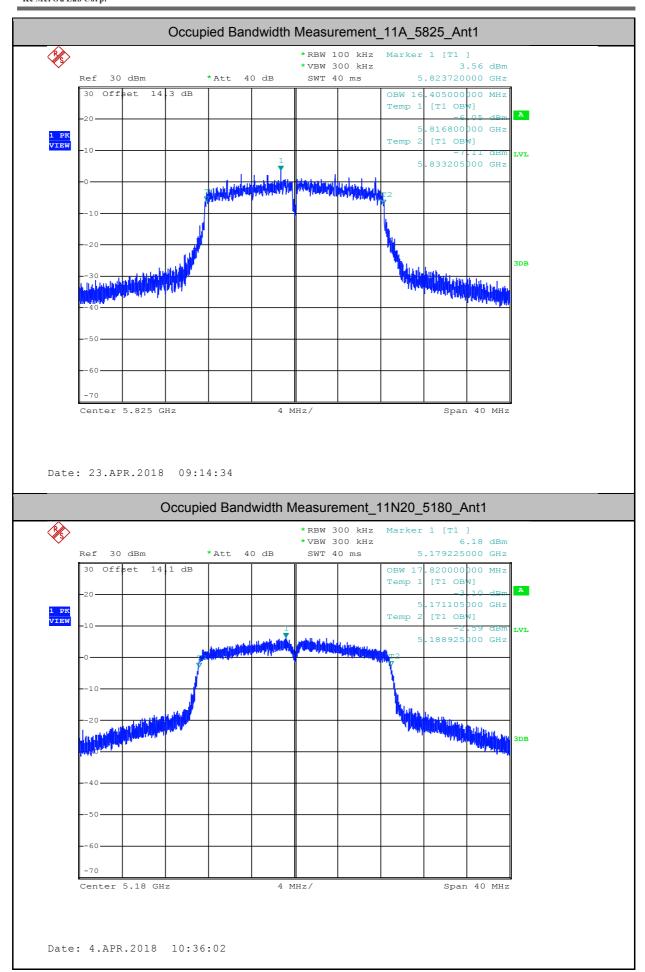


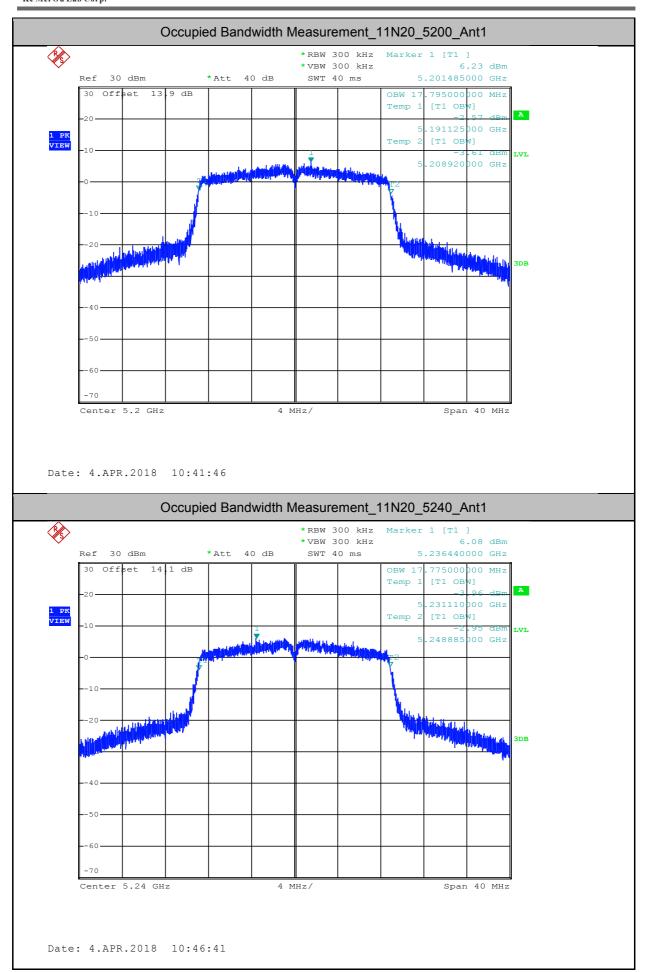


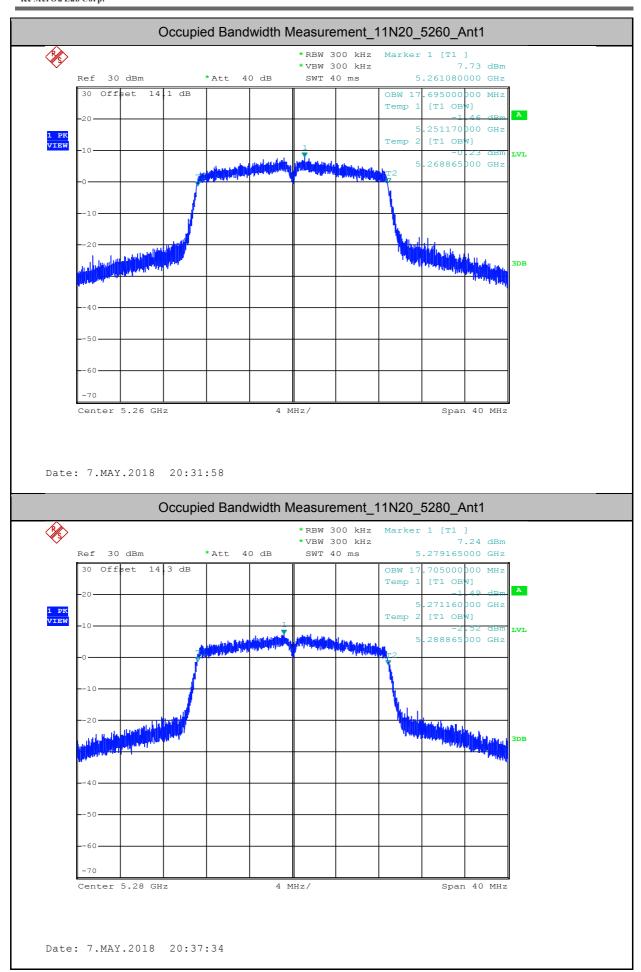


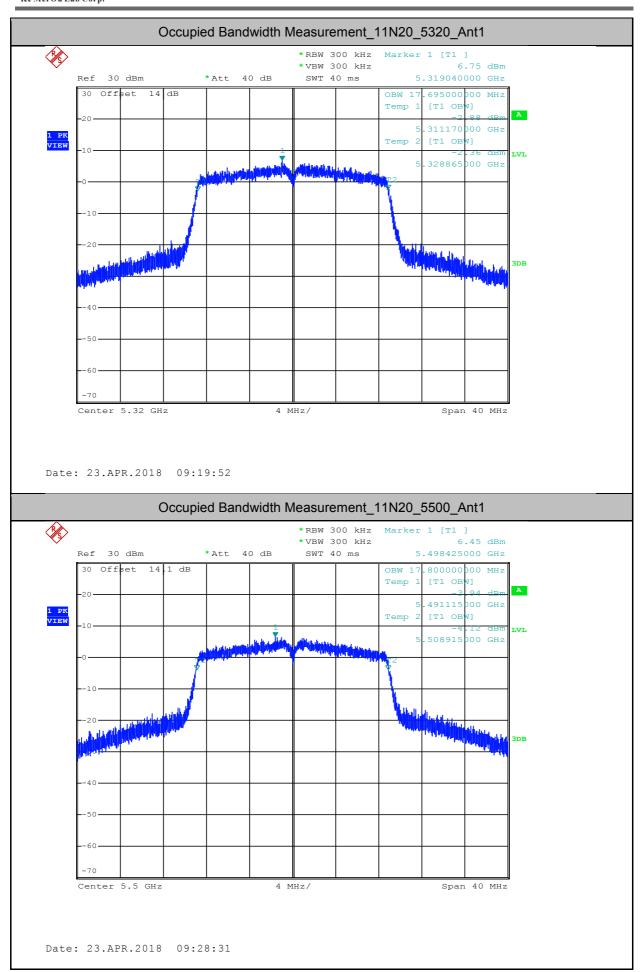


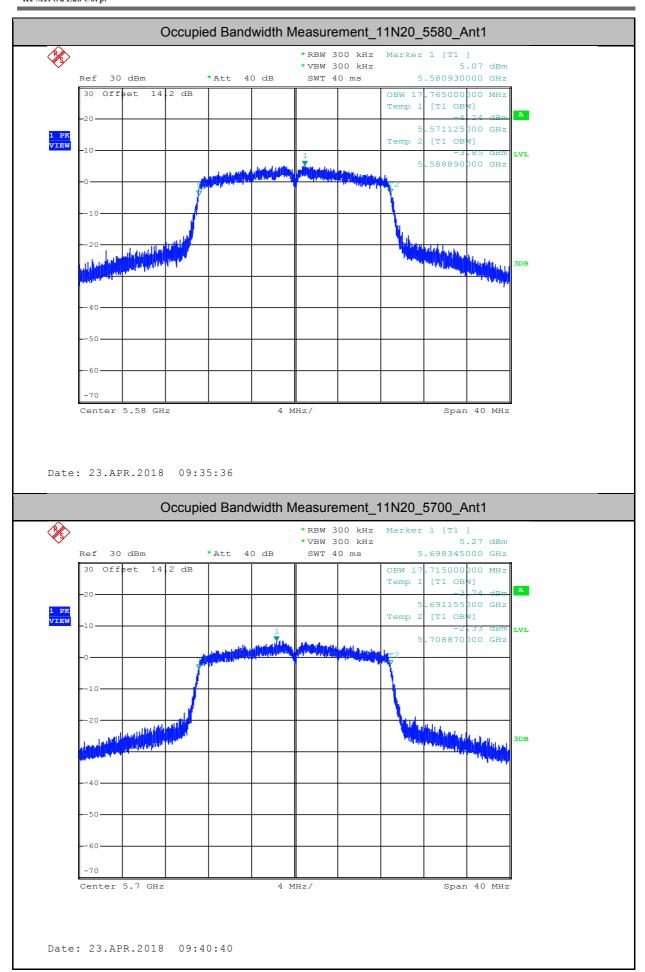


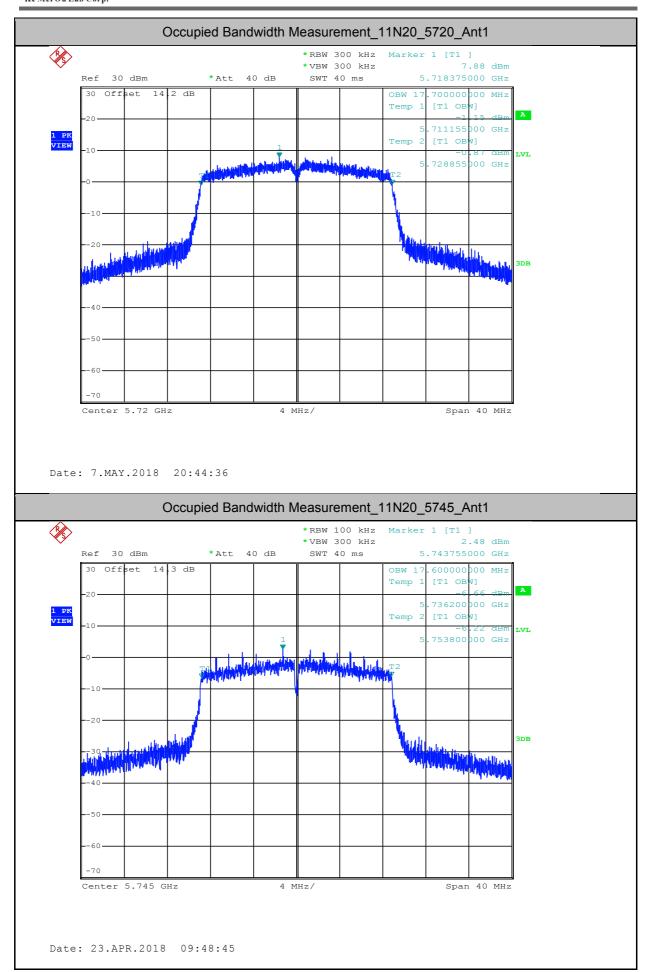


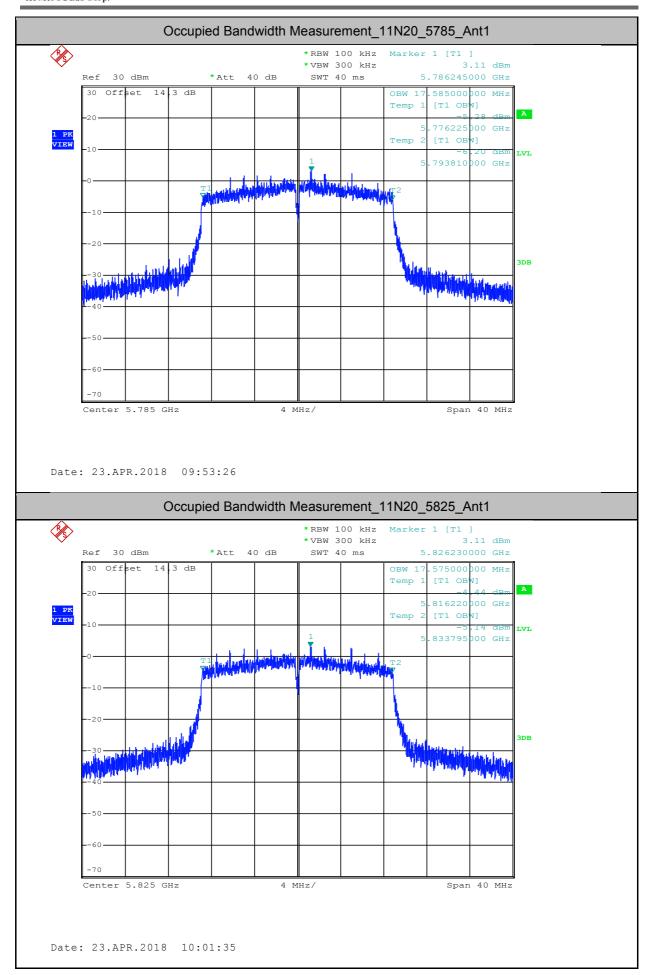


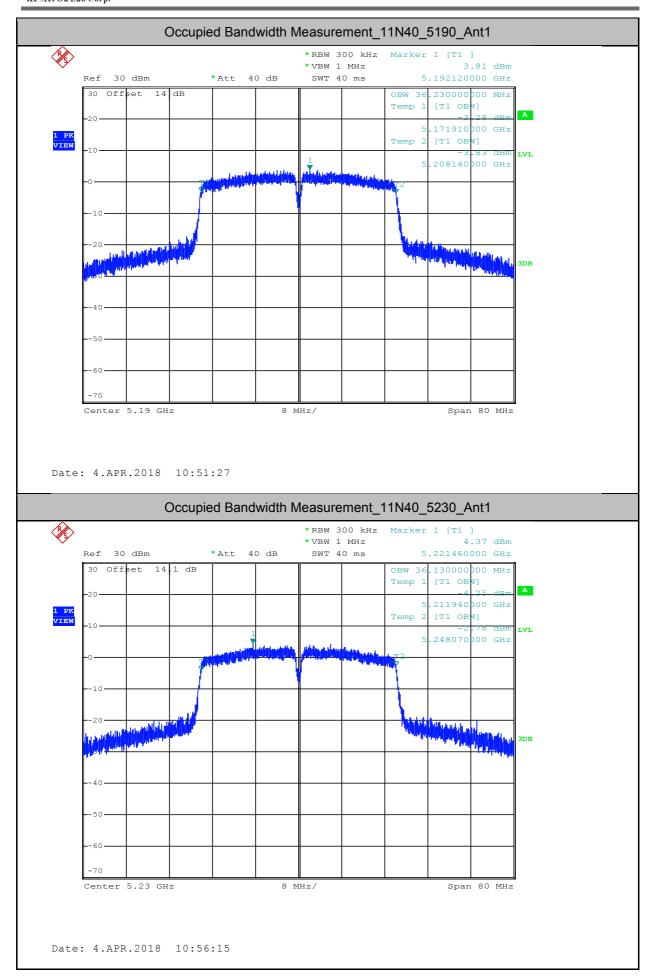

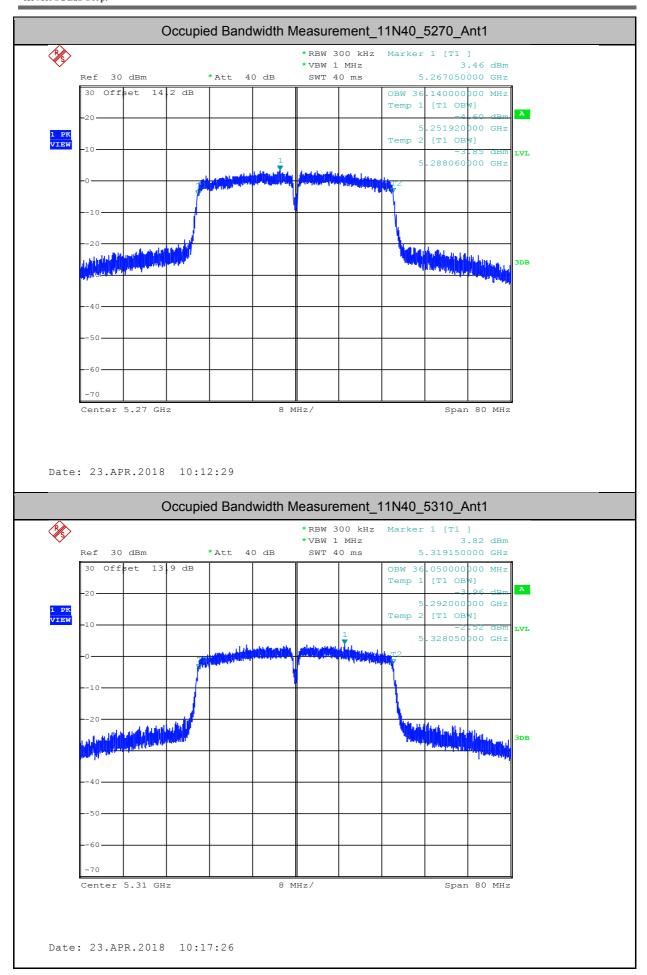

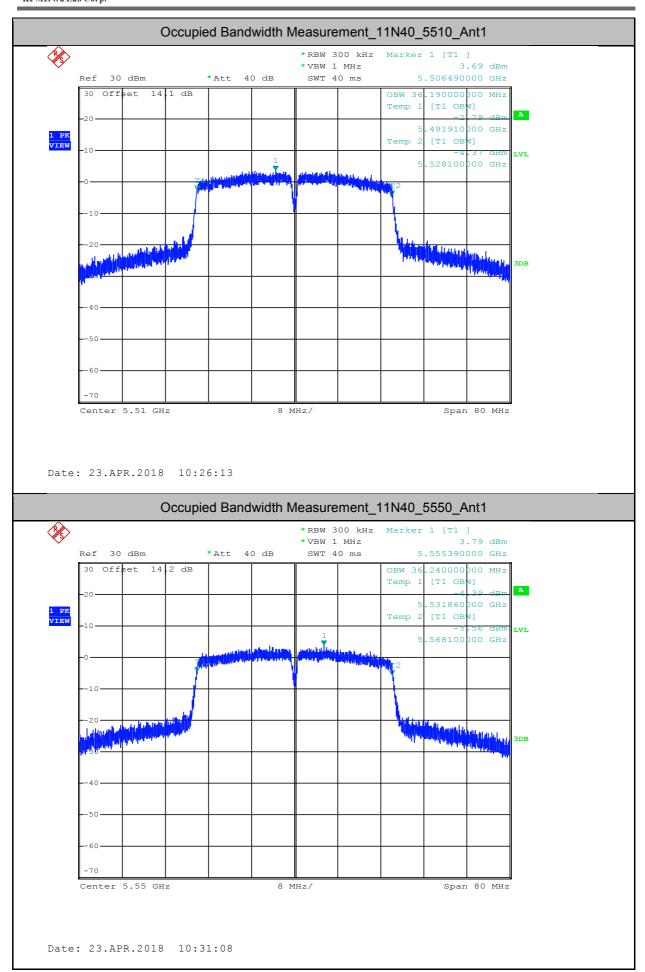


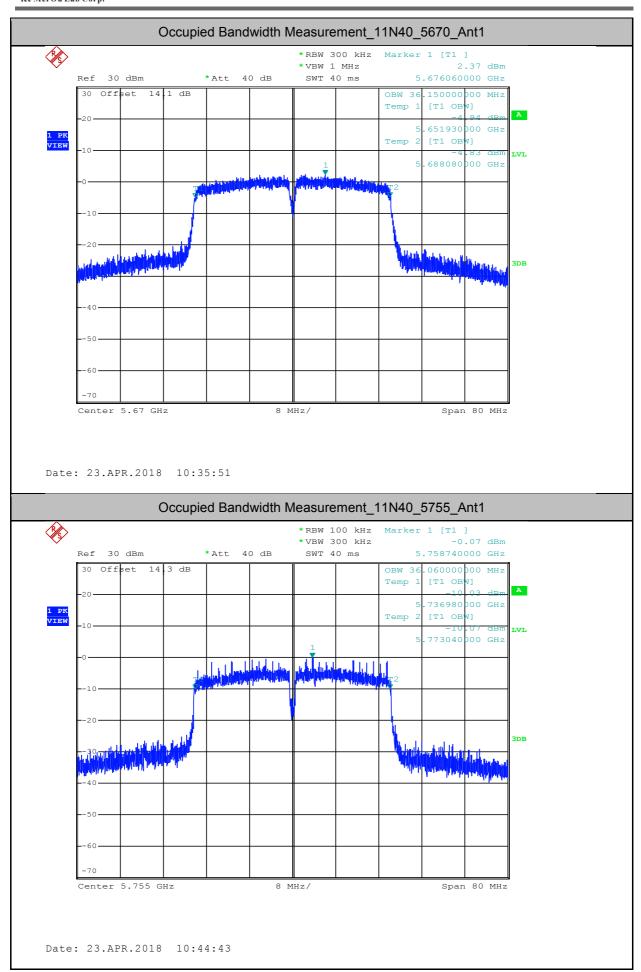


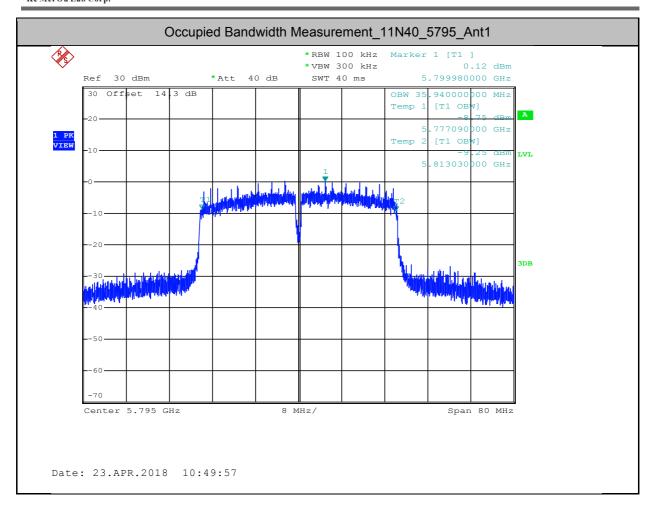



3.Maximum Conduct Output Power


Test Mode	Test Channel	Ant	Level [dBm]	10log(1/x) Factor [dB]	Power [dBm]	Limit [dBm]	Verdict
11A	5180	Ant1	15.22	0.12	15.34	23.98	PASS
11A	5200	Ant1	14.67	0.12	14.79	23.98	PASS
11A	5240	Ant1	14.82	0.12	14.94	23.98	PASS
11A	5260	Ant1	15.27	0.12	15.39	23.98	PASS
11A	5280	Ant1	14.96	0.12	15.08	23.98	PASS
11A	5320	Ant1	15.6	0.12	15.72	23.98	PASS
11A	5500	Ant1	14.8	0.12	14.92	23.98	PASS
11A	5580	Ant1	14.24	0.12	14.36	23.98	PASS
11A	5700	Ant1	15.88	0.12	16.00	23.98	PASS
11A	5720	Ant1	16.14	0.12	16.26	23.98	PASS
11A	5745	Ant1	15.83	0.12	15.95	30.00	PASS
11A	5785	Ant1	15.34	0.12	15.46	30.00	PASS
11A	5825	Ant1	15.07	0.12	15.19	30.00	PASS
11N20	5180	Ant1	14.75	0.13	14.88	23.98	PASS
11N20	5200	Ant1	14.55	0.13	14.68	23.98	PASS
11N20	5240	Ant1	14.71	0.12	14.83	23.98	PASS
11N20	5260	Ant1	15.94	0.13	16.07	23.98	PASS
11N20	5280	Ant1	16.09	0.12	16.21	23.98	PASS
11N20	5320	Ant1	14.78	0.13	14.91	23.98	PASS
11N20	5500	Ant1	14.69	0.13	14.82	23.98	PASS
11N20	5580	Ant1	14.11	0.13	14.24	23.98	PASS
11N20	5700	Ant1	15.4	0.12	15.52	23.98	PASS
11N20	5720	Ant1	16.1	0.13	16.23	23.98	PASS
11N20	5745	Ant1	15.72	0.12	15.84	30.00	PASS
11N20	5785	Ant1	15.15	0.12	15.27	30.00	PASS
11N20	5825	Ant1	15.46	0.12	15.58	30.00	PASS
11N40	5190	Ant1	14.83	0.25	15.08	23.98	PASS
11N40	5230	Ant1	15.05	0.24	15.29	23.98	PASS
11N40	5270	Ant1	14.5	0.25	14.75	23.98	PASS
11N40	5310	Ant1	14.91	0.24	15.15	23.98	PASS
11N40	5510	Ant1	14.72	0.25	14.97	23.98	PASS
11N40	5550	Ant1	14.53	0.24	14.77	23.98	PASS
11N40	5670	Ant1	15.71	0.24	15.95	23.98	PASS
11N40	5755	Ant1	15.86	0.25	16.11	30.00	PASS
11N40	5795	Ant1	15.26	0.25	15.51	30.00	PASS

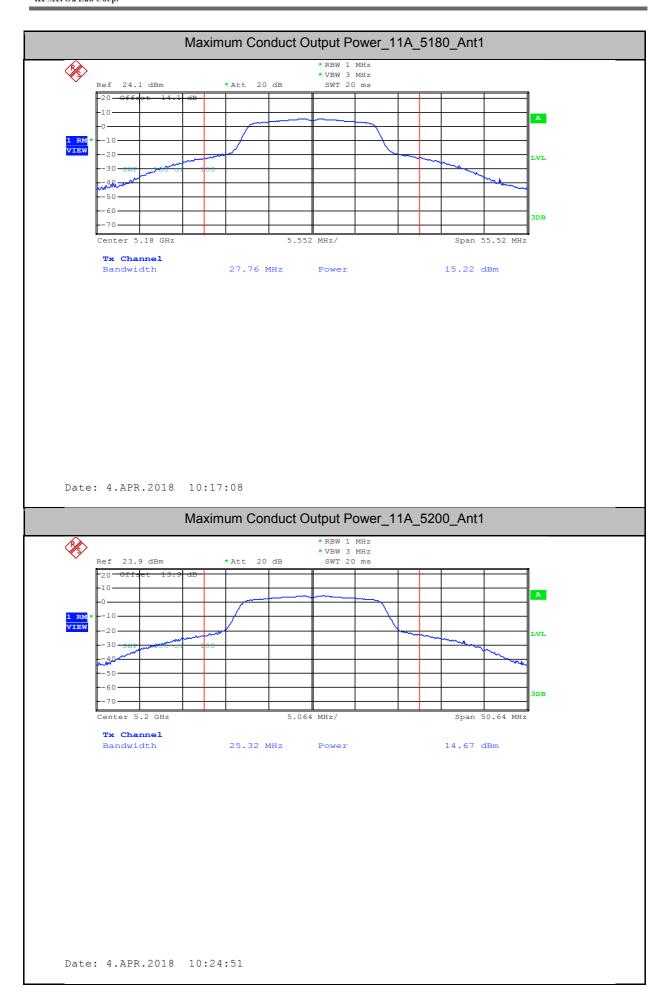


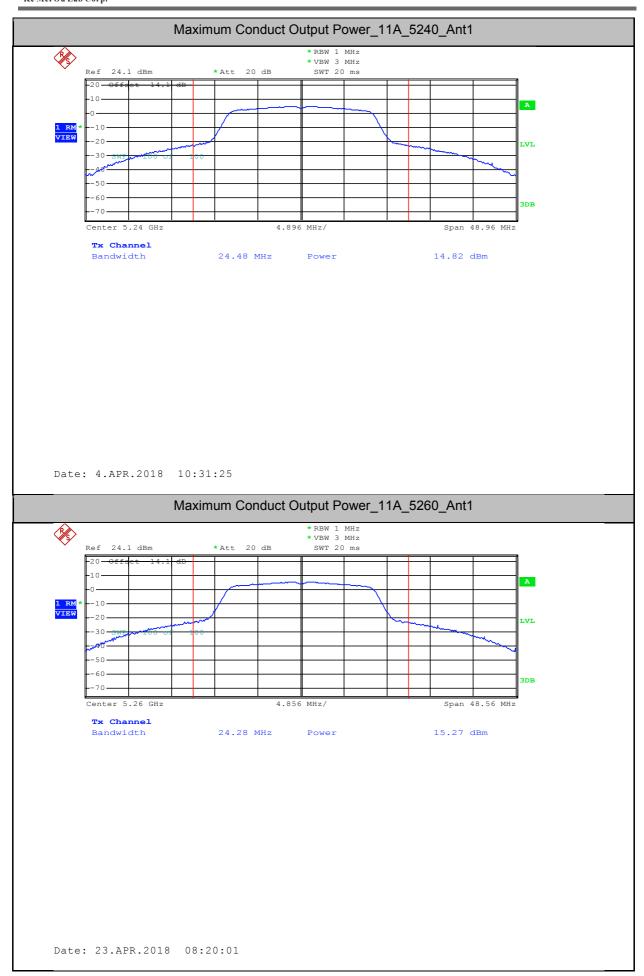


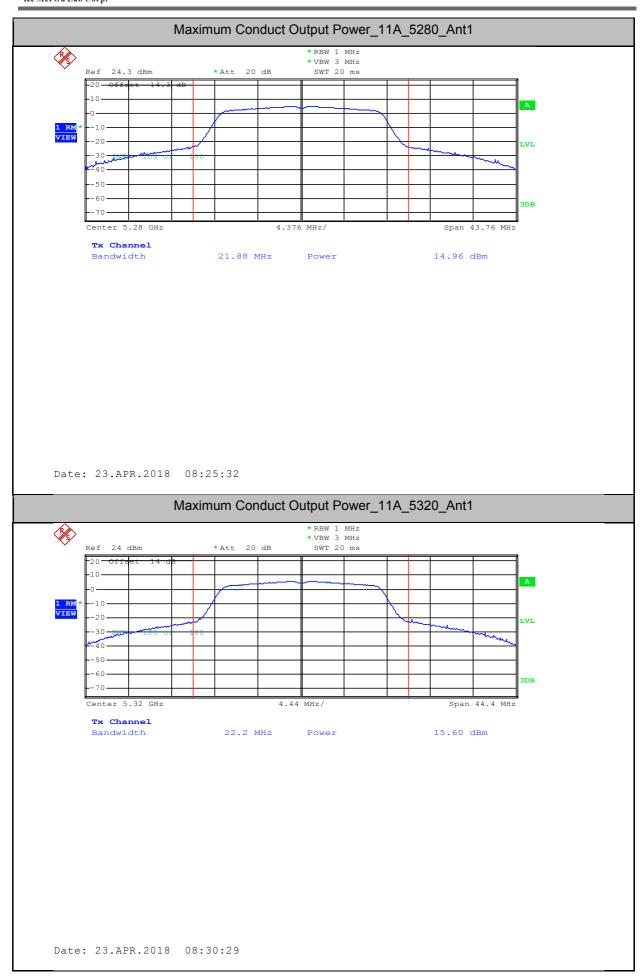


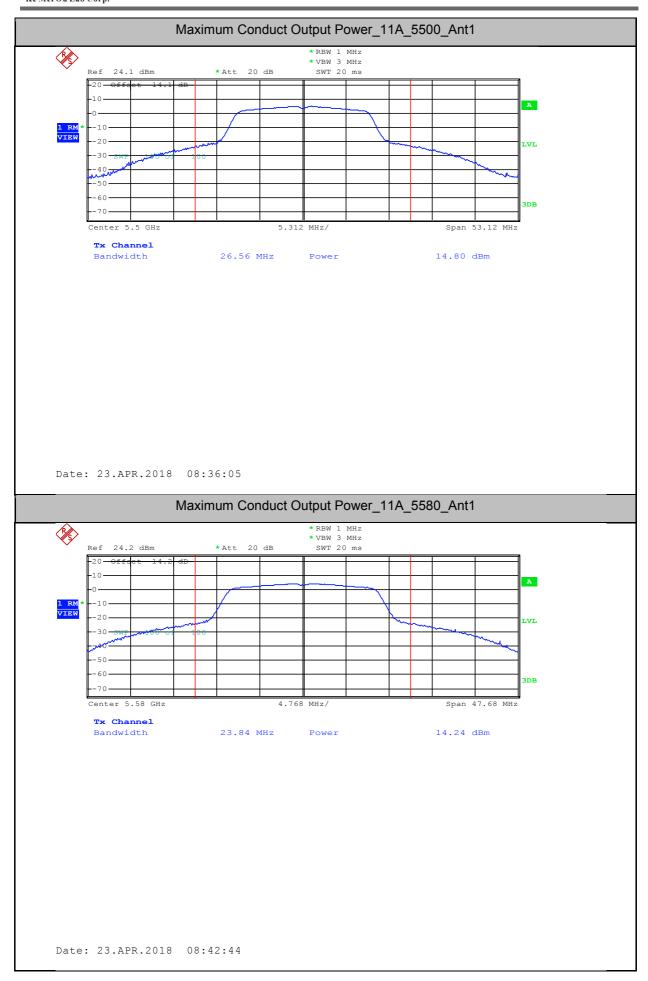


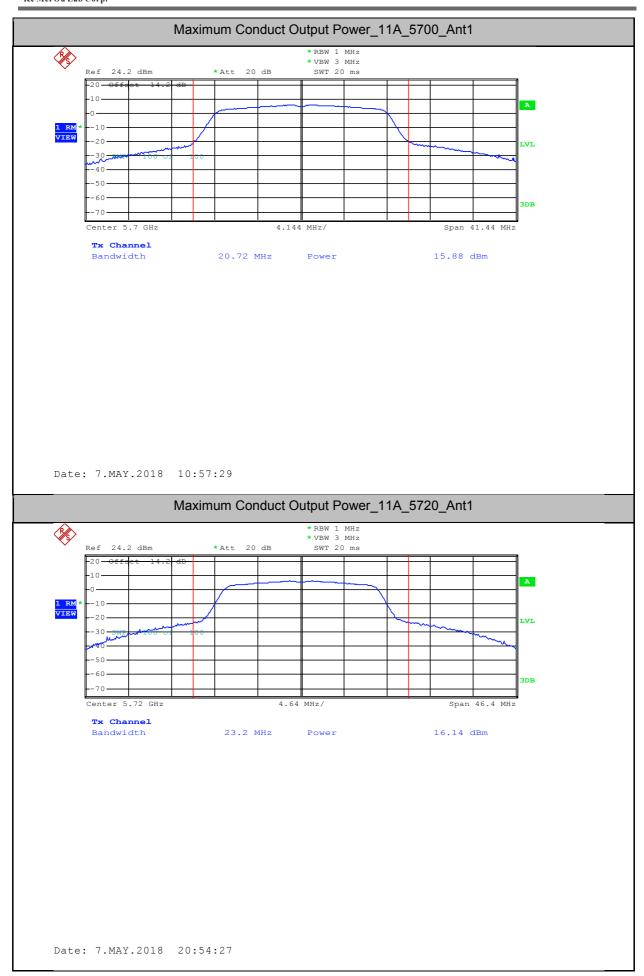


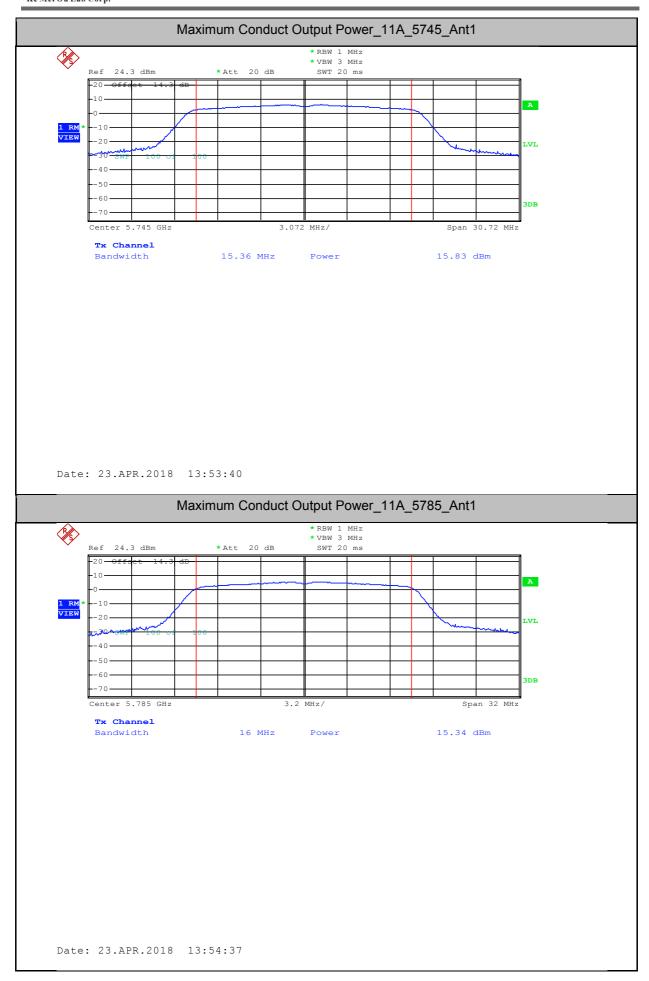


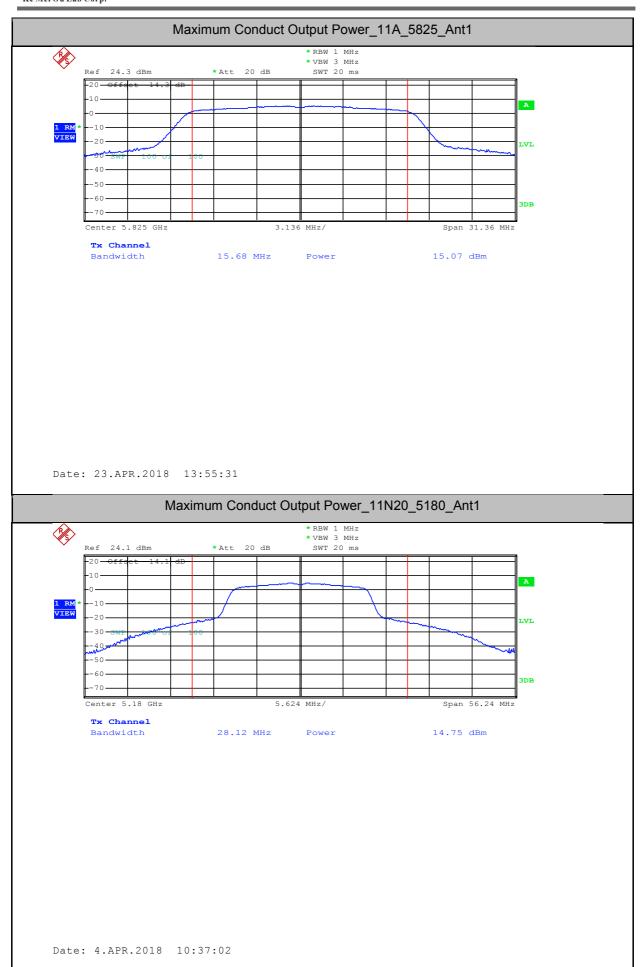


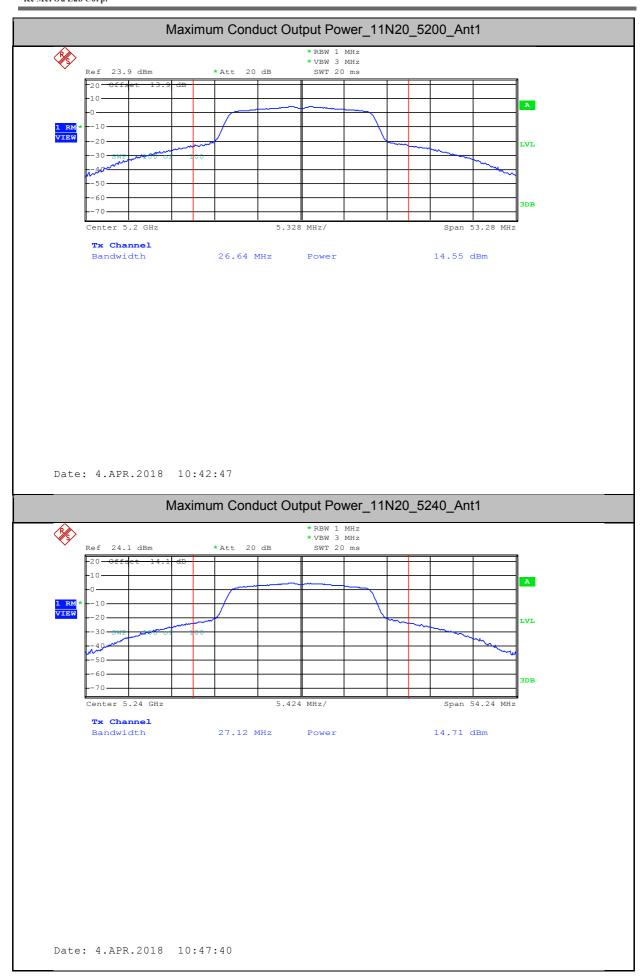


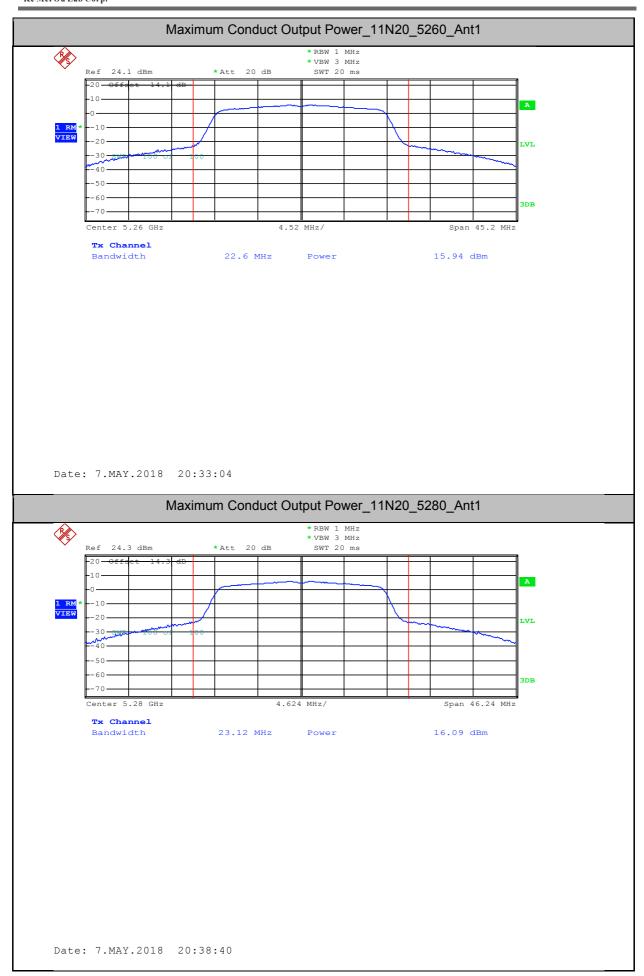


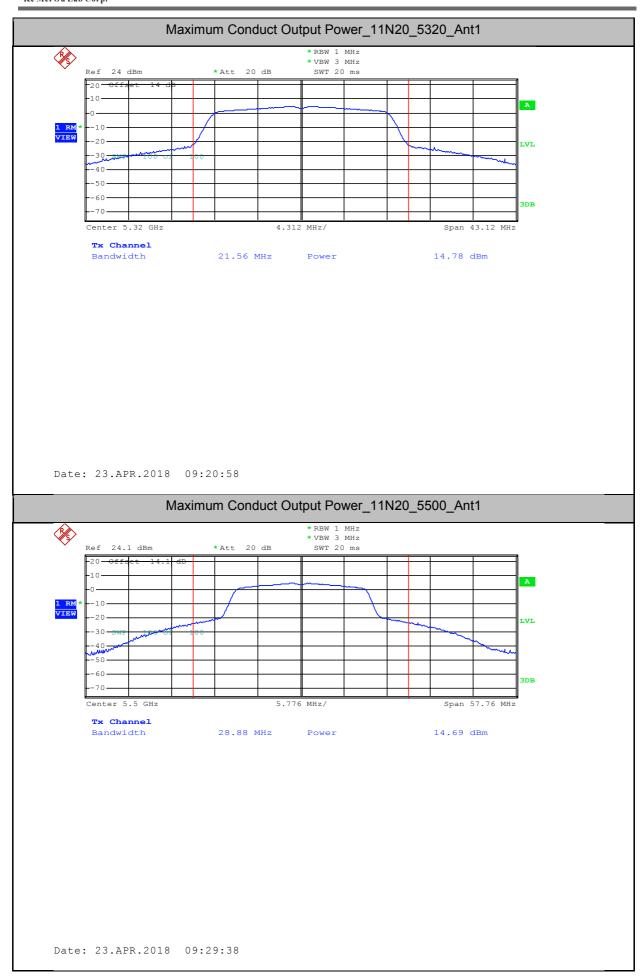


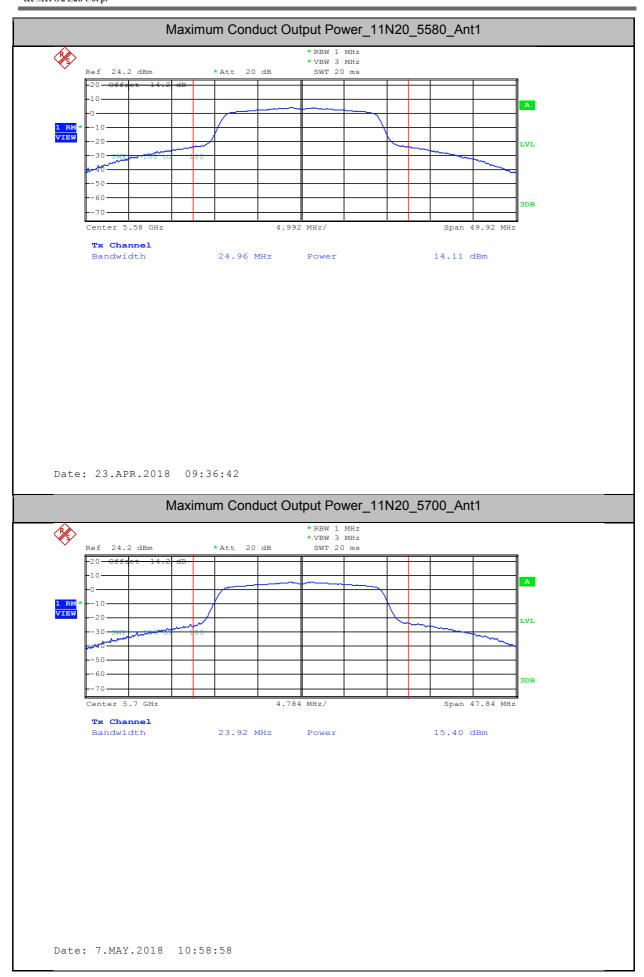


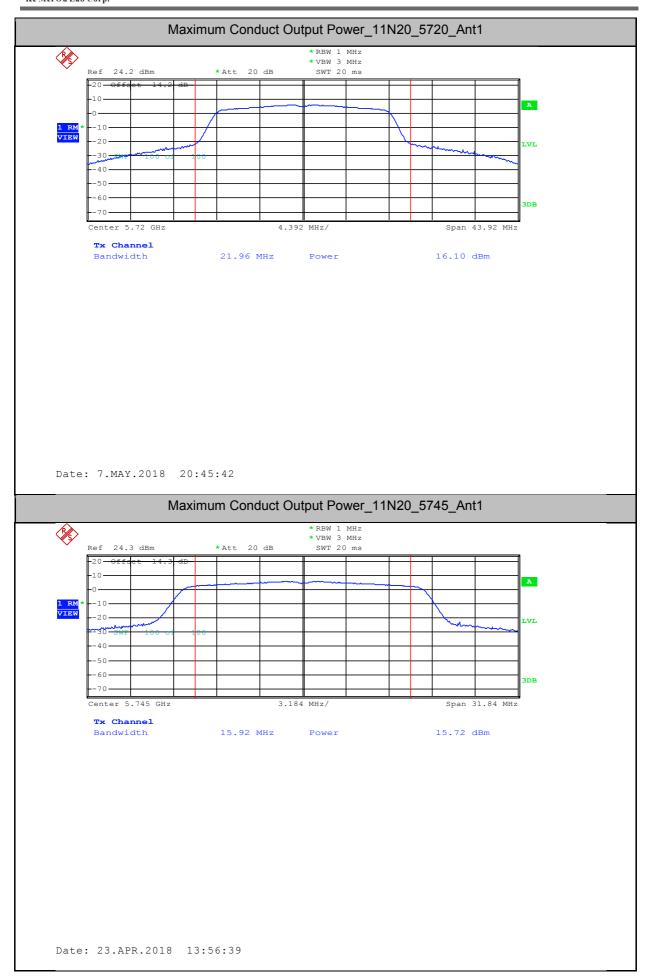


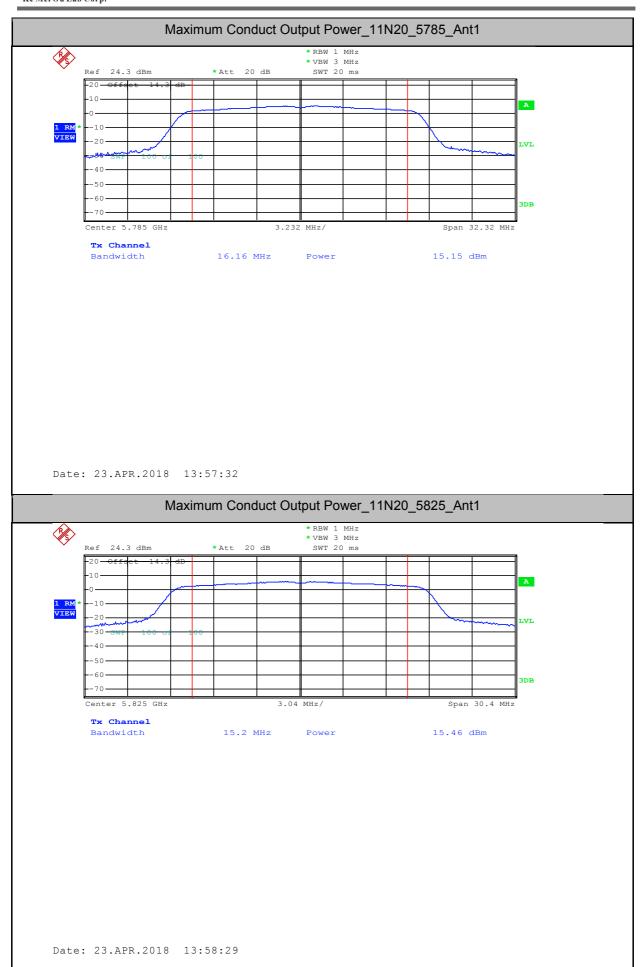


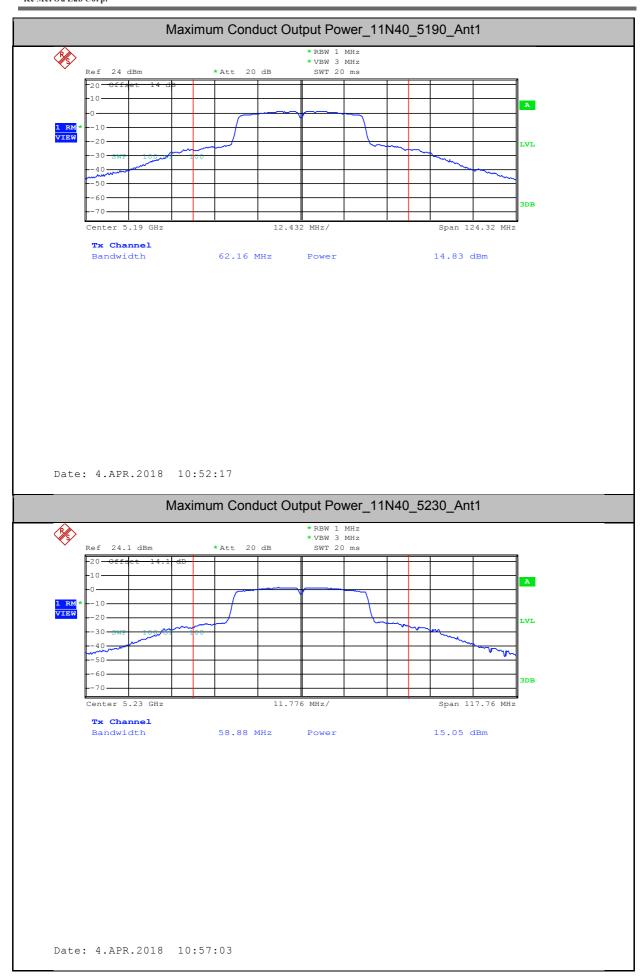

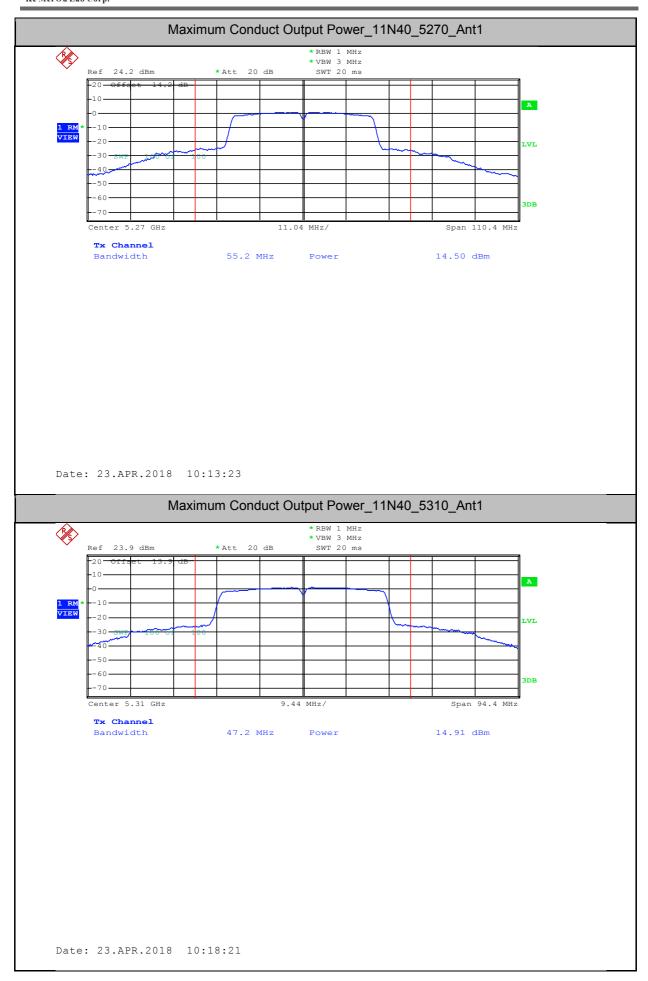

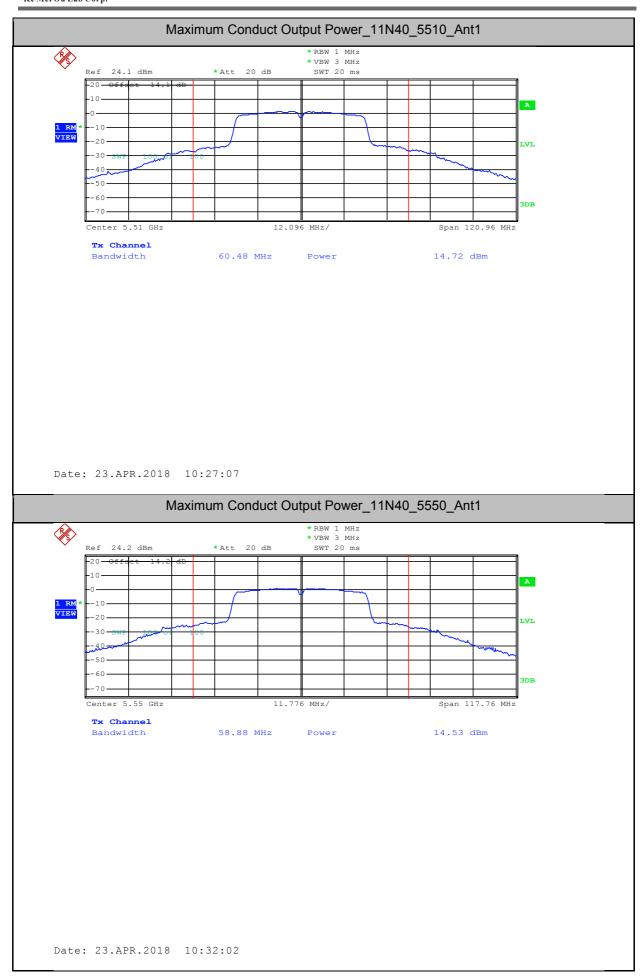

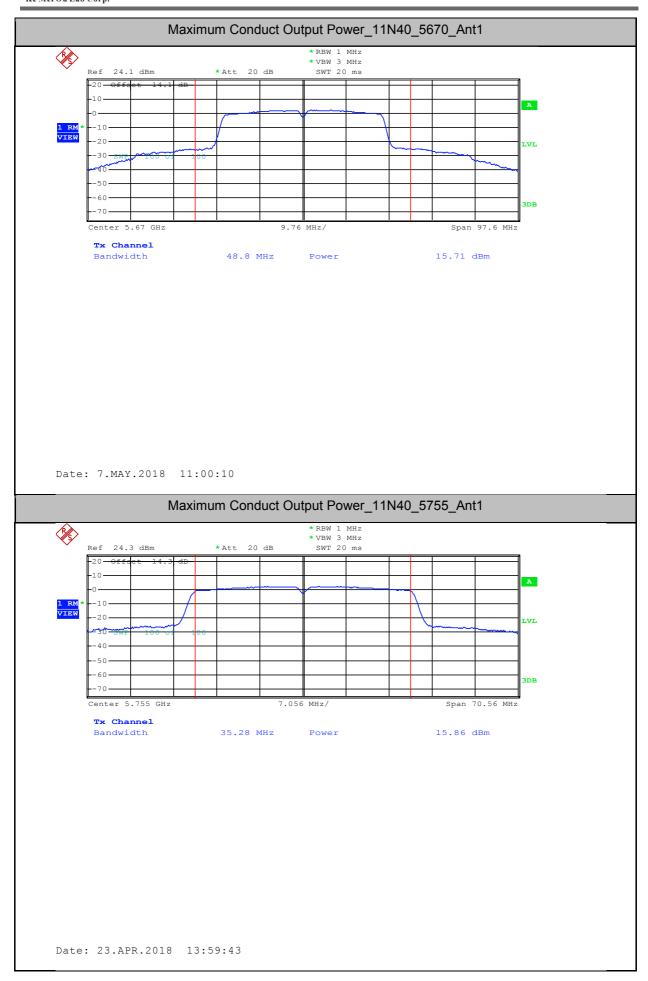

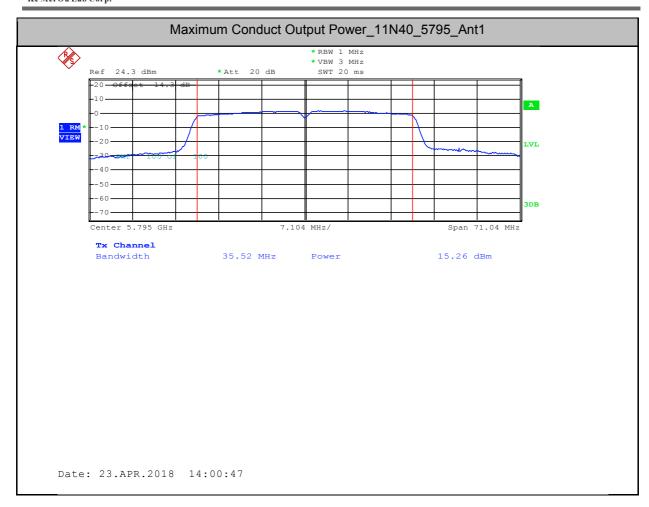


4.Maximum Power Spectral Density


Test Mode	Test Channel	Ant	Level [dBm/MHz]	10log(1/x) Factor [dB]	PSD [dBm/MHz]	Limit [dBm/MHz]	Verdict
11A	5180	Ant1	5.41	0.12	5.53	11.00	PASS
11A	5200	Ant1	4.96	0.12	5.08	11.00	PASS
11A	5240	Ant1	5.18	0.12	5.30	11.00	PASS
11A	5260	Ant1	5.83	0.12	5.95	11.00	PASS
11A	5280	Ant1	5.14	0.12	5.26	11.00	PASS
11A	5320	Ant1	5.83	0.12	5.95	11.00	PASS
11A	5500	Ant1	5.20	0.12	5.32	11.00	PASS
11A	5580	Ant1	4.39	0.12	4.51	11.00	PASS
11A	5700	Ant1	4.42	0.12	4.54	11.00	PASS
11A	5720	Ant1	6.65	0.12	6.77	11.00	PASS
11N20	5180	Ant1	5.02	0.13	5.15	11.00	PASS
11N20	5200	Ant1	4.87	0.13	5.00	11.00	PASS
11N20	5240	Ant1	5.17	0.12	5.29	11.00	PASS
11N20	5260	Ant1	6.02	0.13	6.15	11.00	PASS
11N20	5280	Ant1	6.10	0.12	6.22	11.00	PASS
11N20	5320	Ant1	5.12	0.13	5.25	11.00	PASS
11N20	5500	Ant1	4.92	0.13	5.05	11.00	PASS
11N20	5580	Ant1	4.42	0.13	4.55	11.00	PASS
11N20	5700	Ant1	3.92	0.12	4.04	11.00	PASS
11N20	5720	Ant1	6.46	0.13	6.59	11.00	PASS
11N40	5190	Ant1	1.41	0.25	1.66	11.00	PASS
11N40	5230	Ant1	1.73	0.24	1.97	11.00	PASS
11N40	5270	Ant1	1.43	0.25	1.68	11.00	PASS
11N40	5310	Ant1	1.64	0.24	1.88	11.00	PASS
11N40	5510	Ant1	1.27	0.25	1.52	11.00	PASS
11N40	5550	Ant1	1.09	0.24	1.33	11.00	PASS
11N40	5670	Ant1	0.33	0.24	0.57	11.00	PASS


Test Mode	Test Channel	Ant	Level [dBm/500kHz]		10log(500kHz/RBW) Factor [dB]	PSD [dBm/500kHz]	Limit [dBm/500kHz]	Verdict
11A	5745	Ant1	0.20	0.12	0.00	0.32	17.00	PASS
11A	5785	Ant1	1.05	0.12	0.00	1.17	17.00	PASS
11A	5825	Ant1	1.37	0.12	0.00	1.49	17.00	PASS
11N20	5745	Ant1	0.72	0.12	0.00	0.84	17.00	PASS
11N20	5785	Ant1	1.15	0.12	0.00	1.27	17.00	PASS
11N20	5825	Ant1	1.62	0.12	0.00	1.74	17.00	PASS





11N40	5755	Ant1	-2.53	0.25	0.00	-2.28	17.00	PASS
11N40	5795	Ant1	-1.58	0.25	0.00	-1.33	17.00	PASS

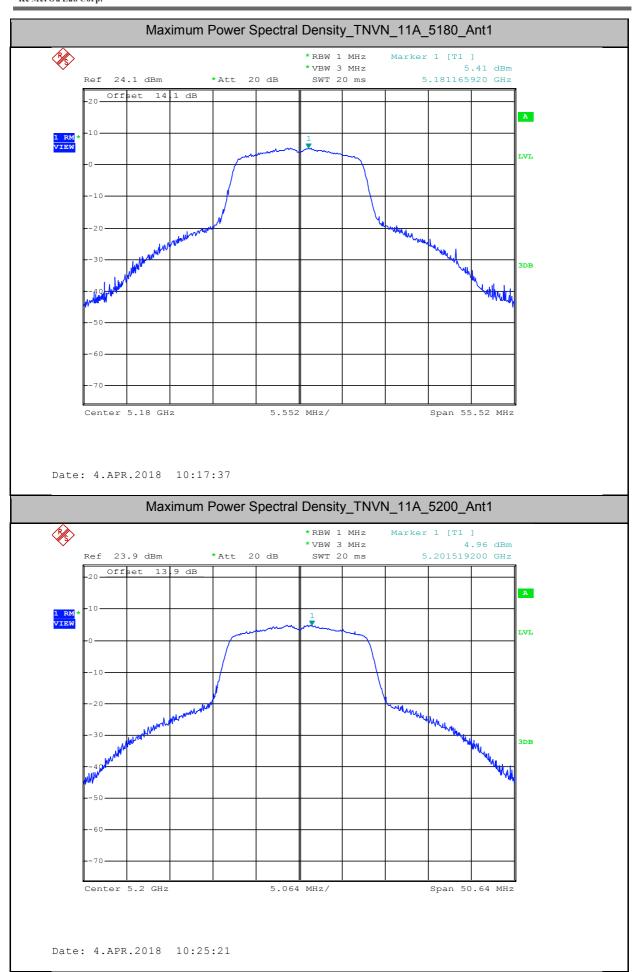


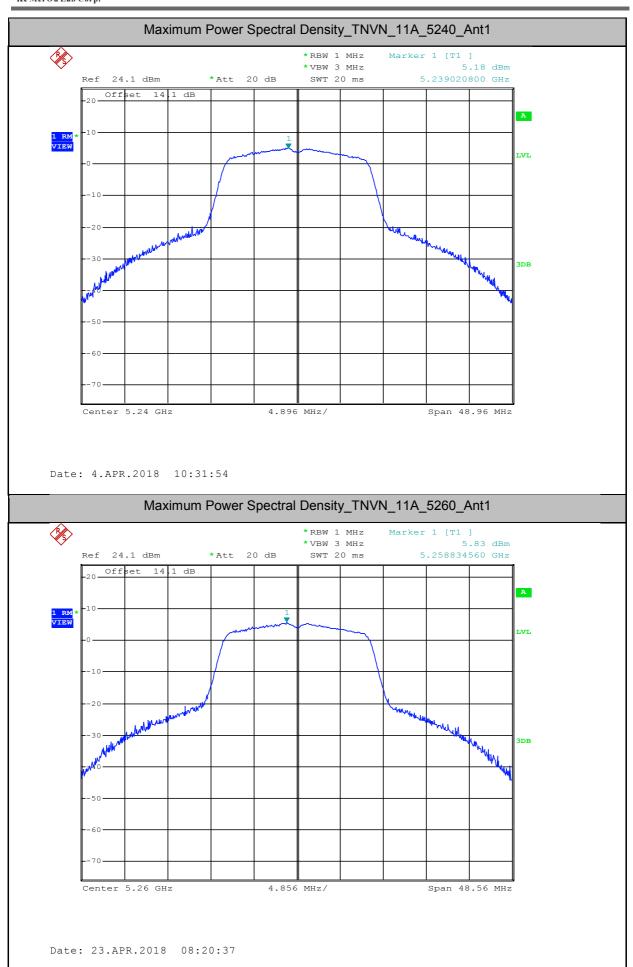


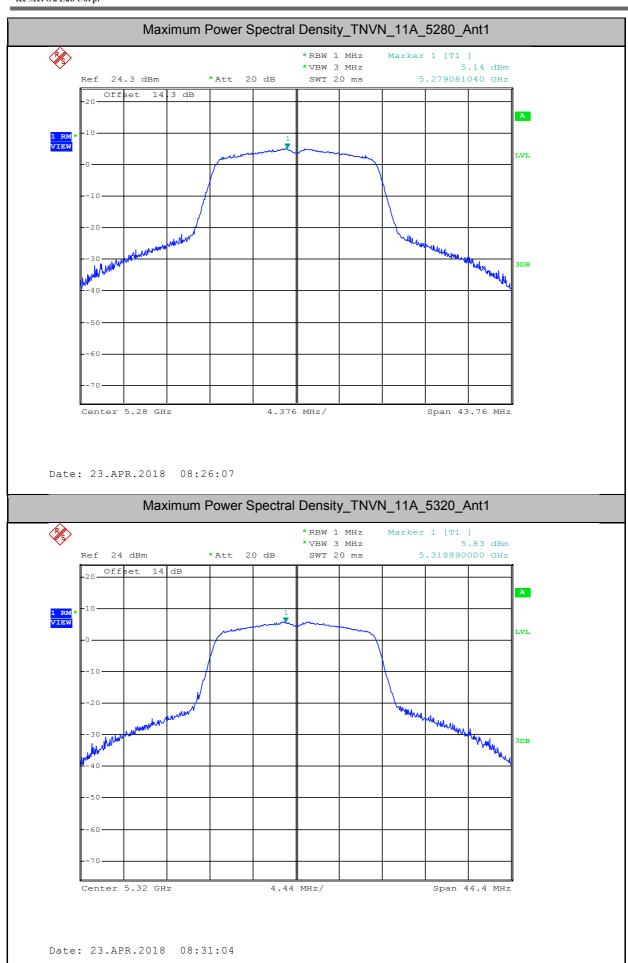


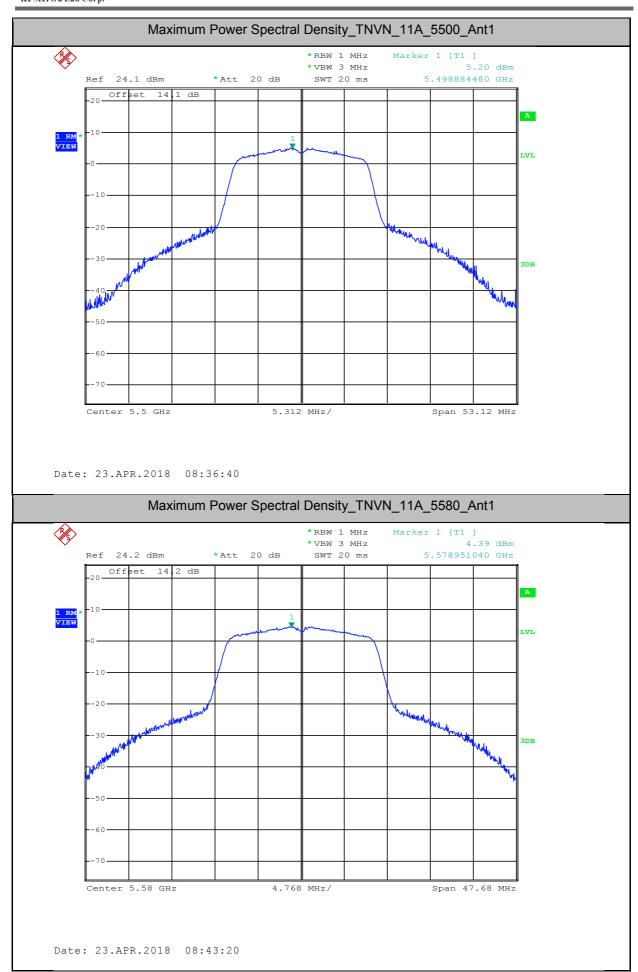


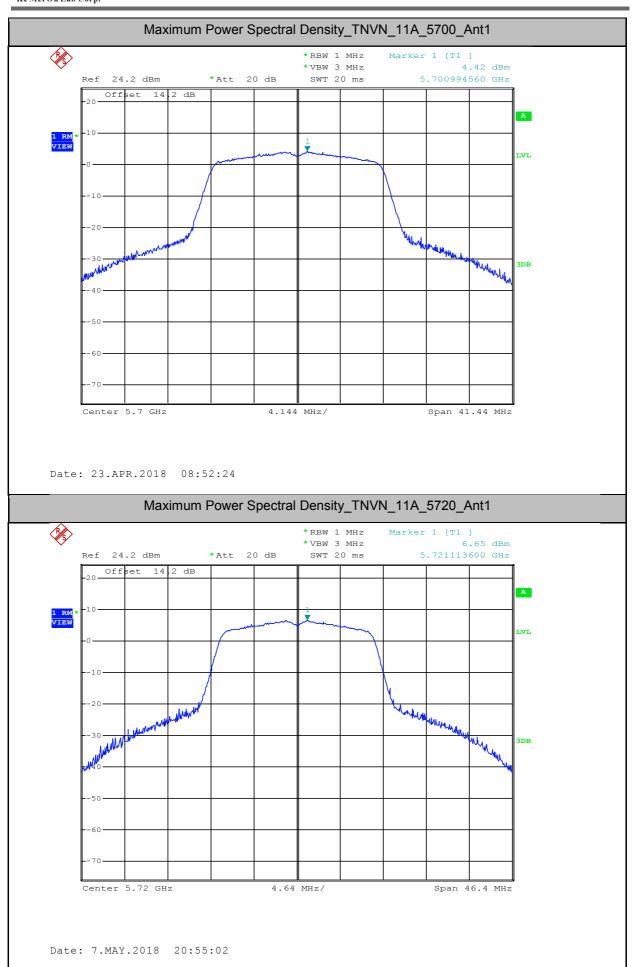


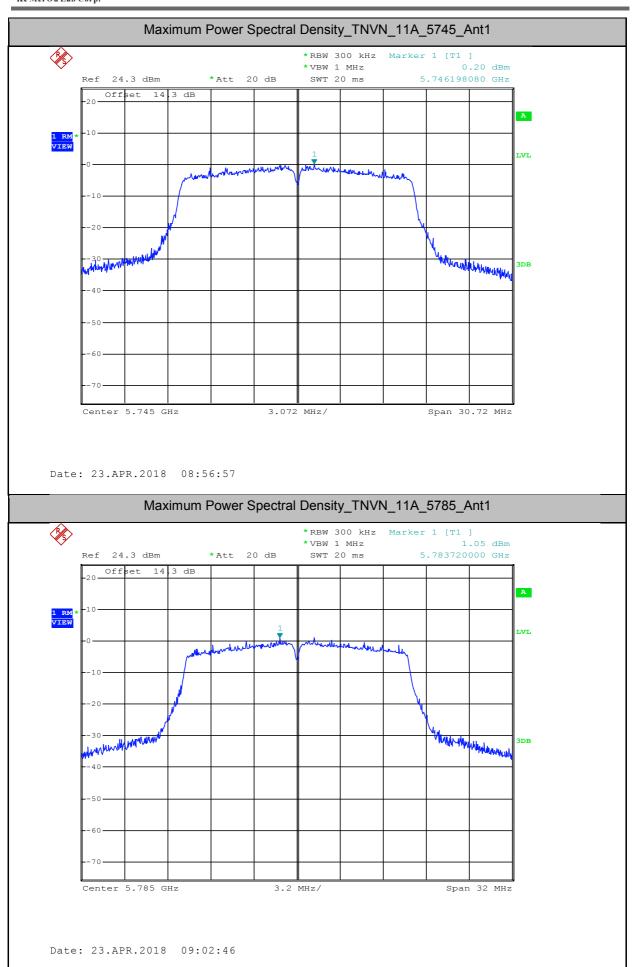


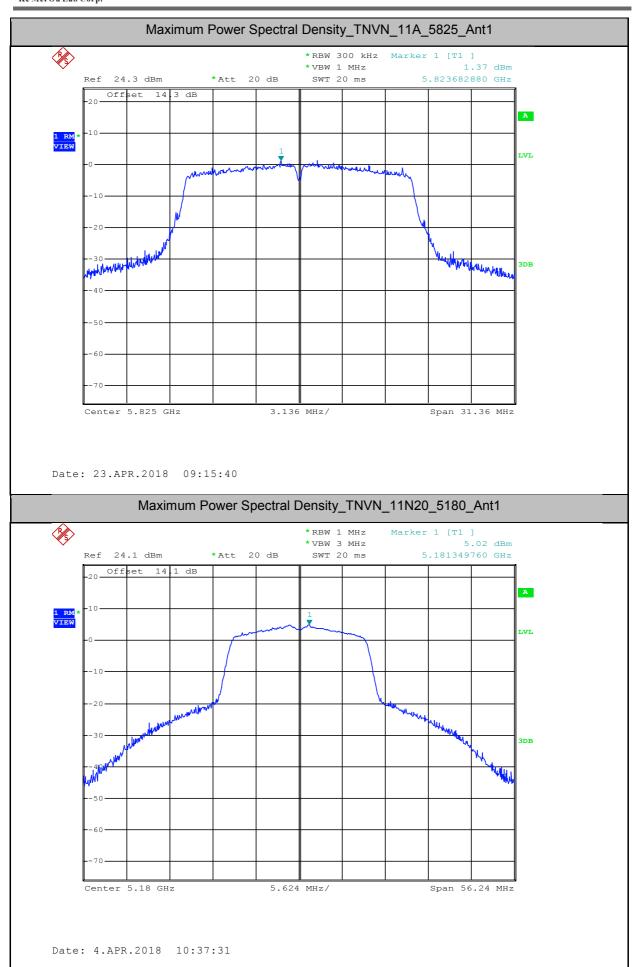


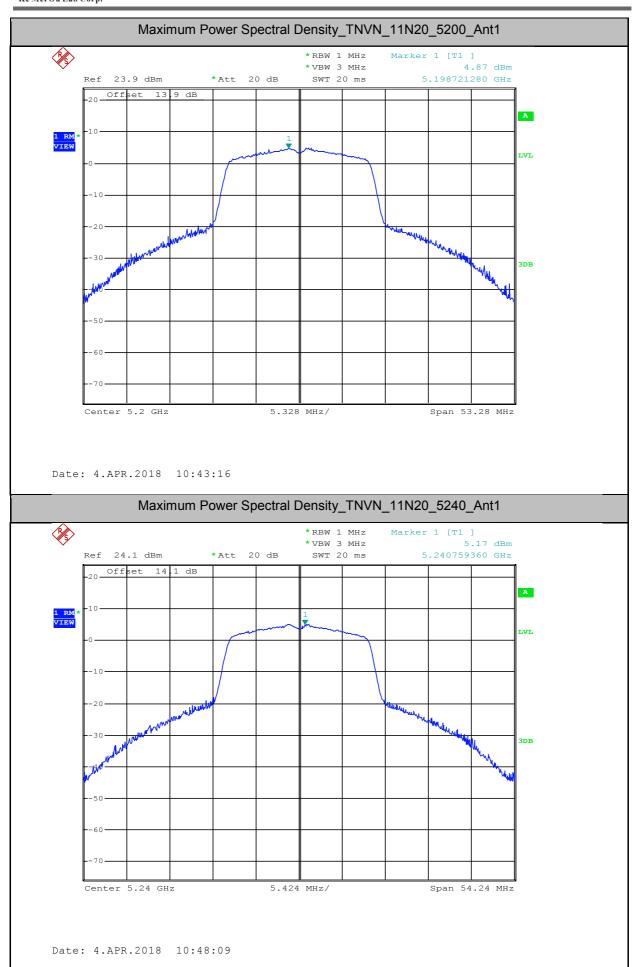


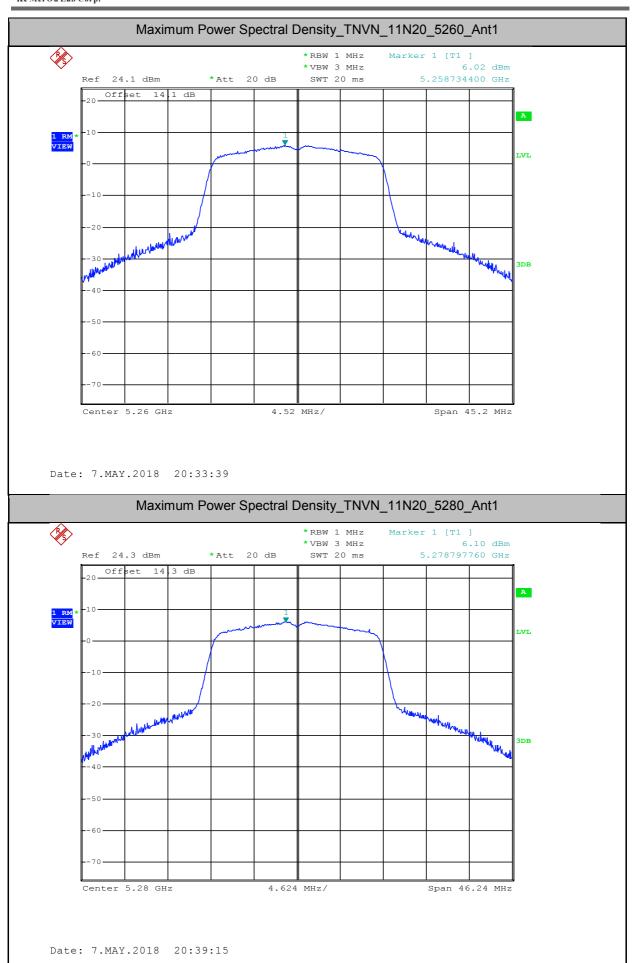


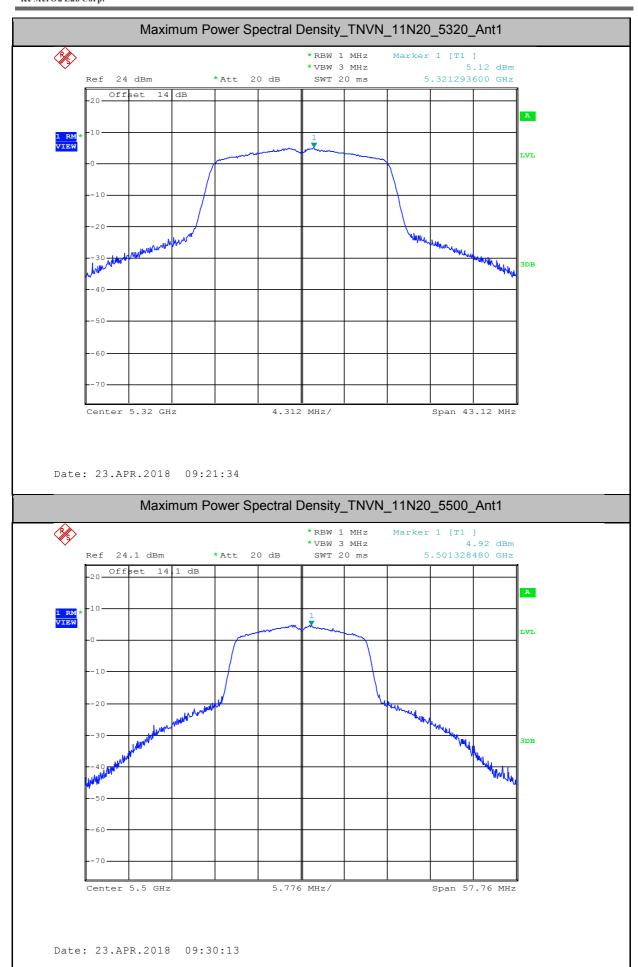


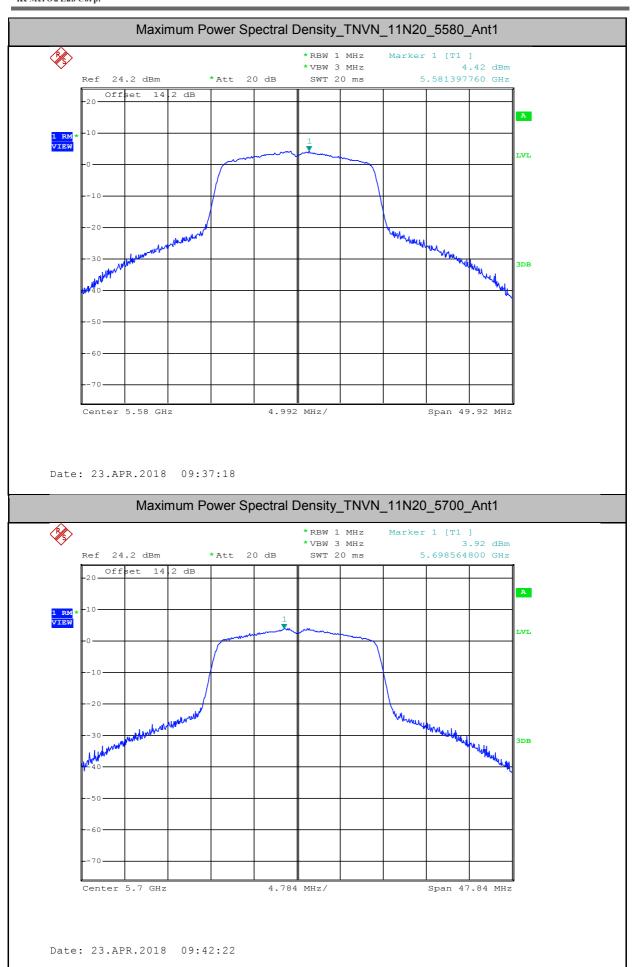


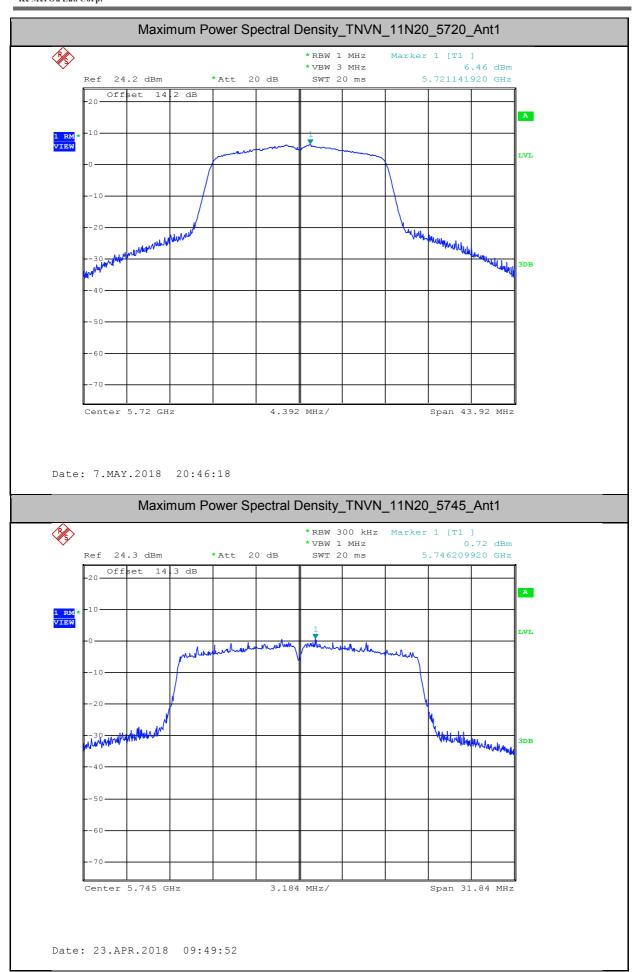


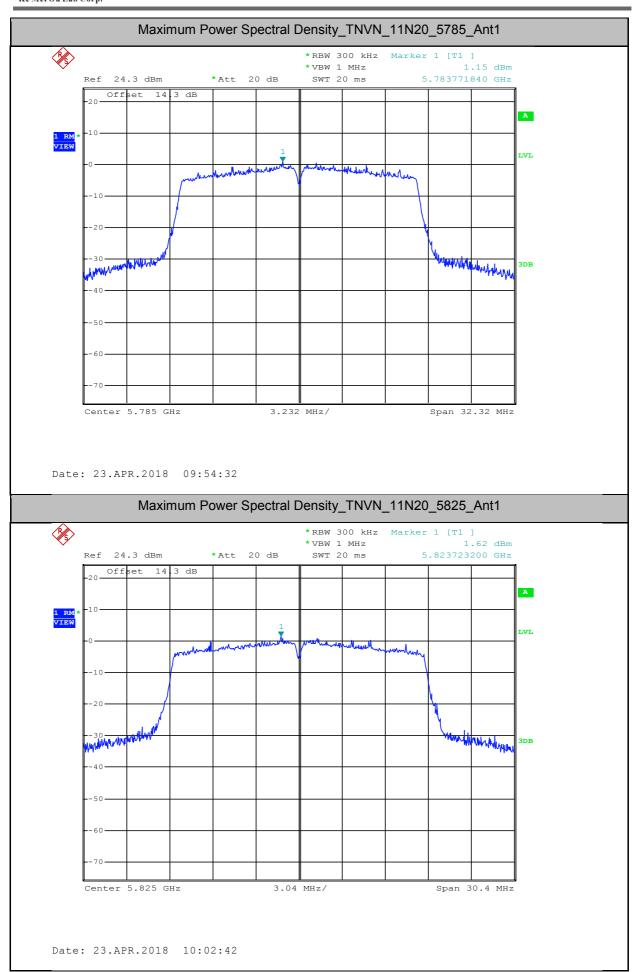


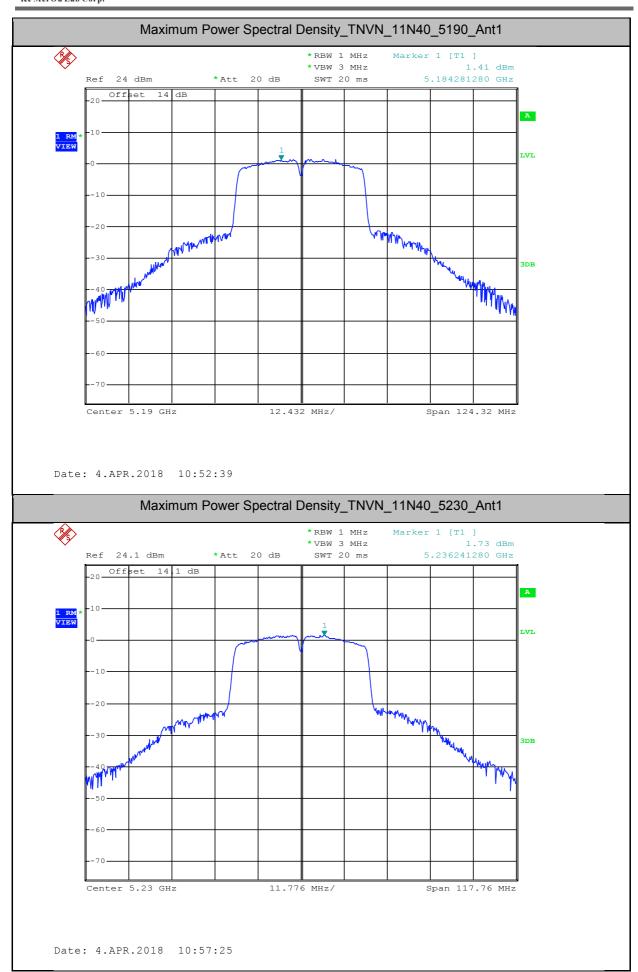

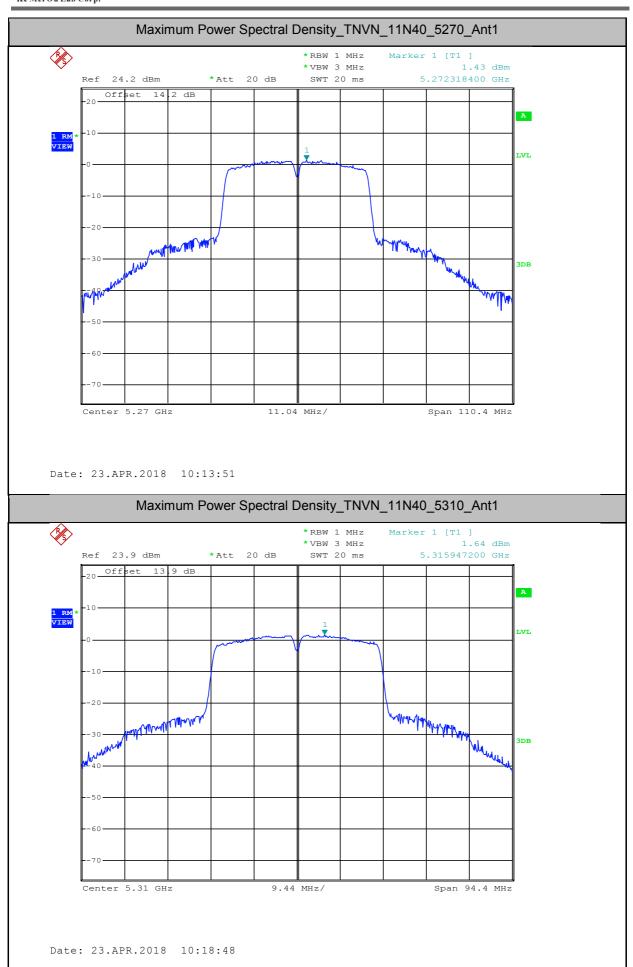

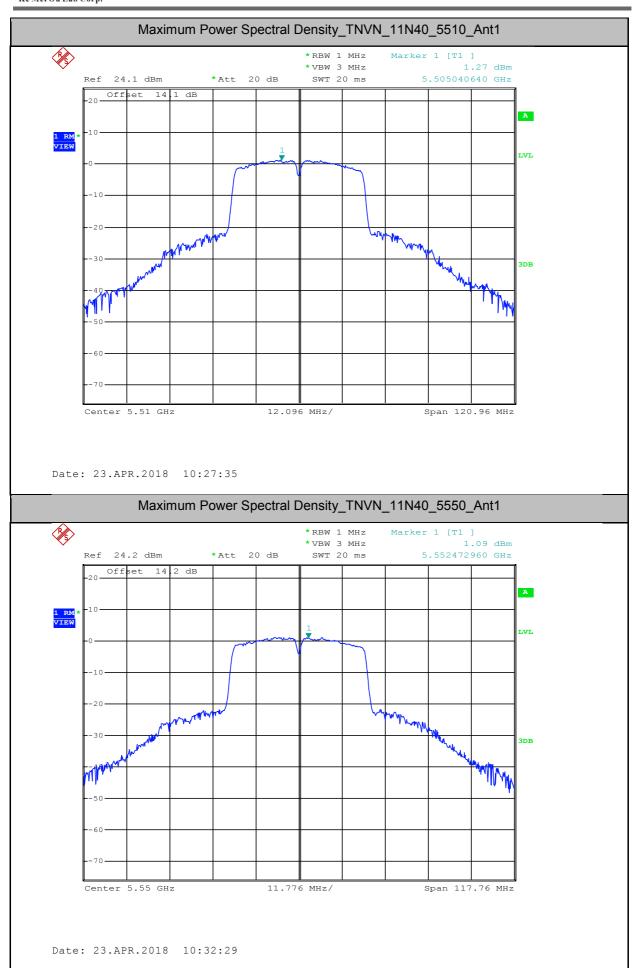

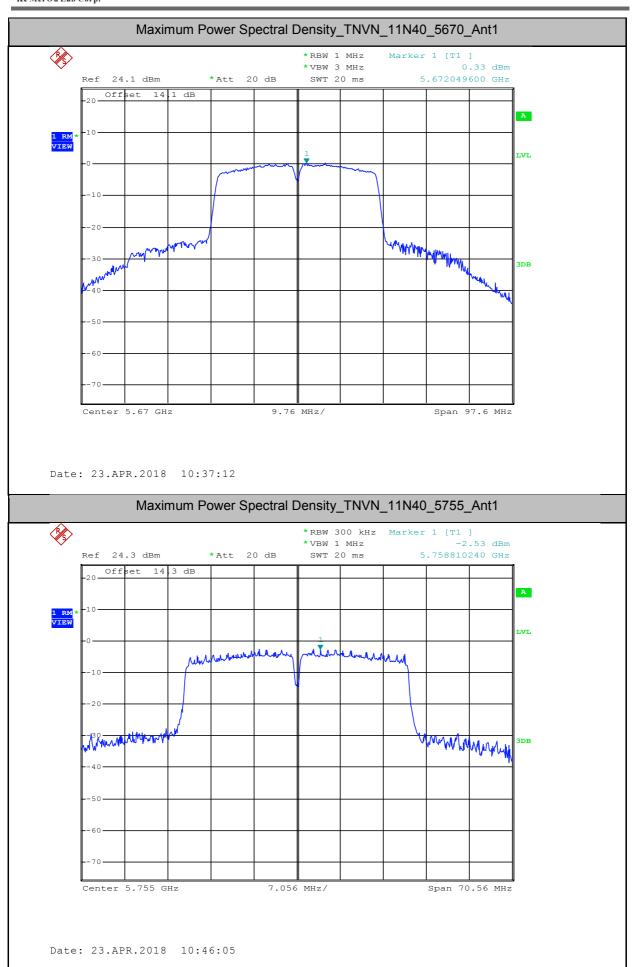


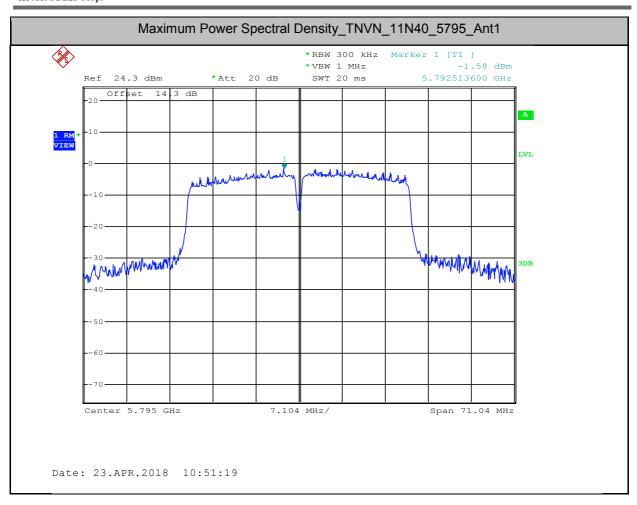



5.Band Edge Measurements


Test Mode	Test Channel	Ant	Max.Level[dBm]	Limit[dBm]	Verdict
11A	5180	Ant1	-42.25	-27	PASS
11A	5240	Ant1	-42.97	-27	PASS
11A	5260	Ant1	-44.63	-27	PASS
11A	5320	Ant1	-43.03	-27	PASS
11A	5500	Ant1	-43.29	-27	PASS
11A	5700	Ant1	-43.44	-27	PASS
11A	5720	Ant1	-41.50	-27	PASS
11N20	5180	Ant1	-42.82	-27	PASS
11N20	5240	Ant1	-44.03	-27	PASS
11N20	5260	Ant1	-43.95	-27	PASS
11N20	5320	Ant1	-43.58	-27	PASS
11N20	5500	Ant1	-43.07	-27	PASS
11N20	5700	Ant1	-43.4	-27	PASS
11N20	5720	Ant1	-40.91	-27	PASS
11N40	5190	Ant1	-35.2	-27	PASS
11N40	5230	Ant1	-44	-27	PASS
11N40	5270	Ant1	-42.54	-27	PASS
11N40	5310	Ant1	-36.23	-27	PASS
11N40	5510	Ant1	-34.48	-27	PASS
11N40	5670	Ant1	-43.06	-27	PASS


Test Mode	Test Channel	Ant	Max.Level[dBm] (Below 5715MHz)	Limit[dBm]	Max.Level[dBm](5715 to 5725MHz)	Limit[dBm]	Verdict
11A	5745	Ant1	-36.9	-27	-42.73	-17	PASS
11A	5825	Ant1	-43.45	-17	-43.93	-27	PASS
11N20	5745	Ant1	-35.83	-27	-43.87	-17	PASS
11N20	5825	Ant1	-43.55	-17	-43.61	-27	PASS
11N40	5755	Ant1	-28.06	-27	-34.42	-17	PASS
11N40	5795	Ant1	-43.64	-17	-44.03	-27	PASS

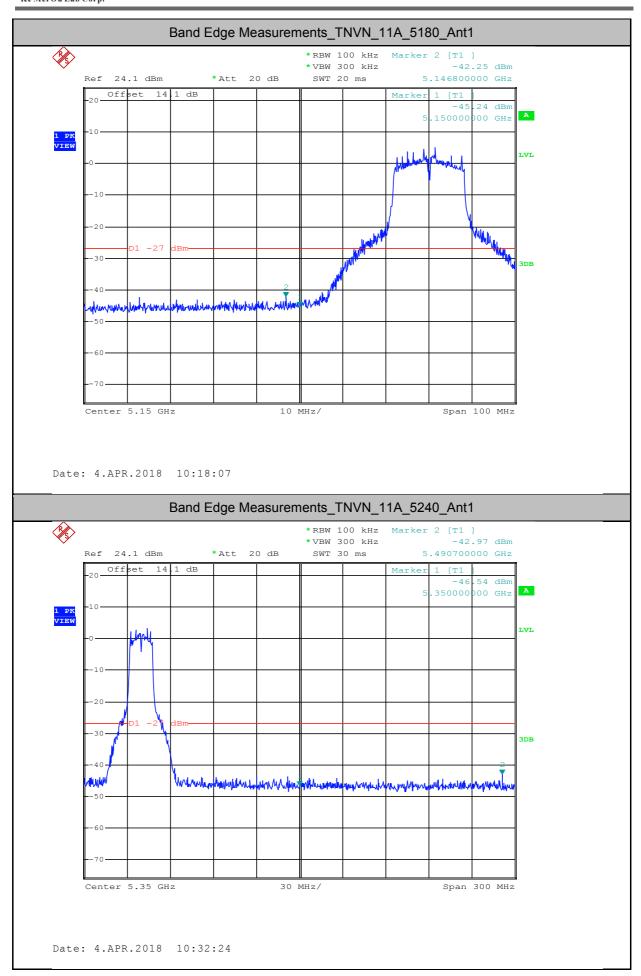


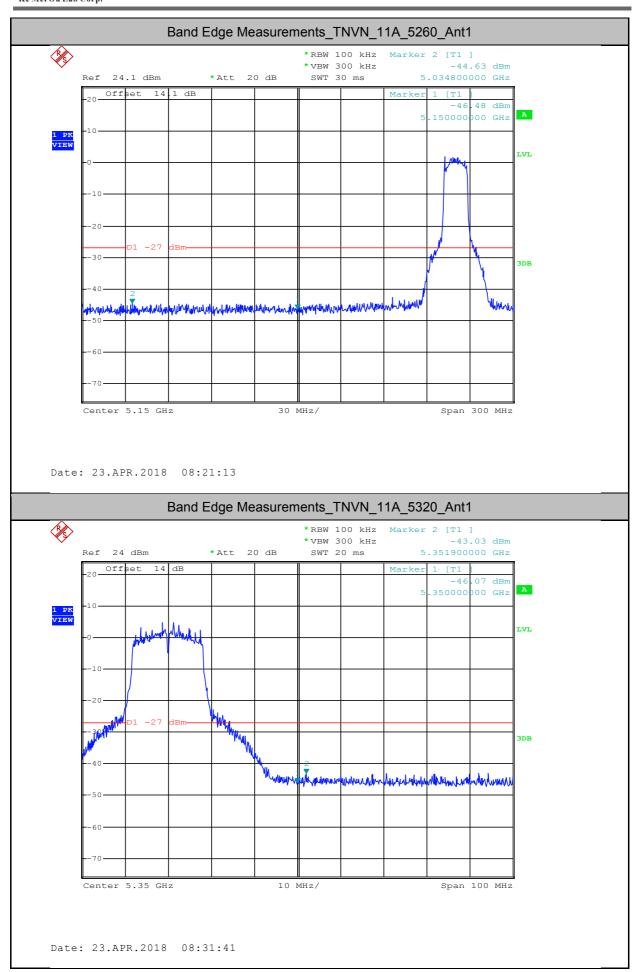


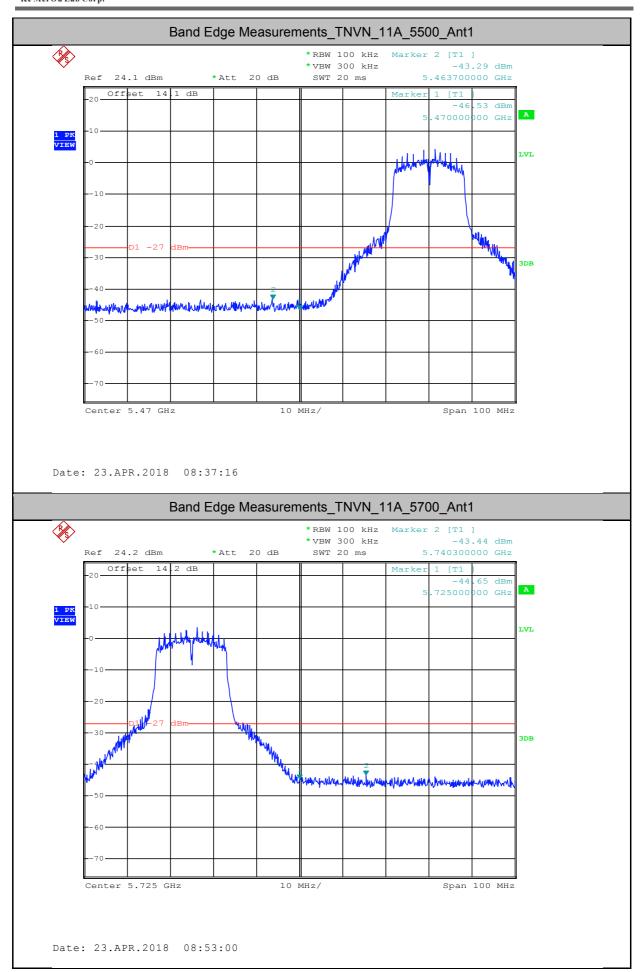


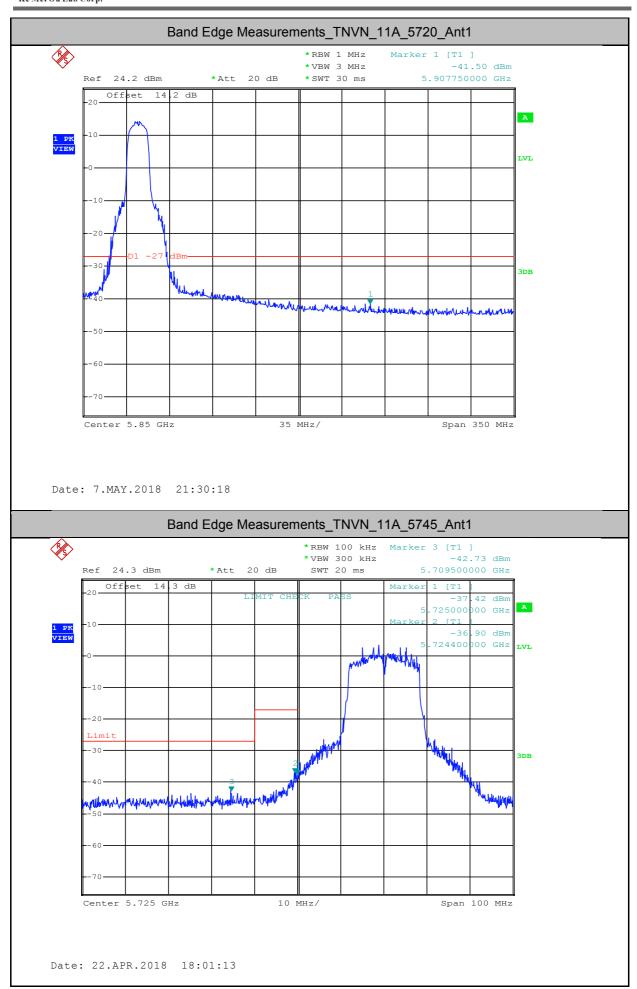


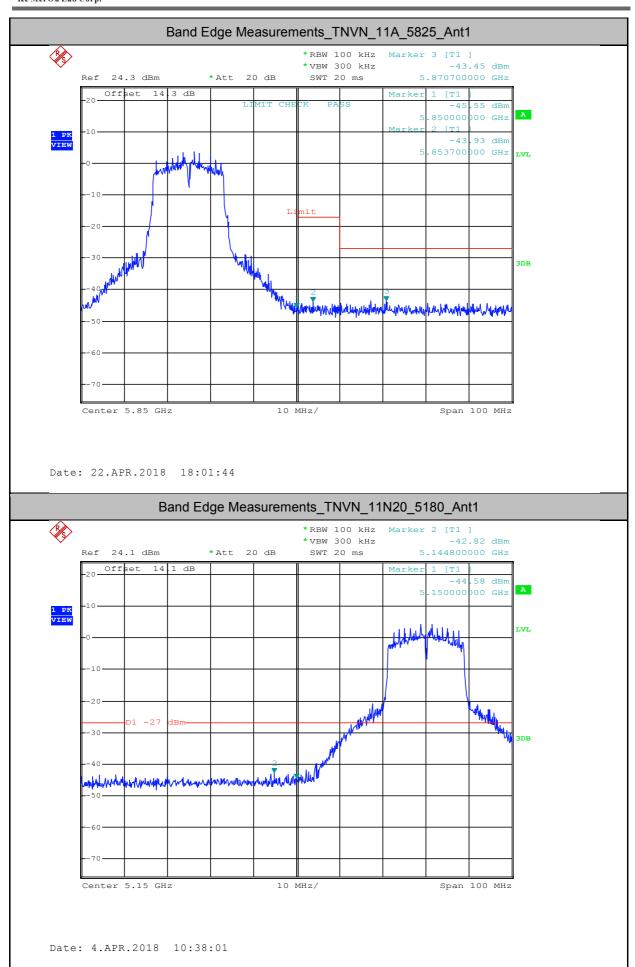


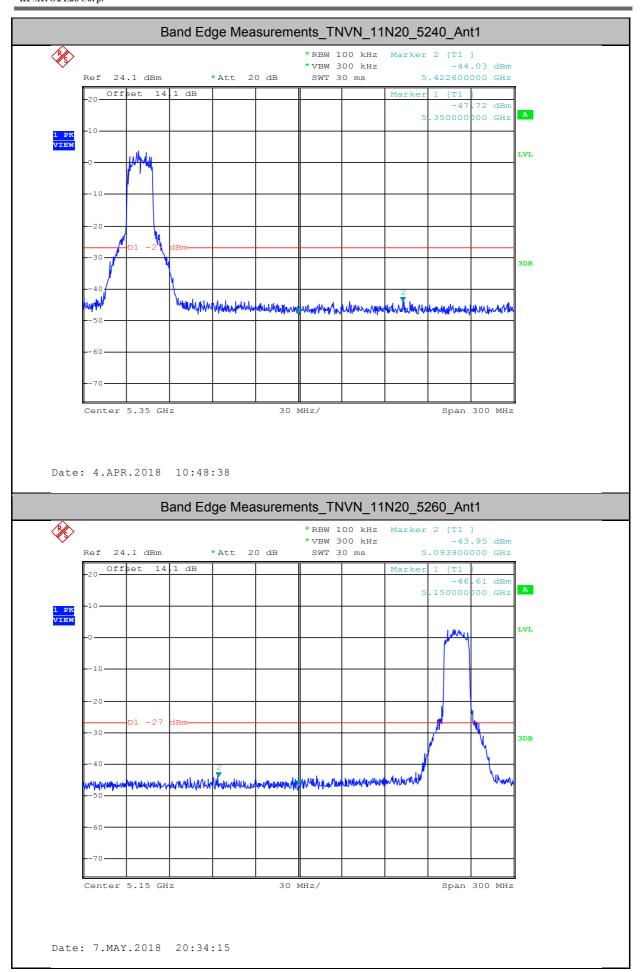


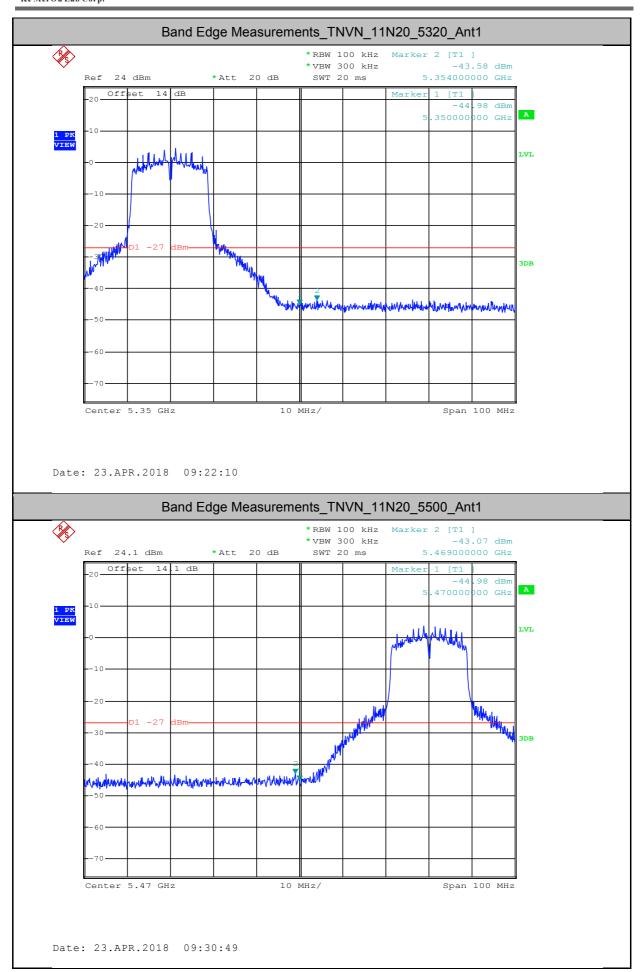


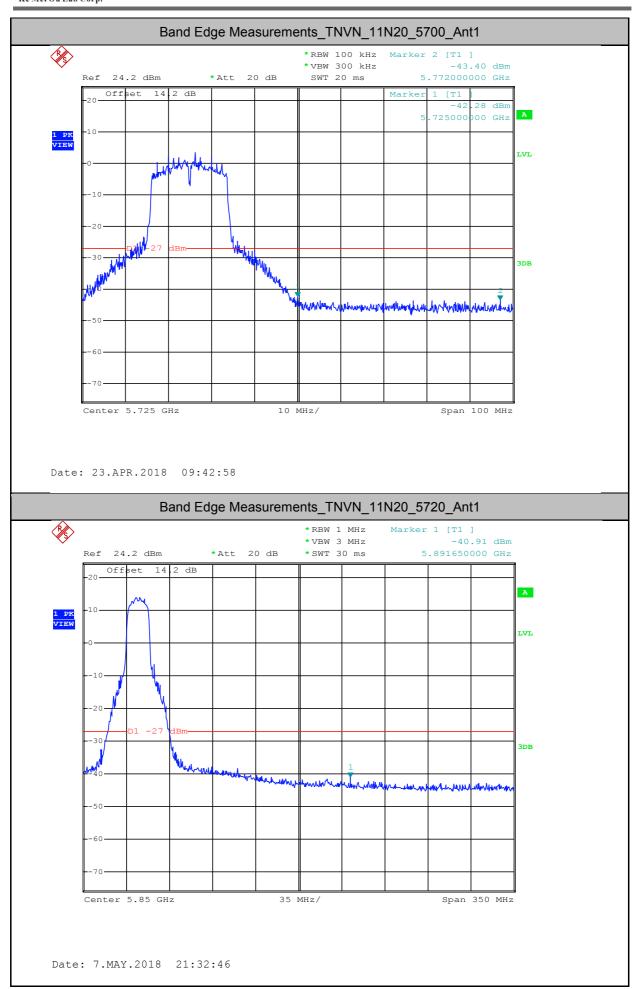


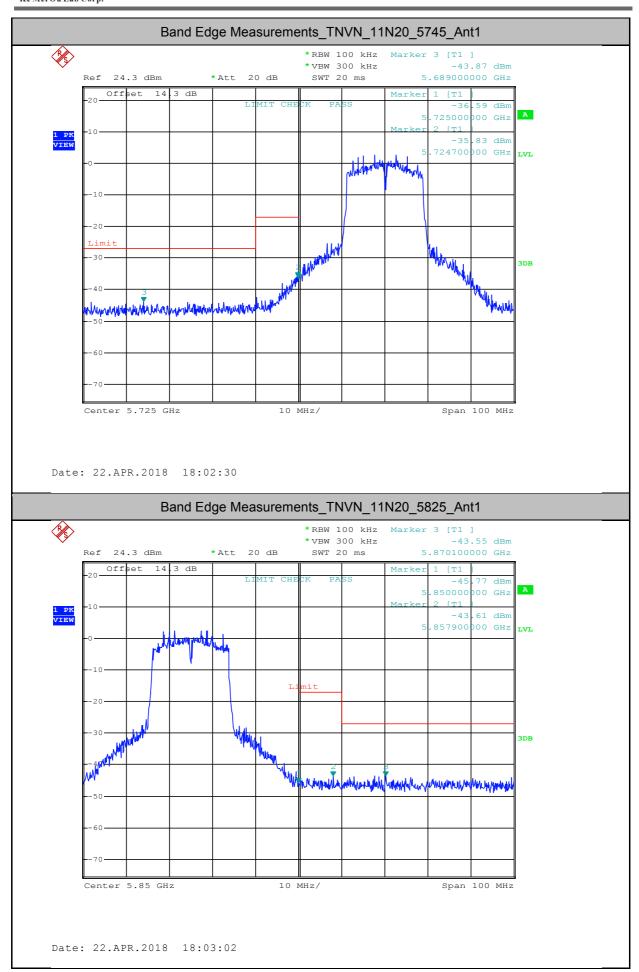

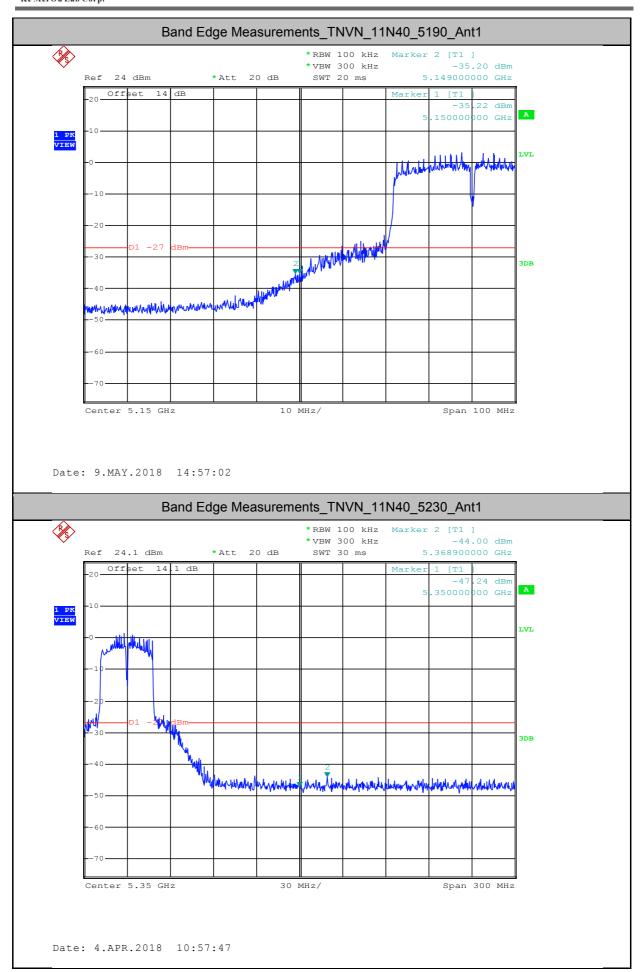

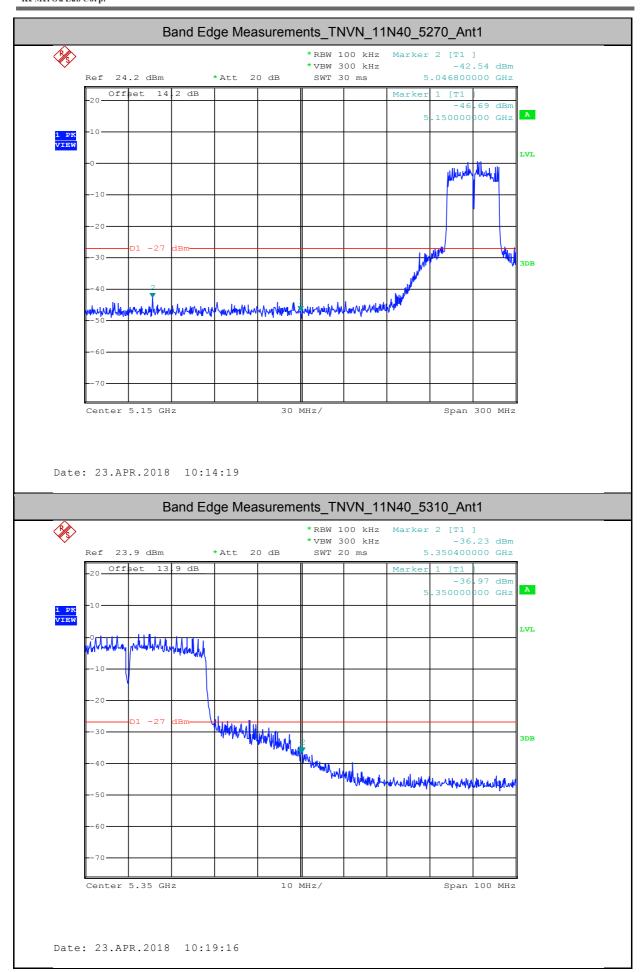

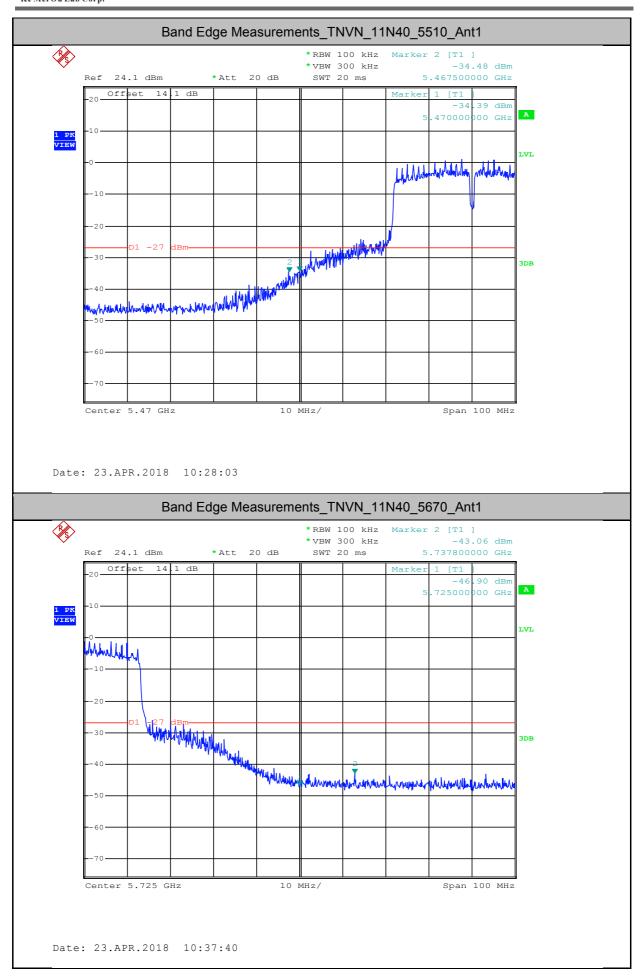

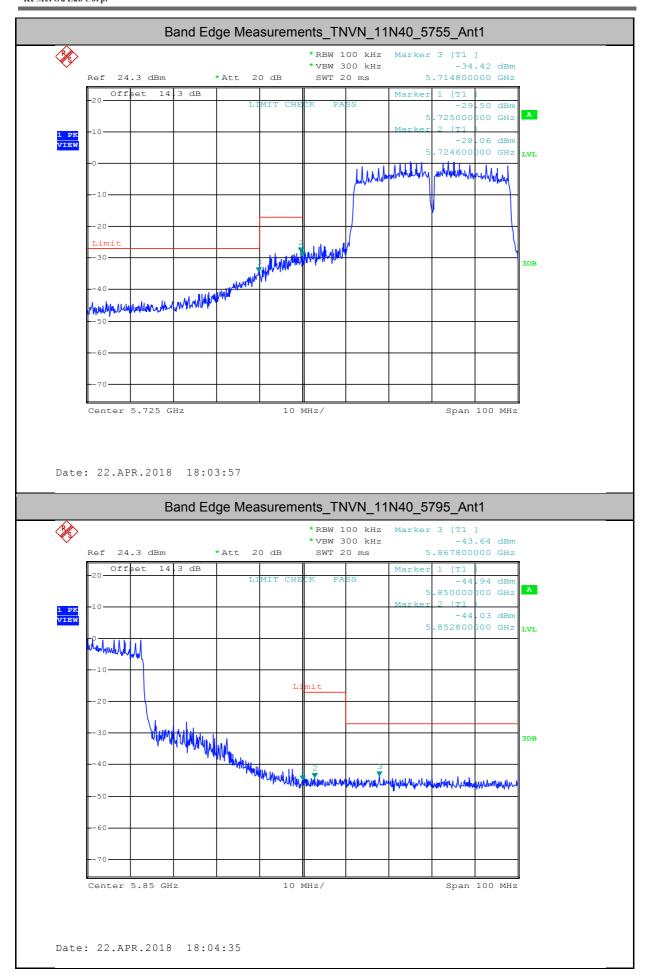



6.Frequency Stability

			Volta	ge vs. F	requency Sta	bility		
Test Mode	Test Channel	Ant	Temp.	Volt.	Deviation [MHz]	Deviation [ppm]	Limit [ppm]	Verdict
11A	5180	Ant1	TN	VN	5180.02	2.89575	20	PASS
11A	5180	Ant1	TN	VH	5180.02	2.89575	20	PASS
11A	5180	Ant1	TN	VL	5180.00	0.00000	20	PASS
11A	5200	Ant1	TN	VL	5200.03	5.76923	20	PASS
11A	5200	Ant1	TN	VN	5200.02	2.88462	20	PASS
11A	5200	Ant1	TN	VH	5200.03	5.76923	20	PASS
11A	5240	Ant1	TN	VL	5240.00	0.00000	20	PASS
11A	5240	Ant1	TN	VN	5240.00	0.00000	20	PASS
11A	5240	Ant1	TN	VH	5240.00	0.00000	20	PASS
11A	5260	Ant1	TN	VL	5259.99	-2.85171	20	PASS
11A	5260	Ant1	TN	VN	5260.00	0.00000	20	PASS
11A	5260	Ant1	TN	VH	5259.99	-2.85171	20	PASS
11A	5280	Ant1	TN	VL	5280.02	2.84091	20	PASS
11A	5280	Ant1	TN	VN	5280.02	2.84091	20	PASS
11A	5280	Ant1	TN	VH	5280.02	2.84091	20	PASS
11A	5320	Ant1	TN	VL	5320.00	0.00000	20	PASS
11A	5320	Ant1	TN	VN	5320.02	2.81955	20	PASS
11A	5320	Ant1	TN	VH	5320.03	5.63910	20	PASS
11A	5500	Ant1	TN	VL	5500.02	2.72727	20	PASS
11A	5500	Ant1	TN	VN	5500.03	5.45455	20	PASS
11A	5500	Ant1	TN	VH	5500.02	2.72727	20	PASS
11A	5580	Ant1	TN	VL	5580.02	2.68817	20	PASS
11A	5580	Ant1	TN	VN	5580.02	2.68817	20	PASS
11A	5580	Ant1	TN	VH	5580.00	0.00000	20	PASS
11A	5700	Ant1	TN	VN	5700.02	2.63158	20	PASS
11A	5700	Ant1	TN	VH	5700.02	2.63158	20	PASS
11A	5700	Ant1	TN	VL	5700.03	5.26316	20	PASS
11A	5720	Ant1	TN	VH	5720.02	2.62238	20	PASS
11A	5720	Ant1	TN	VN	5720.02	2.62238	20	PASS
11A	5720	Ant1	TN	VL	5720.02	2.62238	20	PASS
11A	5745	Ant1	TN	VH	5745.02	2.61097	20	PASS
11A	5745	Ant1	TN	VN	5745.02	2.61097	20	PASS
11A	5745	Ant1	TN	VL	5745.02	2.61097	20	PASS
11A	5785	Ant1	TN	VH	5785.03	5.18583	20	PASS
11A	5785	Ant1	TN	VN	5785.03	5.18583	20	PASS



11A	5785	A 1.4						1
	0100	Ant1	TN	VL	5785.03	5.18583	20	PASS
11A	5825	Ant1	TN	VN	5825.02	2.57511	20	PASS
11A	5825	Ant1	TN	VL	5825.02	2.57511	20	PASS
11A	5825	Ant1	TN	VH	5825.02	2.57511	20	PASS
11N20	5180	Ant1	TN	VH	5180.00	0.00000	20	PASS
11N20	5180	Ant1	TN	VN	5180.02	2.89575	20	PASS
11N20	5180	Ant1	TN	VL	5180.00	0.00000	20	PASS
11N20	5200	Ant1	TN	VH	5200.02	2.88462	20	PASS
11N20	5200	Ant1	TN	VN	5200.03	5.76923	20	PASS
11N20	5200	Ant1	TN	VL	5200.02	2.88462	20	PASS
11N20	5240	Ant1	TN	VN	5240.02	2.86260	20	PASS
11N20	5240	Ant1	TN	VL	5240.02	2.86260	20	PASS
11N20	5240	Ant1	TN	VH	5240.00	0.00000	20	PASS
11N20	5260	Ant1	TN	VH	5260.03	5.70342	20	PASS
11N20	5260	Ant1	TN	VL	5260.02	2.85171	20	PASS
11N20	5260	Ant1	TN	VN	5260.02	2.85171	20	PASS
11N20	5280	Ant1	TN	VL	5280.00	0.00000	20	PASS
11N20	5280	Ant1	TN	VN	5280.02	2.84091	20	PASS
11N20	5280	Ant1	TN	VH	5280.02	2.84091	20	PASS
11N20	5320	Ant1	TN	VH	5320.05	8.45865	20	PASS
11N20	5320	Ant1	TN	VL	5320.02	2.81955	20	PASS
11N20	5320	Ant1	TN	VN	5320.02	2.81955	20	PASS
11N20	5500	Ant1	TN	VH	5500.02	2.72727	20	PASS
11N20	5500	Ant1	TN	VL	5500.00	0.00000	20	PASS
11N20	5500	Ant1	TN	VN	5500.03	5.45455	20	PASS
11N20	5580	Ant1	TN	VH	5580.02	2.68817	20	PASS
11N20	5580	Ant1	TN	VL	5580.00	0.00000	20	PASS
11N20	5580	Ant1	TN	VN	5580.00	0.00000	20	PASS
11N20	5700	Ant1	TN	VL	5700.02	2.63158	20	PASS
11N20	5700	Ant1	TN	VN	5700.02	2.63158	20	PASS
11N20	5700	Ant1	TN	VH	5700.02	2.63158	20	PASS
11N20	5720	Ant1	TN	VL	5720.02	2.62238	20	PASS
11N20	5720	Ant1	TN	VN	5720.02	2.62238	20	PASS
11N20	5720	Ant1	TN	VH	5720.00	0.00000	20	PASS
11N20	5745	Ant1	TN	VH	5745.02	2.61097	20	PASS
11N20	5745	Ant1	TN	VL	5745.00	0.00000	20	PASS
11N20	5745	Ant1	TN	VN	5745.00	0.00000	20	PASS
11N20	5785	Ant1	TN	VN	5785.03	5.18583	20	PASS
11N20	5785	Ant1	TN	VL	5785.03	5.18583	20	PASS
11N20	5785	Ant1	TN	VH	5785.02	2.59291	20	PASS



11N20	5825	Ant1	TN	VL	5825.00	0.00000	20	PASS
11N20	5825	Ant1	TN	VN	5825.03	5.15022	20	PASS
11N20	5825	Ant1	TN	VH	5825.00	0.00000	20	PASS
11N40	5190	Ant1	TN	VH	5190.00	0.00000	20	PASS
11N40	5190	Ant1	TN	VN	5190.00	0.00000	20	PASS
11N40	5190	Ant1	TN	VL	5190.03	5.78035	20	PASS
11N40	5230	Ant1	TN	VN	5230.00	0.00000	20	PASS
11N40	5230	Ant1	TN	VL	5230.00	0.00000	20	PASS
11N40	5230	Ant1	TN	VH	5230.03	5.73614	20	PASS
11N40	5270	Ant1	TN	VL	5270.03	5.69260	20	PASS
11N40	5270	Ant1	TN	VN	5270.03	5.69260	20	PASS
11N40	5270	Ant1	TN	VH	5270.03	5.69260	20	PASS
11N40	5310	Ant1	TN	VH	5310.03	5.64972	20	PASS
11N40	5310	Ant1	TN	VN	5310.00	0.00000	20	PASS
11N40	5310	Ant1	TN	VL	5310.00	0.00000	20	PASS
11N40	5510	Ant1	TN	VL	5510.00	0.00000	20	PASS
11N40	5510	Ant1	TN	VN	5510.00	0.00000	20	PASS
11N40	5510	Ant1	TN	VH	5510.03	5.44465	20	PASS
11N40	5550	Ant1	TN	VL	5550.00	0.00000	20	PASS
11N40	5550	Ant1	TN	VH	5550.00	0.00000	20	PASS
11N40	5550	Ant1	TN	VN	5550.00	0.00000	20	PASS
11N40	5670	Ant1	TN	VL	5670.00	0.00000	20	PASS
11N40	5670	Ant1	TN	VN	5670.00	0.00000	20	PASS
11N40	5670	Ant1	TN	VH	5670.06	10.58201	20	PASS
11N40	5755	Ant1	TN	VN	5755.03	5.21286	20	PASS
11N40	5755	Ant1	TN	VH	5755.00	0.00000	20	PASS
11N40	5755	Ant1	TN	VL	5755.03	5.21286	20	PASS
11N40	5795	Ant1	TN	VH	5795.03	5.17688	20	PASS
11N40	5795	Ant1	TN	VN	5795.03	5.17688	20	PASS
11N40	5795	Ant1	TN	VL	5795.06	10.35375	20	PASS



		Te	empera	ature vs	. Frequency S	Stability		
Test Mode	Test Channel	Ant	Volt.	Temp.	Deviation [MHz]	Deviation [ppm]	Limit [ppm]	Verdict
11A	5180	Ant1	VN	-20	5180.02	2.89575	20	PASS
11A	5180	Ant1	VN	-10	5180.02	2.89575	20	PASS
11A	5180	Ant1	VN	0	5180.02	2.89575	20	PASS
11A	5180	Ant1	VN	10	5180.02	2.89575	20	PASS
11A	5180	Ant1	VN	20	5180.02	2.89575	20	PASS
11A	5180	Ant1	VN	30	5180.03	5.79151	20	PASS
11A	5180	Ant1	VN	40	5180.00	0.00000	20	PASS
11A	5180	Ant1	VN	50	5180.00	0.00000	20	PASS
11A	5180	Ant1	VN	-30	5180.02	2.89575	20	PASS
11A	5200	Ant1	VN	-20	5200.03	5.76923	20	PASS
11A	5200	Ant1	VN	50	5200.00	0.00000	20	PASS
11A	5200	Ant1	VN	40	5200.02	2.88462	20	PASS
11A	5200	Ant1	VN	30	5200.00	0.00000	20	PASS
11A	5200	Ant1	VN	20	5200.02	2.88462	20	PASS
11A	5200	Ant1	VN	10	5200.00	0.00000	20	PASS
11A	5200	Ant1	VN	-10	5200.00	0.00000	20	PASS
11A	5200	Ant1	VN	-30	5200.03	5.76923	20	PASS
11A	5200	Ant1	VN	0	5200.03	5.76923	20	PASS
11A	5240	Ant1	VN	0	5240.00	0.00000	20	PASS
11A	5240	Ant1	VN	10	5240.02	2.86260	20	PASS
11A	5240	Ant1	VN	-30	5240.00	0.00000	20	PASS
11A	5240	Ant1	VN	-20	5240.00	0.00000	20	PASS
11A	5240	Ant1	VN	20	5240.00	0.00000	20	PASS
11A	5240	Ant1	VN	30	5240.02	2.86260	20	PASS
11A	5240	Ant1	VN	40	5240.02	2.86260	20	PASS
11A	5240	Ant1	VN	50	5240.00	0.00000	20	PASS
11A	5240	Ant1	VN	-10	5240.02	2.86260	20	PASS
11A	5260	Ant1	VN	20	5260.02	2.85171	20	PASS
11A	5260	Ant1	VN	50	5260.02	2.85171	20	PASS
11A	5260	Ant1	VN	30	5259.99	-2.85171	20	PASS
11A	5260	Ant1	VN	10	5260.02	2.85171	20	PASS
11A	5260	Ant1	VN	0	5260.00	0.00000	20	PASS
11A	5260	Ant1	VN	-10	5260.00	0.00000	20	PASS
11A	5260	Ant1	VN	-20	5260.02	2.85171	20	PASS
11A	5260	Ant1	VN	-30	5260.00	0.00000	20	PASS
11A	5260	Ant1	VN	40	5260.00	0.00000	20	PASS
11A	5280	Ant1	VN	-30	5280.02	2.84091	20	PASS



11A 5280									
11A 5280	11A	5280	Ant1	VN	-20	5280.03	5.68182	20	PASS
11A 5280	11A	5280	Ant1	VN	0	5280.03	5.68182	20	PASS
11A 5280 Antt VN 30 5280.02 2.84091 20 PASS 11A 5280 Antt VN 40 5280.02 2.84091 20 PASS 11A 5280 Antt VN 50 5280.03 5.68182 20 PASS 11A 5280 Antt VN -10 5280.02 2.84091 20 PASS 11A 5320 Antt VN -0 5320.02 2.81955 20 PASS 11A 5320 Antt VN -10 5320.02 2.81955 20 PASS 11A 5320 Antt VN 0 5320.02 2.81955 20 PASS 11A 5320 Antt VN 0 5320.02 2.81955 20 PASS 11A 5320 Antt VN 20 5320.02 2.81955 20 PASS 11A 5320 Antt VN	11A	5280	Ant1	VN	10	5280.02	2.84091	20	PASS
11A 5280 Antt VN 40 5280.02 2.84091 20 PASS 11A 5280 Antt VN 50 5280.03 5.68182 20 PASS 11A 5280 Antt VN -10 5280.02 2.84091 20 PASS 11A 5320 Antt VN -20 5320.02 2.81955 20 PASS 11A 5320 Antt VN -20 5320.02 2.81955 20 PASS 11A 5320 Antt VN -10 5320.02 2.81955 20 PASS 11A 5320 Antt VN 0 5320.02 2.81955 20 PASS 11A 5320 Antt VN 10 5320.02 2.81955 20 PASS 11A 5320 Antt VN 20 5320.02 2.81955 20 PASS 11A 5320 Antt VN	11A	5280	Ant1	VN	20	5280.02	2.84091	20	PASS
11A 5280 Antt VN 50 5280.03 5.68182 20 PASS 11A 5280 Antt VN -10 5280.02 2.84091 20 PASS 11A 5320 Antt VN 50 5320.02 2.81955 20 PASS 11A 5320 Antt VN -10 5320.02 2.81955 20 PASS 11A 5320 Antt VN -10 5320.02 2.81955 20 PASS 11A 5320 Antt VN 0 5320.02 2.81955 20 PASS 11A 5320 Antt VN 20 5320.02 2.81955 20 PASS 11A 5320 Antt VN 20 5320.02 2.81955 20 PASS 11A 5320 Antt VN -30 5320.02 2.81955 20 PASS 11A 5320 Antt VN	11A	5280	Ant1	VN	30	5280.02	2.84091	20	PASS
11A 5280 Ant1 VN -10 5280.02 2.84091 20 PASS 11A 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -10 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN	11A	5280	Ant1	VN	40	5280.02	2.84091	20	PASS
11A 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -10 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN	11A	5280	Ant1	VN	50	5280.03	5.68182	20	PASS
11A 5320 Ant1 VN -20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -10 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5280	Ant1	VN	-10	5280.02	2.84091	20	PASS
11A 5320 Ant1 VN -10 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN -40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN -40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN -40 5320.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	50	5320.02	2.81955	20	PASS
11A 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	-20	5320.02	2.81955	20	PASS
11A 5320 Ant1 VN 10 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	-10	5320.02	2.81955	20	PASS
11A 5320 Ant1 VN 20 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	0	5320.02	2.81955	20	PASS
11A 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 0 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	10	5320.03	5.63910	20	PASS
11A 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	20	5320.02	2.81955	20	PASS
11A 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 40 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN	11A	5320	Ant1	VN	30	5320.03	5.63910	20	PASS
11A 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.68817 20 PASS 11A 5580 Ant1 VN	11A	5320	Ant1	VN	-30	5320.02	2.81955	20	PASS
11A 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN	11A	5320	Ant1	VN	40	5320.02	2.81955	20	PASS
11A 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	10	5500.02	2.72727	20	PASS
11A 5500 Ant1 VN 0 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 20 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	-20	5500.02	2.72727	20	PASS
11A 5500 Ant1 VN 20 5500.03 5.45455 20 PASS 11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	-10	5500.00	0.00000	20	PASS
11A 5500 Ant1 VN 40 5500.00 0.00000 20 PASS 11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 20 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	0	5500.02	2.72727	20	PASS
11A 5500 Ant1 VN 50 5499.99 -2.72727 20 PASS 11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	20	5500.03	5.45455	20	PASS
11A 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	40	5500.00	0.00000	20	PASS
11A 5500 Ant1 VN 30 5500.00 0.00000 20 PASS 11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN	11A	5500	Ant1	VN	50	5499.99	-2.72727	20	PASS
11A 5580 Ant1 VN 10 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN	11A	5500	Ant1	VN	-30	5500.02	2.72727	20	PASS
11A 5580 Ant1 VN 50 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 40 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN 30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN	11A	5500	Ant1	VN	30	5500.00	0.00000	20	PASS
11A 5580 Ant1 VN 40 5580.03 5.37634 20 PASS 11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN	11A	5580	Ant1	VN	10	5580.02	2.68817	20	PASS
11A 5580 Ant1 VN 20 5580.02 2.68817 20 PASS 11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN	11A	5580	Ant1	VN	50	5580.02	2.68817	20	PASS
11A 5580 Ant1 VN 0 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	40	5580.03	5.37634	20	PASS
11A 5580 Ant1 VN -10 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	20	5580.02	2.68817	20	PASS
11A 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	0	5580.00	0.00000	20	PASS
11A 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	-10	5580.00	0.00000	20	PASS
11A 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	-20	5580.00	0.00000	20	PASS
11A 5700 Ant1 VN -30 5700.00 0.00000 20 PASS 11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	-30	5580.00	0.00000	20	PASS
11A 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5580	Ant1	VN	30	5580.00	0.00000	20	PASS
11A 5700 Ant1 VN 30 5700.03 5.26316 20 PASS 11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5700	Ant1	VN	-30	5700.00	0.00000	20	PASS
11A 5700 Ant1 VN 20 5700.03 5.26316 20 PASS	11A	5700	Ant1	VN	50	5700.02	2.63158	20	PASS
	11A	5700	Ant1	VN	30	5700.03	5.26316	20	PASS
11A 5700 Ant1 VN 10 5700.03 5.26316 20 PASS	11A	5700	Ant1	VN	20	5700.03	5.26316	20	PASS
	11A	5700	Ant1	VN	10	5700.03	5.26316	20	PASS



11A									
11A 5700 Ant1 VN 40 5700.02 2.63158 20 PASS 11A 5700 Ant1 VN -20 5700.00 0.00000 20 PASS 11A 5720 Ant1 VN -10 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 10 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 10 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 40 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 50 5720.02 2.62238 20 PASS 11A 5745 Ant1 VN	11A	5700	Ant1	VN	0	5700.02	2.63158	20	PASS
11A	11A	5700	Ant1	VN	-10	5700.05	7.89474	20	PASS
11A 5720 Antl VN -10 5720.02 2.62238 20 PASS 11A 5720 Antl VN 0 5720.05 7.86713 20 PASS 11A 5720 Antl VN 10 5720.02 2.62238 20 PASS 11A 5720 Antl VN 20 5719.99 -2.62238 20 PASS 11A 5720 Antl VN 30 5720.02 2.62238 20 PASS 11A 5720 Antl VN -30 5720.02 2.62238 20 PASS 11A 5720 Antl VN -30 5720.02 2.62238 20 PASS 11A 5720 Antl VN -20 5720.02 2.62238 20 PASS 11A 5745 Antl VN -0 5745.03 5.22193 20 PASS 11A 5745 Antl VN	11A	5700	Ant1	VN	40	5700.02	2.63158	20	PASS
11A 5720 Antl VN 0 5720.05 7.86713 20 PASS 11A 5720 Antl VN 10 5720.02 2.62238 20 PASS 11A 5720 Antl VN 20 5719.99 -2.62238 20 PASS 11A 5720 Antl VN 30 5720.02 2.62238 20 PASS 11A 5720 Antl VN 40 5720.02 2.62238 20 PASS 11A 5720 Antl VN -30 5720.02 2.62238 20 PASS 11A 5720 Antl VN -20 5720.02 2.62238 20 PASS 11A 5745 Antl VN -20 5720.02 2.62238 20 PASS 11A 5745 Antl VN -20 5745.03 5.22193 20 PASS 11A 5745 Antl VN	11A	5700	Ant1	VN	-20	5700.00	0.00000	20	PASS
11A 5720 Antl VN 10 5720.02 2.62238 20 PASS 11A 5720 Antl VN 20 5719.99 -2.62238 20 PASS 11A 5720 Antl VN 30 5720.02 2.62238 20 PASS 11A 5720 Antl VN 40 5720.02 2.62238 20 PASS 11A 5720 Antl VN 50 5720.02 2.62238 20 PASS 11A 5720 Antl VN -20 5720.02 2.62238 20 PASS 11A 5720 Antl VN -20 5720.02 2.62238 20 PASS 11A 5745 Antl VN 0 5745.03 5.22193 20 PASS 11A 5745 Antl VN 40 5745.00 0.00000 20 PASS 11A 5745 Antl VN	11A	5720	Ant1	VN	-10	5720.02	2.62238	20	PASS
11A 5720 Antt VN 20 5719.99 -2.62238 20 PASS 11A 5720 Antt VN 30 5720.02 2.62238 20 PASS 11A 5720 Antt VN 40 5720.02 2.62238 20 PASS 11A 5720 Antt VN 50 5720.02 2.62238 20 PASS 11A 5720 Antt VN 50 5720.02 2.62238 20 PASS 11A 5720 Antt VN -20 5720.02 2.62238 20 PASS 11A 5745 Antt VN 0 5745.03 5.22193 20 PASS 11A 5745 Antt VN 40 5745.00 0.00000 20 PASS 11A 5745 Antt VN -30 5745.00 2.61097 20 PASS 11A 5745 Antt VN	11A	5720	Ant1	VN	0	5720.05	7.86713	20	PASS
11A 5720 Ant1 VN 30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 40 5720.03 5.24476 20 PASS 11A 5720 Ant1 VN -30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 50 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN -20 5720.02 2.62238 20 PASS 11A 5745 Ant1 VN 0 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 40 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN -30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN	11A	5720	Ant1	VN	10	5720.02	2.62238	20	PASS
11A 5720 Ant1 VN 40 5720.03 5.24476 20 PASS 11A 5720 Ant1 VN -30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 50 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN -20 5720.02 2.62238 20 PASS 11A 5745 Ant1 VN 0 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 40 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN	11A	5720	Ant1	VN	20	5719.99	-2.62238	20	PASS
11A 5720 Ant1 VN -30 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN 50 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN -20 5720.02 2.62238 20 PASS 11A 5745 Ant1 VN 0 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 40 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN	11A	5720	Ant1	VN	30	5720.02	2.62238	20	PASS
11A 5720 Ant1 VN 50 5720.02 2.62238 20 PASS 11A 5720 Ant1 VN -20 5720.02 2.62238 20 PASS 11A 5745 Ant1 VN 0 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 40 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5744.99 -2.61097 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN	11A	5720	Ant1	VN	40	5720.03	5.24476	20	PASS
11A 5720 Antt VN -20 5720.02 2.62238 20 PASS 11A 5745 Antt VN 0 5745.03 5.22193 20 PASS 11A 5745 Antt VN 40 5745.00 0.00000 20 PASS 11A 5745 Antt VN 30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -10 5745.02 2.61097 20 PASS 11A 5745 Antt VN -10 5745.02 2.61097 20 PASS 11A 5745 Antt VN -20 5744.99 -2.61097 20 PASS 11A 5745 Antt VN 20 5745.00 0.00000 20 PASS 11A 5745 Antt VN	11A	5720	Ant1	VN	-30	5720.02	2.62238	20	PASS
11A 5745 Antt VN 0 5745.03 5.22193 20 PASS 11A 5745 Antt VN 40 5745.00 0.00000 20 PASS 11A 5745 Antt VN 30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -10 5745.02 2.61097 20 PASS 11A 5745 Antt VN -20 5744.99 -2.61097 20 PASS 11A 5745 Antt VN -20 5745.00 0.00000 20 PASS 11A 5745 Antt VN -20 5745.00 0.00000 20 PASS 11A 5745 Antt VN -20 5745.02 2.61097 20 PASS 11A 5785 Antt VN	11A	5720	Ant1	VN	50	5720.02	2.62238	20	PASS
11A 5745 Antt VN 40 5745.00 0.00000 20 PASS 11A 5745 Antt VN 30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -30 5745.02 2.61097 20 PASS 11A 5745 Antt VN -10 5745.02 2.61097 20 PASS 11A 5745 Antt VN -20 5745.02 2.61097 20 PASS 11A 5745 Antt VN -20 5745.02 2.61097 20 PASS 11A 5745 Antt VN -20 5745.00 0.00000 20 PASS 11A 5745 Antt VN 20 5745.02 2.61097 20 PASS 11A 5745 Antt VN 20 5745.02 2.61097 20 PASS 11A 5785 Antt VN	11A	5720	Ant1	VN	-20	5720.02	2.62238	20	PASS
11A 5745 Ant1 VN 30 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -30 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5744.99 -2.61097 20 PASS 11A 5745 Ant1 VN 50 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	0	5745.03	5.22193	20	PASS
11A 5745 Ant1 VN -30 5745.03 5.22193 20 PASS 11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	40	5745.00	0.00000	20	PASS
11A 5745 Ant1 VN 10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5744.99 -2.61097 20 PASS 11A 5745 Ant1 VN 50 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	30	5745.02	2.61097	20	PASS
11A 5745 Ant1 VN -10 5745.02 2.61097 20 PASS 11A 5745 Ant1 VN -20 5744.99 -2.61097 20 PASS 11A 5745 Ant1 VN 50 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	-30	5745.03	5.22193	20	PASS
11A 5745 Ant1 VN -20 5744.99 -2.61097 20 PASS 11A 5745 Ant1 VN 50 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 10 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	10	5745.02	2.61097	20	PASS
11A 5745 Ant1 VN 50 5745.00 0.00000 20 PASS 11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.05 7.77874 20 PASS 11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	-10	5745.02	2.61097	20	PASS
11A 5745 Ant1 VN 20 5745.02 2.61097 20 PASS 11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.05 7.77874 20 PASS 11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN	11A	5745	Ant1	VN	-20	5744.99	-2.61097	20	PASS
11A 5785 Ant1 VN -20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.05 7.77874 20 PASS 11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN	11A	5745	Ant1	VN	50	5745.00	0.00000	20	PASS
11A 5785 Ant1 VN -10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 0 5785.05 7.77874 20 PASS 11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN	11A	5745	Ant1	VN	20	5745.02	2.61097	20	PASS
11A 5785 Ant1 VN 0 5785.05 7.77874 20 PASS 11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	-20	5785.03	5.18583	20	PASS
11A 5785 Ant1 VN 50 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	-10	5785.03	5.18583	20	PASS
11A 5785 Ant1 VN 10 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.03 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	0	5785.05	7.77874	20	PASS
11A 5785 Ant1 VN 20 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.03 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	50	5785.02	2.59291	20	PASS
11A 5785 Ant1 VN 30 5785.02 2.59291 20 PASS 11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	10	5785.03	5.18583	20	PASS
11A 5785 Ant1 VN 40 5785.03 5.18583 20 PASS 11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	20	5785.03	5.18583	20	PASS
11A 5785 Ant1 VN -30 5785.03 5.18583 20 PASS 11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN	11A	5785	Ant1	VN	30	5785.02	2.59291	20	PASS
11A 5825 Ant1 VN -10 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5785	Ant1	VN	40	5785.03	5.18583	20	PASS
11A 5825 Ant1 VN -20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5785	Ant1	VN	-30	5785.03	5.18583	20	PASS
11A 5825 Ant1 VN 0 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	-10	5825.00	0.00000	20	PASS
11A 5825 Ant1 VN 10 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	-20	5825.00	0.00000	20	PASS
11A 5825 Ant1 VN 20 5825.00 0.00000 20 PASS 11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	0	5825.02	2.57511	20	PASS
11A 5825 Ant1 VN 30 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	10	5825.02	2.57511	20	PASS
11A 5825 Ant1 VN 50 5825.02 2.57511 20 PASS 11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	20	5825.00	0.00000	20	PASS
11A 5825 Ant1 VN 40 5825.02 2.57511 20 PASS	11A	5825	Ant1	VN	30	5825.02	2.57511	20	PASS
	11A	5825	Ant1	VN	50	5825.02	2.57511	20	PASS
11A 5825 Ant1 VN -30 5825.03 5.15022 20 PASS	11A	5825	Ant1	VN	40	5825.02	2.57511	20	PASS
1 222 17.00	11A	5825	Ant1	VN	-30	5825.03	5.15022	20	PASS



11N20									
11N20	11N20	5180	Ant1	VN	30	5180.02	2.89575	20	PASS
11N20	11N20	5180	Ant1	VN	-30	5180.02	2.89575	20	PASS
11N20	11N20	5180	Ant1	VN	50	5180.00	0.00000	20	PASS
11N20	11N20	5180	Ant1	VN	40	5180.02	2.89575	20	PASS
11N20	11N20	5180	Ant1	VN	10	5180.02	2.89575	20	PASS
11N20	11N20	5180	Ant1	VN	0	5180.02	2.89575	20	PASS
11N20	11N20	5180	Ant1	VN	-20	5180.02	2.89575	20	PASS
11N20 5200 Ant1 VN 40 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 50 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 30 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 20 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN -30 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.00 5.70342 20 PASS 11N20 5260 Ant1 VN 40 5260.00 5.70342 20 PASS 11N20 5260 Ant1 VN 40 5260.00 5.70342 20 PASS 11N20 5260 Ant1 VN 40 5260.00 5.70342 20	11N20	5180	Ant1	VN	-10	5180.03	5.79151	20	PASS
11N20 5200 Ant1 VN 50 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 30 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 20 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1	11N20	5180	Ant1	VN	20	5179.99	-2.89575	20	PASS
11N20 5200 Ant1 VN 30 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 20 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN -0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.02 2.86260 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	40	5200.02	2.88462	20	PASS
11N20 5200 Ant1 VN 20 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	50	5200.02	2.88462	20	PASS
11N20 5200 Ant1 VN 10 5200.00 0.00000 20 PASS 11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88260 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -0 5240.00 0.00000 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	30	5200.02	2.88462	20	PASS
11N20 5200 Ant1 VN 0 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN -30 5200.02 2.86260 20 PASS 11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.00 0.00000 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	20	5200.02	2.88462	20	PASS
11N20 5200 Ant1 VN -10 5200.02 2.88462 20 PASS 11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -10 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	10	5200.00	0.00000	20	PASS
11N20 5200 Ant1 VN -20 5200.03 5.76923 20 PASS 11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1	11N20	5200	Ant1	VN	0	5200.02	2.88462	20	PASS
11N20 5200 Ant1 VN -30 5200.02 2.88462 20 PASS 11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5260 Ant1	11N20	5200	Ant1	VN	-10	5200.02	2.88462	20	PASS
11N20 5240 Ant1 VN 10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1	11N20	5200	Ant1	VN	-20	5200.03	5.76923	20	PASS
11N20 5240 Ant1 VN 50 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1	11N20	5200	Ant1	VN	-30	5200.02	2.88462	20	PASS
11N20 5240 Ant1 VN 40 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	10	5240.02	2.86260	20	PASS
11N20 5240 Ant1 VN -30 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	50	5240.02	2.86260	20	PASS
11N20 5240 Ant1 VN 20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 30 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	40	5240.00	0.00000	20	PASS
11N20 5240 Ant1 VN 0 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 30 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 20 5260.03 5.70342 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	-30	5240.00	0.00000	20	PASS
11N20 5240 Ant1 VN -10 5240.02 2.86260 20 PASS 11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 30 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	20	5240.00	0.00000	20	PASS
11N20 5240 Ant1 VN -20 5240.00 0.00000 20 PASS 11N20 5240 Ant1 VN 30 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1	11N20	5240	Ant1	VN	0	5240.02	2.86260	20	PASS
11N20 5240 Ant1 VN 30 5240.00 0.00000 20 PASS 11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5280 Ant1	11N20	5240	Ant1	VN	-10	5240.02	2.86260	20	PASS
11N20 5260 Ant1 VN -20 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 20 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1	11N20	5240	Ant1	VN	-20	5240.00	0.00000	20	PASS
11N20 5260 Ant1 VN 50 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 20 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1	11N20	5240	Ant1	VN	30	5240.00	0.00000	20	PASS
11N20 5260 Ant1 VN 40 5260.02 2.85171 20 PASS 11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 20 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1	11N20	5260	Ant1	VN	-20	5260.02	2.85171	20	PASS
11N20 5260 Ant1 VN 30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 20 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS 11N20 5280 Ant1	11N20	5260	Ant1	VN	50	5260.00	0.00000	20	PASS
11N20 5260 Ant1 VN 20 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	40	5260.02	2.85171	20	PASS
11N20 5260 Ant1 VN 10 5260.00 0.00000 20 PASS 11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	30	5260.03	5.70342	20	PASS
11N20 5260 Ant1 VN -10 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	20	5260.00	0.00000	20	PASS
11N20 5260 Ant1 VN -30 5260.03 5.70342 20 PASS 11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	10	5260.00	0.00000	20	PASS
11N20 5260 Ant1 VN 0 5260.02 2.85171 20 PASS 11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	-10	5260.03	5.70342	20	PASS
11N20 5280 Ant1 VN -10 5280.00 0.00000 20 PASS 11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	-30	5260.03	5.70342	20	PASS
11N20 5280 Ant1 VN 50 5280.02 2.84091 20 PASS 11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5260	Ant1	VN	0	5260.02	2.85171	20	PASS
11N20 5280 Ant1 VN 40 5280.00 0.00000 20 PASS	11N20	5280	Ant1	VN	-10	5280.00	0.00000	20	PASS
	11N20	5280	Ant1	VN	50	5280.02	2.84091	20	PASS
11N20	11N20	5280	Ant1	VN	40	5280.00	0.00000	20	PASS
1111/20 5200 AIILI VIV 50 5200.02 2.04091 20 PASS	11N20	5280	Ant1	VN	30	5280.02	2.84091	20	PASS



11N20									
11N20	11N20	5280	Ant1	VN	-20	5280.02	2.84091	20	PASS
11N20	11N20	5280	Ant1	VN	20	5280.03	5.68182	20	PASS
11N20	11N20	5280	Ant1	VN	10	5280.02	2.84091	20	PASS
11N20	11N20	5280	Ant1	VN	0	5280.02	2.84091	20	PASS
11N20 5320 Ant1 VN -20 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN -10 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN 10 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN 40 5320.00 0.00000 20 PASS 11N20 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -40 5500.00 0.00000 20 PASS 11N20 5500 Ant1	11N20	5280	Ant1	VN	-30	5280.02	2.84091	20	PASS
11N20 5320 Ant1 VN -10 5320.33 5.63910 20 PASS 11N20 5320 Ant1 VN 10 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN 40 5320.00 0.00000 20 PASS 11N20 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -40 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -40 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	20	5320.00	0.00000	20	PASS
11N20 5320 Ant1 VN 10 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN 40 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -0 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	-20	5320.03	5.63910	20	PASS
11N20 5320 Ant1 VN 30 5320.03 5.63910 20 PASS 11N20 5320 Ant1 VN 40 5320.00 0.00000 20 PASS 11N20 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	-10	5320.03	5.63910	20	PASS
11N20 5320 Ant1 VN 40 5320.00 0.00000 20 PASS 11N20 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	10	5320.02	2.81955	20	PASS
11N20 5320 Ant1 VN 50 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	30	5320.03	5.63910	20	PASS
11N20 5320 Ant1 VN 0 5320.02 2.81955 20 PASS 11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 50 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1	11N20	5320	Ant1	VN	40	5320.00	0.00000	20	PASS
11N20 5320 Ant1 VN -30 5320.02 2.81955 20 PASS 11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 50 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1	11N20	5320	Ant1	VN	50	5320.02	2.81955	20	PASS
11N20 5500 Ant1 VN -10 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 50 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 10 5580.02 2.72727 20 PASS 11N20 5580 Ant1	11N20	5320	Ant1	VN	0	5320.02	2.81955	20	PASS
11N20 5500 Ant1 VN 40 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 50 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5320	Ant1	VN	-30	5320.02	2.81955	20	PASS
11N20 5500 Ant1 VN 50 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	-10	5500.00	0.00000	20	PASS
11N20 5500 Ant1 VN -20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	40	5500.02	2.72727	20	PASS
11N20 5500 Ant1 VN 20 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	50	5500.02	2.72727	20	PASS
11N20 5500 Ant1 VN 30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	-20	5500.02	2.72727	20	PASS
11N20 5500 Ant1 VN 0 5500.00 0.00000 20 PASS 11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	20	5500.02	2.72727	20	PASS
11N20 5500 Ant1 VN -30 5500.02 2.72727 20 PASS 11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	30	5500.02	2.72727	20	PASS
11N20 5500 Ant1 VN 10 5500.02 2.72727 20 PASS 11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1	11N20	5500	Ant1	VN	0	5500.00	0.00000	20	PASS
11N20 5580 Ant1 VN 20 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1	11N20	5500	Ant1	VN	-30	5500.02	2.72727	20	PASS
11N20 5580 Ant1 VN -20 5580.03 5.37634 20 PASS 11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1	11N20	5500	Ant1	VN	10	5500.02	2.72727	20	PASS
11N20 5580 Ant1 VN 10 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1	11N20	5580	Ant1	VN	20	5580.00	0.00000	20	PASS
11N20 5580 Ant1 VN -30 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1	11N20	5580	Ant1	VN	-20	5580.03	5.37634	20	PASS
11N20 5580 Ant1 VN 30 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	10	5580.00	0.00000	20	PASS
11N20 5580 Ant1 VN 40 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	-30	5580.00	0.00000	20	PASS
11N20 5580 Ant1 VN 50 5580.00 0.00000 20 PASS 11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	30	5580.02	2.68817	20	PASS
11N20 5580 Ant1 VN 0 5580.02 2.68817 20 PASS 11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	40	5580.00	0.00000	20	PASS
11N20 5580 Ant1 VN -10 5580.02 2.68817 20 PASS 11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	50	5580.00	0.00000	20	PASS
11N20 5700 Ant1 VN 0 5700.03 5.26316 20 PASS 11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	0	5580.02	2.68817	20	PASS
11N20 5700 Ant1 VN 50 5700.02 2.63158 20 PASS 11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5580	Ant1	VN	-10	5580.02	2.68817	20	PASS
11N20 5700 Ant1 VN 40 5700.00 0.00000 20 PASS 11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	0	5700.03	5.26316	20	PASS
11N20 5700 Ant1 VN 30 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	50	5700.02	2.63158	20	PASS
	11N20	5700	Ant1	VN	40	5700.00	0.00000	20	PASS
11N20 5700 Ant1 VN 10 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	30	5700.02	2.63158	20	PASS
1 1 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2	11N20	5700	Ant1	VN	10	5700.02	2.63158	20	PASS
11N20 5700 Ant1 VN -10 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	-10	5700.02	2.63158	20	PASS
11N20 5700 Ant1 VN -20 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	-20	5700.02	2.63158	20	PASS
11N20 5700 Ant1 VN -30 5700.02 2.63158 20 PASS	11N20	5700	Ant1	VN	-30	5700.02	2.63158	20	PASS



11N20 5700 Ant1 VN 20 5700.02 2.63158 20 11N20 5720 Ant1 VN 50 5720.05 7.86713 20 11N20 5720 Ant1 VN -20 5720.03 5.24476 20 11N20 5720 Ant1 VN 40 5720.02 2.62238 20 11N20 5720 Ant1 VN 30 5720.02 2.62238 20	PASS PASS
11N20 5720 Ant1 VN -20 5720.03 5.24476 20 11N20 5720 Ant1 VN 40 5720.02 2.62238 20 11N20 5720 Ant1 VN 30 5720.02 2.62238 20 11N20 5720 Ant1 VN 30 5720.02 2.62238 20	PASS
11N20 5720 Ant1 VN 40 5720.02 2.62238 20 11N20 5720 Ant1 VN 30 5720.02 2.62238 20	
11N20 5720 Ant1 VN 30 5720.02 2.62238 20) PASS
) PASS
11N20 5720 Ant1 VN 20 5720.03 5.24476 20) PASS
11N20 5720 Ant1 VN 10 5720.02 2.62238 20) PASS
11N20 5720 Ant1 VN 0 5720.03 5.24476 20) PASS
11N20 5720 Ant1 VN -10 5720.02 2.62238 20) PASS
11N20 5720 Ant1 VN -30 5720.03 5.24476 20) PASS
11N20 5745 Ant1 VN -30 5745.00 0.00000 20) PASS
11N20 5745 Ant1 VN 50 5745.00 0.00000 20) PASS
11N20 5745 Ant1 VN 40 5745.03 5.22193 20) PASS
11N20 5745 Ant1 VN 30 5745.00 0.00000 20	PASS
11N20 5745 Ant1 VN 20 5745.02 2.61097 20) PASS
11N20 5745 Ant1 VN 10 5745.00 0.00000 20	PASS
11N20 5745 Ant1 VN 0 5745.02 2.61097 20	PASS
11N20 5745 Ant1 VN -10 5745.02 2.61097 20	PASS
11N20 5745 Ant1 VN -20 5745.00 0.00000 20	PASS
11N20 5785 Ant1 VN 50 5785.03 5.18583 20	PASS
11N20 5785 Ant1 VN 40 5785.03 5.18583 20) PASS
11N20 5785 Ant1 VN 30 5785.02 2.59291 20	PASS
11N20 5785 Ant1 VN 20 5785.02 2.59291 20	PASS
11N20 5785 Ant1 VN 10 5785.03 5.18583 20	PASS
11N20 5785 Ant1 VN 0 5785.05 7.77874 20	PASS
11N20 5785 Ant1 VN -10 5785.03 5.18583 20	PASS
11N20 5785 Ant1 VN -30 5785.02 2.59291 20	PASS
11N20 5785 Ant1 VN -20 5785.02 2.59291 20	PASS
11N20 5825 Ant1 VN 50 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN -20 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN -30 5825.03 5.15022 20	PASS
11N20 5825 Ant1 VN 30 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN 10 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN 0 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN -10 5825.00 0.00000 20	PASS
11N20 5825 Ant1 VN 20 5825.02 2.57511 20	PASS
11N20 5825 Ant1 VN 40 5825.02 2.57511 20	PASS
11N40 5190 Ant1 VN -20 5190.00 0.00000 20	PASS
11N40 5190 Ant1 VN -10 5190.00 0.00000 20	PASS
11N40 5190 Ant1 VN 0 5190.00 0.00000 20	PASS



11N40									
11N40	11N40	5190	Ant1	VN	10	5190.00	0.00000	20	PASS
11N40	11N40	5190	Ant1	VN	20	5190.00	0.00000	20	PASS
11N40	11N40	5190	Ant1	VN	30	5190.00	0.00000	20	PASS
11N40	11N40	5190	Ant1	VN	40	5190.00	0.00000	20	PASS
11N40	11N40	5190	Ant1	VN	50	5190.03	5.78035	20	PASS
11N40 5230 Antl VN -20 5230.03 5.73614 20 PASS 11N40 5230 Antl VN 0 5230.00 0.00000 20 PASS 11N40 5230 Antl VN 50 5230.00 0.00000 20 PASS 11N40 5230 Antl VN 10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -30 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -30 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN 20 5230.00 5.73614 20 PASS 11N40 5230 Antl VN 20 5230.00 0.00000 20 PASS 11N40 5270 Antl VN 10 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 50 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.03 5.69260 20 PASS 11N40 5270 Antl VN 0 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 0 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 0 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 0 5270.00 0.00000 20 PASS 11N40 5270 Antl VN -20 5270.00 0.00000 20 PASS 11N40 5270 Antl VN -30 5270.00 0.00000 20 PASS 11N40 5270 Antl VN -30 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 30 5270.00 0.00000 20 PASS 11N40 5310 Antl VN 50 5310.03 5.64972 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN 40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN 40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN 40 5310.00 0.00000 20 PASS 11N40 5310 Antl VN 40 5310.00 0.00000	11N40	5190	Ant1	VN	-30	5190.00	0.00000	20	PASS
11N40 5230 Antl VN 0 5230.00 0.00000 20 PASS 11N40 5230 Antl VN 50 5230.00 0.00000 20 PASS 11N40 5230 Antl VN 10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -30 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN -10 5230.03 5.73614 20 PASS 11N40 5230 Antl VN 30 5230.03 5.73614 20 PASS 11N40 5230 Antl VN 20 5230.00 0.00000 20 PASS 11N40 5230 Antl VN 20 5230.00 0.00000 20 PASS 11N40 5270 Antl VN 10 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 20 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 20 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.00 0.00000 20 PASS 11N40 5270 Antl VN 40 5270.00 5270.00 20 PASS 11N40 5270 Antl VN -10 5270.03 5.69260 20 PASS 11N40 5270 Antl VN -20 5270.06 11.38520 20 PASS 11N40 5270 Antl VN -30 5270.00 0.00000 20 PASS 11N40 5310 Antl VN 40 5310.03 5.64972 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.00000 20 PASS 11N40 5310 Antl VN -30 5310.00 0.	11N40	5230	Ant1	VN	40	5230.00	0.00000	20	PASS
11N40 5230 Ant1 VN 50 5230.00 0.00000 20 PASS 11N40 5230 Ant1 VN 10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -30 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5310.00 0.00000	11N40	5230	Ant1	VN	-20	5230.03	5.73614	20	PASS
11N40 5230 Ant1 VN 10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 30 5230.00 0.00000 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1	11N40	5230	Ant1	VN	0	5230.00	0.00000	20	PASS
11N40 5230 Ant1 VN -30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN -10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.00 0.00000 20 PASS 11N40 5270 Ant1	11N40	5230	Ant1	VN	50	5230.00	0.00000	20	PASS
11N40 5230 Ant1 VN -10 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -20 5270.00 0.00000 20 PASS 11N40 5270 Ant1	11N40	5230	Ant1	VN	10	5230.03	5.73614	20	PASS
11N40 5230 Ant1 VN 30 5230.03 5.73614 20 PASS 11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1	11N40	5230	Ant1	VN	-30	5230.03	5.73614	20	PASS
11N40 5230 Ant1 VN 20 5230.00 0.00000 20 PASS 11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 50 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5310 Ant1	11N40	5230	Ant1	VN	-10	5230.03	5.73614	20	PASS
11N40 5270 Ant1 VN 10 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 50 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5230	Ant1	VN	30	5230.03	5.73614	20	PASS
11N40 5270 Ant1 VN 50 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 40 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1	11N40	5230	Ant1	VN	20	5230.00	0.00000	20	PASS
11N40 5270 Ant1 VN 40 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5310 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	10	5270.00	0.00000	20	PASS
11N40 5270 Ant1 VN 20 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	50	5270.00	0.00000	20	PASS
11N40 5270 Ant1 VN 0 5270.00 0.00000 20 PASS 11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	40	5270.03	5.69260	20	PASS
11N40 5270 Ant1 VN -10 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.00 0.00000 20 PASS 11N40 5310 Ant1 <td>11N40</td> <td>5270</td> <td>Ant1</td> <td>VN</td> <td>20</td> <td>5270.00</td> <td>0.00000</td> <td>20</td> <td>PASS</td>	11N40	5270	Ant1	VN	20	5270.00	0.00000	20	PASS
11N40 5270 Ant1 VN -20 5270.06 11.38520 20 PASS 11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	0	5270.00	0.00000	20	PASS
11N40 5270 Ant1 VN -30 5270.03 5.69260 20 PASS 11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	-10	5270.03	5.69260	20	PASS
11N40 5270 Ant1 VN 30 5270.00 0.00000 20 PASS 11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.00 0.00000 20 PASS 11N40 5310 Ant1	11N40	5270	Ant1	VN	-20	5270.06	11.38520	20	PASS
11N40 5310 Ant1 VN 10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1	11N40	5270	Ant1	VN	-30	5270.03	5.69260	20	PASS
11N40 5310 Ant1 VN 50 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.00 0.00000 20 PASS 11N40 5510 Ant1	11N40	5270	Ant1	VN	30	5270.00	0.00000	20	PASS
11N40 5310 Ant1 VN -30 5310.06 11.29944 20 PASS 11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.03 5.44465 20 PASS 11N40 5510 Ant1	11N40	5310	Ant1	VN	10	5310.03	5.64972	20	PASS
11N40 5310 Ant1 VN -20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1	11N40	5310	Ant1	VN	50	5310.03	5.64972	20	PASS
11N40 5310 Ant1 VN -10 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1	11N40	5310	Ant1	VN	-30	5310.06	11.29944	20	PASS
11N40 5310 Ant1 VN 0 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	-20	5310.00	0.00000	20	PASS
11N40 5310 Ant1 VN 20 5310.00 0.00000 20 PASS 11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	-10	5310.03	5.64972	20	PASS
11N40 5310 Ant1 VN 30 5310.03 5.64972 20 PASS 11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 50 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	0	5310.00	0.00000	20	PASS
11N40 5310 Ant1 VN 40 5310.00 0.00000 20 PASS 11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 50 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	20	5310.00	0.00000	20	PASS
11N40 5510 Ant1 VN -10 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 50 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	30	5310.03	5.64972	20	PASS
11N40 5510 Ant1 VN -20 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 50 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5310	Ant1	VN	40	5310.00	0.00000	20	PASS
11N40 5510 Ant1 VN 50 5510.03 5.44465 20 PASS 11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5510	Ant1	VN	-10	5510.03	5.44465	20	PASS
11N40 5510 Ant1 VN 40 5510.00 0.00000 20 PASS 11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5510	Ant1	VN	-20	5510.00	0.00000	20	PASS
11N40 5510 Ant1 VN 30 5510.00 0.00000 20 PASS	11N40	5510	Ant1	VN	50	5510.03	5.44465	20	PASS
	11N40	5510	Ant1	VN	40	5510.00	0.00000	20	PASS
11N40 5510 Ant1 VN 20 5510.00 0.00000 20 PASS	11N40	5510	Ant1	VN	30	5510.00	0.00000	20	PASS
	11N40	5510	Ant1	VN	20	5510.00	0.00000	20	PASS
11N40 5510 Ant1 VN 10 5510.00 0.00000 20 PASS	11N40	5510	Ant1	VN	10	5510.00	0.00000	20	PASS



11N40	5510	Ant1	VN	0	5510.00	0.00000	20	PASS
11N40	5510	Ant1	VN	-30	5510.00	0.00000	20	PASS
11N40	5550	Ant1	VN	10	5550.03	5.40541	20	PASS
11N40	5550	Ant1	VN	50	5550.03	5.40541	20	PASS
11N40	5550	Ant1	VN	30	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	-20	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	-10	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	0	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	-30	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	40	5550.00	0.00000	20	PASS
11N40	5550	Ant1	VN	20	5550.00	0.00000	20	PASS
11N40	5670	Ant1	VN	-20	5670.06	10.58201	20	PASS
11N40	5670	Ant1	VN	50	5670.06	10.58201	20	PASS
11N40	5670	Ant1	VN	40	5670.00	0.00000	20	PASS
11N40	5670	Ant1	VN	30	5670.03	5.29101	20	PASS
11N40	5670	Ant1	VN	20	5670.06	10.58201	20	PASS
11N40	5670	Ant1	VN	10	5670.03	5.29101	20	PASS
11N40	5670	Ant1	VN	-30	5670.00	0.00000	20	PASS
11N40	5670	Ant1	VN	0	5670.03	5.29101	20	PASS
11N40	5670	Ant1	VN	-10	5670.03	5.29101	20	PASS
11N40	5755	Ant1	VN	20	5755.00	0.00000	20	PASS
11N40	5755	Ant1	VN	50	5755.03	5.21286	20	PASS
11N40	5755	Ant1	VN	30	5755.06	10.42572	20	PASS
11N40	5755	Ant1	VN	10	5755.03	5.21286	20	PASS
11N40	5755	Ant1	VN	0	5755.03	5.21286	20	PASS
11N40	5755	Ant1	VN	-10	5755.00	0.00000	20	PASS
11N40	5755	Ant1	VN	-20	5755.03	5.21286	20	PASS
11N40	5755	Ant1	VN	-30	5755.03	5.21286	20	PASS
11N40	5755	Ant1	VN	40	5755.00	0.00000	20	PASS
11N40	5795	Ant1	VN	-30	5795.03	5.17688	20	PASS
11N40	5795	Ant1	VN	50	5795.06	10.35375	20	PASS
11N40	5795	Ant1	VN	40	5795.06	10.35375	20	PASS
11N40	5795	Ant1	VN	30	5795.03	5.17688	20	PASS
11N40	5795	Ant1	VN	20	5795.03	5.17688	20	PASS
11N40	5795	Ant1	VN	10	5795.06	10.35375	20	PASS
11N40	5795	Ant1	VN	0	5795.06	10.35375	20	PASS
11N40	5795	Ant1	VN	-20	5795.06	10.35375	20	PASS
11N40	5795	Ant1	VN	-10	5795.00	0.00000	20	PASS



7.Duty Cycle (x)

Test Mode	Test Channel	Ant	Duty Cycle[%]	10log(1/x) Factor[dB]
11A	5180	Ant1	97.29	0.12
11A	5200	Ant1	97.37	0.12
11A	5240	Ant1	97.37	0.12
11A	5260	Ant1	97.29	0.12
11A	5280	Ant1	97.37	0.12
11A	5320	Ant1	97.29	0.12
11A	5500	Ant1	97.29	0.12
11A	5580	Ant1	97.29	0.12
11A	5700	Ant1	97.29	0.12
11A	5720	Ant1	97.37	0.12
11A	5745	Ant1	97.29	0.12
11A	5785	Ant1	97.29	0.12
11A	5825	Ant1	97.29	0.12
11N20	5180	Ant1	97.1	0.13
11N20	5200	Ant1	97.1	0.13
11N20	5240	Ant1	97.19	0.12
11N20	5260	Ant1	97.1	0.13
11N20	5280	Ant1	97.19	0.12
11N20	5320	Ant1	97.1	0.13
11N20	5500	Ant1	97.1	0.13
11N20	5580	Ant1	97.1	0.13
11N20	5700	Ant1	97.19	0.12
11N20	5720	Ant1	97.1	0.13
11N20	5745	Ant1	97.19	0.12
11N20	5785	Ant1	97.19	0.12
11N20	5825	Ant1	97.19	0.12
11N40	5190	Ant1	94.51	0.25
11N40	5230	Ant1	94.52	0.24
11N40	5270	Ant1	94.51	0.25
11N40	5310	Ant1	94.52	0.24
11N40	5510	Ant1	94.51	0.25
11N40	5550	Ant1	94.52	0.24
11N40	5670	Ant1	94.52	0.24
11N40	5755	Ant1	94.51	0.25
11N40	5795	Ant1	94.51	0.25

