FCC RF Test Report

APPLICANT : JET Optoelectronics Co., LTD EQUIPMENT : Monitor, Seatback 10.1 – EVO 4

BRAND NAME : Lincoln U554

MODEL NAME : 620053

MARKETING NAME : Monitor, Seatback 10.1 – EVO 4

FCC ID : Z3K-620053U554

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on May 08, 2017 and testing was completed on Aug. 30, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 . INC.

Page Number

: 1 of 56

1190

Report No.: FR750801A

Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SU	MMAF	RY OF TEST RESULT	4
1	GEN	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Applicable Standards	6
2	TEST	T CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	9
	2.4	Support Unit used in test configuration and system	9
	2.5	UT Operation Test Setup	10
	2.6	Measurement Results Explanation Example	10
3	TES1	Γ RESULT	11
	3.1	Number of Channel Measurement	
	3.2	Hopping Channel Separation Measurement	13
	3.3	Dwell Time Measurement	
	3.4	20dB and 99% Bandwidth Measurement	
	3.5	Peak Output Power Measurement	32
	3.6	Conducted Band Edges Measurement	33
	3.7	Conducted Spurious Emission Measurement	40
	3.8	Radiated Band Edges and Spurious Emission Measurement	
	3.9	Antenna Requirements	
4		OF MEASURING EQUIPMENT	
5	UNC	ERTAINTY OF EVALUATION	56
ΑP	PEND	IX A. CONDUCTED TEST RESULTS	
ΑP	PEND	IX B. RADIATED SPURIOUS EMISSION	
ΑP	PEND	IX C. RADIATED SPURIOUS EMISSION PLOTS	
ΑP	PEND	IX D. DUTY CYCLE PLOTS	
ΑP	PEND	IX E. SETUP PHOTOGRAPHS	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 2 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR750801A	Rev. 01	Initial issue of report	Sep. 05, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 3 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description Limit		Result	Remark	
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs Pass		-	
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-	
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-	
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-	
3.4	-	99% Bandwidth	-	Pass	-	
3.5	3.5 15.247(b)(1) Peak Output Power		≤ 125 mW	Pass	1	
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-	
3.7	15.247(d)	247(d) Conducted Spurious ≤ 20dBc Emission		Pass	-	
		Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 3.90 dB at 528.20 MHz	
ı	- 15.207 AC Conducted Emission		15.207(a)	Not Required	-	
3.9	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-	
Note: Not required means after assessing, test items are not necessary to carry out.						

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554

: 4 of 56 Page Number Report Issued Date: Sep. 05, 2017 Report Version : Rev. 01

Report No.: FR750801A

1 General Description

1.1 Applicant

JET Optoelectronics Co., LTD

3F., No.300, Yangguang St., Neihu Dist., Taipei City 11491, Taiwan, R.O.C

1.2 Manufacturer

JET Optoelectronics Co., LTD

3F., No.300, Yangguang St., Neihu Dist., Taipei City 11491, Taiwan, R.O.C

1.3 Product Feature of Equipment Under Test

Bluetooth and Wi-Fi 2.4GHz 802.11b/g/n.

Product Specification subjective to this standard					
Antonno Tyro	WLAN: Printed Antenna				
Antenna Type	Bluetooth: Printed Antenna				

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z3K-620053U554

TEL: 886-3-327-3456

Page Number : 5 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW0007 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.		
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,		
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.		
rest Site Location	TEL: +886-3-327-3456		
	FAX: +886-3-328-4978		
Took Site No	Sporton Site No.		
Test Site No.	TH05-HY		

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site SPORTON INTERNATIONAL INC.			
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,		
Test Site Location	Taoyuan City, Taiwan (R.O.C.)		
rest Site Location	TEL: +886-3-327-0868		
	FAX: +886-3-327-0855		
Took Site No	Sporton Site No.		
Test Site No.	03CH12-HY		

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

Remark: All test items were verified and recorded according to the standards and without any deviation during the test.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 6 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 7 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

2.2 Test Mode

The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Y plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.

The following summary table is showing all test modes to demonstrate in compliance with the standard.


Summary table of Test Cases							
	Data Rate / Modulation						
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps				
	GFSK	π/4-DQPSK	8-DPSK				
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz				
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz				
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz				
	Bluetooth BR 1Mbps GFSK						
Radiated		Mode 1: CH00_2402 MHz					
Test Cases		Mode 2: CH39_2441 MHz					
		Mode 3: CH78_2480 MHz					

Remark: For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and the conducted spurious emissions and conducted band edge measurement for each data rate are no worse than 1Mbps, and no other significantly frequencies found in conducted spurious emission.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 8 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

2.3 Connection Diagram of Test System

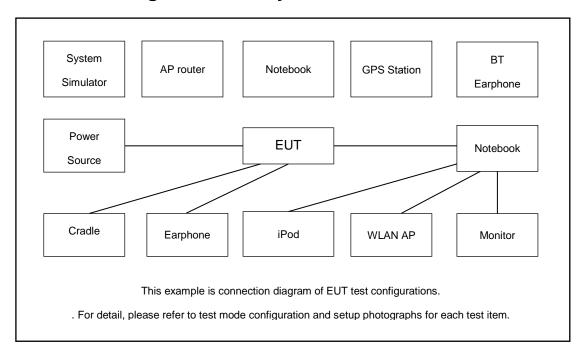

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	iPod Earphone	Apple	N/A	Verification	Unshielded, 1.2m	N/A
2.	Bluetooth Base	R&S	CBT32	N/A	N/A	Unshielded, 1.8 m
	Station					

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 9 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

2.5 UT Operation Test Setup

The RF test items utility, "CMD" installed in the notebook which was programmed in order to make the EUT get into the engineering modes to contact with base station for continuous transmitting and receiving signals.

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

Offset(dB) = RF cable loss(dB) + attenuator factor(dB).
=
$$4.2 + 10 = 14.2$$
 (dB)

Page Number : 10 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report Template No.: BU5-FR15CBT Version 2.0

Report No.: FR750801A

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings: Span = the frequency band of operation;
 RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 11 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.

Number of Hopping Channel Plot on Channel 00 - 78

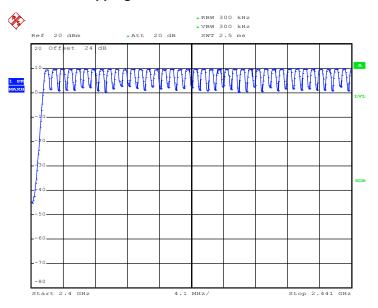

Date: 9.AUG.2017 23:25:49

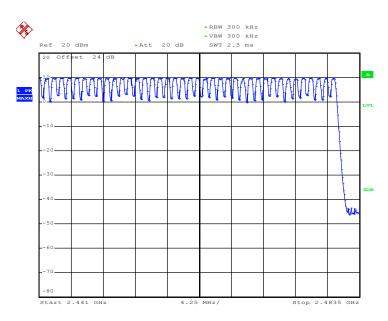

Date: 9.AUG.2017 23:26:37

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 12 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 - Span = wide enough to capture the peaks of two adjacent channels;
 - RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup



3.2.5 Test Result of Hopping Channel Separation

Please refer to Appendix A.


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 13 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<1Mbps>

Channel Separation Plot on Channel 00 - 01

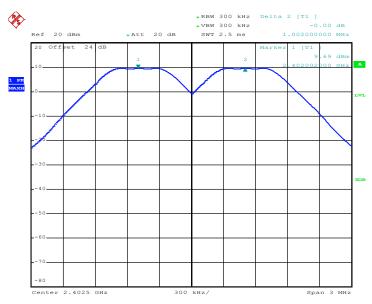

Date: 9.AUG.2017 23:37:44

Channel Separation Plot on Channel 39 - 40

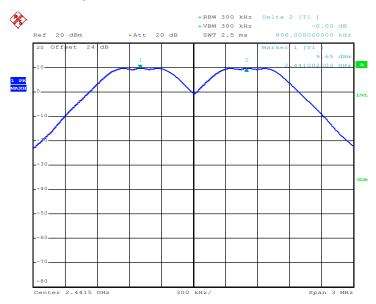


Date: 9.AUG.2017 23:42:37

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 14 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


Channel Separation Plot on Channel 77 - 78

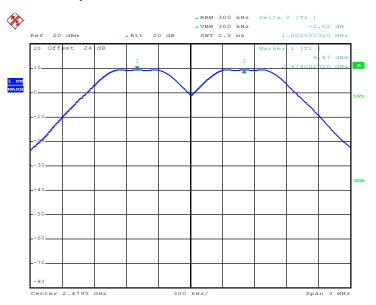

Date: 9.AUG.2017 23:46:52

<2Mbps>

Channel Separation Plot on Channel 00 - 01

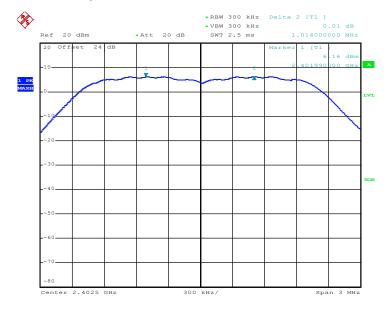


Date: 9.AUG.2017 23:52:06

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 15 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

Channel Separation Plot on Channel 39 - 40

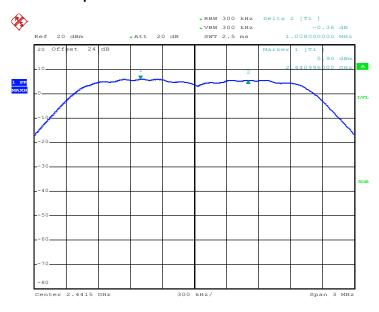

Date: 9.AUG.2017 23:57:05

Channel Separation Plot on Channel 77 - 78

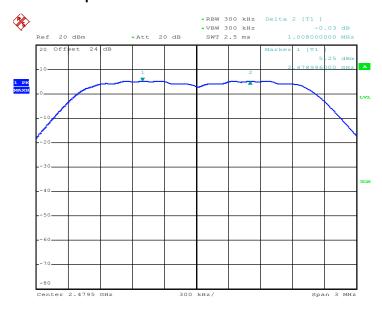

Date: 10.AUG.2017 00:00:55


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 16 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<3Mbps>

Channel Separation Plot on Channel 00 - 01

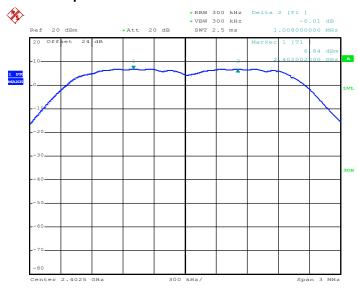

Date: 29.AUG.2017 11:03:51

Channel Separation Plot on Channel 39 - 40

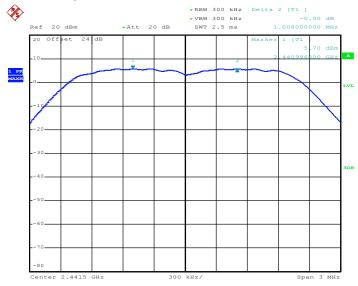


Date: 10.AUG.2017 00:10:06

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 17 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

Channel Separation Plot on Channel 77 - 78

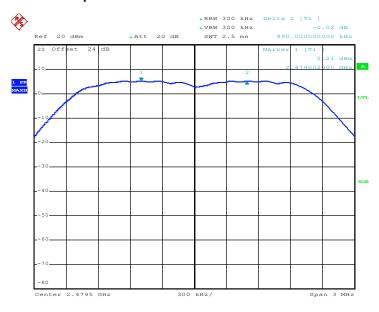

Date: 10.AUG.2017 00:14:34

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 18 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup

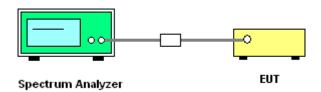


3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 19 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

Package Transfer Time Plot

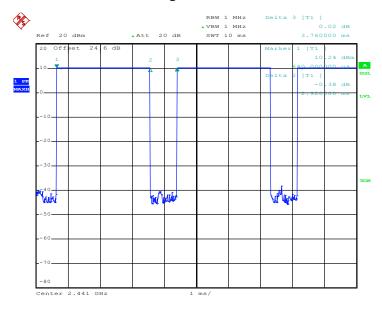

Date: 19.JUL.2017 15:13:03

Remark:

- **1.** In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels. With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4×79) (s), Hops Over Occupancy Time comes to $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$ hops.
- **2.** In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4×20) (s), Hops Over Occupancy Time comes to $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$ hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z3K-620053U554

TEL: 886-3-327-3456

Page Number : 20 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
 - $RBW \geq 1\% \ of \ the \ 20 \ dB \ bandwidth; \ VBW \geq RBW; \ Sweep = auto; \ Detector \ function = peak;$


Trace = \max hold.

- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
 - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;

Trace = max hold.

6. Measure and record the results in the test report.

3.4.4 Test Setup



3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 21 of 56
Report Issued Date : Sep. 05, 2017

Report No.: FR750801A

Report Version : Rev. 01


<1Mbps>

20 dB Bandwidth Plot on Channel 00

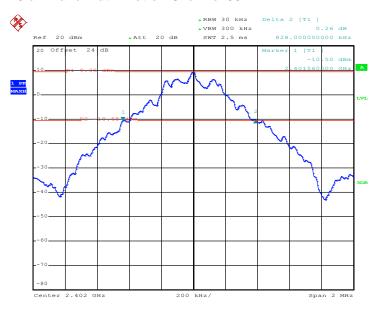

Date: 9.AUG.2017 23:39:11

20 dB Bandwidth Plot on Channel 39

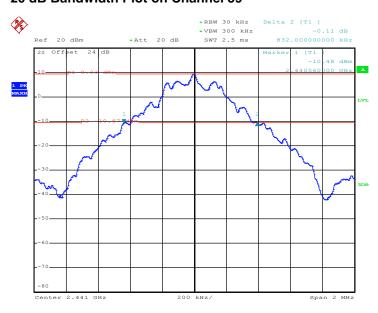


Date: 9.AUG.2017 23:44:05

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 22 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


20 dB Bandwidth Plot on Channel 78

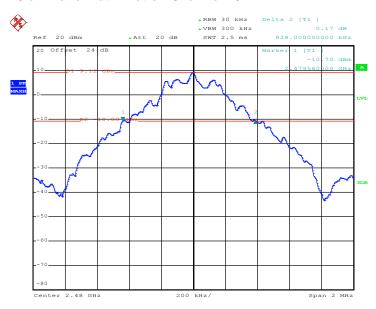

Date: 9.AUG.2017 23:47:59

<2Mbps>

20 dB Bandwidth Plot on Channel 00

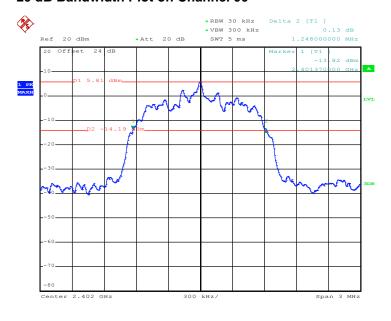


Date: 9.AUG.2017 23:53:09

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 23 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

20 dB Bandwidth Plot on Channel 39

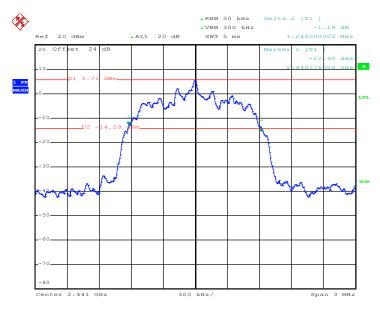

Date: 9.AUG.2017 23:58:21

20 dB Bandwidth Plot on Channel 78

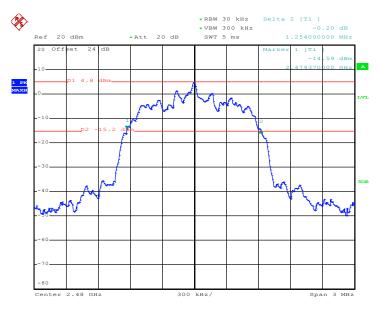

Date: 10.AUG.2017 00:02:01


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 24 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<3Mbps>

20 dB Bandwidth Plot on Channel 00

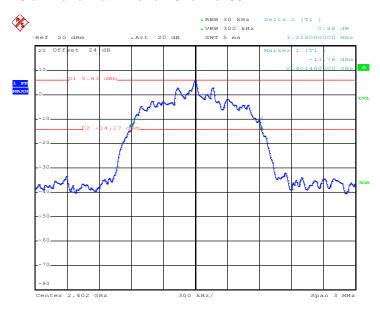

Date: 10.AUG.2017 00:06:18

20 dB Bandwidth Plot on Channel 39

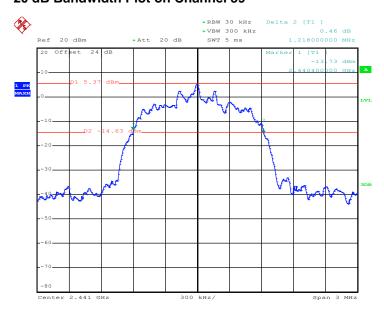


Date: 10.AUG.2017 00:12:01

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 25 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

20 dB Bandwidth Plot on Channel 78

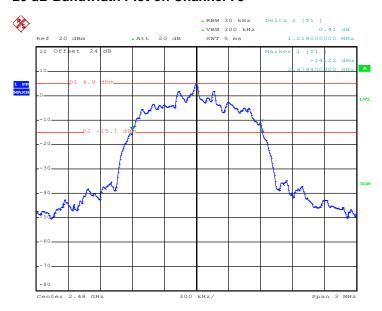

Date: 10.AUG.2017 00:15:47

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 26 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

<1Mbps>

99% Occupied Bandwidth Plot on Channel 00

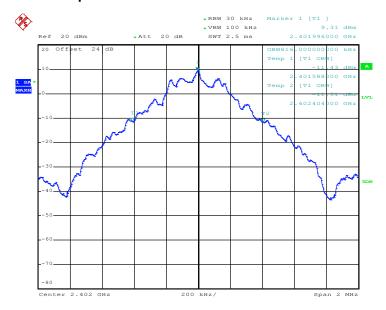


Date: 9.AUG.2017 23:39:51

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 27 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

99% Occupied Bandwidth Plot on Channel 39

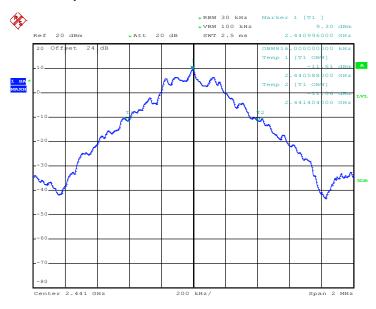

Date: 9.AUG.2017 23:44:44

99% Occupied Bandwidth Plot on Channel 78

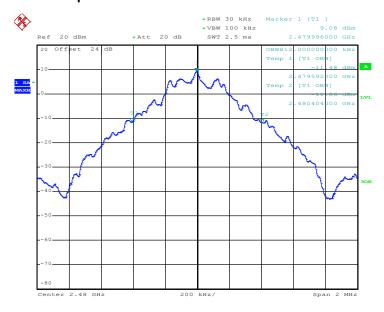

Date: 9.AUG.2017 23:48:37


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 28 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<2Mbps>

99% Occupied Bandwidth Plot on Channel 00

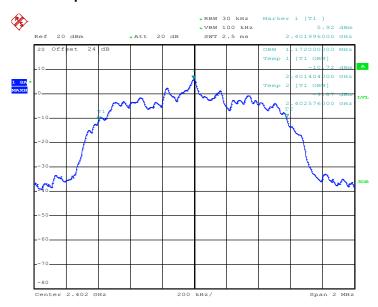

Date: 9.AUG.2017 23:53:47

99% Occupied Bandwidth Plot on Channel 39

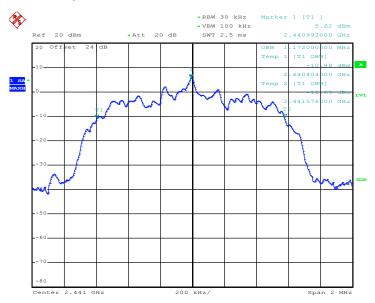


Date: 9.AUG.2017 23:58:59

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 29 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


99% Occupied Bandwidth Plot on Channel 78

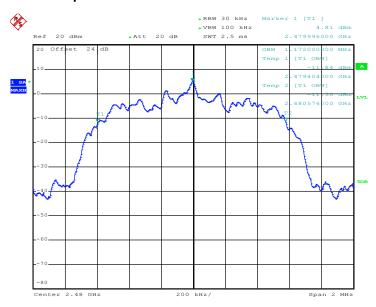

Date: 10.AUG.2017 00:02:39

<3Mbps>

99% Occupied Bandwidth Plot on Channel 00

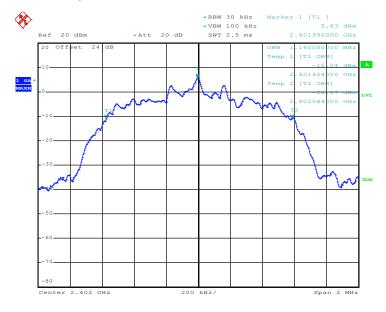


Date: 10.AUG.2017 00:06:55

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 30 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

99% Occupied Bandwidth Plot on Channel 39

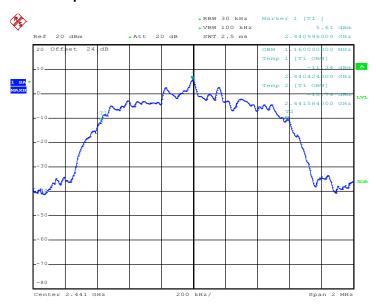

Date: 10.AUG.2017 00:12:40

99% Occupied Bandwidth Plot on Channel 78



Date: 10.AUG.2017 00:16:25

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 31 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.

3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup



3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 32 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup



3.6.5 Test Result of Conducted Band Edges


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 33 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<1Mbps>

Low Band Edge Plot on Channel 00

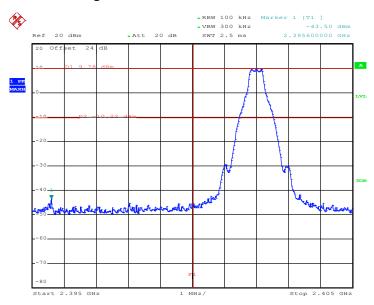

Date: 9.AUG.2017 23:40:19

High Band Edge Plot on Channel 78

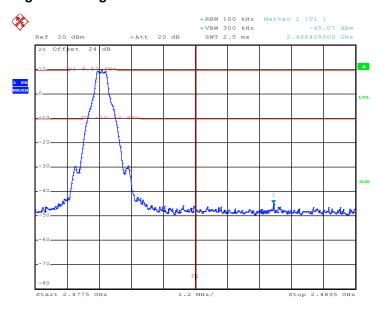

Date: 9.AUG.2017 23:48:56


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 34 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<2Mbps>

Low Band Edge Plot on Channel 00

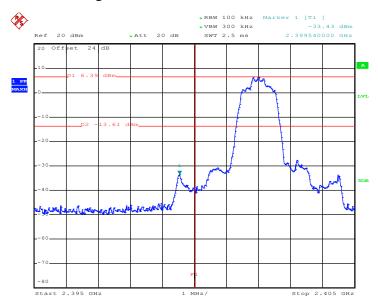

Date: 9.AUG.2017 23:54:09

High Band Edge Plot on Channel 78

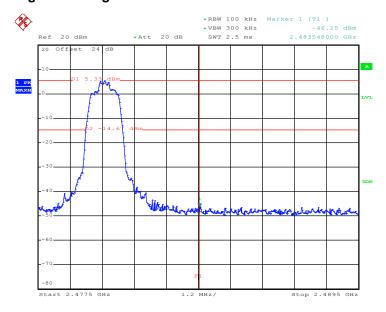

Date: 10.AUG.2017 00:03:00


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 35 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<3Mbps>

Low Band Edge Plot on Channel 00

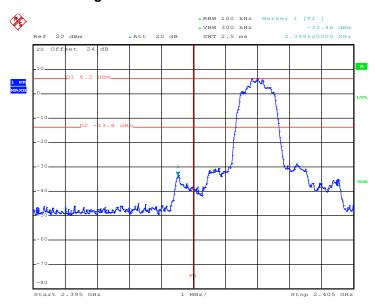

Date: 10.AUG.2017 00:07:22

High Band Edge Plot on Channel 78

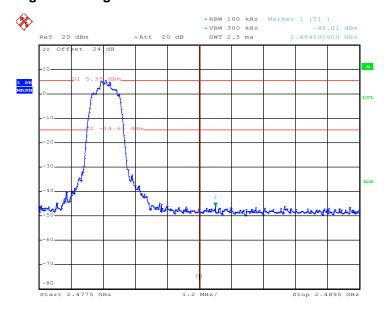

Date: 10.AUG.2017 00:16:52

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 36 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

3.6.6 Test Result of Conducted Hopping Mode Band Edges

Please refer to Appendix A.


<1Mbps>

Hopping Mode Low Band Edge Plot

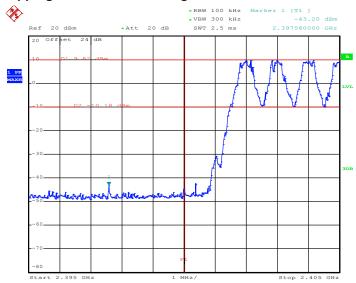

Date: 9.AUG.2017 23:29:44

Hopping Mode High Band Edge Plot

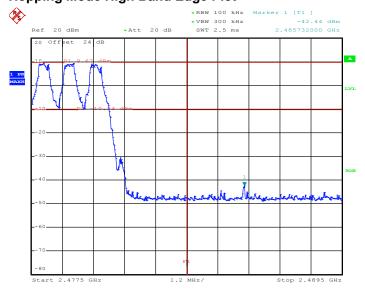

Date: 9.AUG.2017 23:30:56


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 37 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<2Mbps>

Hopping Mode Low Band Edge Plot

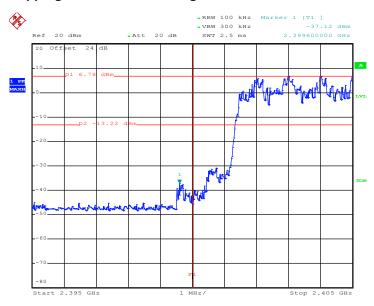

Date: 29.AUG.2017 11:01:06

Hopping Mode High Band Edge Plot

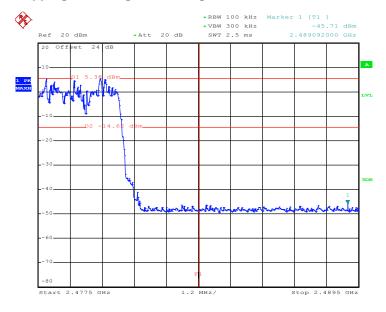

Date: 9.AUG.2017 23:32:15


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 38 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<3Mbps>

Hopping Mode Low Band Edge Plot

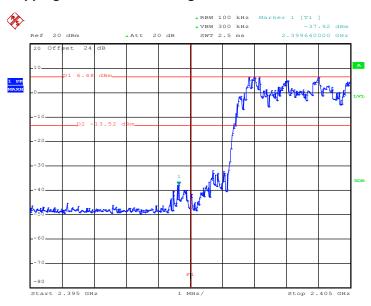

Date: 9.AUG.2017 23:33:00

Hopping Mode High Band Edge Plot

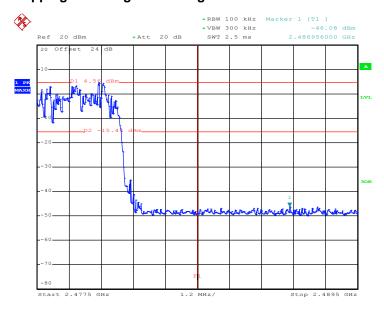

Date: 9.AUG.2017 23:33:46

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 39 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup

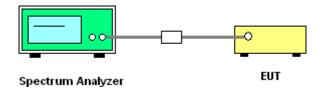

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 40 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

3.7.5 Test Result of Conducted Spurious Emission

Please refer to Appendix A.


<1Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

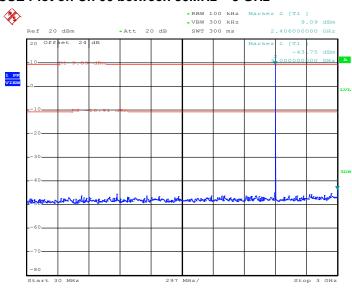

Date: 9.AUG.2017 23:40:45

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

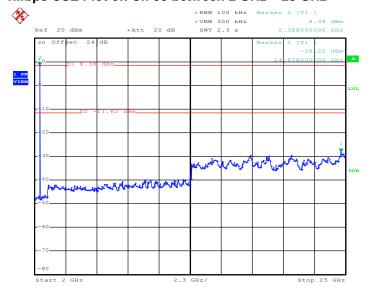

Date: 9.AUG.2017 23:41:07

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 41 of 56
Report Issued Date : Sep. 05, 2017


: Rev. 01

Report No.: FR750801A

Report Template No.: BU5-FR15CBT Version 2.0


Report Version

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

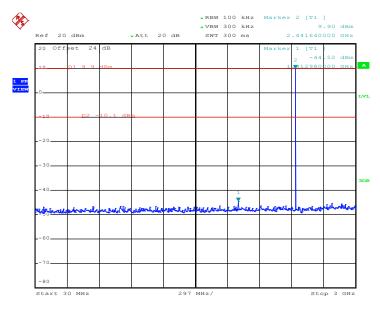

Date: 9.AUG.2017 23:45:12

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

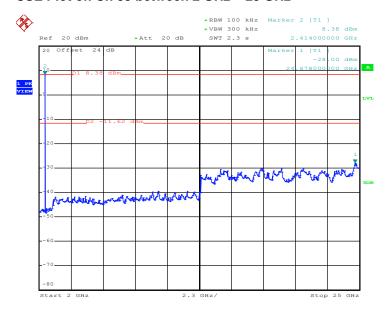


Date: 9.AUG.2017 23:45:34

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 42 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

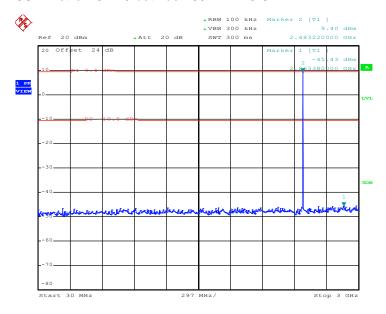

Date: 9.AUG.2017 23:50:27

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

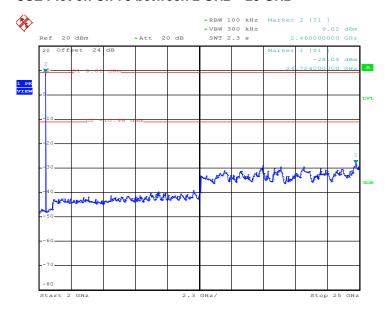

Date: 9.AUG.2017 23:50:49


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 43 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<2Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

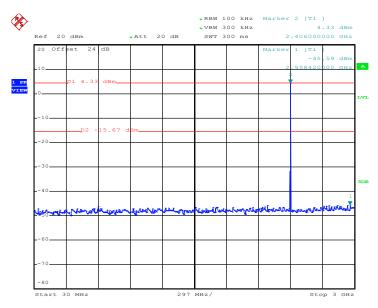

Date: 9.AUG.2017 23:55:28

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

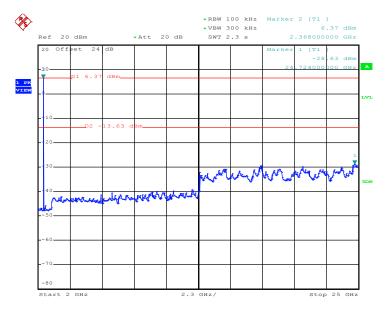


Date: 9.AUG.2017 23:55:50

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 44 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

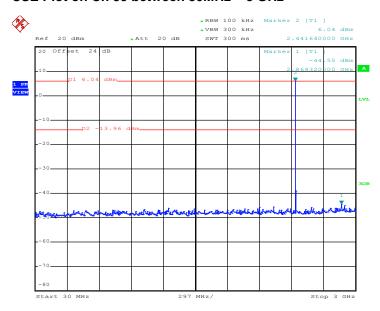

Date: 9.AUG.2017 23:59:24

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

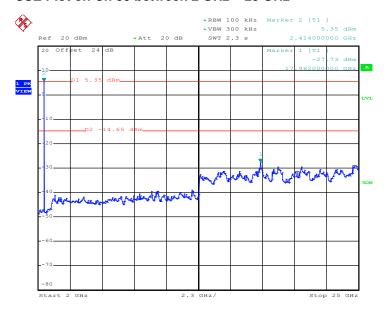


Date: 9.AUG.2017 23:59:46

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 45 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

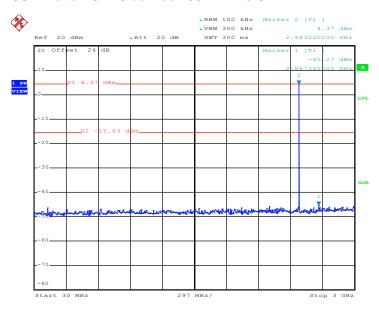

Date: 10.AUG.2017 00:03:27

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

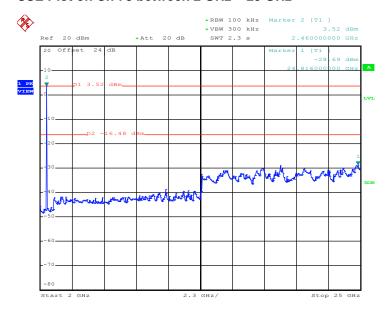

Date: 10.AUG.2017 00:03:49


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 46 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A


<3Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

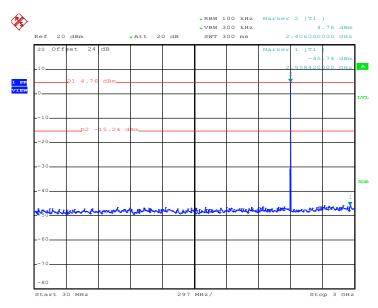

Date: 10.AUG.2017 00:08:32

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

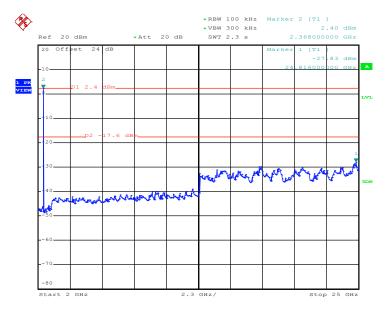


Date: 10.AUG.2017 00:08:54

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 47 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

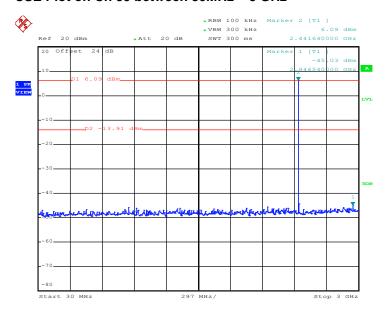

Date: 10.AUG.2017 00:13:05

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

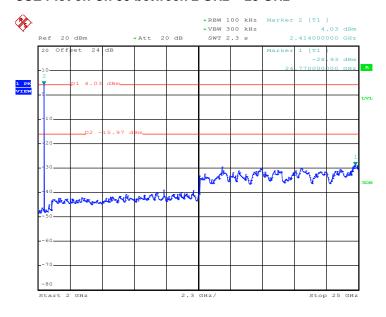


Date: 10.AUG.2017 00:13:27

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 48 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01


Report No.: FR750801A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

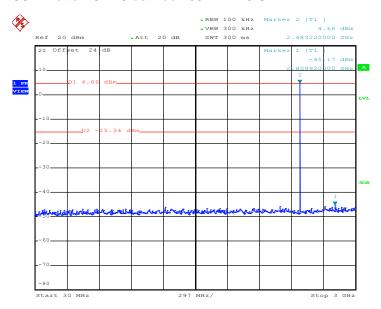

Date: 10.AUG.2017 00:18:03

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

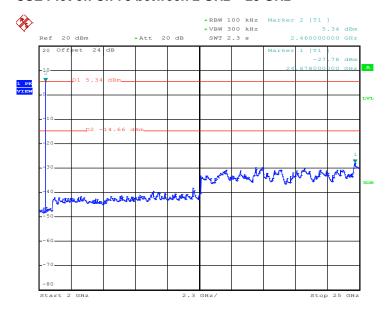

Date: 10.AUG.2017 00:18:25

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 49 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 - 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z3K-620053U554

TEL: 886-3-327-3456

Page Number : 50 of 56

Report Issued Date : Sep. 05, 2017

Report Version : Rev. 01

Report No.: FR750801A

3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c). Duty cycle = On time/100 milliseconds On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$
 - Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.
 - Average Emission Level = Peak Emission Level + 20*log(Duty cycle)
- 6. Corrected Reading: Antenna Factor + Cable Loss + Read Level Preamp Factor = Level


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (-24.71dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 51 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.8.4 Test Setup

For radiated emissions below 30MHz

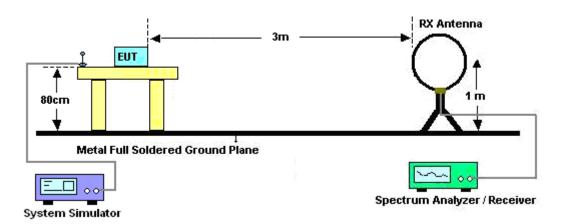


For radiated emissions from 30MHz to 1GHz



TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 52 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

For radiated emissions above 1GHz

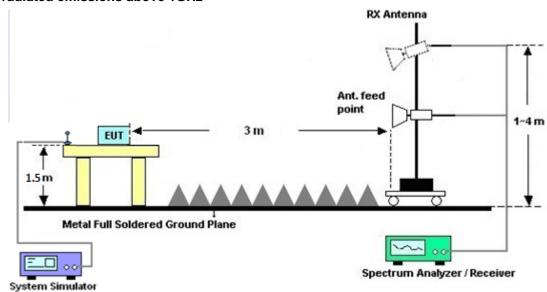

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C and D.

3.8.7 Duty Cycle

Please refer to Appendix E.

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix C and D.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 53 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

3.9 Antenna Requirements

3.9.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.9.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.9.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 54 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Power Meter	Power Meter Anritsu		0932001	N/A	Sep. 29, 2016	Jul. 19, 2017 ~ Aug. 29, 2017	Sep. 28, 2017	Conducted (TH05-HY)
Power Sensor	Anritsu	MA2411B	0846202	300MHz~40GH z	Sep. 29, 2016	Jul. 19, 2017 ~ Aug. 29, 2017	Sep. 28, 2017	Conducted (TH05-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP30	101067	9kHz ~ 30GHz	Nov. 17, 2016	Jul. 19, 2017 ~ Aug. 29, 2017	Nov. 16, 2017	Conducted (TH05-HY)
Programmable Power Supply	GW Instek	PSS-2005	GEO82176 3	N/A	Nov. 14, 2016	Jul. 19, 2017 ~ Aug. 29, 2017	Nov. 13, 2017	Conducted (TH05-HY)
BT Base Station(Measure)	Rohde & Schwarz	CBT	101136	BT 3.0	Sep. 21, 2016	Jul. 19, 2017 ~ Aug. 29, 2017	Sep. 20, 2017	Conducted (TH05-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100488	9 kHz~30 MHz	Oct. 20, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Oct. 19, 2018	Radiation (03CH12-HY)
Bilog Antenna	TESEQ	CBL 6111D&00800 N1D01N-06	37059&01	30MHz~1GHz	Oct. 15, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Oct. 14, 2017	Radiation (03CH12-HY)
EMI Test Receiver	Rohde & Schwarz	ESU26	100390	20Hz~26.5GHz	Dec. 23, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Dec. 22, 2017	Radiation (03CH12-HY)
Horn Antenna	SCHWARZBE CK	BBHA 9120D	9120D-132 8	1GHz ~ 18GHz	Oct. 25, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Oct. 24, 2017	Radiation (03CH12-HY)
Preamplifier	COM-POWER	PA-103	161075	10MHz~1GHz	Mar. 23, 2017	Aug. 11, 2017 ~ Aug. 30, 2017	Mar. 22, 2018	Radiation (03CH12-HY)
Preamplifier	MITEQ	AMF-7D-0010 1800-30-10P	1815698	1GHz~18GHz	Dec. 01, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Nov. 30, 2017	Radiation (03CH12-HY)
Preamplifier	Keysight	83017A	MY532701 48	1GHz~26.5GHz	Jan. 12, 2017	Aug. 11, 2017 ~ Aug. 30, 2017	Jan. 11, 2018	Radiation (03CH12-HY)
Filter	Wainwright	WHKX12-270 0-3000-18000 -60ST	SN2	3 GHz Highpass	Jul. 17, 2017	Aug. 11, 2017 ~ Aug. 30, 2017	Jul. 16, 2018	Radiation (03CH12-HY)
Filter	Wainwright	WLKS1200-1 2SS	SN2	1.2G Low Pass	Mar. 24, 2017	Aug. 11, 2017 ~ Aug. 30, 2017	Mar. 23, 2018	Radiation (03CH12-HY)
Antenna Mast	EMEC	AM-BS-4500- B	N/A	1m~4m	N/A	Aug. 11, 2017 ~ Aug. 30, 2017	N/A	Radiation (03CH12-HY)
Turn Table	EMEC	TT2000	N/A	0~360 Degree	N/A	Aug. 11, 2017 ~ Aug. 30, 2017	N/A	Radiation (03CH12-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA9170 576	18GHz ~ 40GHz	Apr. 27, 2017	Aug. 11, 2017 ~ Aug. 30, 2017	Apr. 26, 2018	Radiation (03CH12-HY)
Preamplifier	MITEQ	TTA1840-35- HG	1887435	18GHz~40GHz	Oct. 13, 2016	Aug. 11, 2017 ~ Aug. 30, 2017	Oct. 12, 2017	Radiation (03CH12-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z3K-620053U554 Page Number : 55 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of Confidence	2.70
of 95% (U = 2Uc(y))	2.70

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	5.40
of 95% (U = 2Uc(y))	5.10

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.20
of 95% (U = 2Uc(y))	5.20

Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)

	-
Measuring Uncertainty for a Level of Confidence of 95% (U = 2Uc(y))	4.70

SPORTON INTERNATIONAL INC.

FAX: 886-3-328-4978 FCC ID: Z3K-620053U554

TEL: 886-3-327-3456

Page Number : 56 of 56
Report Issued Date : Sep. 05, 2017
Report Version : Rev. 01

Report No.: FR750801A

Report Number : FR750801A

Appendix A. Test Result of Conducted Test Items

Test Engineer:	Shiming Liu	Temperature:	21~25	°C
Test Date:	2017/7/19~2017/8/29	Relative Humidity:	51~54	%

Report Number : FR750801A

Bluetooth

Test Engineer:	Shiming Liu	Temperature:	21~25	°C
Test Date:	2017/7/19~2017/8/29	Relative Humidity:	51~54	%

<u>TEST RESULTS DATA</u> 20dB and Hopping Channel Separation

Mod.	Data Rate	ХТИ	CH.	Freq. (MHz)	20db BW (MHz)	99% Bandwidth (MHz)	Hopping Channel Separation Measurement (MHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.83	0.82	1.00	0.5520	Pass
DH	1Mbps	1	39	2441	0.83	0.82	1.00	0.5547	Pass
DH	1Mbps	1	78	2480	0.83	0.81	1.00	0.5520	Pass
2DH	2Mbps	1	0	2402	1.25	1.17	1.01	0.8320	Pass
2DH	2Mbps	1	39	2441	1.24	1.17	1.01	0.8280	Pass
2DH	2Mbps	1	78	2480	1.25	1.17	1.01	0.8360	Pass
3DH	3Mbps	1	0	2402	1.22	1.16	1.01	0.8120	Pass
3DH	3Mbps	1	39	2441	1.22	1.16	1.01	0.8120	Pass
3DH	3Mbps	1	78	2480	1.22	1.16	0.99	0.8120	Pass

TEST RESULTS DATA Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.92	0.31	0.4	Pass
AFH	20	53.33	2.92	0.16	0.4	Pass

Report Number : FR750801A

TEST RESULTS DATA Peak Power Table

DH	chann el		Peak Power (dBm)	Power Limit (dBm)	Test Result
	0	1	10.44	20.97	Pass
DH1	39	1	10.43	20.97	Pass
	78	1	10.36	20.97	Pass

2DH	chann		Peak Power	Power Limit	Test
2011	el		(dBm)	(dBm)	Result
	0	1	8.93	20.97	Pass
2DH1	39	1	8.74	20.97	Pass
	78	1	8.33	20.97	Pass

3DH	chann		Peak Power	Power Limit	Test
3011	el		(dBm)	(dBm)	Result
	0	1	9.40	20.97	Pass
3DH1	39	1	9.21	20.97	Pass
	78	1	8.83	20.97	Pass

TEST RESULTS DATA

Number of Hoppina Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

Appendix B. Radiated Spurious Emission

Test Engineer :	Nick Yo, Peter Liao and Ray Chen	Temperature :	23~24°C
rest Engineer:	NICK 10, Feler Liao and Ray Chen	Relative Humidity :	59~61%

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dB _µ V)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		2376.99	53.13	-20.87	74	53.56	27.03	4.03	31.49	400	60	Р	Н
		2376.99	28.42	-25.58	54	-	-	-	-	-	-	Α	Н
	*	2402	99.47	-	-	99.81	27.11	4.04	31.49	400	60	Р	Н
	*	2402	74.76	-	-	-	-	-	-	-	-	Α	Н
ВТ													Н
CH00													Н
2402MHz		2376.99	51.61	-22.39	74	52.04	27.03	4.03	31.49	380	343	Р	V
2402111112		2376.99	26.9	-27.1	54	-	-	•	-	-	-	Α	V
	*	2402	96.74	-	-	97.08	27.11	4.04	31.49	380	343	Р	V
	*	2402	72.03	-	-	-	-	-	-	-	-	Α	V
													V
													V
		2384.62	52.01	-21.99	74	52.42	27.05	4.03	31.49	354	67	Р	Н
		2384.62	27.3	-26.7	54	-	-	-	-	-	-	Α	Н
	*	2441	97.79	-	-	97.97	27.22	4.07	31.47	354	67	Р	Н
	*	2441	73.08	-	-	-	-	-	-	-	-	Α	Н
		2491.95	44.15	-29.85	74	44.12	27.38	4.11	31.46	354	67	Р	Н
BT		2491.95	19.44	-34.56	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		2385.32	45.04	-28.96	74	45.44	27.06	4.03	31.49	373	310	Р	V
244 I WITIZ		2385.32	20.33	-33.67	54	-	-	-	-	-	-	Α	V
	*	2441	94.39	-	-	94.57	27.22	4.07	31.47	373	310	Р	V
	*	2441	69.68	-	-	-	-	1	-	-	-	Α	V
		2484.74	43.05	-30.95	74	43.06	27.35	4.11	31.47	373	310	Р	V
		2484.74	18.34	-35.66	54	-	-		-	-	-	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B1 of B7



SPORTON LAB. FCC RF Test Report

	*	2480	95.33	-	-	95.37	27.34	4.09	31.47	305	45	Р	Н
	*	2480	70.62	-	-	-	-	-	-	-	-	Α	Н
		2483.88	44.76	-29.24	74	44.77	27.35	4.11	31.47	305	45	Р	Н
		2483.88	20.05	-33.95	54	-	-	-	-	-	-	Α	Н
DT													Н
BT CH 78													Н
2480MHz	*	2480	94.58	-	-	94.62	27.34	4.09	31.47	400	315	Р	V
240011112	*	2480	69.87	-	-	-	-	-	-	-	-	Α	V
		2483.76	45.21	-28.79	74	45.22	27.35	4.11	31.47	400	315	Р	V
		2483.76	20.5	-33.5	54	-	-	-	-	-	-	Α	V
													V
													V
	1. No	o other spurious	s found.										
Remark		I results are PA		Peak and	Average lii	mit line.							

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
		1584	50.95	-23.05	74	54.55	25.23	3.24	32.07	322	108	Р	Н
		1584	26.24	-27.76	54	ı	-	-	-	-	-	Α	Н
DT		4804	58.44	-15.56	74	77.92	32.15	6.16	58.33	100	0	Р	Н
BT CH 00		4804	33.73	-20.27	54	1	-	-	-	-	-	Α	Н
2402MHz		1584	51.46	-22.54	74	55.06	25.23	3.24	32.07	245	198	Р	V
2402WII 12		1584	26.75	-27.25	54	-	-	-	-	-	-	Α	V
		4804	53.51	-20.49	74	72.99	32.15	6.16	58.33	100	0	Р	V
		4804	28.8	-25.2	54	-	-	-	-	-	-	Α	V
		1584	51.06	-22.94	74	54.66	25.23	3.24	32.07	322	108	Р	Н
		1584	26.35	-27.65	54	-	-	-	-	-	-	Α	Н
		4882	60.52	-13.48	74	79.74	32.29	6.21	58.24	100	0	Р	Н
		4882	35.81	-18.19	54	-	-	-	-	-	-	Α	Н
D.T.		7323	44.74	-29.26	74	58.78	37	7.72	59.1	100	0	Р	Н
BT CH 39		7323	20.03	-33.97	54	-	-	-	-	-	-	Α	Н
2441MHz		1584	50.92	-23.08	74	54.52	25.23	3.24	32.07	245	198	Р	V
244 I WIFI2		1584	26.21	-27.79	54	-	-	-	-	-	-	Α	٧
		4882	54.86	-19.14	74	74.08	32.29	6.21	58.24	100	0	Р	٧
		4882	30.15	-23.85	54	-	-	-	-	-	-	Α	V
		7323	45.58	-28.42	74	59.62	37	7.72	59.1	100	0	Р	V
		7323	20.87	-33.13	54	-	-	-	-	-	-	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B3 of B7



1584 -23.04 25.23 3.24 32.07 Ρ Н 50.96 74 54.56 322 108 1584 26.25 -27.75 54 Α Н -14.59 Ρ 4960 59.41 74 78.37 32.43 6.26 58.14 100 0 Н 4960 34.7 -19.3 54 Н Α 7440 43.98 -30.02 74 57.75 37.33 7.75 59.17 100 0 Ρ Н BT 7440 -34.73 19.27 54 Н **CH 78** -22.81 74 3.24 32.07 ٧ 1584 51.19 54.79 25.23 245 198 2480MHz 1584 -27.52 Α ٧ 26.48 54 4960 55.95 -18.05 74 74.91 32.43 6.26 58.14 100 0 Ρ ٧ ٧ 4960 31.24 -22.76 54 Α Ρ ٧ 7440 44.78 -29.22 74 37.33 7.75 59.17 58.55 100 0 ٧ 7440 20.07 -33.93 54 Α No other spurious found. Remark All results are PASS against Peak and Average limit line.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Emission below 1GHz

2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V
		30	21.9	-18.1	40	27.29	24.35	0.48	30.18			Р	Н
		145.56	36.6	-6.9	43.5	48.47	17.42	0.95	30.34			Р	Н
		291.09	33.54	-12.46	46	43.08	19.11	1.39	30.15			Р	Н
		528.2	42.1	-3.9	46	45.61	24.28	1.87	29.75	100	0	Р	Н
		678.7	40.87	-5.13	46	41.63	26.6	2.09	29.56			Р	Н
		1000	34.67	-19.33	54	30.24	30.62	2.55	28.96			Р	Н
													Н
													Н
													Н
													Н
2.4GHz													Н
2.4GHZ BT													Н
LF		36.75	33.87	-6.13	40	42.63	21.05	0.48	30.27			Р	V
		129.09	32.11	-11.39	43.5	43.81	17.66	0.95	30.36			Р	V
		291.09	33.1	-12.9	46	42.64	19.11	1.39	30.15			Р	V
		528.2	40.7	-5.3	46	44.21	24.28	1.87	29.75	100	0	Р	V
		678.7	40.43	-5.57	46	41.19	26.6	2.09	29.56			Р	V
		873.3	35.72	-10.28	46	33.12	29.28	2.39	29.21			Р	V
													V
													V
													V
													V
													V
													V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: B5 of B7

Note symbol

Report No. : FR750801A

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions
	shall not exceed the level of the fundamental frequency.
!	Test result is over limit line.
P/A	Peak or Average
H/V	Horizontal or Vertical

SPORTON INTERNATIONAL INC. Page Number : B6 of B7

A calculation example for radiated spurious emission is shown as below:

Report No.: FR750801A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01												-	
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : B7 of B7



Appendix C. Radiated Spurious Emission Plots

Toot Engineer		Temperature :	23~24°C
Test Engineer :	Nick Yo, Peter Liao and Ray Chen	Relative Humidity :	59~61%

Report No.: FR750801A

Note symbol


-L	Low channel location
-R	High channel location

SPORTON INTERNATIONAL INC. Page Number : C1 of C11



2.4GHz 2400~2483.5MHz


BT (Band Edge @ 3m)

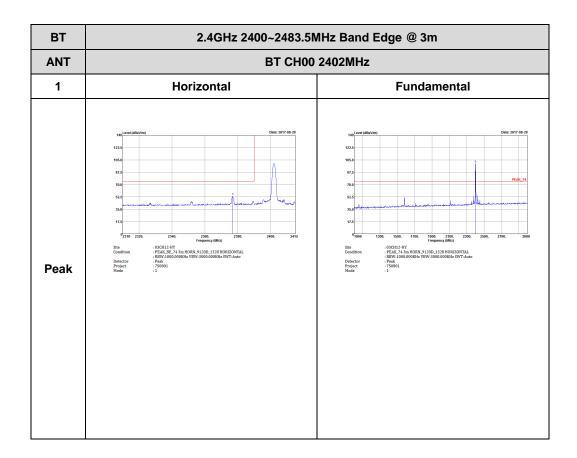


TEL: 886-3-327-3456 FAX: 886-3-328-4978

TEL: 886-3-327-3456 FAX: 886-3-328-4978


Report No.: FR750801A

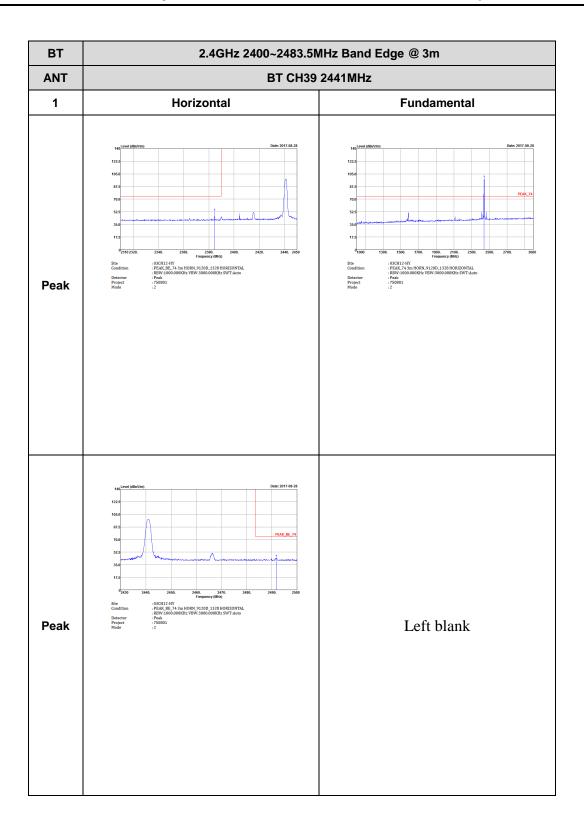

Report No.: FR750801A

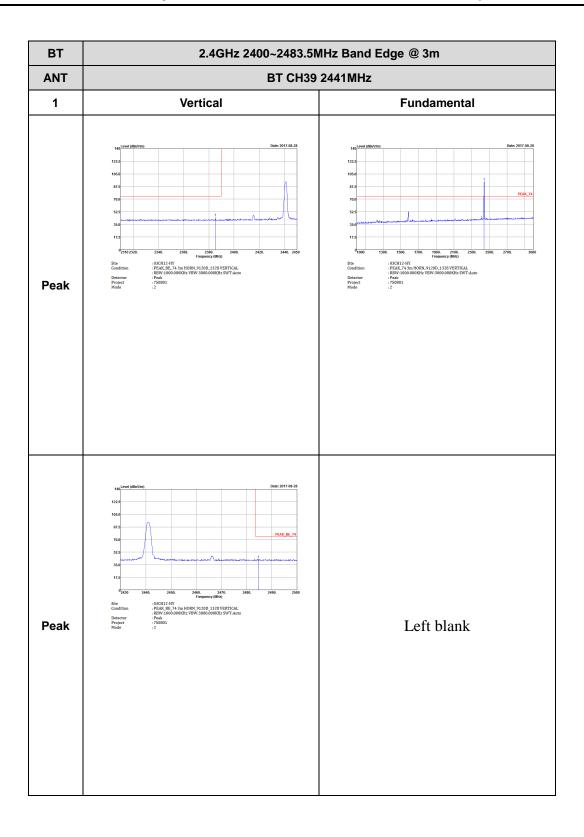

Report No. : FR750801A

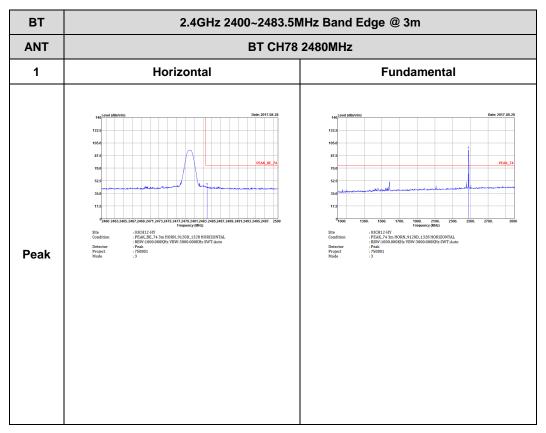

ANT BT CH78 2480MHz

1 Vertical Fundamental

1 Vertical Fundamental

1 George 1800 Fundamental

1 Geor


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Report No. : FR750801A

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

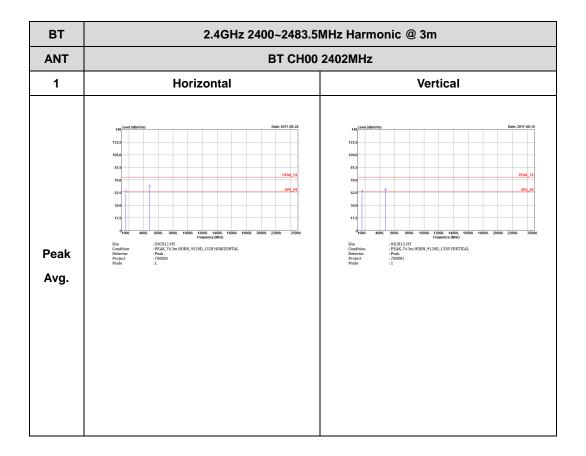

ANT

BT CH39 2441MHz


1 Horizontal

Vertical

1 Horizontal

Peak
Avg.


TEL: 886-3-327-3456 FAX: 886-3-328-4978

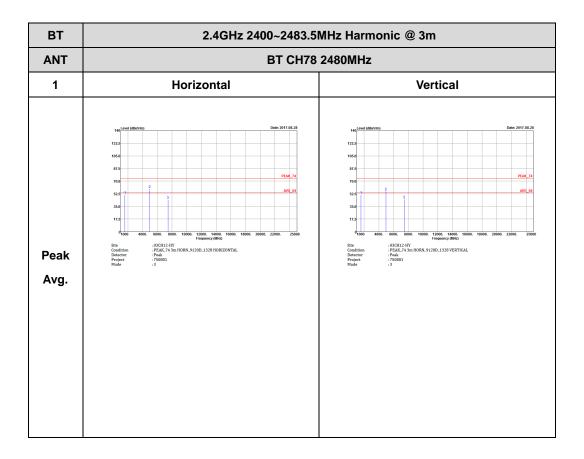

TEL: 886-3-327-3456 FAX: 886-3-328-4978



Emission below 1GHz 2.4GHz BT (LF)

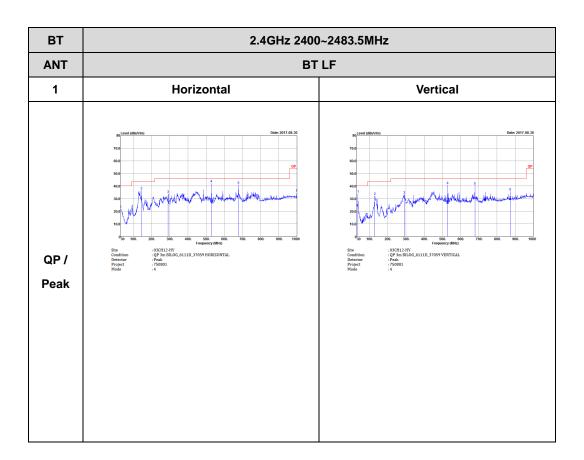


TEL: 886-3-327-3456 FAX: 886-3-328-4978



Report No.: FR750801A


Appendix D. Duty Cycle Plots

DH5 on time (One Pulse) Plot on Channel 39

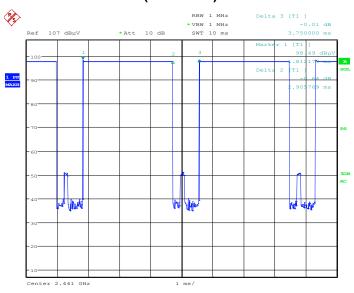

Date: 28.AUG.2017 02:02:35

on time (Count Pulses) Plot on Channel 39

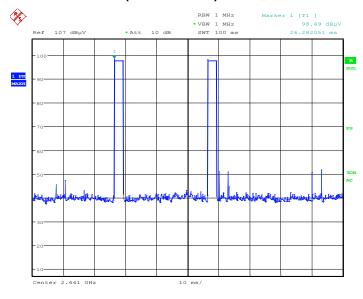

Date: 28.AUG.2017 02:03:14

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 * 2.91 / 100 = 5.82 %
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.71 dB
- 3. **DH5** has the highest duty cycle worst case and is reported.



FCC RF Test Report

Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

2.91 ms x 20 channels = 58.2 ms

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

$$2.91 \text{ ms } x 2 = 5.82 \text{ ms}$$

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.76 \text{ ms}/100\text{ms}) = -24.71 \text{ dB}$

TEL: 886-3-327-3456 FAX: 886-3-328-4978