
Appendix A. Test Result of Conducted Spurious Emission

Test Result of Conducted Spurious at Band Edges in the Restricted Band

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Grounding	Peak
				Limit	Line	Level	Gain	Loss	Factor	Avg
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dBi)	(dB)	(dB)	(P/A)
BT CH00 2402MHz		2376.69	-31.47	-10.27	-21.2	-35.93	3.2	1.26	0	Р
		2376.69	-59.21	-18.01	-41.2	-	ı	-	0	Α
	*	2402.505	-9.15	-	-	-13.62	3.2	1.27	0	Р
	*	2402.505	-36.89	-	-	-	-	-	0	Α
		2389.56	-39.19	-17.99	-21.2	-43.66	3.2	1.27	0	Р
		2389.56	-66.93	-25.73	-41.2	-	-	-	0	Α
BT CH39	*	2441.833	-9.21	-	-	-13.69	3.2	1.28	0	Р
2441MHz	*	2441.833	-36.95	-	-	-	-	-	0	Α
244111112		2491.84	-37.59	-16.39	-21.2	-42.08	3.2	1.29	0	Р
		2491.84	-65.33	-24.13	-41.2	-	ı	-	0	Α
	*	2480.912	-9.12	-	-	-13.6	3.2	1.28	0	Р
BT CH78 2480MHz	*	2480.995	-36.86	-	-	-	-	-	0	А
		2483.52	-24.54	-3.34	-21.2	-29.02	3.2	1.28	0	Р
		2483.52	-52.28	-11.08	-41.2	-	-	-	0	А

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Report No.: FR4O2349A

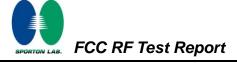

Test Result of Conducted Spurious Emission in the Restricted Band

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Grounding	Peak
				Limit	Line	Level	Gain	Loss	Factor	Avg
		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dBi)	(dB)	(dB)	(P/A)
		32.91	-67.44	-12.24	-55.2	-75.51	3.2	0.17	4.7	Р
		168.71	-79.72	-28.02	-51.7	-87.92	3.2	0.3	4.7	Р
		444.19	-79.3	-30.1	-49.2	-87.64	3.2	0.44	4.7	Р
ВТ		627.52	-80.38	-31.18	-49.2	-88.81	3.2	0.53	4.7	Р
CH00		800.18	-66.17	-16.97	-49.2	-74.64	3.2	0.57	4.7	Р
2402MHz		948.59	-80.66	-31.46	-49.2	-89.19	3.2	0.63	4.7	Р
		4804	-30.61	-9.41	-21.2	-35.48	3.2	1.67	0	Р
		4804	-58.35	-17.15	-41.2	-	-	1	0	Α
		7206	-49.06	-27.86	-21.2	-54.14	3.2	1.88	0	Р
		45.52	-76.35	-21.15	-55.2	-84.44	3.2	0.19	4.7	Р
		72.68	-77.68	-22.48	-55.2	-85.79	3.2	0.21	4.7	Р
		318.09	-80.46	-31.26	-49.2	-88.74	3.2	0.38	4.7	Р
вт		558.65	-79.74	-30.54	-49.2	-88.13	3.2	0.49	4.7	Р
CH39		703.18	-72.38	-23.18	-49.2	-80.83	3.2	0.55	4.7	Р
2441MHz		813.76	-51.07	-1.87	-49.2	-59.56	3.2	0.59	4.7	Р
		4882	-29.57	-8.37	-21.2	-34.47	3.2	1.70	0	Р
		4882	-57.31	-16.11	-41.2	-	-	1	0	А
		7323	-53.87	-32.67	-21.2	-59.04	3.2	1.97	0	Р
		45.52	-75.81	-20.61	-55.2	-83.9	3.2	0.19	4.7	Р
		140.58	-79.43	-27.73	-51.7	-87.6	3.2	0.27	4.7	Р
		438.37	-80.21	-31.01	-49.2	-88.55	3.2	0.44	4.7	Р
вт		552.83	-79.89	-30.69	-49.2	-88.28	3.2	0.49	4.7	Р
CH78		703.18	-73.03	-23.83	-49.2	-81.48	3.2	0.55	4.7	Р
2480MHz		827.34	-49.91	-0.71	-49.2	-58.4	3.2	0.59	4.7	Р
		4960	-30.74	-9.54	-21.2	-35.67	3.2	1.73	0	Р
		4960	-58.48	-17.28	-41.2	-	-	-	0	А
		7440	-48.68	-27.48	-21.2	-53.95	3.2	2.07	0	Р

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Report No.: FR4O2349A