

FCC RF Test Report

APPLICANT : Texas Instruments Incorporated

EQUIPMENT: WiFi and Bluetooth Module

BRAND NAME : Texas Instruments
MODEL NAME : WL1835MODGA
FCC ID : Z64-WL1835MOD

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Aug. 30, 2013 and testing was completed on Oct. 10, 2013. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the procedures and shown to be compliant with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 1 of 85 Report Issued Date : Nov. 06, 2013

1190

Report Version : Rev. 02



TABLE OF CONTENTS

RE۱	EVISION HISTORY3						
SUI	имаг	RY OF TEST RESULT	4				
1	GENI	ERAL DESCRIPTION	5				
	1.1	Applicant	5				
	1.2	Manufacturer	5				
	1.3	Feature of Equipment Under Test	5				
	1.4	Product Specification of Equipment Under Test					
	1.5	Modification of EUT	6				
	1.6	Testing Site	6				
	1.7	Applied Standards	6				
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7				
	2.1	Descriptions of Test Mode	7				
	2.2	Test Mode					
	2.3	Connection Diagram of Test System					
	2.4	Support Unit used in test configuration and system					
	2.5	EUT Operation Test Setup					
	2.6	Measurement Results Explanation Example	11				
3	TEST	RESULT	12				
	3.1	Number of Channel Measurement					
	3.2	Hopping Channel Separation Measurement					
	3.3	Dwell Time Measurement					
	3.4	20dB and 99% Bandwidth Measurement					
	3.5	Peak Output Power Measurement					
	3.6	Conducted Band Edges Measurement					
	3.7	Conducted Spurious Emission Measurement					
	3.8	Radiated Band Edges and Spurious Emission Measurement					
	3.9	AC Conducted Emission Measurement					
	3.10	Antenna Requirements	83				
4	LIST	OF MEASURING EQUIPMENT	84				
5	UNC	ERTAINTY OF EVALUATION	85				
AF	PENI	DIX A. SETUP PHOTOGRAPHS					

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 2 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR383067A	Rev. 01	Initial issue of report	Nov. 04, 2013
FR383067A	Rev. 02	Update report for revising equipment name.	Nov. 06, 2013

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 3 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



SUMMARY OF TEST RESULT

Report Section	FCC Rule	IC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	RSS-210 A8.4(2)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	RSS-210 A8.1(b)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	RSS-210 A8.1(d)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	RSS-210 A8.1(a)	20dB Bandwidth	NA	Pass	-
3.4	-	RSS-Gen 4.6.1	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	RSS-210 A8.1(b)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	RSS-210 A8.5	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	RSS-210 A8.5	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	RSS-210 A8.5	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 7.84 dB at 50.520 MHz
3.9	15.207	RSS-Gen 7.2.4	AC Conducted Emission	15.207(a)	Pass	Under limit 8.80 dB at 0.350 MHz
3.10	15.203 & 15.247(b)	RSS-210 A8.4	Antenna Requirement	N/A	Pass	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 4 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



1 General Description

1.1 Applicant

Texas Instruments Incorporated

12500 TI Boulevard M/S 8751. Dallas, TX 75243.

1.2 Manufacturer

Jorjin Technologies Inc.

17F., No. 239, Sec. 1, Datong Rd, Xizhi Dist. New Taipei City 221, Taiwan. R.O.C.

1.3 Feature of Equipment Under Test

Product Feature				
Equipment	WiFi and Bluetooth Module			
Brand Name	Texas Instruments			
Model Name	WL1835MODGA			
FCC ID	Z64-WL1835MOD			
	WLAN 11b/g/n (HT20/HT40)			
EUT supports Radios application	Bluetooth v3.0 + EDR			
	Bluetooth v4.0 + LE			
EUT Stage	Production Unit			

Remark: The above EUT's information was declared by manufacturer. Please refer to the specifications or user's manual for more detailed description.

1.4 Product Specification of Equipment Under Test

Product Specification subjective to this standard				
Tx/Rx Frequency Range	2402 MHz ~ 2480 MHz			
Number of Channels	79			
Carrier Frequency of Each Channel	2402+n*1 MHz; n=0~78			
Maximum Output Power to Antenna	Bluetooth BR(1Mbps): 11.79 dBm (0.0151 W) Bluetooth EDR (2Mbps): 9.17 dBm (0.0083 W) Bluetooth EDR (3Mbps): 9.63 dBm (0.0092 W)			
99% Occupied Bandwidth	Bluetooth BR(1Mbps) : 0.836MHz Bluetooth EDR (2Mbps) : 1.180MHz Bluetooth EDR (3Mbps) : 1.188MHz			
Antenna Type	Chip Antenna type with gain -0.36 dBi			
Type of Modulation	Bluetooth BR (1Mbps) : GFSK Bluetooth EDR (2Mbps) : π /4-DQPSK Bluetooth EDR (3Mbps) : 8-DPSK			

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 5 of 85

Report Issued Date : Nov. 06, 2013

Report Version : Rev. 02

1.5 Modification of EUT

No modifications are made to the EUT during all test items.

1.6 Testing Site

Test Site	SPORTON INTERNATIONAL INC.			
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,			
Test Site Location	Kwei-Shan Hsiang, Tao Yuan Hsien, Taiwan, R.O.C.			
	TEL: +886-3-32	273456 / FAX: +	886-3-3284978	
Took Site No		Sporton Site No).	FCC/IC Registration No.
Test Site No.	TH02-HY	CO05-HY	03CH07-HY	722060/4086B-1

Note: The test site complies with ANSI C63.4 2003 requirement.

1.7 Applied Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- FCC Public Notice DA 00-705
- ANSI C63.4-2003

Remark:

- 1. All test items were verified and recorded according to the standards and without any deviation during the test.
- 2. This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 6 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



2 Test Configuration of Equipment Under Test

2.1 Descriptions of Test Mode

Preliminary tests were performed in different data rates and recorded the RF output power in the following table:

		В	luetooth RF Output Powe	er	
Channal	Eroguenev	Data Rate / Modulation			
Channel	Frequency	GFSK	π/4-DQPSK	8-DPSK	
		1Mbps	2Mbps	3Mbps	
Ch00	2402MHz	<mark>11.79</mark> dBm	<mark>9.17</mark> dBm	<mark>9.63</mark> dBm	
Ch39	2441MHz	11.62 dBm	8.58 dBm	9.11 dBm	
Ch78	2480MHz	11.48 dBm	8.03 dBm	8.59 dBm	

Remark:

- 1. All the test data for each data rate were verified, but only the worst case was reported.
- 2. The data rate was set in 1Mbps for all the test items due to the highest RF output power.
- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction (150 kHz to 30 MHz), radiation (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower).
- b. AC power line Conducted Emission was tested under maximum output power.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 7 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



2.2 Test Mode

The following summary table is showing all test modes to demonstrate in compliance with the standard.

Summary table of Test Cases					
		Data Rate / Modulation			
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps		
	GFSK	π /4-DQPSK	8-DPSK		
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz		
	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz		
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz		
		Bluetooth BR 1Mbps GFS	SK .		
Radiated		Mode 1: CH00_2402 MHz	2		
Test Cases		Mode 2: CH39_2441 MHz	2		
	Mode 3: CH78_2480 MHz				
AC					
Conducted					
Emission					

Remark:

For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and the conducted spurious emissions and conducted band edge measurement for each data rate are no worse than 1Mbps, and no other significantly frequencies found in conducted spurious emission.


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 8 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02




2.3 **Connection Diagram of Test System**

<Bluetooth Tx Mode>

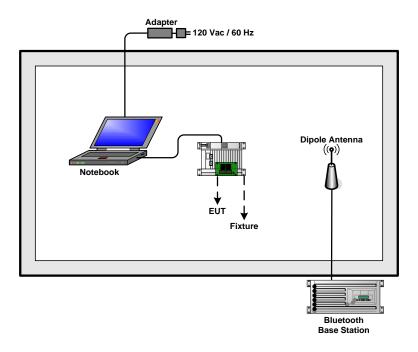

<AC Conducted Emission Mode>

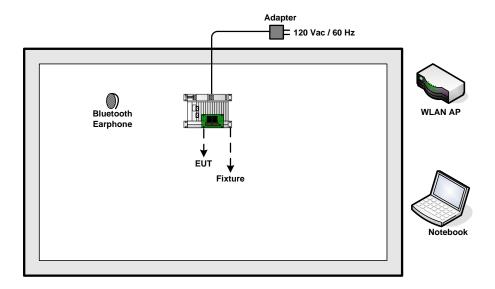

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 9 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02



2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Bluetooth Base Station	R&S	CBT32	N/A	N/A	Unshielded, 1.8 m
2.	WLAN AP	D-Link	DIR-628	KA2DIR628A2	N/A	Unshielded, 1.8 m
3.	Notebook	DELL	Latitude E6320	FCC DoC	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
4.	Bluetooth Earphone	Sony Ericsson	MW600	PY7DDA-2029	N/A	N/A
5.	Notebook	DELL	Vostro 1510	FCC DoC	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
6.	Adapter	Aviv Energy	HK-IP15-A05	N/A	N/A	Unshielded, 1.8 m
7.	Fixture	N/A	WG7XXXT01	N/A	N/A	N/A

2.5 EUT Operation Test Setup

For Bluetooth function, the RF utility, "HCI_Tester" was installed in notebook which was programmed in order to make the EUT get into the engineering modes to contact with Bluetooth base station for continuous transmitting and receiving signals.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 10 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

$$Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$$

= 4.2 + 10 = 14.2 (dB)

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 11 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.


3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = the frequency band of operation; RBW ≥ 1% of the span; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup



3.1.5 Test Result of Number of Hopping Frequency

Test Mode :	1Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%


Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	> 15	Pass

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 12 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Number of Hopping Channel Plot on Channel 00 - 78

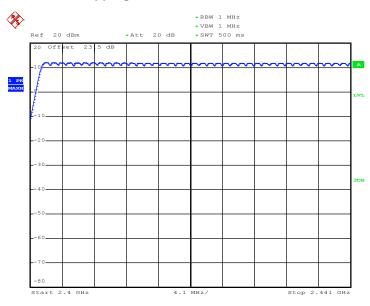

Date: 4.OCT.2013 16:20:00

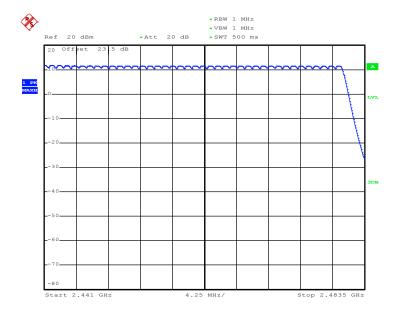

Date: 4.OCT.2013 16:26:08

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 13 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.


3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 Span = wide enough to capture the peaks of two adjacent channels; RBW ≥ 1% of the span;
 VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup

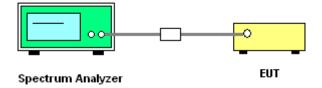

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 14 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.2.5 Test Result of Hopping Channel Separation

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.5440	Pass
39	2441	1.002	0.5440	Pass
78	2480	1.002	0.5467	Pass

Channel Separation Plot on Channel 00 - 01

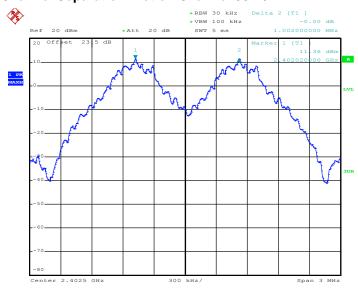


Date: 4.0CT.2013 15:18:28

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 15 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






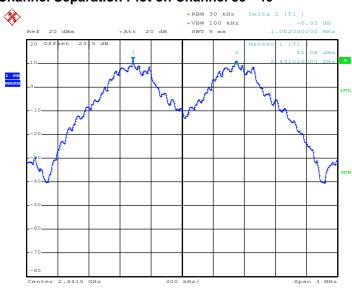

Date: 4.OCT.2013 15:19:15

Channel Separation Plot on Channel 77 - 78

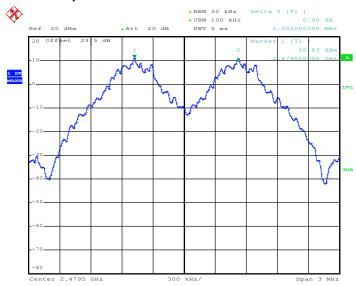

Date: 4.OCT.2013 15:26:59


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 16 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8520	Pass
39	2441	1.008	0.8520	Pass
78	2480	1.002	0.8520	Pass

Channel Separation Plot on Channel 00 - 01

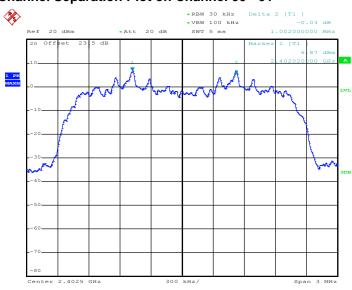


Date: 4.OCT.2013 15:32:02

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 17 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






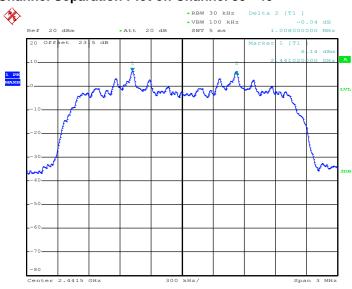

Date: 4.OCT.2013 15:30:57

Channel Separation Plot on Channel 77 - 78

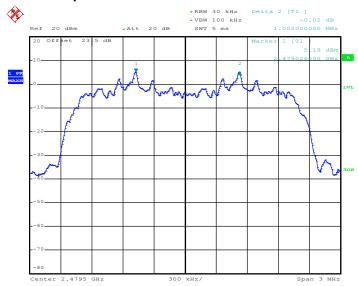

Date: 4.OCT.2013 15:28:44

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 18 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	Frequency Separation (MHz)	(2/3 of 20dB BW) Limits (MHz)	Pass/Fail
00	2402	1.002	0.8640	Pass
39	2441	1.002	0.8640	Pass
78	2480	1.002	0.8640	Pass

Channel Separation Plot on Channel 00 - 01

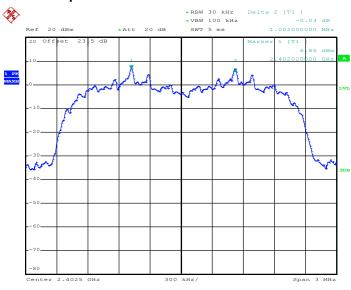


Date: 4.OCT.2013 15:33:23

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 19 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






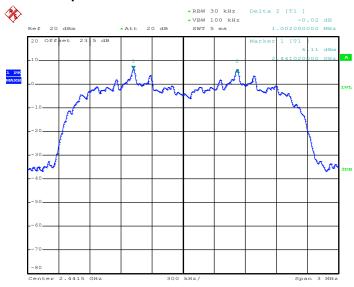

Date: 4.OCT.2013 15:34:32

Channel Separation Plot on Channel 77 - 78

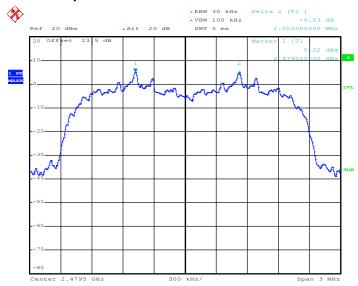

Date: 4.OCT.2013 15:35:37

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 20 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02



3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.


3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup

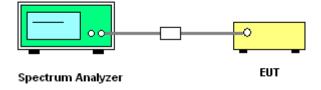

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 21 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.3.5 Test Result of Dwell Time

Test Mode :	DH5	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Mode	Channel	Hops Over Occupancy Time(hops)	IIMA	Dwell Time (sec)	Limits (sec)	Pass/Fail
Normal	79	106.67	2.92	0.31	0.4	Pass
AFH	20	53.33	2.92	0.16	0.4	Pass

Remark:

- In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels.
 With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4 x 79) (s),
 Hops Over Occupancy Time comes to (1600 / 6 / 79) x (0.4 x 79) = 106.67 hops.
- 2. In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels.
 With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4 x 20) (s),
 Hops Over Occupancy Time comes to (800 / 6 / 20) x (0.4 x 20) = 53.33 hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 22 of 85 Report Issued Date : Nov. 06, 2013

Report No.: FR383067A

Report Version : Rev. 02



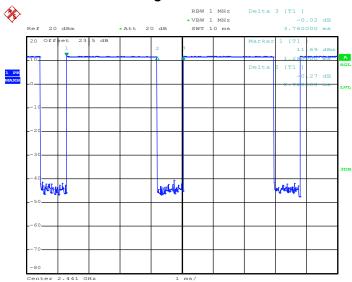

Date: 30.SEP.2013 16:22:35

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 23 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 Span = approximately 2 to 3 times the 20 dB bandwidth, centered on a hopping channel;
 RBW ≥ 1% of the 20 dB bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;

Trees may held

Trace = max hold.

- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 For 99% Bandwidth measurement, the RBW=30kHz, and VBW = 100kHz. Sweep = auto;
 Detector function = sample. Trace = max hold.
- 6. Measure and record the results in the test report.

3.4.4 Test Setup



SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 24 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.4.5 Test Result of 20dB Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	0.816
39	2441	0.816
78	2480	0.820

20 dB Bandwidth Plot on Channel 00



Date: 4.OCT.2013 15:38:44

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 25 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02







Date: 4.OCT.2013 15:39:06

20 dB Bandwidth Plot on Channel 78



Date: 4.OCT.2013 15:49:01


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 26 of 85 Report Issued Date: Nov. 06, 2013 : Rev. 02 Report Version

Test Mode :	2Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.278
39	2441	1.278
78	2480	1.278

20 dB Bandwidth Plot on Channel 00

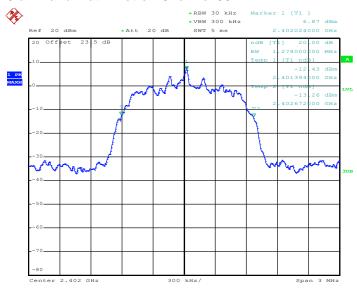


Date: 4.OCT.2013 15:50:45

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 27 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02




20 dB Bandwidth Plot on Channel 39

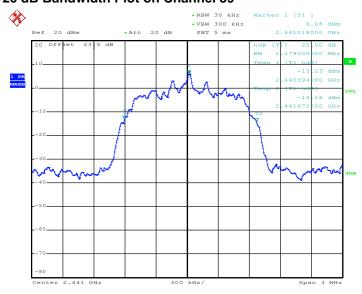

Date: 4.OCT.2013 15:50:14

20 dB Bandwidth Plot on Channel 78

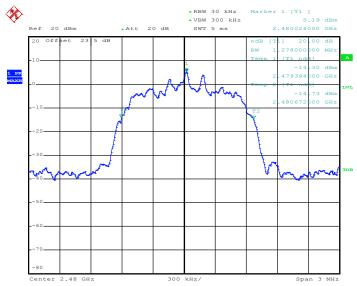

Date: 4.OCT.2013 15:49:40


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 28 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	20dB Bandwidth (MHz)
00	2402	1.296
39	2441	1.296
78	2480	1.296

20 dB Bandwidth Plot on Channel 00

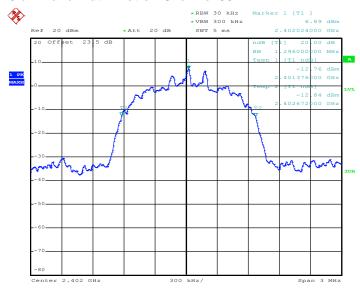


Date: 4.OCT.2013 15:51:26

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 29 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






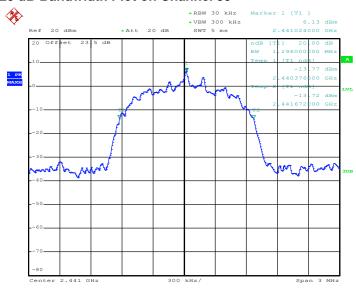

Date: 4.OCT.2013 15:52:32

20 dB Bandwidth Plot on Channel 78

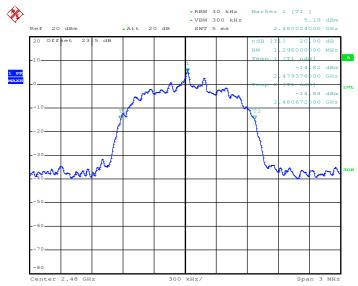

Date: 4.OCT.2013 15:53:07

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 30 of 85 Report Issued Date: Nov. 06, 2013 : Rev. 02 Report Version

3.4.6 Test Result of 99% Occupied Bandwidth

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	0.824
39	2441	0.836
78	2480	0.816

99% Occupied Bandwidth Plot on Channel 00



Date: 4.OCT.2013 15:44:44

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 31 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02







Date: 4.OCT.2013 15:45:21

99% Occupied Bandwidth Plot on Channel 78



Date: 4.OCT.2013 16:42:19


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 32 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	2Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.180
39	2441	1.180
78	2480	1.180

99% Occupied Bandwidth Plot on Channel 00

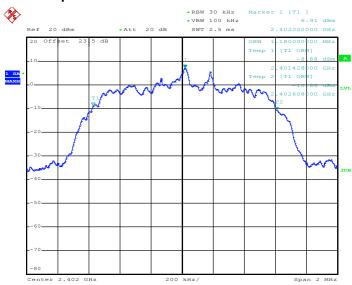


Date: 4.OCT.2013 16:27:25

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 33 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






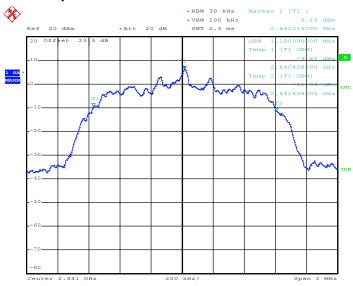

Date: 4.OCT.2013 16:28:05

99% Occupied Bandwidth Plot on Channel 78

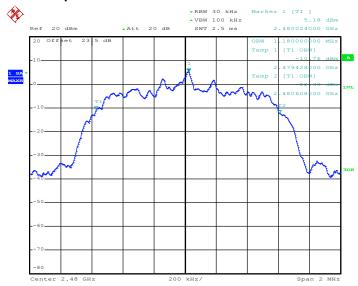

Date: 4.OCT.2013 16:28:53


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 34 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

Channel	Frequency (MHz)	99% Occupied Bandwidth (MHz)
00	2402	1.188
39	2441	1.188
78	2480	1.180

99% Occupied Bandwidth Plot on Channel 00

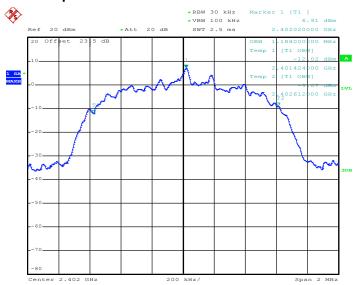


Date: 4.OCT.2013 16:31:12

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 35 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02






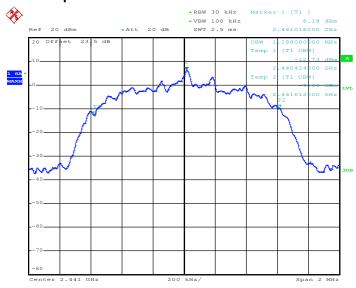

Date: 4.OCT.2013 16:30:15

99% Occupied Bandwidth Plot on Channel 78

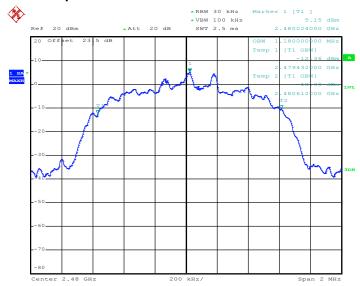

Date: 4.OCT.2013 16:29:33

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 36 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps is 1watt, and for 2Mbps, 3Mbps and AFH are 0.125 watts.


3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup

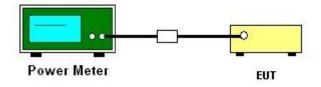

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 37 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.5.5 Test Result of Peak Output Power

Test Mode :	1Mbps	Temperature :	24~26℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

	Fragueney	RF Power (dBm)		
Channel	Frequency (MHz)	GFSK	Max. Limits	Pass/Fail
	(IVITIZ)	1 Mbps	(dBm)	Pass/Faii
00	2402	11.79	20.97	Pass
39	2441	11.62	20.97	Pass
78	2480	11.48	20.97	Pass

Note: For AFH mode using 20 hopping channels, the maximum output power limit is 20.97dBm.

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

	Eroguenev	RF Power (dBm)		
Channel	Frequency	π /4-DQPSK Max.		Pass/Fail
	(MHz)	2 Mbps	(dBm)	Pass/Faii
00	2402	9.17	20.97	Pass
39	2441	8.58	20.97	Pass
78	2480	8.03	20.97	Pass

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

	F	RF Power (dBm)		
Channel	Frequency	8-DPSK	Max. Limits	Pass/Fail
	(MHz)	3 Mbps	(dBm)	Pass/Faii
00	2402	9.63	20.97	Pass
39	2441	9.11	20.97	Pass
78	2480	8.59	20.97	Pass

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 38 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- The testing follows the guidelines in Band-edge Compliance of RF Conducted Emissions of FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz (≥ 1% span=10MHz), VBW = 300kHz (≥ RBW). Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 39 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.6.6 Test Result of Conducted Band Edges

Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	00 and 78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

Low Band Edge Plot on Channel 00

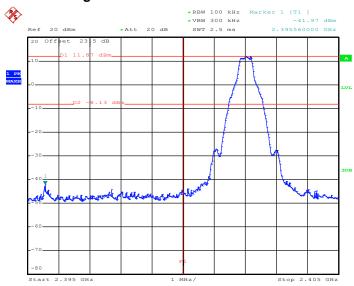


Date: 4.OCT.2013 16:03:57

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 40 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





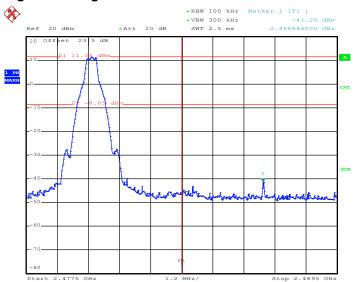


Date: 4.OCT.2013 16:06:16

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 41 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

Low Band Edge Plot on Channel 00

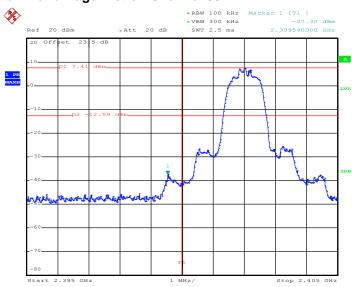


Date: 4.OCT.2013 16:10:06

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 42 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





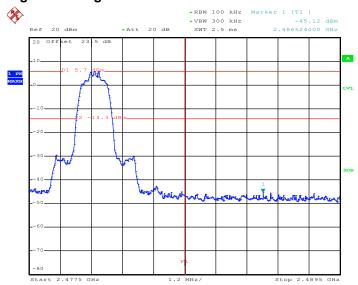


Date: 4.OCT.2013 16:08:01

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 43 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Channel :	00 and 78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

Low Band Edge Plot on Channel 00

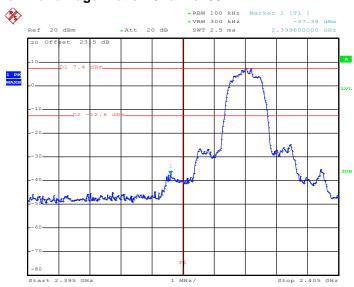


Date: 4.OCT.2013 16:11:31

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 44 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



High Band Edge Plot on Channel 78

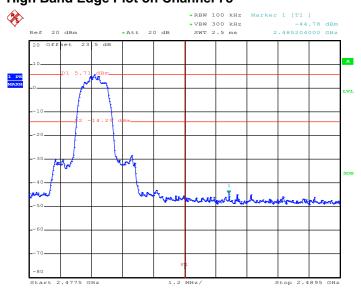

Date: 4.OCT.2013 16:13:38


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 45 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.6.7 Test Result of Conducted Hopping Mode Band Edges


Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

1Mbps Hopping Mode Low Band Edge Plot

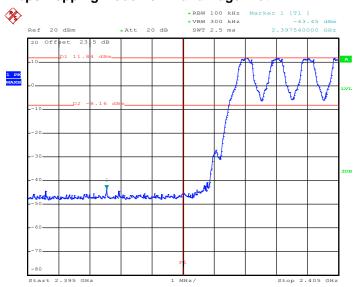

Date: 4.OCT.2013 16:01:53

1Mbps Hopping Mode High Band Edge Plot

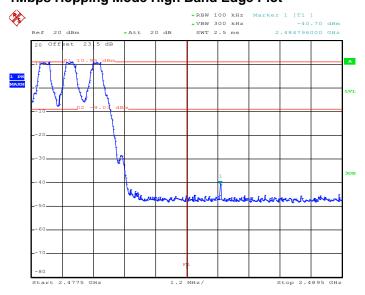


Date: 4.OCT.2013 16:03:19

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 46 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02




Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

2Mbps Hopping Mode Low Band Edge Plot

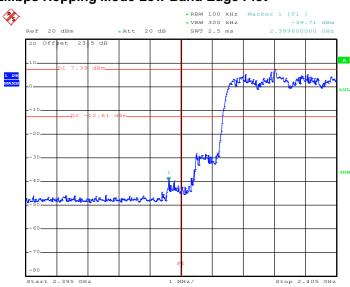

Date: 4.OCT.2013 15:59:01

2Mbps Hopping Mode High Band Edge Plot

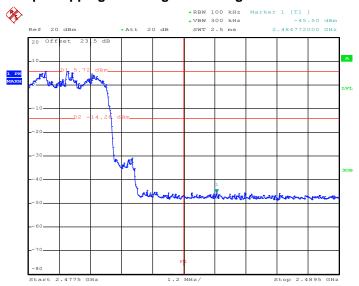


Date: 4.OCT.2013 15:58:03

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD




Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Engineer :	Book Lin	Relative Humidity :	50~53%

3Mbps Hopping Mode Low Band Edge Plot

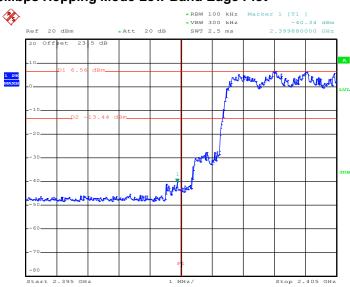

Date: 4.OCT.2013 15:55:34

3Mbps Hopping Mode High Band Edge Plot

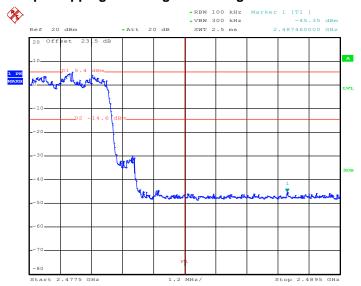

Date: 4.OCT.2013 15:56:51

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 48 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- The testing follows the guidelines in Spurious RF Conducted Emissions of FCC Public Notice DA 00-705 Measurement Guidelines
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- 6. The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup




SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 49 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.7.5 Test Result of Conducted Spurious Emission

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	00	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

1Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

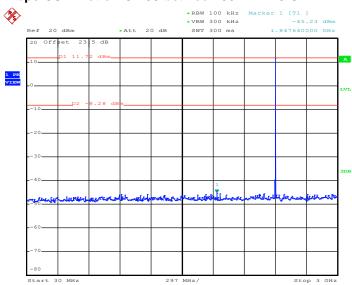


Date: 4.OCT.2013 16:04:32

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 50 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Report No.: FR383067A

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

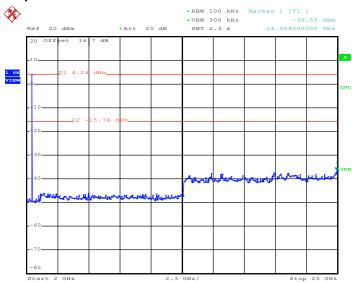


Date: 4.OCT.2013 16:04:54

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 51 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	1Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	50~53%
		Test Engineer :	Book Lin


1Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

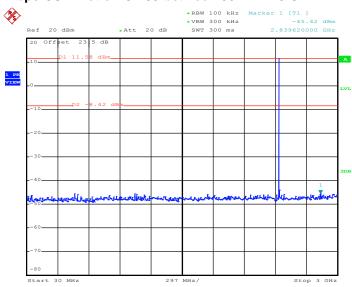

Date: 4.OCT.2013 16:05:28

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 52 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



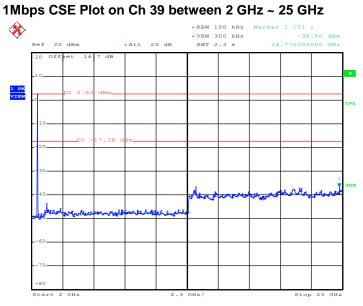


Date: 4.OCT.2013 16:05:51

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 53 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02

Test Mode :	1Mbps	Temperature :	24~26 ℃
Test Channel :	78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

1Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

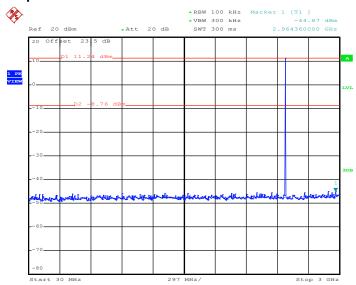


Date: 4.OCT.2013 16:06:42

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 54 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





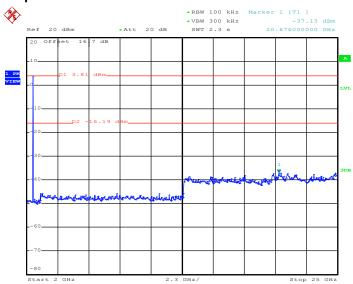


Date: 4.OCT.2013 16:07:03

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 55 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	00	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

2Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

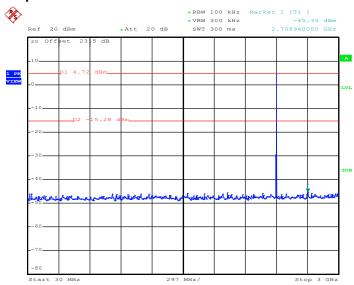


Date: 4.OCT.2013 16:10:35

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 56 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



2Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

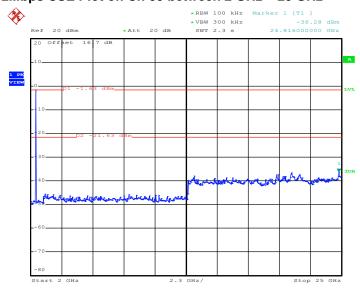


Date: 4.OCT.2013 16:10:57

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 57 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	2Mbps	Temperature :	24~26℃
Test Channel :	39	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

2Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

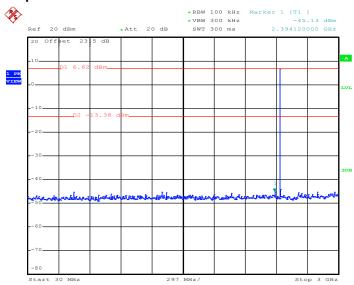


Date: 4.OCT.2013 16:09:20

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 58 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



2Mbps CSE Plot on Ch 39 between 2 GHz \sim 25 GHz

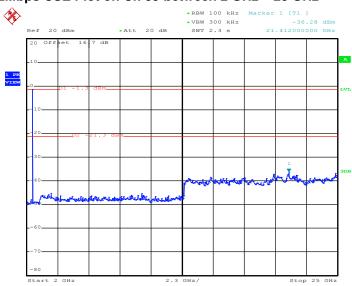


Date: 4.OCT.2013 16:09:42

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 59 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	2Mbps	Temperature :	24~26 ℃
Test Channel :	78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

2Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

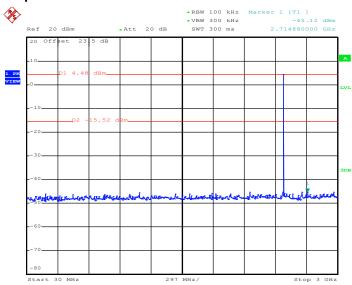


Date: 4.OCT.2013 16:08:25

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 60 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



2Mbps CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

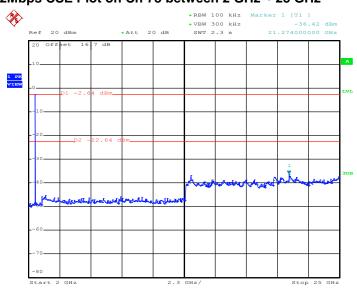


Date: 4.OCT.2013 16:08:48

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 61 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26℃
Test Channel :	00	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

3Mbps CSE Plot on Ch 00 between 30MHz ~ 3 GHz

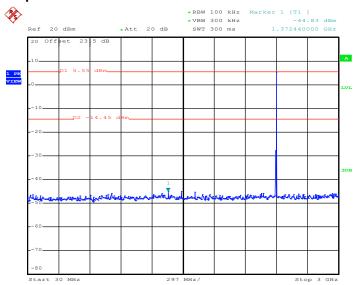


Date: 4.OCT.2013 16:11:56

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 62 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





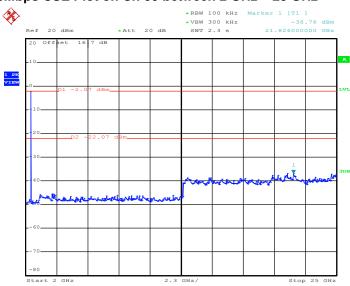


Date: 4.OCT.2013 16:12:19

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 63 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Channel :	39	Relative Humidity :	50~53%
		Test Engineer :	Book Lin

3Mbps CSE Plot on Ch 39 between 30MHz ~ 3 GHz

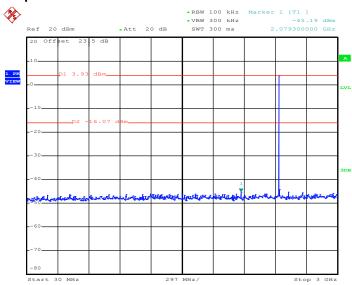


Date: 4.OCT.2013 16:12:48

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 64 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





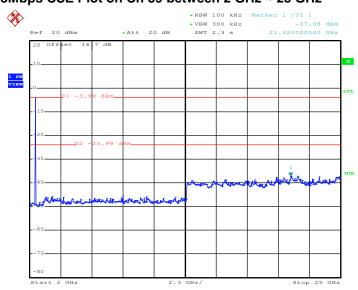


Date: 4.OCT.2013 16:13:10

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 65 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	3Mbps	Temperature :	24~26 ℃
Test Channel :	78	Relative Humidity :	50~53%
		Test Engineer :	Book Lin


3Mbps CSE Plot on Ch 78 between 30MHz ~ 3 GHz

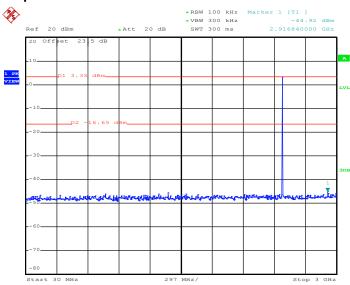


Date: 4.OCT.2013 16:14:25

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 66 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02





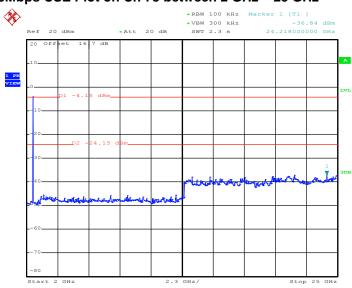

Date: 4.OCT.2013 16:14:47

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 67 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the FCC section 15.209 limits as below.

Frequency	Field Strength	Measurement Distance
(MHz)	(microvolts/meter)	(meters)
0.009 - 0.490	2400/F(kHz)	300
0.490 - 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 68 of 85 Report Issued Date : Nov. 06, 2013

Report No.: FR383067A

Report Version : Rev. 02

3.8.3 Test Procedures

- The testing follows the guidelines in Spurious Radiated Emissions of FCC Public Notice DA 00-705 Measurement Guidelines.
- 2. The EUT was placed on a turntable with 0.8 meter above ground.
- 3. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 4. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 5. Set to the maximum power setting and enable the EUT transmit continuously.
- 6. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c).

Duty cycle = On time/100 milliseconds

On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$

Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20*log(Duty cycle)

7. Corrected Reading: Antenna Factor + Cable Loss + Read Level - Preamp Factor = Level

Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (24.73dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD




Report No.: FR383067A

3.8.4 **Test Setup**

For radiated emissions below 30MHz

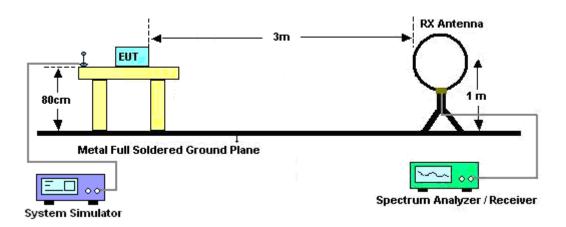

For radiated emissions from 30MHz to 1GHz

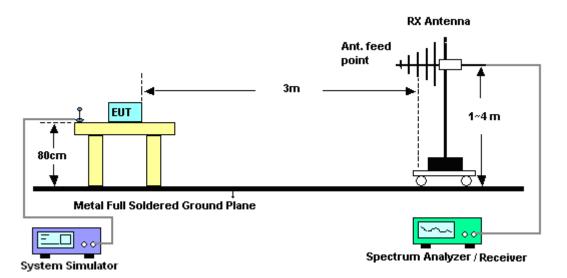


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 70 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02



For radiated emissions above 1GHz

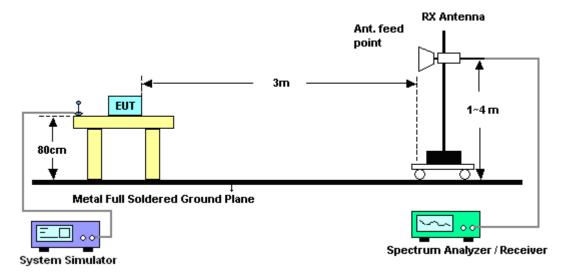

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 71 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Report No.: FR383067A


Duty cycle correction factor for average measurement 3.8.6

DH5 on time (One Pulse) Plot on Channel 39

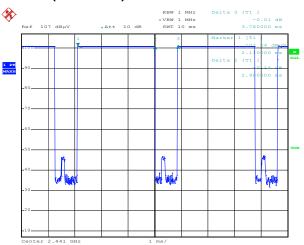

Date: 7.OCT.2013 23:04:56

DH5 on time (Count Pulses) Plot on Channel 39

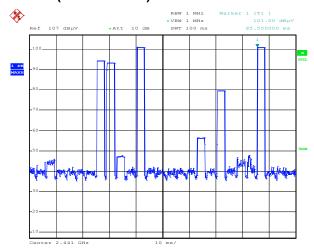

Date: 7.OCT.2013 23:06:22

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = $2 \times 2.90 / 100 = 5.80 \%$
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.73 dB
- DH5 has the highest duty cycle worst case and is reported.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 72 of 85 Report Issued Date: Nov. 06, 2013 Report Version : Rev. 02

Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

 $2.90 \text{ ms } \times 20 \text{ channels} = 58.0 \text{ ms}$

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

2.90 ms x 2 = 5.80 ms

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.80 \text{ ms}/100\text{ms}) = -24.73 \text{ dB}$

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 73 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.8.7 Test Result of Radiated Spurious at Band Edges

Test Mode :	1Mbps	Temperature :	21~24°C
Test Channel :	00	Relative Humidity :	51~53%
		Test Engineer :	Ken Wu

	ANTENNA POLARITY : HORIZONTAL											
Frequency	equency Level Over Limit Read Antenna Cable Preamp Ant Table Remark											
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos			
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)			
2377.14	51.98	-22.02	74	47.09	32.28	6.88	34.27	135	301	Peak		
2377.14	27.25	-26.75	54	-	-	-	-	-	-	Average		

	ANTENNA POLARITY : VERTICAL											
Frequency	equency Level Over Limit Read Antenna Cable Preamp Ant Table Remark											
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos			
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)			
2376.96	54.63	-19.37	74	49.74	32.28	6.88	34.27	100	98	Peak		
2376.96	29.9	-24.1	54	-	-	-	-	-	-	Average		

Test Mode :	1Mbps	Temperature :	21~24°C
Test Channel :	78	Relative Humidity :	51~53%
		Test Engineer :	Ken Wu

	ANTENNA POLARITY : HORIZONTAL											
Frequency	quency Level Over Limit Read Antenna Cable Preamp Ant Table Ren											
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos			
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)			
2483.5	64.63	-9.37	74	59.62	32.38	7.06	34.43	162	302	Peak		
2483.5	39.9	-14.1	54	-	-	-	-	-	-	Average		

	ANTENNA POLARITY : VERTICAL												
Frequency	requency Level Over Limit Read Antenna Cable Preamp Ant Table Remai												
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos				
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)				
2483.5	65.56	-8.44	74	60.55	32.38	7.06	34.43	121	54	Peak			
2483.5	40.83	-13.17	54	-	-	-	-	-	-	Average			

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 74 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Note: Pre-scanned all test modes and only choose the worst case mode recorded in the test report for radiated spurious emission below 1GHz.

Test Mode :	1Mbps	Temperature :	21~24°C
Test Channel :	00	Relative Humidity :	51~53%
Test Engineer :	Ken Wu	Polarization :	Horizontal
Remark :	2403 MHz is fundamental si	gnal which can be igno	ored.

Frequency	Level	Over Limit	Limit Line	Read Level	Antenna Factor	Cable Loss	Preamp Factor	Ant Pos	Table Pos	Remark
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)	
2403	102.26	-	-	97.34	32.31	6.91	34.3	135	301	Peak
2403	77.53	-	-	-	-	-	-	-	-	Average
4803	46.85	-27.15	74	63.08	33.98	8.75	58.96	100	0	Peak
4803	22.12	-31.88	54	-	-	-	-	-	-	Average

Note: Other harmonics are lower than background noise.

Test Mode :	1Mbps	Temperature :	21~24°C					
Test Channel :	00	Relative Humidity :	51~53%					
Test Engineer :	Ken Wu	Polarization :	Vertical					
Remark :	2403 MHz is fundamental si	03 MHz is fundamental signal which can be ignored.						

Frequ	iency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant		Remark
(M	Hz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB)	Loss (dB)	Factor (dB)	Pos (cm)	Pos (deg)	
24	.03	104.89	-	-	99.97	32.31	6.91	34.3	100	98	2403
24	03	80.16	-	-	-	-	-	-	-	-	2403
48	03	49.01	-24.99	74	65.24	33.98	8.75	58.96	100	0	4803
48	03	24.28	-29.72	54	-	-	-	-	-	-	4803

Note: Other harmonics are lower than background noise.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 75 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	1Mbps	Temperature :	21~24°C						
Test Channel :	39	Relative Humidity :	51~53%						
Test Engineer :	Ken Wu	Polarization :	Horizontal						
Remark :	2442 MHz is fundamental si	442 MHz is fundamental signal which can be ignored.							

Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Remark
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)	
2442	106.91	-	-	101.96	32.35	6.99	34.39	137	359	Peak
2442	82.18	-	-	-	-	-	-	-	-	Average
4884	46.88	-27.12	74	62.91	33.95	8.85	58.83	100	0	Peak
4884	22.15	-31.85	54	-	-	-	-	-	-	Average
7323	45.75	-28.25	74	57.05	35.53	10.91	57.74	100	0	Peak
7323	21.02	-32.98	54	-		-	-	-	-	Average

Note: Other harmonics are lower than background noise.

Test Mode :	1Mbps	Temperature :	21~24°C				
Test Channel :	39	Relative Humidity :	51~53%				
Test Engineer :	Ken Wu	Polarization : Vertical					
Remark :	2442 MHz is fundamental si	2442 MHz is fundamental signal which can be ignored.					

Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Remark
/ NALL- \	(dD::)//ss)	Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)	
2442	106.12	-	-	101.17	32.35	6.99	34.39	100	95	Peak
2442	81.39	-	-	-	-	-	-	-	-	Average
4882	49.3	-24.7	74	65.33	33.95	8.85	58.83	100	0	Peak
4882	24.57	-29.43	54	-	-	-	-	-	-	Average
7323	52.61	-21.39	74	63.91	35.53	10.91	57.74	100	0	Peak
7323	27.88	-26.12	54	-	-	-	-	-	-	Average

Note: Other harmonics are lower than background noise.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 76 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	1Mbps	Temperature :	21~24°C			
Test Channel :	78	Relative Humidity :	51~53%			
Test Engineer :	Ken Wu	Polarization : Horizontal				
Remark :	2481 MHz is fundamental signal which can be ignored.					

Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Remark
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	
(MHz)	$(dB\mu V/m)$	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)	
51.6	24.28	-15.72	40	46.87	7.9	0.71	31.2	-	-	Peak
148.8	25.7	-17.8	43.5	44.35	11.24	1.21	31.1	-	-	Peak
211.44	34.47	-9.03	43.5	54.28	9.91	1.37	31.09	138	63	Peak
311.9	34.32	-11.68	46	49.89	13.64	1.79	31	-	-	Peak
666.8	31.8	-14.2	46	39.07	20.33	2.87	30.47	-	-	Peak
697.6	32	-14	46	38.89	20.58	2.93	30.4	-	-	Peak
2481	103.53	-	-	98.52	32.38	7.06	34.43	162	302	Peak
2481	78.8	-	-	-	-	-	-	-	-	Average
4960	46.68	-27.32	74	62.51	33.91	8.92	58.66	100	0	Peak
4960	21.95	-32.05	54	-	-	-	-	-	-	Average
7440	48.08	-25.92	74	59.38	35.51	11.04	57.85	100	0	Peak
7440	23.35	-30.65	54	-	-	-	-	-	-	Average

Note: Other harmonics are lower than background noise.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 77 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



Test Mode :	1Mbps	Temperature :	21~24°C				
Test Channel :	78	Relative Humidity :	51~53%				
Test Engineer :	Ken Wu	n Wu Polarization : Vertical					
Remark :	2481 MHz is fundamental si	2481 MHz is fundamental signal which can be ignored.					

Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Remark
		Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	
(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB)	(dB)	(dB)	(cm)	(deg)	
50.52	32.16	-7.84	40	54.56	8.1	0.7	31.2	133	36	Peak
118.29	21.77	-21.73	43.5	40.27	11.52	1.09	31.11	-	-	Peak
210.9	24.89	-18.61	43.5	44.78	9.84	1.36	31.09	-	-	Peak
398	30.35	-15.65	46	43.17	15.95	2.14	30.91	-	-	Peak
666.1	34.45	-11.55	46	41.72	20.33	2.87	30.47	-	-	Peak
997.2	31.89	-22.11	54	34.03	24.56	3.51	30.21	-	-	Peak
2481	104.37	-	-	99.36	32.38	7.06	34.43	121	54	Peak
2481	79.64	-	-	-	-	-	-	-	-	Average
4960	51.63	-22.37	74	67.46	33.91	8.92	58.66	100	0	Peak
4960	26.9	-27.1	54	-	-	-	-	-	-	Average
7440	56.96	-17.04	74	68.26	35.51	11.04	57.85	100	0	Peak
7440	32.23	-21.77	54	-	-	-	-	-	-	Average

Note: Other harmonics are lower than background noise.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 78 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Frequency of emission (MHz)	Conducted limit (dBµV)					
Frequency of emission (MH2)	Quasi-peak	Average				
0.15-0.5	66 to 56*	56 to 46*				
0.5-5	56	46				
5-30	60	50				

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.9.3 Test Procedures

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth with Maximum Hold Mode.

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 79 of 85
Report Issued Date : Nov. 06, 2013

Report No.: FR383067A

Report Version : Rev. 02



3.9.4 Test Setup

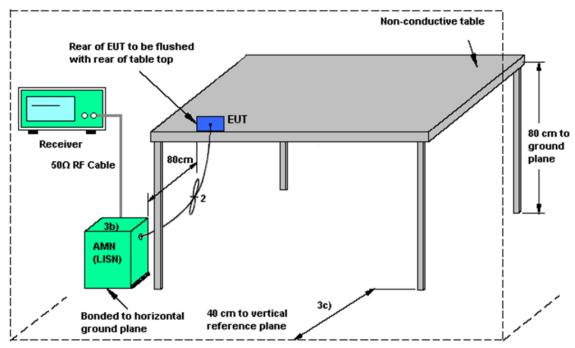

AMN = Artificial mains network (LISN)

AE = Associated equipment

EUT = Equipment under test

ISN = Impedance stabilization network

SPORTON INTERNATIONAL INC.


TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 80 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



3.9.5 Test Result of AC Conducted Emission

Test Mode :	Mode 1	Temperature :	20~22℃
Test Engineer :	Slash Huang	Relative Humidity :	45~47%
Test Voltage :	120Vac / 60Hz	Phase :	Line

Function Type: | WLAN Link + Bluetooth Link + Adapter

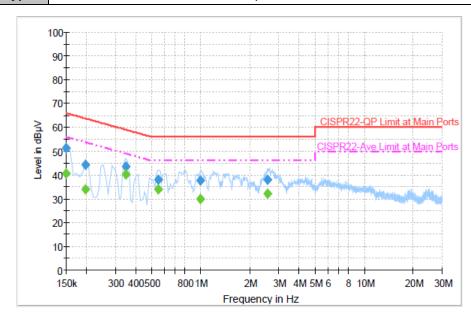

Final Result : Quasi-Peak

Frequency	Quasi-Peak	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)	Filler	Lille	(dB)	(dB)	(dBµV)
0.150000	51.2	Off	L1	19.4	14.8	66.0
0.198000	44.1	Off	L1	19.3	19.6	63.7
0.350000	43.5	Off	L1	19.4	15.5	59.0
0.550000	38.1	Off	L1	19.4	17.9	56.0
0.998000	37.5	Off	L1	19.4	18.5	56.0
2.558000	37.9	Off	L1	19.6	18.1	56.0

Final Result : Average


Frequency (MHz)	Average (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.150000	40.5	Off	L1	19.4	15.5	56.0
0.198000	34.1	Off	L1	19.3	19.6	53.7
0.350000	40.2	Off	L1	19.4	8.8	49.0
0.550000	33.8	Off	L1	19.4	12.2	46.0
0.998000	29.9	Off	L1	19.4	16.1	46.0
2.558000	32.0	Off	L1	19.6	14.0	46.0

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 81 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

Test Mode :	Mode 1	Temperature :	20~22 ℃
Test Engineer :	Slash Huang	Relative Humidity :	45~47%
Test Voltage :	120Vac / 60Hz	Phase :	Neutral

Function Type: WLAN Link + Bluetooth Link + Adapter

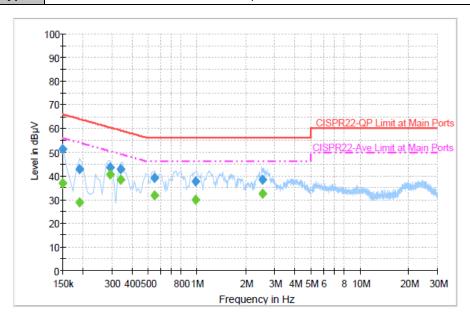

Final Result : Quasi-Peak

Frequency (MHz)	Quasi-Peak (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.150000	51.2	Off	N	19.4	14.8	66.0
0.190000	42.8	Off	N	19.4	21.2	64.0
0.294000	43.7	Off	N	19.4	16.7	60.4
0.342000	42.7	Off	N	19.4	16.5	59.2
0.550000	39.2	Off	N	19.4	16.8	56.0
0.982000	37.5	Off	N	19.5	18.5	56.0
2.534000	38.4	Off	N	19.6	17.6	56.0

Final Result : Average

Frequency (MHz)	Average (dBµV)	Filter	Line	Corr. (dB)	Margin (dB)	Limit (dBµV)
0.150000	37.0	Off	N	19.4	19.0	56.0
0.190000	28.7	Off	N	19.4	25.3	54.0
0.294000	40.4	Off	N	19.4	10.0	50.4
0.342000	38.3	Off	N	19.4	10.9	49.2
0.550000	31.6	Off	N	19.4	14.4	46.0
0.982000	30.1	Off	N	19.5	15.9	46.0
2.534000	32.3	Off	N	19.6	13.7	46.0

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 82 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the FCC rule.

3.10.2 Antenna Anti-Replacement Construction

Non-standard antenna connector is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 83 of 85 Report Issued Date: Nov. 06, 2013

Report No.: FR383067A

Report Version : Rev. 02



4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Spectrum Analyzer	Rohde & Schwarz	FSP40	100055	9kHz~40GHz	Jun. 07, 2013	Sep. 30, 2013~ Oct. 04, 2013	Jun. 06, 2014	Conducted (TH02-HY)
Power Meter	Agilent	E4416A	GB41292344	300MHz~40GHz	Feb. 05, 2013	Sep. 30, 2013~ Oct. 04, 2013	Feb. 04, 2014	Conducted (TH02-HY)
Power Sensor	Agilent	E9327A	US40441548	300MHz~40GHz	Feb. 05, 2013	Sep. 30, 2013~ Oct. 04, 2013	Feb. 04, 2014	Conducted (TH02-HY)
EMI Test Receiver	Rohde & Schwarz	ESCI 7	100724	9kHz~7GHz	Sep. 06, 2013	Oct. 10, 2013	Sep. 05, 2014	Radiation (03CH07-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP30	101067	9kHz~30GHz	Nov. 30, 2012	Oct. 07, 2013~ Oct. 10, 2013	Nov. 29, 2013	Radiation (03CH07-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	860004/0001	9kHz~30 MHz	Jul. 03, 2012	Oct. 07, 2013~ Oct. 10, 2013	Jul. 03, 2014	Radiation (03CH07-HY)
Bilog Antenna	Schaffner	CBL6111C	2726	30MHz ~ 1GHz	Oct. 10, 2013	Oct. 10, 2013	Oct. 09, 2014	Radiation (03CH07-HY)
Double Ridge Horn Antenna	ESCO	3117	75962	1GHz~18GHz	Aug. 22, 2013	Oct. 07, 2013~ Oct. 10, 2013	Aug. 21, 2014	Radiation (03CH07-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA917025 1	18GHz~40GHz	Oct. 03, 2013	Oct. 07, 2013~ Oct. 10, 2013	Oct. 02, 2014	Radiation (03CH07-HY)
Preamplifier	COM-POWER	PA-103A	161241	30MHz~1GHz	Feb. 26, 2013	Oct. 10, 2013	Feb. 25, 2014	Radiation (03CH07-HY)
Preamplifier	Agilent	8449B	3008A02362	1GHz~26.5GHz	Dec. 01, 2012	Oct. 07, 2013~ Oct. 10, 2013	Nov. 30, 2013	Radiation (03CH07-HY)
Preamplifier	MITEQ	AMF-7D-0 0101800-3 0-10P	159088	DC~18G High Gain	Feb. 27, 2013	Oct. 07, 2013~ Oct. 10, 2013	Feb. 26, 2014	Radiation (03CH07-HY)
Turn Table	ChainTek	ChainTek 3000	N/A	0 ~ 360 degree	N/A	Oct. 07, 2013~ Oct. 10, 2013	N/A	Radiation (03CH07-HY)
Antenna Mast	ChainTek	ChainTek 3000	N/A	N/A	N/A	Oct. 07, 2013~ Oct. 10, 2013	N/A	Radiation (03CH07-HY)
EMI Test Receiver	Rohde & Schwarz	ESCS 30	100356	9kHz ~ 2.75GHz	Nov. 13, 2012	Oct. 07, 2013	Nov. 12, 2013	Conduction (CO05-HY)
Two-LISN (for auxiliary equipment)	Rohde & Schwarz	ENV216	100081	9kHz ~ 30MHz	Dec. 12, 2012	Oct. 07, 2013	Dec. 11, 2013	Conduction (CO05-HY)
Two-LISN	Rohde & Schwarz	ENV216	100080	9kHz ~ 30MHz	Dec. 06, 2012	Oct. 07, 2013	Dec. 05, 2013	Conduction (CO05-HY)
AC Power Source	APC	APC-1000 W	N/A	N/A	N/A	Oct. 07, 2013	N/A	Conduction (CO05-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 84 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of	2.26
Confidence of 95% (U = 2Uc(y))	2.26

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of	2.54
Confidence of 95% (U = 2Uc(y))	2.54

Uncertainty of Radiated Emission Measurement (1 GHz ~ 40 GHz)

Measuring Uncertainty for a Level of	4.70
Confidence of 95% (U = 2Uc(y))	4.72

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : 85 of 85
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02



SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: Z64-WL1835MOD Page Number : A1 of A1
Report Issued Date : Nov. 06, 2013
Report Version : Rev. 02