FCC RF Test Report

APPLICANT : Bullitt Group

EQUIPMENT: Rugged Smart Phone

BRAND NAME : CAT
MODEL NAME : S41
MARKETING NAME : S41

FCC ID : ZL5S41A

STANDARD : FCC Part 15 Subpart C §15.247

CLASSIFICATION : (DSS) Spread Spectrum Transmitter

The product was received on Jun. 06, 2017 and testing was completed on Aug. 11, 2017. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The test results in this report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERNATIONAL INC., the test report shall not be reproduced except in full.

Reviewed by: Joseph Lin / Supervisor

Approved by: Jones Tsai / Manager

SPORTON INTERNATIONAL INC.

No. 52, Hwa Ya 1st Rd., Hwa Ya Technology Park, Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 1 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

1190

Report No.: FR760506-01A

TABLE OF CONTENTS

RE	VISIO	N HISTORY	3
SU	MMAR	Y OF TEST RESULT	4
1	GENE	ERAL DESCRIPTION	5
	1.1	Applicant	5
	1.2	Manufacturer	5
	1.3	Product Feature of Equipment Under Test	5
	1.4	Modification of EUT	5
	1.5	Testing Location	6
	1.6	Applicable Standards	6
2	TEST	CONFIGURATION OF EQUIPMENT UNDER TEST	7
	2.1	Carrier Frequency Channel	7
	2.2	Test Mode	8
	2.3	Connection Diagram of Test System	
	2.4	Support Unit used in test configuration and system	9
	2.5	EUT Operation Test Setup	9
	2.6	Measurement Results Explanation Example	10
3	TEST	RESULT	11
	3.1	Number of Channel Measurement	11
	3.2	Hopping Channel Separation Measurement	13
	3.3	Dwell Time Measurement	19
	3.4	20dB and 99% Bandwidth Measurement	21
	3.5	Peak Output Power Measurement	31
	3.6	Conducted Band Edges Measurement	32
	3.7	Conducted Spurious Emission Measurement	39
	3.8	Radiated Band Edges and Spurious Emission Measurement	49
	3.9	AC Conducted Emission Measurement	53
	3.10	Antenna Requirements	55
4	LIST	OF MEASURING EQUIPMENT	56
5	UNC	ERTAINTY OF EVALUATION	57
AP	PENDI	X A. CONDUCTED TEST RESULTS	
API	PENDI	X B. AC CONDUCTED EMISSION TEST RESULT	
AP	PENDI	X C. RADIATED SPURIOUS EMISSION	
AP	PENDI	X D. RADIATED SPURIOUS EMISSION PLOTS	
AP	PENDI	X E. DUTY CYCLE PLOTS	
API	PENDI	X F. SETUP PHOTOGRAPHS	

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 2 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

REVISION HISTORY

REPORT NO.	VERSION	DESCRIPTION	ISSUED DATE
FR760506-01A	Rev. 01	Initial issue of report	Aug. 23, 2017

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 3 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

SUMMARY OF TEST RESULT

Report Section	FCC Rule	Description	Limit	Result	Remark
3.1	15.247(a)(1)	Number of Channels	≥ 15Chs	Pass	-
3.2	15.247(a)(1)	Hopping Channel Separation	≥ 2/3 of 20dB BW	Pass	-
3.3	15.247(a)(1)	Dwell Time of Each Channel	≤ 0.4sec in 31.6sec period	Pass	-
3.4	15.247(a)(1)	20dB Bandwidth	NA	Pass	-
3.4	-	99% Bandwidth	-	Pass	-
3.5	15.247(b)(1)	Peak Output Power	≤ 125 mW	Pass	-
3.6	15.247(d)	Conducted Band Edges	≤ 20dBc	Pass	-
3.7	15.247(d)	Conducted Spurious Emission	≤ 20dBc	Pass	-
3.8	15.247(d)	Radiated Band Edges and Radiated Spurious Emission	15.209(a) & 15.247(d)	Pass	Under limit 9.07 dB at 47.010 MHz
3.9	15.207	AC Conducted Emission	15.207(a)	Pass	Under limit 11.20 dB at 0.606 MHz
3.10	15.203 & 15.247(b)	Antenna Requirement	N/A	Pass	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 4 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

1 General Description

1.1 Applicant

Bullitt Group

One Valpy, Valpy Street, Reading, Berkshire, England RG1 1AR

1.2 Manufacturer

Compal Electronics, INC.

No. 385, Yangguang St. Neihu District, Taipei City 11491, Taiwan, R.O.C

1.3 Product Feature of Equipment Under Test

GSM/WCDMA/LTE, Bluetooth, Wi-Fi 2.4GHz 802.11b/g/n, Wi-Fi 5GHz 802.11a/n, FM Receiver, NFC, and GPS

Report No.: FR760506-01A

Product Specification subjective to this standard					
	WWAN: PIFA and Coupling type (LDS) Antenna				
	WLAN: PIFA Antenna				
Antenna Type	Bluetooth: PIFA Antenna				
	GPS / Glonass: PIFA Antenna				
	NFC: Loop Antenna				

<Sample Information>

S41					
Dual SIM					
Single SIM					
Cg.c C					
For Dual-SIM or Single-SIM control by SW, the HW difference is SIM holder.					

Remark: All test items were performed with Sample 1.

1.4 Modification of EUT

No modifications are made to the EUT during all test items.

 SPORTON INTERNATIONAL INC.
 Page Number
 : 5 of 57

 TEL: 886-3-327-3456
 Report Issued Date
 : Aug. 23, 2017

 FAX: 886-3-328-4978
 Report Version
 : Rev. 01

FCC ID : ZL5S41A Report Template No.: BU5-FR15CBT Version 2.0

1.5 Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW0007 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC Test.

Test Site	SPORTON INTERNATIONAL INC.			
	No. 52, Hwa Ya 1 st Rd., Hwa Ya Technology Park,			
Test Site Location	Kwei-Shan District, Tao Yuan City, Taiwan, R.O.C.			
rest Site Location	TEL: +886-3-327-3456			
	FAX: +886-3-328-4978			
Toot Site No	Sporton	Site No.		
Test Site No.	TH05-HY	CO05-HY		

Note: The test site complies with ANSI C63.4 2014 requirement.

Test Site	SPORTON INTERNATIONAL INC.		
	No.58, Aly. 75, Ln. 564, Wenhua 3rd Rd. Guishan Dist,		
Test Site Location	Taoyuan City, Taiwan (R.O.C.)		
Test Site Location	TEL: +886-3-327-0868		
	FAX: +886-3-327-0855		
Toot Site No	Sporton Site No.		
Test Site No.	03CH11-HY		

Note: The test site complies with ANSI C63.4 2014 requirement.

1.6 Applicable Standards

According to the specifications of the manufacturer, the EUT must comply with the requirements of the following standards:

- FCC Part 15 Subpart C §15.247
- ANSI C63.10-2013

Remark:

- All test items were verified and recorded according to the standards and without any deviation during the test.
- This EUT has also been tested and complied with the requirements of FCC Part 15, Subpart B, recorded in a separate test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 6 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

2 Test Configuration of Equipment Under Test

2.1 Carrier Frequency Channel

Frequency Band	Channel	Freq. (MHz)	Channel	Freq. (MHz)	Channel	Freq. (MHz)
	0	2402	27	2429	54	2456
	1	2403	28	2430	55	2457
	2	2404	29	2431	56	2458
	3	2405	30	2432	57	2459
	4	2406	31	2433	58	2460
	5	2407	32	2434	59	2461
	6	2408	33	2435	60	2462
	7	2409	34	2436	61	2463
	8	2410	35	2437	62	2464
	9	2411	36	2438	63	2465
	10	2412	37	2439	64	2466
	11	2413	38	2440	65	2467
	12	2414	39	2441	66	2468
2400-2483.5 MHz	13	2415	40	2442	67	2469
	14	2416	41	2443	68	2470
	15	2417	42	2444	69	2471
	16	2418	43	2445	70	2472
	17	2419	44	2446	71	2473
	18	2420	45	2447	72	2474
	19	2421	46	2448	73	2475
	20	2422	47	2449	74	2476
	21	2423	48	2450	75	2477
	22	2424	49	2451	76	2478
	23	2425	50	2452	77	2479
	24	2426	51	2453	78	2480
	25	2427	52	2454	-	-
	26	2428	53	2455	-	-

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 7 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

2.2 Test Mode

- a. The EUT has been associated with peripherals and configuration operated in a manner tended to maximize its emission characteristics in a typical application. Frequency range investigated: conduction emission (150 kHz to 30 MHz), radiation emission (9 kHz to the 10th harmonic of the highest fundamental frequency or to 40 GHz, whichever is lower). For radiated measurement, pre-scanned in three orthogonal panels, X, Y, Z. The worst cases (Z plane) were recorded in this report, and the worst mode of radiated spurious emissions is Bluetooth 1Mbps mode, and recorded in this report.
- b. AC power line Conducted Emission was tested under maximum output power.

The following summary table is showing all test modes to demonstrate in compliance with the standard.


The following summary table is showing all test modes to demonstrate in compliance with the standard.							
Summary table of Test Cases							
		Data Rate / Modulation					
Test Item	Bluetooth BR 1Mbps	Bluetooth EDR 2Mbps	Bluetooth EDR 3Mbps				
	GFSK	π/4-DQPSK	8-DPSK				
Conducted	Mode 1: CH00_2402 MHz	Mode 4: CH00_2402 MHz	Mode 7: CH00_2402 MHz				
Conducted	Mode 2: CH39_2441 MHz	Mode 5: CH39_2441 MHz	Mode 8: CH39_2441 MHz				
Test Cases	Mode 3: CH78_2480 MHz	Mode 6: CH78_2480 MHz	Mode 9: CH78_2480 MHz				
	Bluetooth BR 1Mbps GFSK						
		Bluetooth BR 1Mbps GFSK					
Radiated		Bluetooth BR 1Mbps GFSK Mode 1: CH00_2402 MHz					
Radiated Test Cases		•					
		Mode 1: CH00_2402 MHz					
		Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz					
Test Cases	Mode 1 LTE Band 7 Idle +	Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz Bluetooth Link + WLAN (2.4	4GHz) Link + NFC on + FM				
Test Cases	Mode 1 LTE Band 7 Idle +	Mode 1: CH00_2402 MHz Mode 2: CH39_2441 MHz Mode 3: CH78_2480 MHz	4GHz) Link + NFC on + FM				

Remark: For radiated test cases, the worst mode data rate 1Mbps was reported only, because this data rate has the highest RF output power at preliminary tests, and the conducted spurious emissions and conducted band edge measurement for each data rate are no worse than 1Mbps, and no other significantly frequencies found in conducted spurious emission.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 8 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

2.3 Connection Diagram of Test System

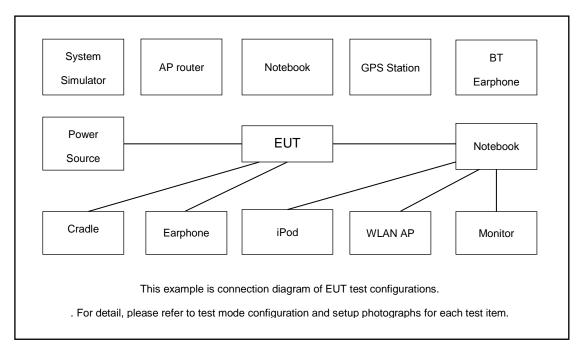

2.4 Support Unit used in test configuration and system

Item	Equipment	Trade Name	Model Name	FCC ID	Data Cable	Power Cord
1.	Base Station	Anritsu	MT8820C	N/A	N/A	Unshielded,1.8m
2.	Bluetooth Earphone	Sony Ericsson	MW600	PY7DDA-2029	N/A	N/A
3.	Bluetooth Base Station	R&S	CBT32	N/A	N/A	Unshielded, 1.8 m
4.	WLAN AP	ASUS	RT-AC66U	MSQ-RTAC66U	N/A	Unshielded,1.8m
5.	Notebook	DELL	Latitude E6320	FCC DoC/ Contains FCC ID: QDS-BRCM1054	N/A	AC I/P: Unshielded, 1.2 m DC O/P: Shielded, 1.8 m
6.	SD Card	SanDisk	MicroSD HC	FCC DoC	N/A	N/A

2.5 EUT Operation Test Setup

For Bluetooth function, an engineering test program was installed in EUT which was programmed in order to make the EUT get into the engineering modes to contact with Bluetooth base station for continuous transmitting and receiving signals.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 9 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

2.6 Measurement Results Explanation Example

For all conducted test items:

The offset level is set in the spectrum analyzer to compensate the RF cable loss and attenuator factor between EUT conducted output port and spectrum analyzer. With the offset compensation, the spectrum analyzer reading level is exactly the EUT RF output level.

Example:

The spectrum analyzer offset is derived from RF cable loss and attenuator factor.

Offset = RF cable loss + attenuator factor.

Following shows an offset computation example with cable loss 4.2 dB and 10dB attenuator.

$$Offset(dB) = RF \ cable \ loss(dB) + attenuator \ factor(dB).$$

= 4.2 + 10 = 14.2 (dB)

Report No.: FR760506-01A

3 Test Result

3.1 Number of Channel Measurement

3.1.1 Limits of Number of Hopping Frequency

Frequency hopping systems in the 2400-2483.5 MHz band shall use at least 15 channels.

3.1.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.1.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- Use the following spectrum analyzer settings: Span = the frequency band of operation;
 RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. The number of hopping frequency used is defined as the number of total channel.
- 7. Record the measurement data derived from spectrum analyzer.

3.1.4 Test Setup




TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 11 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


3.1.5 Test Result of Number of Hopping Frequency

Please refer to Appendix A.

Number of Hopping Channel Plot on Channel 00 - 78

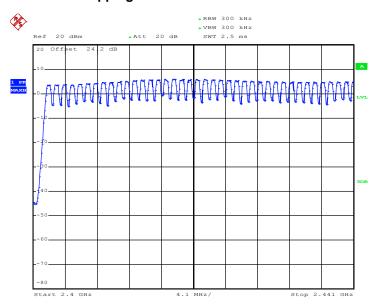

Date: 11.AUG.2017 14:14:46

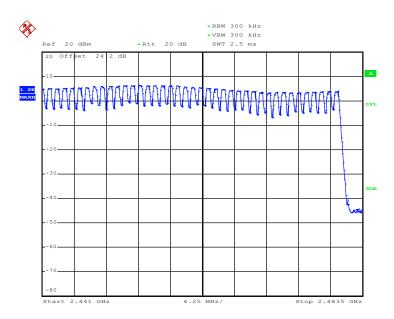

Date: 11.AUG.2017 14:15:40

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 12 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.2 Hopping Channel Separation Measurement

3.2.1 Limit of Hopping Channel Separation

Frequency hopping systems operating in the 2400-2483.5 MHz band may have hopping channel carrier frequencies that are separated by 25 kHz or two-thirds of the 20 dB bandwidth of the hopping channel, whichever is greater.

3.2.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.2.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.2.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings:
 - Span = wide enough to capture the peaks of two adjacent channels;
 - RBW = 300kHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.2.4 Test Setup



3.2.5 Test Result of Hopping Channel Separation


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 13 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<1Mbps>

Channel Separation Plot on Channel 00 - 01

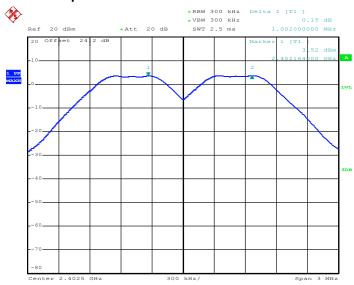

Date: 11.AUG.2017 13:58:16

Channel Separation Plot on Channel 39 - 40

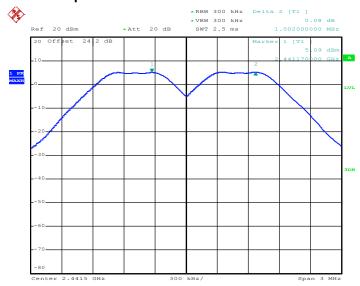


Date: 11.AUG.2017 14:05:13

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 14 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


Channel Separation Plot on Channel 77 - 78

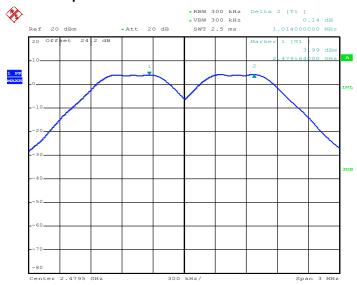

Date: 11.AUG.2017 14:11:33

<2Mbps>

Channel Separation Plot on Channel 00 - 01

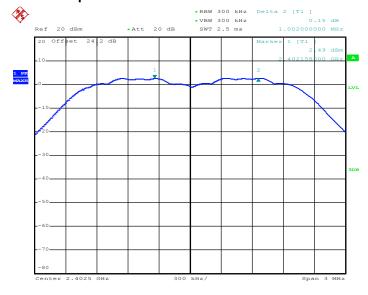


Date: 11.AUG.2017 14:23:59

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 15 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

Channel Separation Plot on Channel 39 - 40

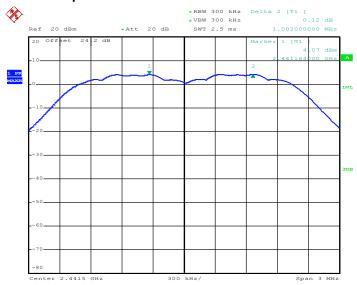

Date: 11.AUG.2017 14:29:37

Channel Separation Plot on Channel 77 - 78

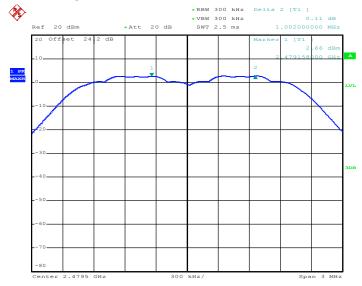

Date: 11.AUG.2017 14:35:20


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 16 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<3Mbps>

Channel Separation Plot on Channel 00 - 01

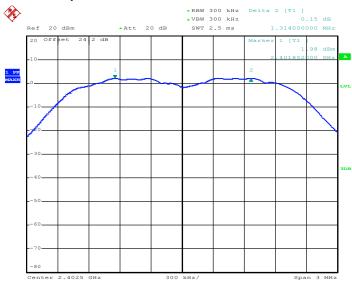

Date: 11.AUG.2017 14:55:18

Channel Separation Plot on Channel 39 - 40

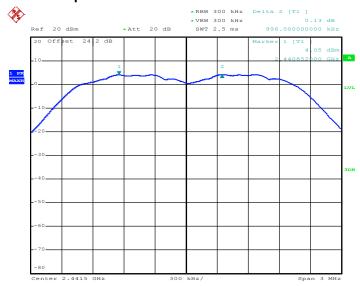


Date: 11.AUG.2017 15:16:31

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 17 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

Channel Separation Plot on Channel 77 - 78

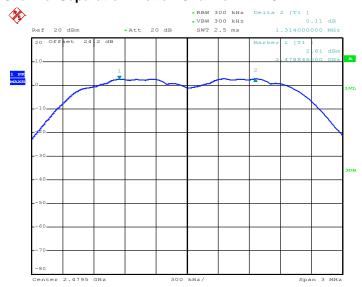

Date: 11.AUG.2017 15:24:17

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 18 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

3.3 Dwell Time Measurement

3.3.1 Limit of Dwell Time

The average time of occupancy on any channel shall not be greater than 0.4 seconds within a period of 0.4 seconds multiplied by the number of hopping channels employed.

3.3.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.3.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.4.
- The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator.
 The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Enable the EUT hopping function.
- 5. Use the following spectrum analyzer settings: Span = zero span, centered on a hopping channel; RBW = 1 MHz; VBW ≥ RBW; Sweep = as necessary to capture the entire dwell time per hopping channel; Detector function = peak; Trace = max hold.
- 6. Measure and record the results in the test report.

3.3.4 Test Setup




3.3.5 Test Result of Dwell Time

Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 19 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

Package Transfer Time Plot

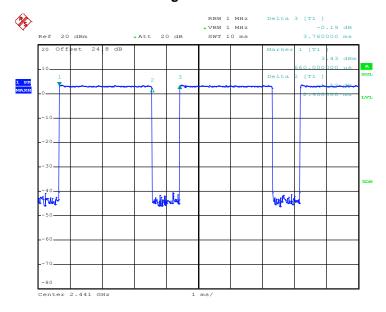

Date: 26.JUL.2017 21:37:39

Remark:

- **1.** In normal mode, hopping rate is 1600 hops/s with 6 slots in 79 hopping channels. With channel hopping rate (1600 / 6 / 79) in Occupancy Time Limit (0.4×79) (s), Hops Over Occupancy Time comes to $(1600 / 6 / 79) \times (0.4 \times 79) = 106.67$ hops.
- **2.** In AFH mode, hopping rate is 800 hops/s with 6 slots in 20 hopping channels. With channel hopping rate (800 / 6 / 20) in Occupancy Time Limit (0.4×20) (s), Hops Over Occupancy Time comes to $(800 / 6 / 20) \times (0.4 \times 20) = 53.33$ hops.
- 3. Dwell Time(s) = Hops Over Occupancy Time (hops) x Package Transfer Time

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 20 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.4 20dB and 99% Bandwidth Measurement

3.4.1 Limit of 20dB and 99% Bandwidth

Reporting only

3.4.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.4.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 6.9.2 and 6.9.3.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Use the following spectrum analyzer settings for 20dB Bandwidth measurement.
 - Span = approximately 2 to 5 times the 20 dB bandwidth, centered on a hopping channel;
 - $RBW \geq 1\% \ of \ the \ 20 \ dB \ bandwidth; \ VBW \geq RBW; \ Sweep = auto; \ Detector \ function = peak;$


Trace = \max hold.

- 5. Use the following spectrum analyzer settings for 99 % Bandwidth measurement.
 - Span = approximately 1.5 to 5 times the 99% bandwidth, centered on a hopping channel;
 - RBW ≥ 1% of the 99% bandwidth; VBW ≥ RBW; Sweep = auto; Detector function = peak;

Trace = max hold.

6. Measure and record the results in the test report.

3.4.4 Test Setup

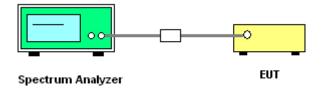

3.4.5 Test Result of 20dB Bandwidth

Please refer to Appendix A.


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 21 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<1Mbps>

20 dB Bandwidth Plot on Channel 00

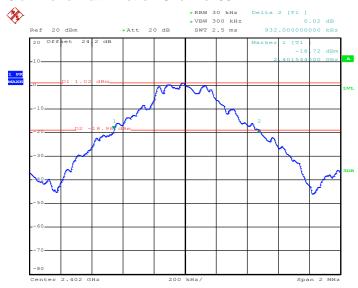

Date: 11.AUG.2017 13:53:50

20 dB Bandwidth Plot on Channel 39

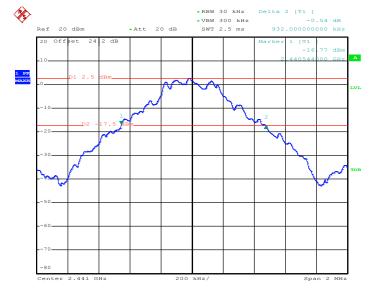


Date: 11.AUG.2017 14:00:08

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 22 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


20 dB Bandwidth Plot on Channel 78

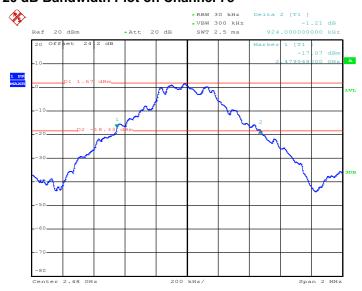

Date: 11.AUG.2017 14:07:20

<2Mbps>

20 dB Bandwidth Plot on Channel 00

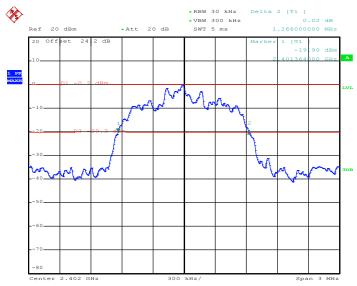


Date: 11.AUG.2017 14:18:13

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 23 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

20 dB Bandwidth Plot on Channel 39

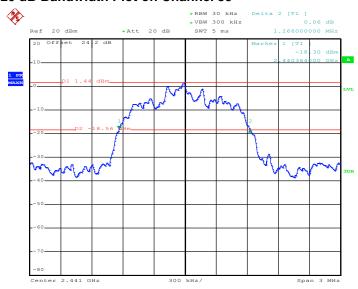

Date: 11.AUG.2017 14:26:14

20 dB Bandwidth Plot on Channel 78

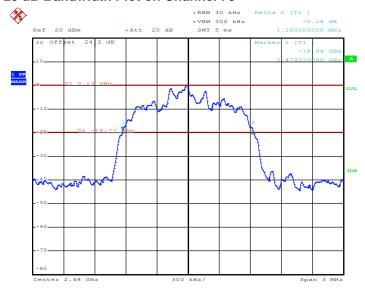

Date: 11.AUG.2017 14:31:14


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 24 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<3Mbps>

20 dB Bandwidth Plot on Channel 00

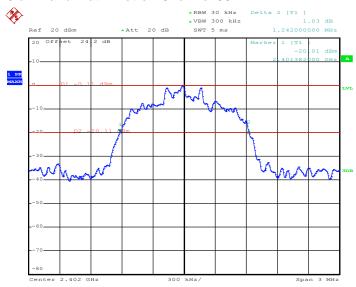

Date: 11.AUG.2017 14:42:47

20 dB Bandwidth Plot on Channel 39

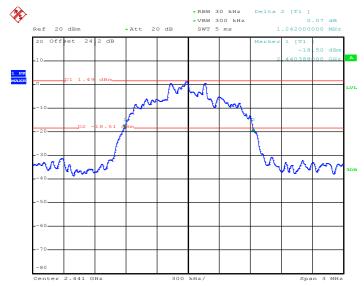


Date: 11.AUG.2017 15:11:42

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 25 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

20 dB Bandwidth Plot on Channel 78

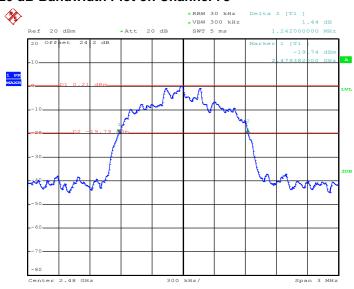


Date: 11.AUG.2017 15:17:55

3.4.6 Test Result of 99% Occupied Bandwidth

Please refer to Appendix A.

<1Mbps>

99% Occupied Bandwidth Plot on Channel 00

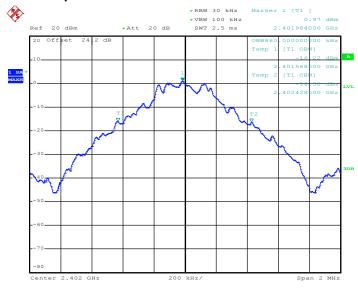


Date: 11.AUG.2017 13:55:37

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 26 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

99% Occupied Bandwidth Plot on Channel 39

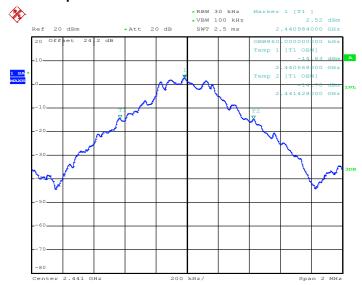

Date: 11.AUG.2017 14:01:29

99% Occupied Bandwidth Plot on Channel 78

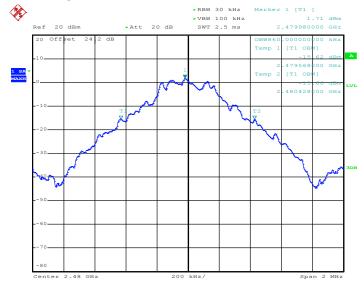

Date: 11.AUG.2017 14:09:41


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 27 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

<2Mbps>

99% Occupied Bandwidth Plot on Channel 00

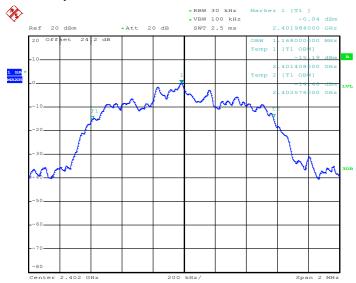

Date: 11.AUG.2017 14:20:04

99% Occupied Bandwidth Plot on Channel 39



Date: 11.AUG.2017 14:27:39

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 28 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


99% Occupied Bandwidth Plot on Channel 78



Date: 11.AUG.2017 14:32:38

<3Mbps>

99% Occupied Bandwidth Plot on Channel 00

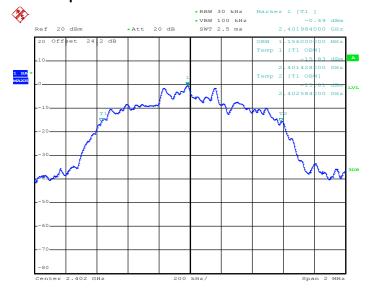


Date: 11.AUG.2017 14:45:18

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 29 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

99% Occupied Bandwidth Plot on Channel 39

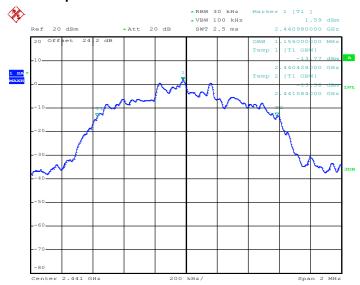

Date: 11.AUG.2017 15:13:07

99% Occupied Bandwidth Plot on Channel 78

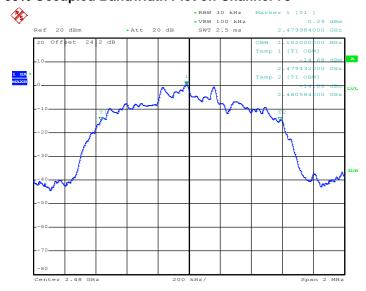

Date: 11.AUG.2017 15:19:35

Note: The occupied channel bandwidth is maintained within the band of operation for all of the modulations.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 30 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.5 Peak Output Power Measurement

3.5.1 Limit of Peak Output Power

Section 15.247 (b) The maximum peak conducted output power of the intentional radiator shall not exceed the following: (1) For frequency hopping systems operating in the 2400-2483.5 MHz band employing at least 75 non-overlapping hopping channels, and all frequency hopping systems in the 5725-5850 MHz band: 1 watt. For all other frequency hopping systems in the 2400-2483.5 MHz band 0.125 watts. The power limit for 1Mbps, 2Mbps, 3Mbps and AFH modes are 0.125 watts.


3.5.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.5.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.5.
- 2. The RF output of EUT was connected to the power meter by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Measure the conducted output power with cable loss and record the results in the test report.
- 5. Measure and record the results in the test report.

3.5.4 Test Setup

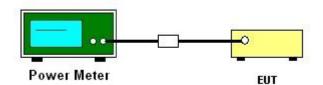

3.5.5 Test Result of Peak Output Power

Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 31 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.6 Conducted Band Edges Measurement

3.6.1 Limit of Band Edges

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.

3.6.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.6.3 Test Procedures

- 1. The testing follows ANSI C63.10-2013 clause 7.8.6.
- 2. Set to the maximum power setting and enable the EUT transmit continuously.
- 3. Set RBW = 100kHz, VBW = 300kHz. Band edge emissions must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100kHz RBW. The attenuation shall be 30 dB instead of 20 dB when RMS conducted output power procedure is used.
- 4. Enable hopping function of the EUT and then repeat step 2. and 3.
- 5. Measure and record the results in the test report.

3.6.4 Test Setup



3.6.5 Test Result of Conducted Band Edges


Please refer to Appendix A.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 32 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<1Mbps>

Low Band Edge Plot on Channel 00

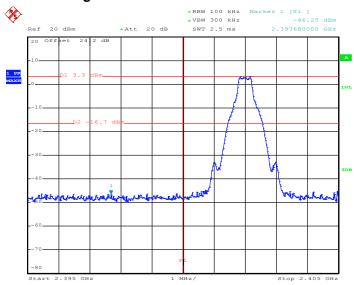

Date: 11.AUG.2017 13:54:59

High Band Edge Plot on Channel 78

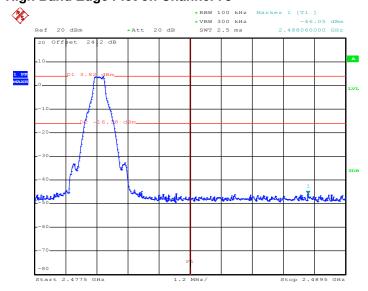

Date: 11.AUG.2017 14:08:59


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 33 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<2Mbps>

Low Band Edge Plot on Channel 00

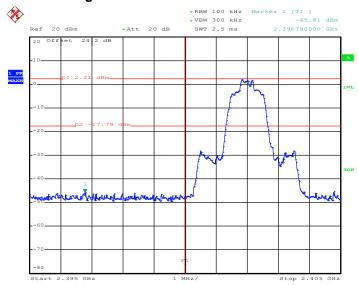

Date: 11.AUG.2017 14:19:23

High Band Edge Plot on Channel 78

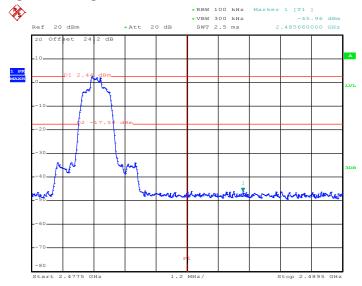

Date: 11.AUG.2017 14:32:02


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 34 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<3Mbps>

Low Band Edge Plot on Channel 00

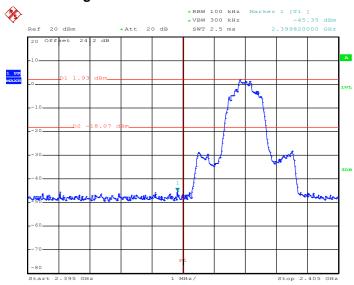

Date: 11.AUG.2017 14:43:57

High Band Edge Plot on Channel 78

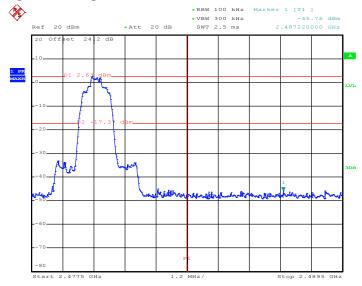

Date: 11.AUG.2017 15:18:54

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 35 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

3.6.6 Test Result of Conducted Hopping Mode Band Edges

Please refer to Appendix A.


<1Mbps>

Hopping Mode Low Band Edge Plot

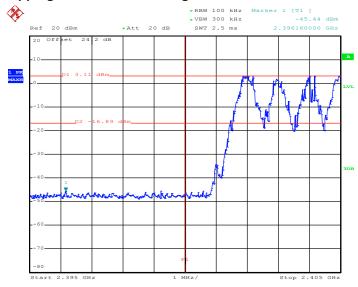

Date: 11.AUG.2017 14:12:57

Hopping Mode High Band Edge Plot

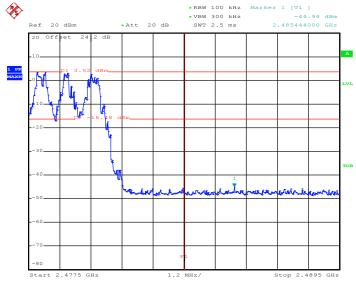

Date: 11.AUG.2017 14:13:35


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 36 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<2Mbps>

Hopping Mode Low Band Edge Plot

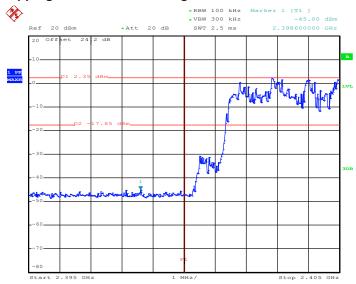

Date: 11.AUG.2017 14:37:32

Hopping Mode High Band Edge Plot

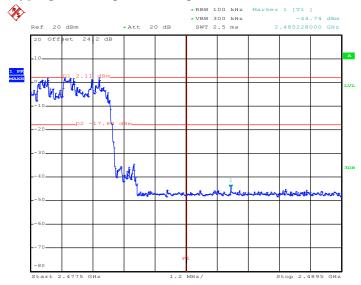

Date: 11.AUG.2017 14:38:39


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 37 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<3Mbps>

Hopping Mode Low Band Edge Plot

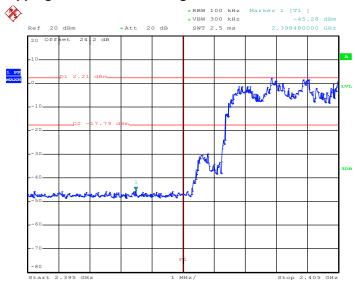

Date: 11.AUG.2017 14:39:52

Hopping Mode High Band Edge Plot

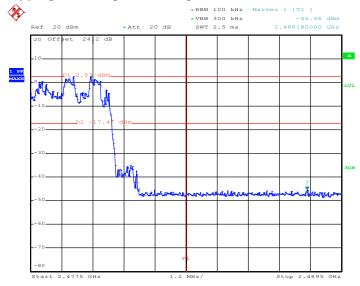

Date: 11.AUG.2017 14:40:42

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 38 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.7 Conducted Spurious Emission Measurement

3.7.1 Limit of Spurious Emission Measurement

In any 100 kHz bandwidth outside the intentional radiation frequency band, the radio frequency power shall be at least 20 dB below the highest level of the radiated power. In addition, radiated emissions which fall in the restricted bands must also comply with the radiated emission limits.


3.7.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

3.7.3 Test Procedure

- 1. The testing follows ANSI C63.10-2013 clause 7.8.8.
- 2. The RF output of EUT was connected to the spectrum analyzer by RF cable and attenuator. The path loss was compensated to the results for each measurement.
- 3. Set to the maximum power setting and enable the EUT transmit continuously.
- 4. Set RBW = 100 kHz, VBW = 300kHz, scan up through 10th harmonic. All harmonics / spurs must be at least 20 dB down from the highest emission level within the authorized band as measured with a 100 kHz RBW.
- 5. Measure and record the results in the test report.
- The RF fundamental frequency should be excluded against the limit line in the operating frequency band.

3.7.4 Test Setup

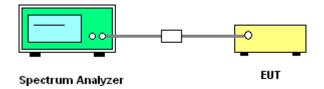

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 39 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

3.7.5 Test Result of Conducted Spurious Emission

Please refer to Appendix A.


<1Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

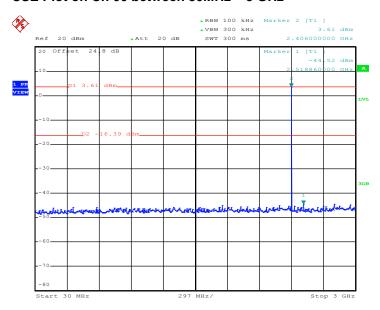

Date: 11.AUG.2017 22:58:21

1Mbps CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

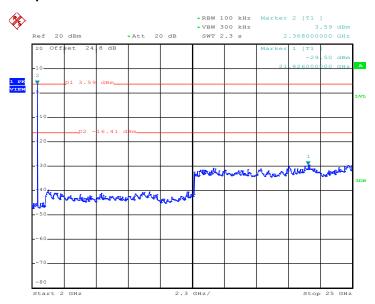


Date: 11.AUG.2017 22:58:43

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 40 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

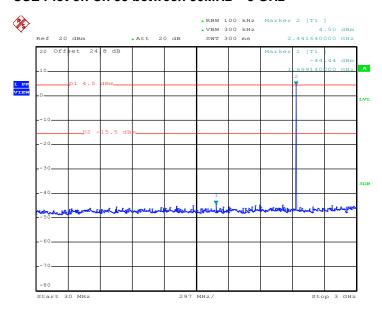

Date: 11.AUG.2017 23:00:55

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

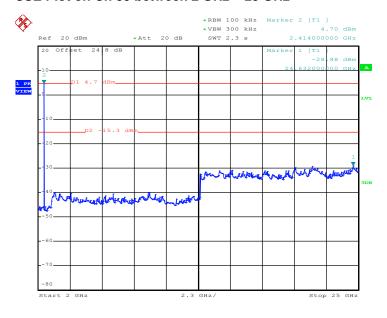


Date: 11.AUG.2017 23:01:17

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 41 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

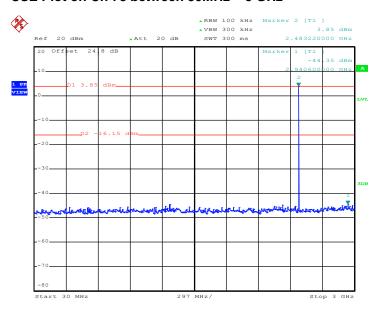

Date: 11.AUG.2017 23:08:57

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

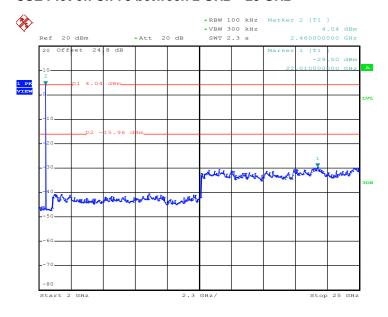

Date: 11.AUG.2017 23:09:18


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 42 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<2Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

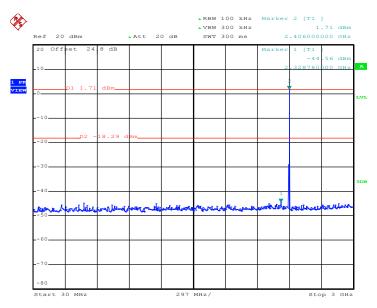

Date: 11.AUG.2017 23:14:38

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

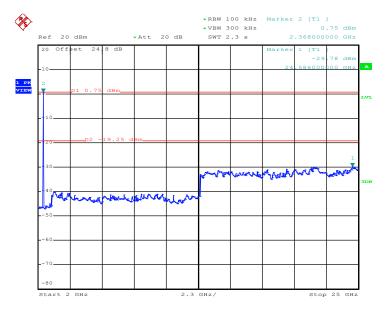


Date: 11.AUG.2017 23:16:58

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 43 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

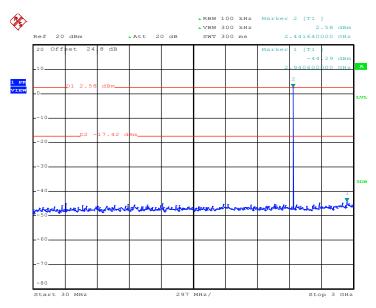

Date: 11.AUG.2017 23:21:07

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

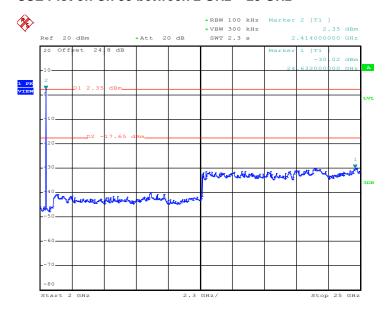


Date: 11.AUG.2017 23:21:29

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 44 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

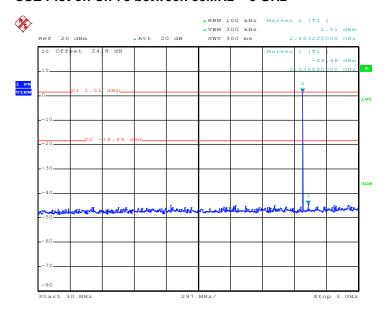

Date: 11.AUG.2017 23:24:03

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

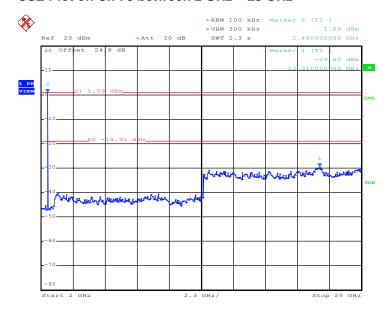

Date: 11.AUG.2017 23:22:24


SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 45 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A


<3Mbps>

CSE Plot on Ch 00 between 30MHz ~ 3 GHz

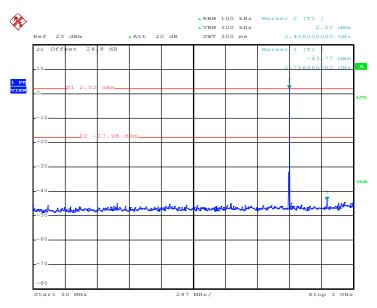

Date: 11.AUG.2017 23:26:07

CSE Plot on Ch 00 between 2 GHz ~ 25 GHz

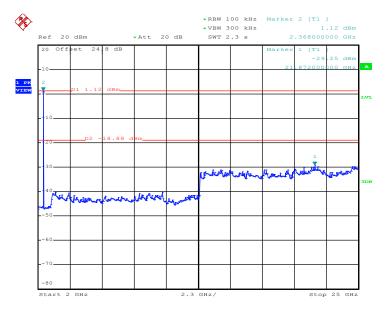


Date: 11.AUG.2017 23:26:29

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 46 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 39 between 30MHz ~ 3 GHz

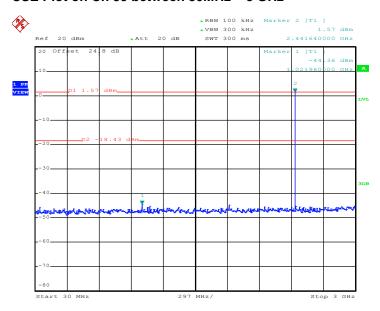

Date: 11.AUG.2017 23:27:08

CSE Plot on Ch 39 between 2 GHz ~ 25 GHz

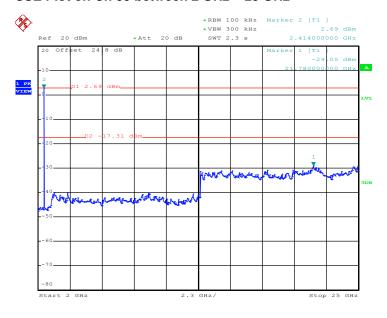


Date: 11.AUG.2017 23:27:30

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 47 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

CSE Plot on Ch 78 between 30MHz ~ 3 GHz

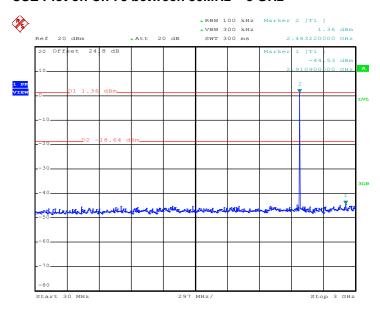

Date: 11.AUG.2017 23:31:39

CSE Plot on Ch 78 between 2 GHz ~ 25 GHz

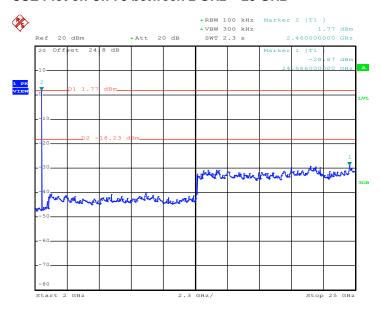

Date: 11.AUG.2017 23:32:01

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 48 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.8 Radiated Band Edges and Spurious Emission Measurement

3.8.1 Limit of Radiated Band Edges and Spurious Emission

In any 100 kHz bandwidth outside the intentional radiator frequency band, all harmonics/spurious must be at least 20 dB below the highest emission level within the authorized band. In addition, radiated emissions which fall in the restricted bands must also comply with the limits as below.

Frequency (MHz)	Field Strength (microvolts/meter)	Measurement Distance (meters)
0.009 – 0.490	2400/F(kHz)	300
0.490 – 1.705	24000/F(kHz)	30
1.705 – 30.0	30	30
30 – 88	100	3
88 – 216	150	3
216 - 960	200	3
Above 960	500	3

3.8.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 49 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.8.3 Test Procedures

- 1. The EUT was placed on a turntable with 0.8 meter for frequency below 1GHz and 1.5 meter for frequency above 1GHz respectively above ground.
- 2. The EUT was set 3 meters from the interference receiving antenna, which was mounted on the top of a variable height antenna tower.
- 3. For each suspected emission, the EUT was arranged to its worst case and then tune the Antenna tower (from 1 m to 4 m) and turntable (from 0 degree to 360 degrees) to find the maximum reading. A pre-amp and a high pass filter are used for the test in order to get better signal level to comply with the guidelines.
- 4. Set to the maximum power setting and enable the EUT transmit continuously.
- 5. Use the following spectrum analyzer settings:
 - (1) Span shall wide enough to fully capture the emission being measured;
 - (2) Set RBW=100 kHz for f < 1 GHz, RBW=1MHz for f>1GHz; VBW ≥ RBW; Sweep = auto; Detector function = peak; Trace = max hold for peak
 - (3) For average measurement: use duty cycle correction factor method per 15.35(c).Duty cycle = On time/100 milliseconds

On time = $N_1*L_1+N_2*L_2+...+N_{n-1}*LN_{n-1}+N_n*L_n$

Where N_1 is number of type 1 pulses, L_1 is length of type 1 pulses, etc.

Average Emission Level = Peak Emission Level + 20*log(Duty cycle)

6. Corrected Reading: Antenna Factor + Cable Loss + Read Level - Preamp Factor = Level


Note: The average levels were calculated from the peak level corrected with duty cycle correction factor (24.82dB) derived from 20log (dwell time/100ms). This correction is only for signals that hop with the fundamental signal, such as band-edge and harmonic. Other spurious signals that are independent of the hopping signal would not use this correction.

Page Number : 50 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01


Report No.: FR760506-01A

3.8.4 Test Setup

For radiated emissions below 30MHz

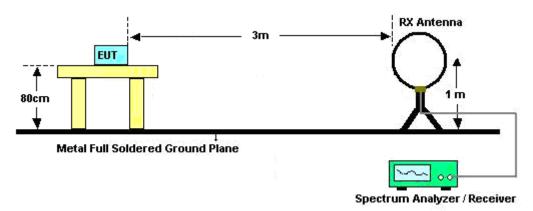


For radiated emissions from 30MHz to 1GHz

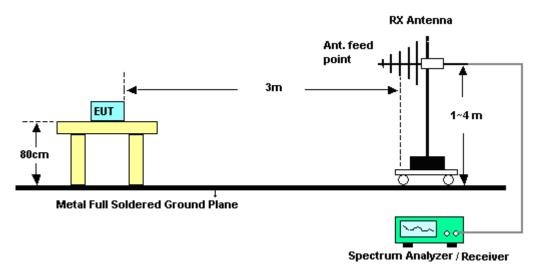

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 51 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

For radiated emissions above 1GHz

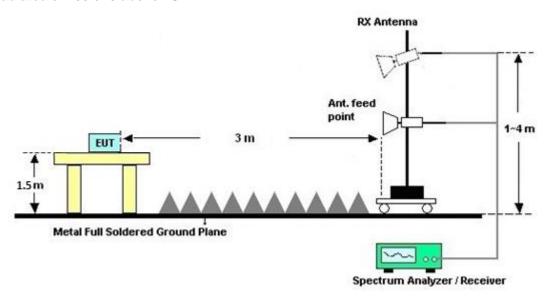

3.8.5 Test Results of Radiated Spurious Emissions (9 kHz ~ 30 MHz)

The low frequency, which started from 9 kHz to 30MHz, was pre-scanned and the result which was 20dB lower than the limit line per 15.31(o) was not reported.

3.8.6 Test Result of Radiated Spurious at Band Edges

Please refer to Appendix C and D.

3.8.7 Duty Cycle

Please refer to Appendix E.

3.8.8 Test Result of Radiated Spurious Emission (30MHz ~ 10th Harmonic)

Please refer to Appendix C and D.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 52 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.9 AC Conducted Emission Measurement

3.9.1 Limit of AC Conducted Emission

For equipment that is designed to be connected to the public utility (AC) power line, the radio frequency voltage that is conducted back onto the AC power line on any frequency or frequencies within the band 150 kHz to 30 MHz shall not exceed the limits in the following table.

Eroquency of emission (MUz)	Conducted limit (dBµV)			
Frequency of emission (MHz)	Quasi-peak	Average		
0.15-0.5	66 to 56*	56 to 46*		
0.5-5	56	46		
5-30	60	50		

^{*}Decreases with the logarithm of the frequency.

3.9.2 Measuring Instruments

The measuring equipment is listed in the section 4 of this test report.


3.9.3 Test Procedures

- 1. The EUT was placed 0.4 meter from the conducting wall of the shielding room was kept at least 80 centimeters from any other grounded conducting surface.
- 2. Connect EUT to the power mains through a line impedance stabilization network (LISN).
- 3. All the support units are connecting to the other LISN.
- 4. The LISN provides 50 ohm coupling impedance for the measuring instrument.
- 5. The FCC states that a 50 ohm, 50 microhenry LISN should be used.
- 6. Both sides of AC line were checked for maximum conducted interference.
- 7. The frequency range from 150 kHz to 30 MHz was searched.
- 8. Set the test-receiver system to Peak Detect Function and specified bandwidth (IF Bandwidth = 9kHz) with Maximum Hold Mode. Then measurement is also conducted by Average Detector and Quasi-Peak Detector Function respectively.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 53 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.9.4 Test Setup

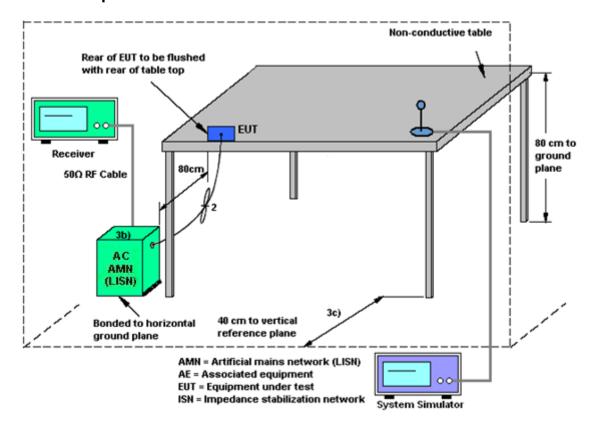

3.9.5 Test Result of AC Conducted Emission

Please refer to Appendix B.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 54 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

3.10 Antenna Requirements

3.10.1 Standard Applicable

If directional gain of transmitting antennas is greater than 6dBi, the power shall be reduced by the same level in dB comparing to gain minus 6dBi. The use of a permanently attached antenna or of an antenna that uses a unique coupling to the intentional radiator shall be considered sufficient to comply with the rule.

3.10.2 Antenna Anti-Replacement Construction

An embedded-in antenna design is used.

3.10.3 Antenna Gain

The antenna peak gain of EUT is less than 6 dBi. Therefore, it is not necessary to reduce maximum peak output power limit.

4 List of Measuring Equipment

Instrument	Manufacturer	Model No.	Serial No.	Characteristics	Calibration Date	Test Date	Due Date	Remark
Power Meter	Agilent	E4416A	GB4129234 4	NA	Dec. 26, 2016	Jul. 26, 2017 ~ Aug. 11, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Power Sensor	Agilent	E9327A	US40441548	50MHz~18GHz	Dec. 26, 2016	Jul. 26, 2017 ~ Aug. 11, 2017	Dec. 25, 2017	Conducted (TH05-HY)
Spectrum Analyzer	Rohde & Schwarz	FSP40	100057	9kHz-40GHz	Nov. 25, 2016	Jul. 26, 2017 ~ Aug. 11, 2017	Nov. 24, 2017	Conducted (TH05-HY)
BT Base Station (Measure)	Rohde & Schwarz	СВТ	101136	BT 3.0	Sep. 21, 2016	Jul. 26, 2017 ~ Aug. 11, 2017	Sep. 20, 2017	Conducted (TH05-HY)
AC Power Source	ChainTek	APC-1000 W	N/A	N/A	N/A	Aug. 03, 2017	N/A	Conduction (CO05-HY)
EMI Test Receiver	Rohde & Schwarz	ESCI 7	100724	9kHz~7GHz	Aug. 30, 2016	Aug. 03, 2017	Aug. 29, 2017	Conduction (CO05-HY)
LISN	Rohde & Schwarz	ENV216	100080	9kHz~30MHz	Nov. 29, 2016	Aug. 03, 2017	Nov. 28, 2017	Conduction (CO05-HY)
Amplifier	MITEQ	TTA1840-3 5-HG	1871923	18GHz~40GHz, VSWR : 2.5:1 max	Jul. 21, 2017	Aug. 01, 2017 ~ Aug. 02, 2017	Jul. 20, 2018	Radiation (03CH11-HY)
Amplifier	SONOMA	310N	187312	9kHz~1GHz	Nov. 10, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Bilog Antenna	TESEQ	CBL 6111D&N-6 -06	35414&AT-N 0602	30MHz~1GHz	Oct. 15, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Oct. 14, 2017	Radiation (03CH11-HY)
Horn Antenna	SCHWARZBE CK	BBHA 9120 D	9120D-1326	1GHz ~ 18GHz	Oct. 07, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Oct. 06, 2017	Radiation (03CH11-HY)
Loop Antenna	Rohde & Schwarz	HFH2-Z2	100488	9 kHz~30 MHz	Oct. 20, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Oct. 19, 2018	Radiation (03CH11-HY)
Preamplifier	Keysight	83017A	MY5327008 0	1GHz~26.5GHz	Nov. 10, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Nov. 09, 2017	Radiation (03CH11-HY)
Preamplifier	MITEQ	AMF-7D-00 101800-30- 10P	1902247	1GHz~18GHz	Jun. 23, 2017	Aug. 01, 2017 ~ Aug. 02, 2017	Jun. 22, 2018	Radiation (03CH11-HY)
Spectrum Analyzer	Keysight	N9010A	MY5420048 6	10Hz ~ 44GHz	Oct. 12, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Oct. 11, 2017	Radiation (03CH11-HY)
Antenna Mast	EMEC	AM-BS-450 0-B	N/A	1~4m	N/A	Aug. 01, 2017 ~ Aug. 02, 2017	N/A	Radiation (03CH11-HY)
Turn Table	EMEC	TT 2000	N/A	0~360 Degree	N/A	Aug. 01, 2017 ~ Aug. 02, 2017	N/A	Radiation (03CH11-HY)
EMI Test Receiver	Agilent	N9038A (MXE)	MY5329005 3	20Hz to 26.5GHz	Jan. 12, 2017	Aug. 01, 2017 ~ Aug. 02, 2017	Jan. 11, 2018	Radiation (03CH11-HY)
SHF-EHF Horn Antenna	SCHWARZBE CK	BBHA 9170	BBHA91705 84	18GHz- 40GHz	Nov. 08, 2016	Aug. 01, 2017 ~ Aug. 02, 2017	Nov. 07, 2017	Radiation (03CH11-HY)

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 56 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No. : FR760506-01A

5 Uncertainty of Evaluation

Uncertainty of Conducted Emission Measurement (150 kHz ~ 30 MHz)

Measuring Uncertainty for a Level of Confidence	2.70
of 95% (U = 2Uc(y))	2.70

Uncertainty of Radiated Emission Measurement (30 MHz ~ 1000 MHz)

Measuring Uncertainty for a Level of Confidence	5.20
of 95% (U = 2Uc(y))	5.20

Uncertainty of Radiated Emission Measurement (1000 MHz ~ 18000 MHz)

Measuring Uncertainty for a Level of Confidence	5.50
of 95% (U = 2Uc(y))	5.50

<u>Uncertainty of Radiated Emission Measurement (18000 MHz ~ 40000 MHz)</u>

Measuring Uncertainty for a Level of Confidence	5.00
of 95% (U = 2Uc(y))	5.20

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 FCC ID: ZL5S41A Page Number : 57 of 57
Report Issued Date : Aug. 23, 2017
Report Version : Rev. 01

Report No.: FR760506-01A

Report Number : FR760506-01A

Appendix A. Test Result of Conducted Test Items

Test Engineer:	Allen Lin	Temperature:	21~25	°C
Test Date:	2017/07/26~2017/08/11	Relative Humidity:	51~54	%

<u>TEST RESULTS DATA</u> 20dB and Hopping Channel Separation

Mod.	Data Rate	ХТИ	CH.	Freq. (MHz)	20db BW (MHz)	Hopping Channel Separation Measurement (MHz)	Hopping Channel Separation Measurement Limit (MHz)	Pass/Fail
DH	1Mbps	1	0	2402	0.93	1.00	0.6213	Pass
DH	1Mbps	1	39	2441	0.93	1.00	0.6213	Pass
DH	1Mbps	1	78	2480	0.92	1.01	0.6160	Pass
2DH	2Mbps	1	0	2402	1.27	1.00	0.8440	Pass
2DH	2Mbps	1	39	2441	1.27	1.00	0.8440	Pass
2DH	2Mbps	1	78	2480	1.26	1.00	0.8400	Pass
3DH	3Mbps	1	0	2402	1.24	1.31	0.8280	Pass
3DH	3Mbps	1	39	2441	1.24	1.00	0.8280	Pass
3DH	3Mbps	1	78	2480	1.24	1.31	0.8280	Pass

TEST RESULTS DATA 99% Bandwidth

Mod.	Data Rate	NTX	CH.	Freq. (MHz)	99% Bandwidth (MHz)
DH	1Mbps	1	0	2402	0.86
DH	1Mbps	1	39	2441	0.86
DH	1Mbps	1	78	2480	0.86
2DH	2Mbps	1	0	2402	1.17
2DH	2Mbps	1	39	2441	1.17
2DH	2Mbps	1	78	2480	1.16
3DH	3Mbps	1	0	2402	1.16
3DH	3Mbps	1	39	2441	1.16
3DH	3Mbps	1	78	2480	1.15

TEST RESULTS DATA

Dwell Time

Mod.	Hopping Channel Number Rate	Hops Over Occupancy Time(hops)	Package Transfer Time (msec)	Dwell Time (sec)	Limits (sec)	Pass/Fail
Nomal	79	106.67	2.90	0.31	0.4	Pass
AFH	20	53.33	2.90	0.15	0.4	Pass

TEST RESULTS DATA Peak Power Table

DH chann el			Peak Power	Power Limit	Test
			(dBm)	(dBm)	Result
	0	1	4.55	20.97	Pass
DH1	39	1	5.71	20.97	Pass
	78	1	5.15	20.97	Pass

2DH	chann		Peak Power	Power Limit	Test
200	el		(dBm)	(dBm)	Result
	0	1	3.82	20.97	Pass
2DH1	39	1	5.00	20.97	Pass
	78	1	4.26	20.97	Pass

3DH	chann		Peak Power	Power Limit	Test
3011	0 1	(dBm)	(dBm)	Result	
	0	1	4.00	20.97	Pass
3DH1	39	1	5.25	20.97	Pass
	78	1	4.37	20.97	Pass

TEST RESULTS DATA

Number of Hoppina Frequency

Number of Hopping (Channel)	Adaptive Frequency Hopping (Channel)	Limits (Channel)	Pass/Fail
79	20	>15	Pass

Appendix B. AC Conducted Emission Test Results

Test Engineer :	Charact Viv	Temperature :	26~27°C
rest Engineer.	Shareer Tu	Relative Humidity :	50~56%

Report No. : FR760506-01A

SPORTON INTERNATIONAL INC. Page Number : B1 of B1


TEL: 886-3-327-3456 FAX: 886-3-328-4978

EUT Information

Report NO: 760506-01
Test Mode: Mode 1
Test Voltage: 120Vac/60Hz

Phase: Line

ENV216 Auto Test FCC Power Bar - L

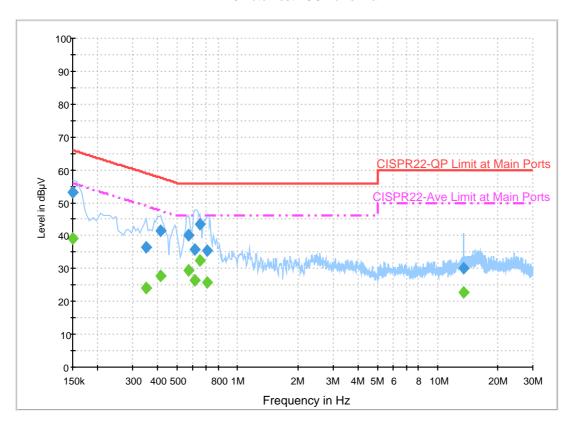

Final Result 1

Frequency	QuasiPeak	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	53.2	Off	L1	19.6	12.8	66.0
0.350000	36.4	Off	L1	19.6	22.6	59.0
0.414000	41.4	Off	L1	19.6	16.2	57.6
0.566000	40.2	Off	L1	19.6	15.8	56.0
0.614000	35.7	Off	L1	19.6	20.3	56.0
0.646000	43.5	Off	L1	19.6	12.5	56.0
0.702000	35.6	Off	L1	19.6	20.4	56.0
13.558000	30.2	Off	L1	20.2	29.8	60.0


Final Result 2

Frequency	Average	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	39.1	Off	L1	19.6	16.9	56.0
0.350000	24.0	Off	L1	19.6	25.0	49.0
0.414000	27.8	Off	L1	19.6	19.8	47.6
0.566000	29.5	Off	L1	19.6	16.5	46.0
0.614000	26.5	Off	L1	19.6	19.5	46.0
0.646000	32.5	Off	L1	19.6	13.5	46.0
0.702000	25.8	Off	L1	19.6	20.2	46.0
13.558000	22.8	Off	L1	20.2	27.2	50.0

EUT Information

Report NO: 760506-01
Test Mode: Mode 1
Test Voltage: 120Vac/60Hz
Phase: Neutral

ENV216 Auto Test FCC Power Bar - N

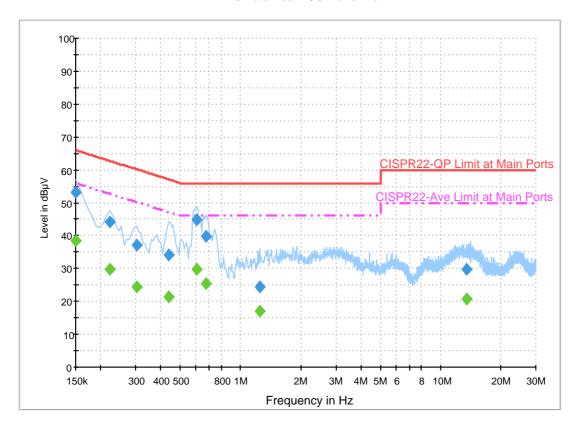

Final Result 1

Frequency	QuasiPeak	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	53.1	Off	N	19.5	12.9	66.0
0.222000	44.1	Off	N	19.5	18.6	62.7
0.302000	37.1	Off	N	19.5	23.1	60.2
0.438000	34.0	Off	N	19.5	23.1	57.1
0.606000	44.8	Off	N	19.5	11.2	56.0
0.670000	39.7	Off	N	19.5	16.3	56.0
1.246000	24.4	Off	N	19.6	31.6	56.0
13.558000	29.7	Off	N	20.3	30.3	60.0

Final Result 2

Frequency	Average	Filter	Line	Corr.	Margin	Limit
(MHz)	(dBµV)			(dB)	(dB)	(dBµV)
0.150000	38.4	Off	N	19.5	17.6	56.0
0.222000	29.9	Off	N	19.5	22.8	52.7
0.302000	24.3	Off	N	19.5	25.9	50.2
0.438000	21.4	Off	N	19.5	25.7	47.1
0.606000	29.8	Off	N	19.5	16.2	46.0
0.670000	25.4	Off	N	19.5	20.6	46.0
1.246000	16.9	Off	N	19.6	29.1	46.0
13.558000	20.7	Off	N	20.3	29.3	50.0

Appendix C. Radiated Spurious Emission

Toot Engineer :	I.C. Liona, Joseph Hugana and Kon Wu	Temperature :	24~26 ℃
rest Engineer:	J.C. Liang, Jacky Huang and Ken Wu	Relative Humidity:	50~55%

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		(BALL -)	(-ID)//)	Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	(110.0
		(MHz)	(dBµV/m)	,	(dBµV/m)		(dB/m)	(dB)	(dB)	(cm)	(deg)		, ,
		2330.06	41.94	-32.06	74	42.68	26.65	6.22	33.61	303	349	Р	Н
		2330.06	17.12	-36.88	54	-	-	-	-	-	-	Α	Н
	*	2402	94.64	-	-	95	26.87	6.36	33.59	303	349	Р	Н
	*	2402	69.82	-	-	-	-	-	-	-	-	Α	Н
ВТ													Н
CH00													Н
2402MHz		2372.58	41.37	-32.63	74	41.87	26.81	6.29	33.6	121	305	Р	V
		2372.58	16.55	-37.45	54	-	-	-	-	-	-	Α	V
	*	2402	98.78	-	-	99.14	26.87	6.36	33.59	121	305	Р	V
	*	2402	73.96	-	-	-	-	-	-	-	-	Α	٧
													V
													V
		2378.32	42.67	-31.33	74	43.17	26.81	6.29	33.6	124	351	Р	Н
		2378.32	17.85	-36.15	54	-	-	-	-	-	-	Α	Н
	*	2441	98.75	-	-	98.92	27.03	6.38	33.58	124	351	Р	Н
	*	2441	73.93	-	-	-	-	-	-	-	-	Α	Н
ВТ		2491.95	42.45	-31.55	74	42.43	27.2	6.39	33.57	124	351	Р	Н
BT		2491.95	17.63	-36.37	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		2354.52	41.83	-32.17	74	42.38	26.76	6.29	33.6	100	306	Р	٧
277 (IVII IZ		2354.52	17.01	-36.99	54	-	-	-	-	-	-	Α	٧
	*	2441	101.76	-	-	101.93	27.03	6.38	33.58	100	306	Р	V
	*	2441	76.94	-	-	-	-	-	-	-	-	Α	٧
		2487.61	42.17	-31.83	74	42.16	27.2	6.39	33.58	100	306	Р	V
		2487.61	17.35	-36.65	54	-	-	-	-	-	-	Α	V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: C1 of C6

	*	2480	96.3	-	-	96.36	27.14	6.38	33.58	199	124	Р	Н
	*	2480	71.48	-	-	-	-	-	-	-	-	Α	Н
		2491.24	42.08	-31.92	74	42.07	27.2	6.39	33.58	199	124	Р	Н
		2491.24	17.26	-36.74	54	-	-	-	-	-	-	Α	Н
DT													Н
BT CH 78													Н
2480MHz	*	2480	100.82	-	-	100.88	27.14	6.38	33.58	113	306	Р	V
2400WII IZ	*	2480	76	-	-	-	-	-	-	-	-	Α	V
		2484.04	43.62	-30.38	74	43.68	27.14	6.38	33.58	113	306	Р	V
		2484.04	18.8	-35.2	54	-	-	-	-	-	-	Α	V
													V
													V
	1. No	o other spuriou	s found.										
Remark	2. AI	I results are PA	SS against	Peak and	Average li	mit line.							

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978

2.4GHz 2400~2483.5MHz

BT (Harmonic @ 3m)

ВТ	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
		(MHz)	(dBµV/m)	Limit (dB)	Line (dBµV/m)	Level (dBµV)	Factor (dB/m)	Loss (dB)	Factor (dB)	Pos (cm)	Pos (deg)	Avg. (P/A)	(H/V
		4804	48.06	-25.94	74	69.45	31.6	9.6	63.02	100	0	Р	Н
•		4804	23.24	-30.76	54	-	-	-	-	-	_	Α	Н
													Н
ВТ													Н
CH 00		4804	45.88	-28.12	74	67.27	31.6	9.6	63.02	100	0	Р	V
2402MHz		4804	21.06	-32.94	54	-	-	-	-	-	-	Α	V
													V
													V
		4880	45.95	-28.05	74	67.12	31.71	9.56	62.87	100	0	Р	Н
		4880	21.13	-32.87	54		-	-	-	-	-	Α	Н
		7320	43.84	-30.16	74	57.26	37.51	11.31	62.7	100	0	Р	Н
BT		7320	19.02	-34.98	54	-	-	-	-	-	-	Α	Н
CH 39 2441MHz		4880	44.01	-29.99	74	65.18	31.71	9.56	62.87	100	0	Р	V
244 I IVI MZ		4880	19.19	-34.81	54	-	-	-	-	-	-	Α	V
		7320	43.15	-30.85	74	56.57	37.51	11.31	62.7	100	0	Р	V
		7320	18.33	-35.67	54	ı	ı	-	-	-	-	Α	V
		4960	45.19	-28.81	74	66.06	31.84	9.53	62.68	100	0	Р	Н
		4960	20.37	-33.63	54	-	-	-	-	-	-	Α	Н
DT		7440	44.42	-29.58	74	57.41	38.06	11.34	62.77	100	0	Р	Н
BT CH 78		7440	19.6	-34.4	54	-	-	-	-	-	-	Α	Н
2480MHz		4960	43.58	-30.42	74	64.45	31.84	9.53	62.68	100	0	Р	V
246UNITZ		4960	18.76	-35.24	54	-	-	-	-	-	-	Α	V
		7440	44.06	-29.94	74	57.05	38.06	11.34	62.77	100	0	Р	V
		7440	19.24	-34.76	54	-	-	-	-	-	-	Α	V

2. All results are PASS against Peak and Average limit line.

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: C3 of C6

Emission below 1GHz

2.4GHz BT (LF)

вт	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
		(MHz)	(dBµV/m)		(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V
		64.29	23.16	-16.84	40	42.81	11.81	1.02	32.49	-	-	Р	Н
		156.09	29.99	-13.51	43.5	44.11	16.61	1.61	32.43	-	-	Р	Н
		200.91	28.61	-14.89	43.5	44.27	14.95	1.72	32.39	-	-	Р	Н
		560.4	26.72	-19.28	46	29.83	26.25	2.98	32.43	ı	-	Р	Н
		757.8	30.33	-15.67	46	30.86	28.2	3.44	32.3	-	-	Р	Н
		957.3	33.71	-12.29	46	29.68	31.1	3.9	31.14	100	0	Р	Н
													Н
													Н
													Н
													Н
													Н
2.4GHz													Н
BT LF		47.01	30.93	-9.07	40	47.02	15.38	1.02	32.49	100	0	Р	V
		125.04	28.6	-14.9	43.5	42	17.51	1.51	32.46	-	-	Р	V
		199.83	25.29	-18.21	43.5	40.96	14.94	1.72	32.39	-	-	Р	V
		425.3	26.64	-19.36	46	33.46	22.84	2.63	32.34	-	-	Р	V
		689.2	29.77	-16.23	46	32.23	26.61	3.27	32.47	-	-	Р	V
		938.4	34.02	-11.98	46	31.05	30.29	3.82	31.31	-	-	Р	V
													V
													V
													V
													V
													V
													V

SPORTON INTERNATIONAL INC.

TEL: 886-3-327-3456 FAX: 886-3-328-4978 Page Number

: C4 of C6

Note symbol

Report No. : FR760506-01A

*	Fundamental Frequency which can be ignored. However, the level of any unwanted emissions shall not						
	exceed the level of the fundamental frequency.						
!	Test result is over limit line.						
P/A	Peak or Average						
H/V	Horizontal or Vertical						

SPORTON INTERNATIONAL INC. Page Number : C5 of C6

TEL: 886-3-327-3456 FAX: 886-3-328-4978

A calculation example for radiated spurious emission is shown as below:

Report No.: FR760506-01A

WIFI	Note	Frequency	Level	Over	Limit	Read	Antenna	Cable	Preamp	Ant	Table	Peak	Pol.
Ant.				Limit	Line	Level	Factor	Loss	Factor	Pos	Pos	Avg.	
1+2		(MHz)	(dBµV/m)	(dB)	(dBµV/m)	(dBµV)	(dB/m)	(dB)	(dB)	(cm)	(deg)	(P/A)	(H/V)
802.11b		2390	55.45	-18.55	74	54.51	32.22	4.58	35.86	103	308	Р	Н
CH 01													
2412MHz		2390	43.54	-10.46	54	42.6	32.22	4.58	35.86	103	308	Α	Н

1. Level($dB\mu V/m$) =

Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) - Preamp Factor(dB)

2. Over Limit(dB) = Level(dB μ V/m) – Limit Line(dB μ V/m)

For Peak Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 54.51(dB\mu V) 35.86 (dB)$
- $= 55.45 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level(dBµV/m) Limit Line(dBµV/m)
- $= 55.45(dB\mu V/m) 74(dB\mu V/m)$
- = -18.55(dB)

For Average Limit @ 2390MHz:

- 1. Level(dBµV/m)
- = Antenna Factor(dB/m) + Cable Loss(dB) + Read Level(dBµV) Preamp Factor(dB)
- $= 32.22(dB/m) + 4.58(dB) + 42.6(dB\mu V) 35.86 (dB)$
- $= 43.54 (dB\mu V/m)$
- 2. Over Limit(dB)
- = Level($dB\mu V/m$) Limit Line($dB\mu V/m$)
- $= 43.54(dB\mu V/m) 54(dB\mu V/m)$
- = -10.46(dB)

Both peak and average measured complies with the limit line, so test result is "PASS".

SPORTON INTERNATIONAL INC. Page Number : C6 of C6

TEL: 886-3-327-3456 FAX: 886-3-328-4978






Appendix D. Radiated Spurious Emission Plots


Took Engineer	LC Liana lasky livens and Kan We	Temperature :	24~26 ℃
Test Engineer :	J.C. Liang, Jacky Huang and Ken Wu	Relative Humidity :	50~55%

2.4GHz 2400~2483.5MHz

BT (Band Edge @ 3m)

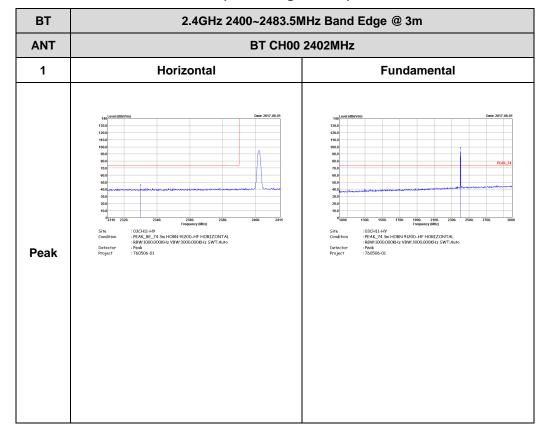


TEL: 886-3-327-3456 FAX: 886-3-328-4978

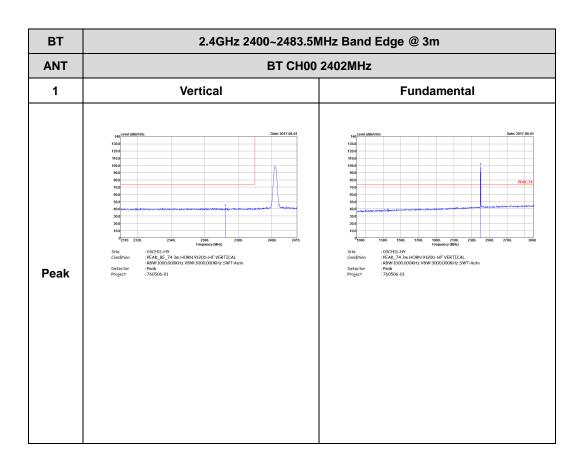


TEL: 886-3-327-3456 FAX: 886-3-328-4978

Report No. : FR760506-01A

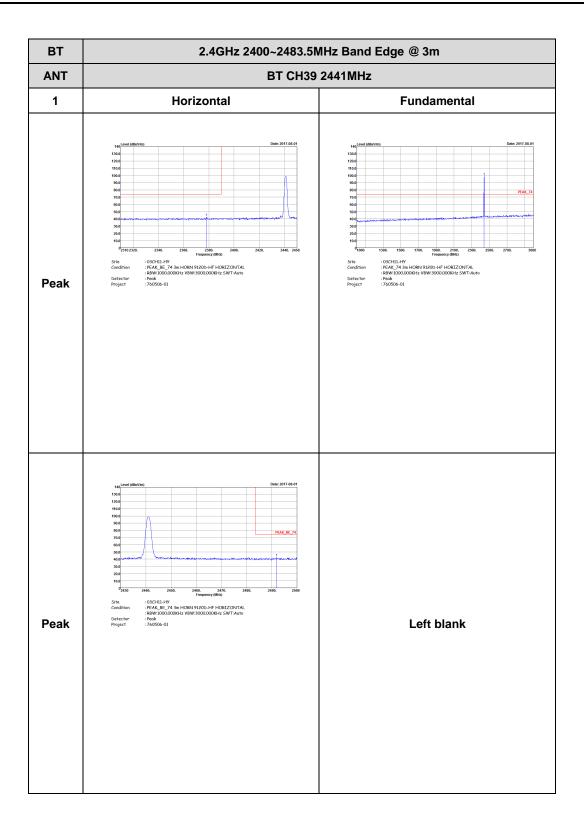

TEL: 886-3-327-3456 FAX: 886-3-328-4978

Report No. : FR760506-01A

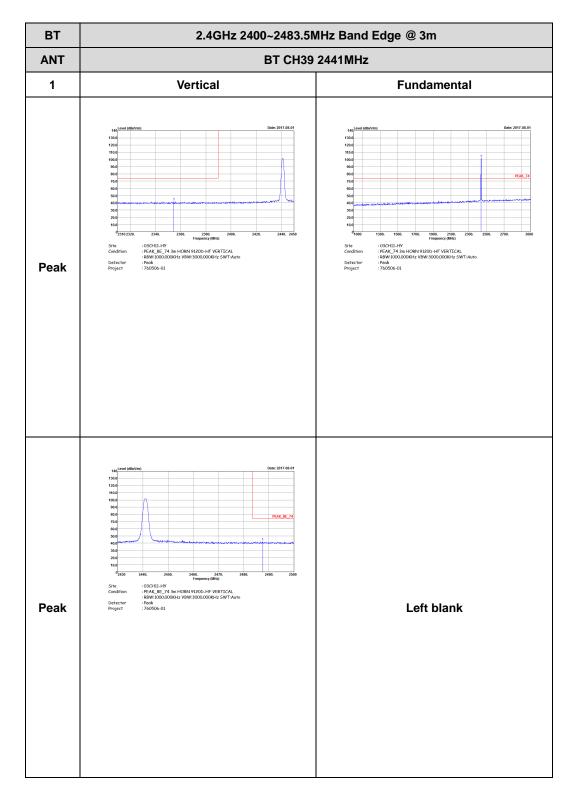

TEL: 886-3-327-3456 FAX: 886-3-328-4978

TEL: 886-3-327-3456 FAX: 886-3-328-4978

ANT

BT CH78 2480MHz

1

Vertical

Fundamental


Westings and the state of the state

TEL: 886-3-327-3456 FAX: 886-3-328-4978




2.4GHz 2400~2483.5MHz


BT (Harmonic @ 3m)

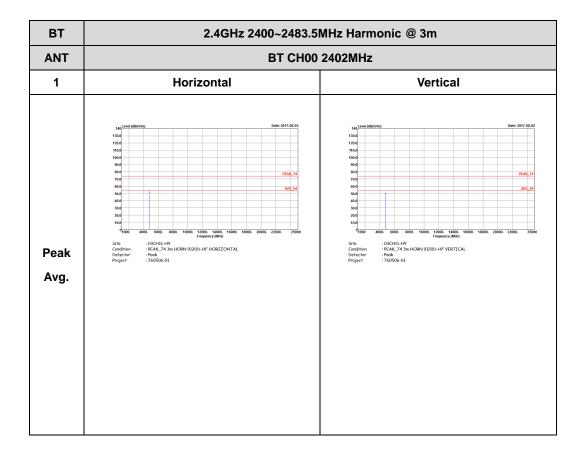

TEL: 886-3-327-3456 FAX: 886-3-328-4978

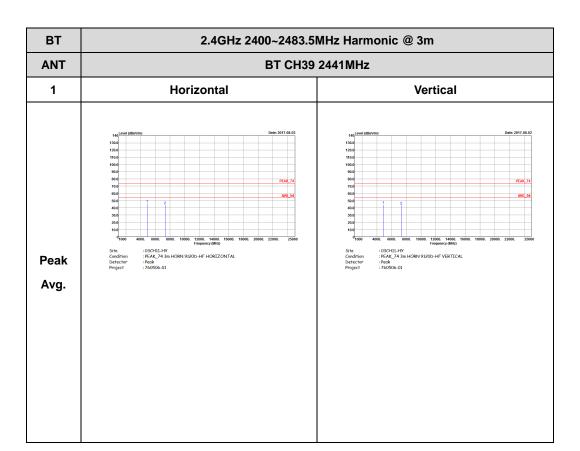


TEL: 886-3-327-3456 FAX: 886-3-328-4978

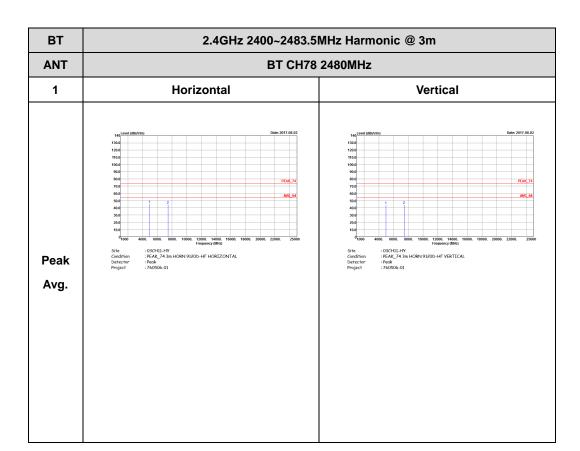

TEL: 886-3-327-3456 FAX: 886-3-328-4978



Emission below 1GHz 2.4GHz BT (LF)

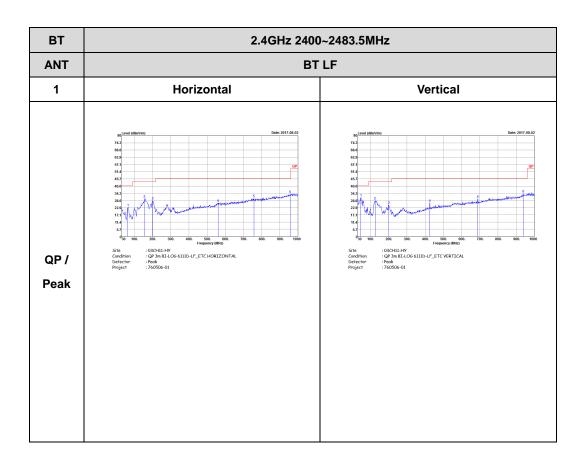


TEL: 886-3-327-3456 FAX: 886-3-328-4978


Report No.: FR760506-01A

Appendix E. Duty Cycle Plots

DH5 on time (One Pulse) Plot on Channel 39

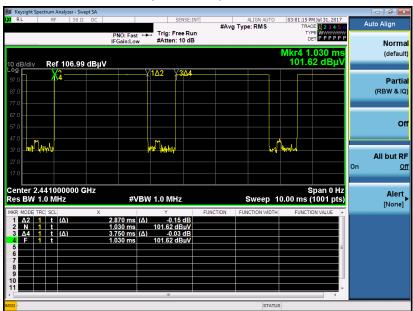

on time (Count Pulses) Plot on Channel 39

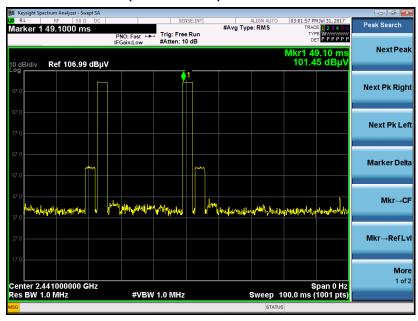

Note:

- 1. Worst case Duty cycle = on time/100 milliseconds = 2 * 2.87 / 100 = 5.74 %
- 2. Worst case Duty cycle correction factor = 20*log(Duty cycle) = -24.82 dB
- 3. DH5 has the highest duty cycle worst case and is reported.

Page Number

: E-1 of E2



Duty Cycle Correction Factor Consideration for AFH mode:

Bluetooth normal hopping rate is 1600Hz and reduced to 800Hz in AFH mode; due to the reduced number of hopping frequencies, with the same packet configuration the dwell time in each channel frequency within 100msec period is longer in AFH mode than normal mode.

In AFH mode, the minimum hopping frequencies are 20, to get the longest dwell time DH5 packet is observed; the period to have DH5 packet completing one hopping sequence is

2.87 ms x 20 channels = 57.4 ms

There cannot be 2 complete hopping sequences within 100ms period, considering the random hopping behavior, maximum 2 hops can be possibly observed within the period. [100ms / 57.6ms] = 2 hops

Thus, the maximum possible ON time:

$$2.87 \text{ ms } x 2 = 5.74 \text{ ms}$$

Worst case Duty Cycle Correction factor, which is derived from the maximum possible ON time,

 $20 \times log(5.76 \text{ ms}/100\text{ms}) = -24.82 \text{ dB}$

TEL: 886-3-327-3456 FAX: 886-3-328-4978