

Report No.: HA850813-03B



HEARING AID COMPATIBILITY T-COIL TEST REPORT

FCC ID : ZL5S48C

Equipment: Rugged Smart Phone

Brand Name : CAT
Model Name : S48c
T-Rating : T3

Applicant : Bullitt Group

One Valpy, Valpy Street, Reading, Berkshire,

England RG1 1AR

Standard : FCC 47 CFR §20.19

ANSI C63.19-2011

The product was received on Jun. 23 2018 and testing was started from Jul. 05, 2018 and completed on Jul. 06, 2018. We, SPORTON INTERNATIONAL INC., would like to declare that the tested sample has been evaluated in accordance with the test procedures and has been in compliance with the applicable technical standards.

The report must not be used by the client to claim product certification, approval, or endorsement by TAF or any agency of government.

The test results in this variant report apply exclusively to the tested model / sample. Without written approval of SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory, the test report shall not be reproduced except in full.

Approved by: Jones Tsai / Manager

SPORTON INTERTIONAL INC. EMC & Wireless Communications Laboratory

No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.)

TEL: 886-3-327-3456 Page: 1 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

Table of Contents

Report No.: HA850813-03B

Page: 2 of 25

Issued Date: Jul. 10, 2018

1.	Attestation of Test Results4						
2.	General Information 1 Testing Location 6 Applied Standards 6 Air Interface and Operating Mode 6 Measurement standards for T-Coil 6 6.1 Frequency Response 6 6.2 T-Coil Signal Quality Categories 6 7.1 Test Flow Chart 1 7.2 Test Setup Diagram 1 7.3 Description of EUT Test Position 1 8 Test Equipment List 1 9.1 GSM Tests Results 1 9.2 UMTS Tests Results 1						
ა. 4.							
	6.2	T-Coil Signal Quality Categories	8				
7.	T-Coil	Test Procedure					
	7.1	Test Flow Chart	10				
	7.2						
8.	Test E	Equipment List	14				
9.	T-Coil	testing for CMRS Voicetesting for CMRS Voice	15				
	9.1	GSM Tests Results	15				
	9.2	UMTS Tests Results	15				
	9.3	CDMA Tests Results					
10.	T-Coil	testing for CMRS IP Voice					
	10.1	V0212 1000 100010					
		VoWiFi Tests Results					
11.	T-Coil	testing for OTT VoIP Application	21				
12.	Uncer	rtainty Assessment	24				
13.	Refere	encesences	25				

Appendix A. Plots of T-Coil Measurement Appendix B. DASY Calibration Certificate Appendix C. Test Setup Photos

History of this test report

Report No.: HA850813-03B

Report No.	Version	Description	Issued Date
HA850813-03B	Rev. 01	Initial issue of report	Jul. 10, 2018

TEL: 886-3-327-3456 Page: 3 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

1. Attestation of Test Results

Air Interface	Band MHz	T-Rating	Frequency	Magnetic
	Bana IIII 2	1 ramig	Response	Intensity
OOM OMBO Valar	GSM850	T3	Pass	Pass
GSM CMRS Voice	GSM1900	T3	Pass	Pass
OTT	EDGE850	T3	Pass	Pass
OTT over EDGE	EDGE1900	T3	Pass	Pass
	Band 2	T4	Pass	Pass
UMTS CMRS Voice	Band 4	T4	Pass	Pass
	Band 5	T4	Pass	Pass
	Band 2	T3	Pass	Pass
OTT over UMTS	Band 4	T3	Pass	Pass
	Band 5	T3	Pass	Pass
	BC0	T4	Pass	Pass
CDMA CMRS Voice	BC1	T4	Pass	Pass
	BC10	T4	Pass	Pass
	BC0	T3	Pass	Pass
OTT over CDMA	BC1	T3	Pass	Intensity Pass Pass Pass Pass Pass Pass Pass Pa
	BC10	T3	Pass	Pass
	Band 2	T3	Pass	Pass
	Band 4	T3	Pass	Pass
	Band 5	T3	Pass	Pass Pass Pass
	Band 7	T3	Pass	
	Band 12	T3	Pass	Pass
VoLTE	Band 13	T3	Pass	Pass
	Band 14	T3	Pass	Pass
	Band 25	T3	Pass	Pass
	Band 26	T3	Pass	Pass
	Band 66	T3	Pass	Pass
	Band 41	T3	Pass	Pass
OTT over LTF	Band 25	T3	Pass	Pass
OTT over LTE	Band 41	T3	Pass	Pass
	2450	T4	Pass	Pass
	5200	T4	Pass	Pass
VoWiFI	5300	T4	Pass	Pass Pass Pass Pass Pass Pass Pass Pass
	5500	T4	Pass	Pass
	5800	T4	Pass	Pass
OTT over WiFi	2450	T3	Pass	Pass
OTT over WiFi	5300	T3	Pass	

Report No.: HA850813-03B

The device is compliance with HAC limits specified in guidelines FCC 47CFR §20.19 and ANSI Standard ANSI C63.19.

Reviewed by: <u>Eric Huang</u> Report Producer: <u>Wan Liu</u>

TEL: 886-3-327-3456 Page: 4 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

2. General Information

	Product Feature & Specification
Applicant Name	Bullitt Group
Equipment Name	Rugged Smart Phone
Brand Name	CAT
Model Name	S48c
FCC ID	ZL5S48C
S/N	1L6880180524000587
EUT Stage	Identical Prototype
Date Tested	2018/7/5 ~ 2018/7/6
Frequency Band	GSM850: 824.2 MHz ~ 848.8 MHz GSM1900: 1850.2 MHz ~ 1909.8 MHz WCDMA Band II: 1852.4 MHz ~ 1907.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band IV: 1712.4 MHz ~ 1752.6 MHz WCDMA Band V: 826.4 MHz ~ 846.6 MHz CDMA2000 BC0: 824.7 MHz ~ 848.31 MHz CDMA 2000 BC1: 1851.25 MHz ~ 1908.75 MHz CDMA 2000 BC10: 817.9 MHz ~ 823.1 MHz LTE Band 2: 1850.7 MHz ~ 1909.3 MHz LTE Band 4: 1710.7 MHz ~ 1754.3 MHz LTE Band 5: 824.7 MHz ~ 848.3 MHz LTE Band 7: 2502.5 MHz ~ 2567.5 MHz LTE Band 12: 699.7 MHz ~ 715.3 MHz LTE Band 13: 779.5 MHz ~ 784.5 MHz LTE Band 14: 790.5 MHz ~ 784.5 MHz LTE Band 25: 1850.7 MHz ~ 1914.3 MHz LTE Band 26: 814.7 MHz ~ 848.3 MHz LTE Band 66: 1710.7 MHz ~ 1914.3 MHz LTE Band 66: 8710.7 MHz ~ 2687.5 MHz LTE Band 66: 1710.7 MHz ~ 2687.5 MHz LTE Band 66: 1710.7 MHz ~ 2687.5 MHz LTE Band 66: 5180 MHz ~ 25240 MHz WLAN 2.4GHz Band: 5260 MHz ~ 5320 MHz WLAN 5.3GHz Band: 5745 MHz ~ 5720 MHz WLAN 5.8GHz Band: 5745 MHz ~ 5825 MHz Bluetooth: 2402 MHz ~ 2480 MHz NFC: 13.56 MHz
Mode	GSM/GPRS/EGPRS RMC/AMR 12.2Kbps HSDPA HSUPA DC-HSDPA HSPA+ CDMA2000: 1xRTT/1xEv-Do(Rev.0)/1xEv-Do(Rev.A) LTE: QPSK, 16QAM, 64QAM WLAN 2.4GHz 802.11b/g/n HT20/HT40 WLAN 5GHz 802.11a/n/ac HT20/HT40/VHT20/VHT80 Bluetooth BR/EDR/LE NFC

Report No.: HA850813-03B

TEL: 886-3-327-3456 Page: 5 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

3. Testing Location

Sporton Lab is accredited to ISO 17025 by Taiwan Accreditation Foundation (TAF code: 1190) and the FCC designation No. TW1190 under the FCC 2.948(e) by Mutual Recognition Agreement (MRA) in FCC test.

Report No.: HA850813-03B

Testing Laboratory					
Test Site SPORTON INTERNATIONAL INC.					
Test Site Location	No. 52, Huaya 1st Rd., Guishan Dist., Taoyuan City, Taiwan (R.O.C.) TEL: +886-3-327-3456 FAX: +886-3-328-4978				
Test Site No.	Sporton Site No.: SAR04-HY				

4. Applied Standards

- FCC CFR47 Part 20.19
- ANSI C63.19 2011-version
- FCC KDB 285076 D01 HAC Guidance v05
- FCC KDB 285076 D02 T Coil testing v03
- FCC KDB 285076 D03 HAC FAQ v01

TEL: 886-3-327-3456 Page: 6 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

5. Air Interface and Operating Mode

Air Interface	Band MHz	Туре	C63.19 Tested	Simultaneous Transmitter	Name of Voice Service	Power Reduction
	GSM850	1/0	.,	WLAN, BT	OMBON :	No
	GSM1900	VO	Yes	WLAN, BT	CMRS Voice	No
GSM	EDGE850	\/D	V	NAME AND DET	SIP calling ^(1,2) , Google Duo ⁽¹⁾	Nie
	EDGE1900	VD	Yes	WLAN, BT	Google Duo ⁽¹⁾	No
	850			WLAN, BT		No
	1750	VO	Yes	WLAN, BT	CMRS Voice	No
UMTS	1900			WLAN, BT		No
	HSPA	VD	Yes	WLAN, BT	SIP calling ^(1,2) , Google Duo ⁽¹⁾	No
	850	VO	Yes	WLAN, BT	CMRS Voice	No
CDMA	1900	VO	res	WLAN, BT		No
02	EVDO	VD	Yes	WLAN, BT	SIP calling ^(1,2) , Google Duo ⁽¹⁾	No
	Band 2			WLAN, BT		No
	Band 4			WLAN, BT		No
	Band 5			WLAN, BT		No
	Band 7			WLAN, BT	VoLTE, SIP calling ^(1,2) , Google Duo ⁽¹⁾	No
LTE	Band 12	VD	Yes	WLAN, BT		No
(FDD)	Band 13	VD	165	WLAN, BT	Google Duo ⁽¹⁾	No
	Band 14			WLAN, BT		No
	Band 25			WLAN, BT		No
	Band 26			WLAN, BT		No
	Band 66			WLAN, BT		No
LTE (TDD)	Band 41	VD	Yes	WLAN, BT	VoLTE, SIP calling ^(1,2) , Google Duo ⁽¹⁾	No
	2450					No
	5200				VoWiFi,	No
Wi-Fi	5300	VD	Yes	GSM,WCDMA,CDMA,LTE	SIP calling ^(1,2) , Google Duo ⁽¹⁾	No
	5500				Google Duo ⁽¹⁾	No
	5800					No
BT	2450	DT	No	GSM,WCDMA,CDMA,LTE	NA	No

Report No.: HA850813-03B

Type Transport:

VO= Voice only

DT= Digital Transport only (no voice)

VD= CMRS and IP Voice Service over Digital Transport

- 1. For protocols not listed in Table 7.1 of ANSI C63.19-2011 or the ANSI C63.19-2011 VoLTE interpretation, the average speech level of -20 dBm0 should be used. The SIP calling is android internal auxiliary functions under the dialing program.
- The device have similar frequency in some LTE bands: 5/26, 4/66, 2/25, since the supported frequency spans for the smaller LTE bands are completely cover by the larger LTE bands, therefore, only larger LTE bands were required to be tested for hearing-aid compliance.


TEL: 886-3-327-3456 Page: 7 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

6. Measurement standards for T-Coil

6.1 Frequency Response


The frequency response of the perpendicular component of the magnetic field, measured in 1/3 octave bands, shall follow the response curve specified in this sub-clause, over the frequency range 300 Hz to 3000 Hz. Figure 1.1 and Figure 1.2 provide the boundaries as a function of frequency. These response curves are for true field-strength measurements of the T-Coil signal. Thus, the 6 dB/octave probe response has been corrected from the raw readings.

Report No.: HA850813-03B

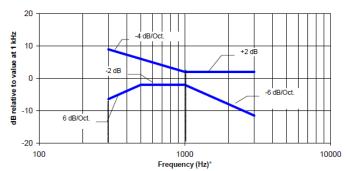

NOTE-The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.1 Magnetic field frequency response for WDs with field strength≤-15dB at 1 KHz

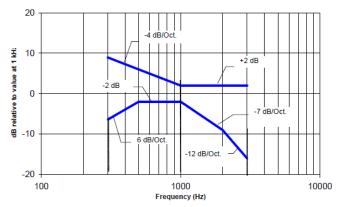

NOTE—The frequency response is between 300 Hz and 3000 Hz.

Fig. 1.2 Magnetic field frequency response for WDs with a field that exceeds -15 dB(A/m) at 1 kHz

6.2 T-Coil Signal Quality Categories

This section provides the signal quality requirement for the intended T-Coil signal from a WD. Only the RF immunity of the hearing aid is measured in T-Coil mode. It is assumed that a hearing aid can have no immunity to an interference signal in the audio band, which is the intended reception band for this mode. A device is assessed beginning by determining the category of the RF environment in the area of the T-Coil source.

The RF measurements made for the T-Coil evaluation are used to assign the category T1 through T4. The limitation is given in Table 1. This establishes the RF environment presented by the WD to a hearing aid.

Category	Telephone parameters WD signal quality ((signal + noise) to noise ratio in dB)
Category T1	0 to 10 dB
Category T2	10 to 20 dB
Category T3	20 to 30 dB
Category T4	> 30 dB

Table 1 T-Coil Signal Quality Categories

TEL: 886-3-327-3456 Page: 8 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

7. T-Coil Test Procedure

Referenced to ANSI C63.19-2011, Section 7.4,

This section describes the procedures used to measure the ABM (T-Coil) performance of the WD. In addition to measuring the absolute signal levels, the A-weighted magnitude of the unintended signal shall also be determined. To assure that the required signal quality is measured, the measurement of the intended signal and the measurement of the unintended signal must be made at the same location for each measurement position. In addition, the RF field strength at each measurement location must be at or below that required for the assigned category.

Report No.: HA850813-03B

Measurements shall not include undesired properties from the WD's RF field; therefore, use of a coaxial connection to a base station simulator or non-radiating load, there might still be RF leakage from the WD, which can interfere with the desired measurement. Pre-measurement checks should be made to avoid this possibility. All measurements shall be performed with the WD operating on battery power with an appropriate normal speech audio signal input level given in ANSI C63.19-2011 Table 7.1. If the device display can be turned off during a phone call, then that may be done during the measurement as well,


Measurement shall be performed at two locations specified in ANSI C63.19-2011 A.3, with the correct probe orientation for a particular location, in a multistage sequence by first measuring the field intensity of the desired T-Coil signal the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired magnetic components (ABM2) must be measured at the same location as the desired ABM or T-Coil signal (ABM1), and the ratio of desired to undesired ABM signals must be calculated. For the perpendicular field location, only the ABM1 frequency response shall be determined in a third measurement stage.

The following steps summarize the basic test flow for determining ABM1 and ABM2. These steps assume that a sine wave or narrowband 1/3 octave signal can be used for the measurement of ABM1.

- a. A validation of the test setup and instrumentation may be performed using a TMFS or Helmholtz coil Measure the emissions and confirm that they are within the specified tolerance.
- b. Position the WD in the test setup and connect the WD RF connector to a base station simulator or a non-radiating load. Confirm that equipment that requires calibration has been calibrated, and that the noise level meets the requirements given in ANSI C63.19-2011 clause 7.3.1.
- c. The drive level to the WD ise set such that the reference input level specified in ANSI C63.19-2011 Table 7.1 is input to the base station simulator (or manufacturer's test mode equivalent) in 1 kHz, 1/3 octave band. This drive level shall be used for the T-Coil signal test (ABM1) at f = 1 kHz. Either a sine wave at 1025 Hz or a voice-like signal, band-limited to the 1 kHz 1/3 octave, as defined in ANSI C63.19-2011 clause 7.4.2, shall be used for the reference audio signal. If interference is found at 1025 Hz an alternative nearby reference audio signal frequency may be used. The same drive level shall be used for the ABM1 frequency response measurements at each 1/3 octave band center frequency. The WD volume control may be set at any level up to maximum, provided that a signal at any frequency at maximum modulation would not result in clipping or signal overload.
- d. Determine the magnetic measurement locations for the WD device (A.3), if not already specified by the manufacturer, as described in ANSI C63.19-2011 clause 7.4.4.1.1 and 7.4.4.2.
- e. At each measurement location, measure and record the desired T-Coil magnetic signals (ABM1 at fi) as described in ANSI C63.19-2011 clause 7.4.4.2 in each individual ISO 266-1975 R10 standard 1/3 octave band. The desired audio band input frequency (fi) shall be centered in each 1/3 octave band maintaining the same drive level as determined in item c) and the reading taken for that band.
- f. Equivalent methods of determining the frequency response may also be employed, such as fast Fourier transform (FFT) analysis using noise excitation or input-output comparison using simulated speech. The full-band integrated probe output, as specified in D.9, may be used, as long as the appropriate calibration curve is applied to the measured result, so as to yield an accurate measurement of the field magnitude. (The resulting measurement shall be an accurate measurement in dB A/m.)
- g. All Measurements of the desired signal shall be shown to be of the desired signal and not of an undesired signal. This may be shown by turning the desired signal ON and OFF with the probe measuring the same location. If the scanning method is used the scans shall show that all measurement points selected for the ABM1 measurement meet the ambient and test system noise criteria in ANSI C63.19-2011 clause 7.3.1.
- h. At the measurement location for each orientation, measure and record the undesired broadband audio magnetic signal (ABM2) as specified in ANSI C63.19-2011 clause 7.4.4.4 with no audio signal applied (or digital zero applied, if appropriate) using A-weighting and the half-band integrator. Calculate the ratio of the desired to undesired signal strength (i,e., signal quality).
- i. Obtain the data from the postprocessor, SEMCAD, and determine the category that properly classifies the signal quality based on ANSI C63.19-2011 Table 8.5.

TEL: 886-3-327-3456 Page: 9 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

7.1 Test Flow Chart

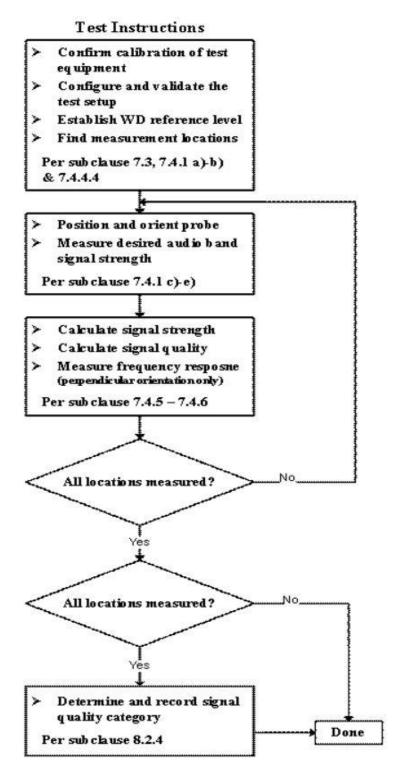


Report No.: HA850813-03B

Fig. 2 T-Coil Signal Test flowchart

TEL: 886-3-327-3456 Page: 10 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

7.2 Test Setup Diagram

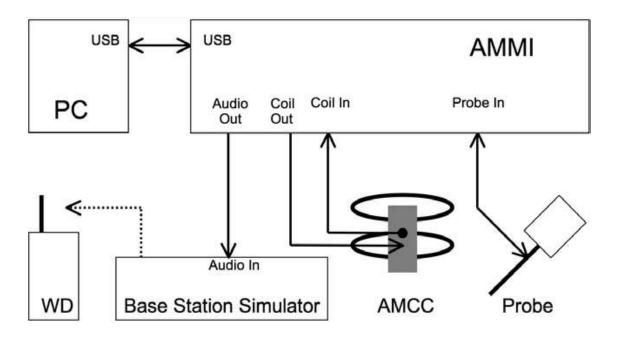

Report No.: HA850813-03B

General Note:

- 1. Define the all applicable input audio level as below according to C63 and KDB 285076 D02v03:
 - GSM input level: -16dBm0
 - UMTS input level: -16dBm0
 - CDMA input level: -18dBm0
 - VoLTE input level: -16dBm0
 - VoWiFi input level: -20dBm0
 - OTT VoIP input Level: -20dBm0
- 2. For GSM / UMTS / CDMA test setup and input level, the correct input level definition is via a communication tester CMU200's "Decoder Cal" and "Codec Cal" with audio option B52 and B85 to set the correct audio input levels.
- 3. CMU200 is able to output 1kHz audio signal equivalent to 3.14dBm0 at "Decoder Cal." confuguration, the signal reference is used to adjust the AMMI gain setting to reach -16dBm0 for GSM/UMTS and -18dBm0 for CDMA. CMW500 input is calibrated and the relation between the analog input voltage and the internal level in dBm0 can be determined
- 4. The test setup used for VoLTE over IMS and VoWiFi over IMS is via the callbox of CMW500 for T-coil measurement, The data application unit of the CMW500 was used to simulate the IP multimedia subsystem server. The CMW500 can be manually configured to ensure and control the speech input level result is -16dBm0 for VoLTE, -20dBm0 for VoWiFi when the device during the IMS connection.
- 5. The test setup used for Google DUO VoIP call is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and also monitor the audio input level of -20dBm0.
- 6. The test setup used for SIP Calling is via the data application unit on CMW500 connection to the Internet, also connection to the other auxiliary VoIP unit which is used to configure the audio codec and bit rate and can be determined the audio input level of -20dBm0.

TEL: 886-3-327-3456 Page: 11 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

 The Required gain factor for the specific signal shall typically be multiplied by this factor to achieve approx. the same level as for the 1kHz sine signal

Report No.: HA850813-03B

2. The below calculation formula is an example and showing how to determine the input level for the device.

The predefined signal types have the following differences / factors compared to the 1kHz sine signal:

Signal [file name]	Duration [s]	Peak-to- RMS [dB]	RMS [dB]	Required gain factor *)	Gain setting
1kHz sine		3.0	0.0	1.00	
48k_1.025kHz_10s.wav	10	3.0	0.0	1.00	
48k_1kHz_3.15kHz_10s.wav	10	6.0	-3.0	1.42	
48k_315Hz_1kHz_10s.wav	10	6.0	-2.9	1.40	
48k csek 8k 441 white 10s.wav	10	13.8	-10.5	3.34	
48k_multisine_50-5000_10s.wav	10	11.1	-7.9	2.49	
48k_voice_1kHz_1s.wav	1	16.2	-12.7	4.33	
48k_voice_300-3000_2s.wav	2	21.6	-18.6	8.48	

(*) The gain for the specific signal shall typically be multiplied by this factor to acheive approx. the same level as for the 1kHz sine signal.

Insert the gain applicable for your setup in the last column of the table.

Calculation formula:

- Audio Level at -16dBm0 = ((-16dBm0) (3.14dBm0)) + X dBv
- Calculated Gain at -16dBm0 = 10((audio level at -16dBm0 Y dBm0) / 20) * 10

Gatting setting at -16dBm0 = required gain factor * calculated gain

Gain Value	20* log(gain)	AMCC Coil In	Level
(linear)	dB	(dBv RMS)	dBm0
		-2.47	3.14
10	20	-19.85	-14.24
8.17	18.24	-21.61	-16

Signal Type	Duration (s)	Peak to RMS (dB)	RMS (dB)	Required Gain Factor	Calculated Gain Setting
1kHz sine	-	3	0	1	8.17
48k_voice_1kHz	1	16.2	-12.7	4.33	35.36
48k_voice_300Hz ~ 3kHz	2	21.6	-18.6	8.48	69.25

TEL: 886-3-327-3456 Page: 12 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

7.3 Description of EUT Test Position

Fig.3 illustrate the references and reference plane that shall be used in a typical EUT emissions measurement. The principle of this section is applied to EUT with similar geometry. Please refer to Appendix C for the setup photographs.

Report No.: HA850813-03B

- ♦ The area is 5 cm by 5 cm.
- ♦ The area is centered on the audio frequency output transducer of the EUT.
- ◆ The area is in a reference plane, which is defined as the planar area that contains the highest point in the area of the phone that normally rests against the user's ear. It is parallel to the centerline of the receiver area of the phone and is defined by the points of the receiver-end of the EUT handset, which, in normal handset use, rest against the ear.
- ◆ The measurement plane is parallel to, and 10 mm in front of, the reference plane.

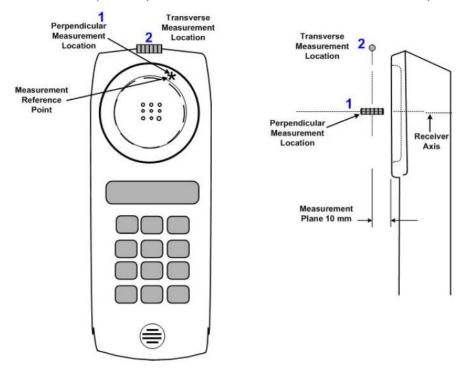


Fig.3 A typical EUT reference and plane for T-Coil measurements

TEL: 886-3-327-3456 Page: 13 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

8. Test Equipment List

Manufacturer	Name of Equipment	Type/Madel	Serial Number	Calib	ration
Manuracturer	Name of Equipment	Type/Model	Seriai Number	Last Cal.	Due Date
SPEAG	Audio Magnetic 1D Field Probe	AM1DV3	3130	Nov. 21, 2017	Nov. 20, 2018
SPEAG	Data Acquisition Electronics	DAE4	1424	Jan. 18, 2018	Jan. 17, 2019
SPEAG	Audio Magnetic Calibration Coil	AMCC	1049	NCR	NCR
SPEAG	Audio Measuring Instrument	AMMI	1041	NCR	NCR
WonDer	Thermometer	WD-5016	TM132-1	Mar. 16, 2018	Mar. 15, 2019
SPEAG	Test Arch Phantom	N/A	N/A	NCR	NCR
SPEAG	Phone Positioner	N/A	N/A	NCR	NCR
R&S	Base Station	CMW500	115793	May. 24, 2018	May. 23, 2019
R&S	Base Station	CMU200	116457	May. 30, 2018	May. 29, 2019

Report No.: HA850813-03B

Note:

TEL: 886-3-327-3456 Page: 14 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

^{1.} NCR: "No-Calibration Required"

9. T-Coil testing for CMRS Voice

General Note:

- Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following worst investigation codec would be remarked to be used for the testing for the handset.
- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.

Report No.: HA850813-03B

b. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

9.1 GSM Tests Results

<Codec Investigation>

Codec	FR_V1	HR_V1	Orientation	Band / Channel	
ABM 1 (dBA/m)	0.64	-0.37			
ABM 2 (dBA/m)	-23.63	-24.93	Axial	GSM850 / 189	
Signal Quality (dB)	24.27	24.56	Axidi	G3100007 109	
Freq. Response	PASS	PASS			

Remark: According to codec investigation, the worst codec is FR_V1

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
_	GSM850	ED 1/4	189	Axial (Z)	0.64	-23.63	24.27	Т3	-50.26	0.77	PASS
'	GSIVI65U	FR_V1	109	Transversal (Y)	-0.40	-24.88	24.48	Т3	-50.31	0.77	PASS
	00144000	ED 1/4	004	Axial (Z)	-9.58	-33.75	24.17	Т3	-50.28	4.00	DAGG
2	GSM1900	FR_V1	661	Transversal (Y)	-3.67	-28.19	24.52	Т3	-50.22	1.26	PASS

9.2 UMTS Tests Results

<Codec Investigation>

Codec	AMR 4.75Kbps	AMR 7.95Kbps	AMR 12.2Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	14.77	14.22	14.77		
ABM 2 (dBA/m)	-38.8	-39.17	-38.05	Axial	Band 2 / 9400
Signal Quality (dB)	53.57	53.39	52.82	Axiai	Band 2 / 9400
Freq. Response	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is AMR 12.2Kbps

TEL: 886-3-327-3456 Page: 15 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
3	WCMDA II	AMT 12.2Kbps	9400	Axial (Z)	14.77	-38.05	52.82	T4	-50.26	2	PASS
3	WCIVIDA II	AIVIT 12.2KDps	9400	Transversal (Y)	10.73	-41.48	52.21	T4	-50.22	2	PASS
	WCMDA IV	AMT 12 OKhna	1413	Axial (Z)	12.60	-40.23	52.83	T4	-50.29	2	PASS
4	WCIVIDA IV	AMT 12.2Kbps	1413	Transversal (Y)	11.13	-41.44	52.57	T4	-50.26	2	PASS
_	MOMPAN	AMT 40 OKb	4400	Axial (Z)	14.61	-38.24	52.85	T4	-50.31		DAGG
5	WCMDA V	AMT 12.2Kbps	4182	Transversal (Y)	11.40	-40.93	52.33	T4	-50.29	2	PASS

Report No.: HA850813-03B

9.3 CDMA Tests Results

<Codec Investigation>

Codec	RC1 SO68	RC3 SO68	RC4 SO68	Orientation	Band / Channel
ABM 1 (dBA/m)	4.98	4.7	4.77		
ABM 2 (dBA/m)	-47.86	-47.52	-47.47	Axial	DC0 / 204
Signal Quality (dB)	52.84	52.22	52.24	Axiai	BC0 / 384
Freq. Response	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is RC3 SO68

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
6	CDMA BC0	RC3 SO68	384	Axial (Z)	4.70	-47.52	52.22	T4	-50.26	1.76	PASS
6	CDIVIA BCU	KC3 3000	304	Transversal (Y)	1.99	-47.70	49.69	T4	-50.24	1.76	PASS
7	CDMA BC1	RC3 SO68	600	Axial (Z)	5.13	-50.25	55.38	T4	-50.35	1.76	PASS
,	CDIVIA BC I	RC3 5000	600	Transversal (Y)	2.27	-49.99	52.26	T4	-50.21	1.76	PASS
	CDMA DC40	DC2 5069	F90	Axial (Z)	5.16	-49.97	55.13	T4	-50.33	4.60	DACC
8	CDMA BC10	RC3 SO68	580	Transversal (Y)	2.11	-50.08	52.19	T4	-50.18	1.62	PASS

TEL: 886-3-327-3456 Page: 16 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

10. T-Coil testing for CMRS IP Voice

10.1 VoLTE Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel / band, the following worst investigation codec would be remarked to be used for the testing for the handset.

2. Air Interface Investigation:

a. Use the worst-case codec test and document a limited set of bands / channel / bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.

Report No.: HA850813-03B

- b. Select LTE FDD / TDD one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/RB size to verify the variation to find out worst configuration.
- c. The TDD LTE power class 3 supports uplink-downlink configuration 0 and 6 and power class 2 supports uplink-downlink configuration1 to 5 for this device, an investigation was performed to determine the worst-case uplink-downlink configuration to be used for the testing for the handset.
- According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

LTE FDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	4.1	-7.69	-2.03	-10.18	-9.96	-1.06	-9.2	-2.01	-1.84	-10.66		
ABM 2 (dBA/m)	-20.33	-31.8	-28.06	-33.62	-33.34	-24.48	-32.56	-25.54	-25.39	-34.43		B25 / 20M /
Signal Quality (dB)	24.43	24.11	26.03	23.44	23.38	23.42	23.36	23.53	23.55	23.77	Axial	26340
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is EVS WB 5.9Kbps

LTE TDD

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / BW / Channel
ABM 1 (dBA/m)	1.14	1.09	1.17	1.2	1.03	1.19	1.1	1.22	1.29	1.03		
ABM 2 (dBA/m)	-22.96	-23.02	-23.01	-22.97	-23.13	-22.91	-22.98	-22.91	-22.8	-23.1	Audel	B41 / 20M /
Signal Quality (dB)	24.1	24.11	24.18	24.17	24.16	24.1	24.18	24.13	24.19	24.13	Axial	40620
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec is NB AMR 4.75Kbps

TEL: 886-3-327-3456 Page: 17 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018



SPORTON LAB. HAC T-COIL TEST REPORT

<Air Interface Investigation>

Plot No.	Air Interface	BW (MHz)	Modulation / Mode	RB Size	RB offset	Channel	UL-DL Configuration	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	LTE B25	20	QPSK	1	0	26340		Axial (Z)	-9.00	-32.04	23.04
	LTE B25	20	QPSK	50	0	26340		Axial (Z)	-8.95	-32.11	23.16
	LTE B25	20	QPSK	100	0	26340		Axial (Z)	-9.02	-32.16	23.14
	LTE B25	20	16QAM	1	0	26340		Axial (Z)	-9.05	-32.16	23.11
FDD	LTE B25	20	64QAM	1	0	26340		Axial (Z)	-8.98	-32.15	23.17
FDD	LTE B25	15	QPSK	1	0	26340		Axial (Z)	-9.03	-32.09	23.06
	LTE B25	10	QPSK	1	0	26340		Axial (Z)	-9.05	-32.13	23.08
	LTE B25	5	QPSK	1	0	26340		Axial (Z)	-8.98	-32.11	23.13
	LTE B25	3	QPSK	1	0	26340		Axial (Z)	-9.05	-32.15	23.10
	LTE B25	1.4	QPSK	1	0	26340		Axial (Z)	-9.02	-32.15	23.13
	LTE B41_PC3	20	QPSK	1	0	40620	0	Axial (Z)	1.20	-22.50	23.70
	LTE B41_PC3	20	QPSK	50	0	40620	0	Axial (Z)	1.18	-22.56	23.74
	LTE B41_PC3	20	QPSK	100	0	40620	0	Axial (Z)	1.16	-22.69	23.85
	LTE B41_PC3	20	16QAM	1	0	40620	0	Axial (Z)	1.22	-22.66	23.88
	LTE B41_PC3	20	64QAM	1	0	40620	0	Axial (Z)	1.18	-22.67	23.85
	LTE B41_PC3	15	QPSK	1	0	40620	0	Axial (Z)	1.20	-22.66	23.86
	LTE B41_PC3	10	QPSK	1	0	40620	0	Axial (Z)	1.20	-22.55	23.75
TDD	LTE B41_PC3	5	QPSK	1	0	40620	0	Axial (Z)	1.18	-22.68	23.86
	LTE B41_PC3	20	QPSK	1	0	40620	6	Axial (Z)	1.18	-22.63	23.81
	LTE B41_PC2	20	QPSK	1	0	40620	1	Axial (Z)	1.24	-22.52	23.76
	LTE B41_PC2	20	QPSK	1	0	40620	2	Axial (Z)	1.26	-22.57	23.83
	LTE B41_PC2	20	QPSK	1	0	40620	3	Axial (Z)	1.25	-22.71	23.96
	LTE B41_PC2	20	QPSK	1	0	40620	4	Axial (Z)	1.17	-22.71	23.88
	LTE B41_PC2	20	QPSK	1	0	40620	5	Axial (Z)	1.19	-22.75	23.94
	UL CA B41	20	QPSK	1	0	40620	0	Axial (Z)	1.22	-22.69	23.91

Report No.: HA850813-03B

Plot No.	Air Interface	BW (MHz)	Modulation	RB Size	RB offset	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)		Frequency Response
9	LTE Band 7	20	QPSK	1	0	21100	Axial (Z)	-4.75	-28.67	23.92	T3	-50.31	2	PASS
9	LTL Danu 7	20	QFSK		U	21100	Transversal (Y)	-4.25	-28.58	24.33	T3	-50.28	2	FAGG
10	LTE Band 12	10	QPSK	1	0	23095	Axial (Z)	-2.00	-25.98	23.98	T3	-50.26	2	PASS
10	LIL Danu 12	10	QFSK		U	23093	Transversal (Y)	-1.27	-25.54	24.27	T3	-50.24	2	FAGG
11	LTE Band 13	10	QPSK	1	0	23230	Axial (Z)	-9.87	-33.90	24.03	Т3	-50.30	2	PASS
	LIL Danu 13	10	QFSK		U	23230	Transversal (Y)	-9.72	-34.06	24.34	Т3	-50.29	2	FAGG
12	LTE Band 14	10	QPSK	1	0	23330	Axial (Z)	-2.36	-26.41	24.05	T3	-50.32	2	PASS
12	LIL Dallu 14	10	QFSK		U	23330	Transversal (Y)	-0.90	-25.27	24.37	Т3	-50.19	2	FAGG
13	LTE Band 25	20	QPSK	1	0	26340	Axial (Z)	-9.20	-32.56	23.36	T3	-50.28	2	PASS
13	LIE Dallu 23	20	QFSK	'	0	20340	Transversal (Y)	-9.54	-33.36	23.82	Т3	-50.26	2	PASS
14	LTE Band 26	15	QPSK	1	0	26865	Axial (Z)	-12.82	-36.71	23.89	T3	-50.30	2	PASS
14	LIE Dallu 20	15	QFSK	'	0	20000	Transversal (Y)	-2.19	-26.34	24.15	Т3	-50.18	2	PASS
15	LTE Band 66	20	QPSK	1	0	132322	Axial (Z)	-2.96	-26.63	23.67	T3	-50.28	2	PASS
15	LIE DANG 66	20	QF5K	'	0	132322	Transversal (Y)	-5.05	-29.32	24.27	T3	-50.16		FA33
16	LTE Band 41	20	QPSK	1	0	40620	Axial (Z)	1.10	-22.98	24.08	Т3	-50.27	2	PASS
16	LIE Dano 41	20	QF5K	'	0	40020	Transversal (Y)	-4.90	-29.41	24.51	T3	-50.22		FA33

TEL: 886-3-327-3456 Page: 18 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

10.2 VoWiFi Tests Results

General Note:

Codec Investigation: For a voice service/air interface, investigate the variations of codec configurations
(WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It
is only necessary to document this for one channel/band, the following worst investigation codec would be remarked
to be used for the testing for the handset.

Report No.: HA850813-03B

- 2. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface and the following worst configure would be remarked to be used for the testing for the handset.
 - b. Select WLAN 2.4GHz and WLAN 5GHz one frequency band to do measurement at the worst SNR position was additionally performed with varying the BWs/Modulations/data rate to verify the variation to find out worst configuration.
 - c. According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

<Codec Investigation>

Codec	NB AMR 4.75Kbps	WB AMR 6.60Kbps	NB AMR 12.2Kbps	WB AMR 23.85Kbps	EVS SWB 9.6Kbps	EVS SWB 128Kbps	EVS WB 5.9Kbps	EVS WB 128Kbps	EVS NB 5.9Kbps	EVS NB 24.4Kbps	Orientation	Band / Channel
ABM 1 (dBA/m)	-8.43	-8.36	-8.26	-8.42	-8.43	-8.34	-8.46	-8.42	-8.37	-8.53		
ABM 2 (dBA/m)	-46.71	-46.66	-46.6	-46.79	-46.73	-46.71	-46.79	-46.74	-46.71	-46.96		WLAN2.4G
Signal Quality (dB)	38.28	38.3	38.34	38.37	38.3	38.37	38.33	38.32	38.34	38.43	Axial	/ 6
Freq. Response	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS	PASS		

Remark: According to codec investigation, the worst codec is NB AMR 4.75Kbps

TEL: 886-3-327-3456 Page: 19 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

<Air Interface Investigation>

Frequency Bands	Modulation	Bandwidth	Data Rate	Channel	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB
	802.11b	20	1M	6	Axial (Z)	-7.62	-42.88
	802.11b	20	11M	6	Axial (Z)	-7.53	-43.40
	802.11g	20	6M	6	Axial (Z)	-7.60	-43.96
WLAN 2.4GHz	802.11g	20	54M	6	Axial (Z)	-7.67	-44.07
WLAN 2.4GHZ	802.11n-HT20	20	MCS0	6	Axial (Z)	-7.57	-44.08
	802.11n-HT20	20	MCS7	6	Axial (Z)	-7.52	-43.27
	802.11n-HT40	40	MCS0	6	Axial (Z)	-7.48	-43.42
	802.11n-HT40	40	MCS7	6	Axial (Z)	-7.53	-44.04
	802.11a	20	6M	40	Axial (Z)	-7.53	-47.76
	802.11a	20	54M	40	Axial (Z)	-7.63	-51.06
	802.11an-HT20	20	MCS0	40	Axial (Z)	-7.51	-47.94
	802.11an-HT20	20	MCS7	40	Axial (Z)	-7.40	-49.79
	802.11an-HT40	40	MCS0	38	Axial (Z)	-7.58	-49.78
WLAN 5GHz	802.11an-HT40	40	MCS7	38	Axial (Z)	-7.63	-48.01
WLAN 5GHZ	802.11ac-VHT20	20	MCS0	40	Axial (Z)	-7.51	-50.15
	802.11ac-VHT20	20	MCS8	40	Axial (Z)	-7.64	-48.18
	802.11ac-VHT40	40	MCS0	38	Axial (Z)	-7.51	-50.20
	802.11ac-VHT40	40	MCS8	38	Axial (Z)	-7.53	-49.91
	802.11ac-VHT80	80	MCS0	50	Axial (Z)	-7.52	-47.99
	802.11ac-VHT80	80	MCS8	50	Axial (Z)	-7.47	-49.48

Report No.: HA850813-03B

Plot No.	Air Interface	Modulation	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response				
17	WLAN2.4GHz	802.11b 1Mbps	6	Axial (Z)	-8.26	-46.54	38.28	T4	-50.26	2	PASS				
17	WLANZ.4GHZ	602.11b 1Mbps	O	Transversal (Y)	-16.25	-48.20	31.95	T4	-50.18	2	FASS				
18	WLAN5GHz	902 11a 6Mbpa	40	Axial (Z)	-8.01	-51.76	43.75	T4	-50.29	2	PASS				
10	WLANSGHZ	802.11a 6Mbps	802.11a 6Mbps	802.11a 6Mbps	40	Transversal (Y)	-15.80	-51.14	35.34	T4	-50.21	2	FASS		
19	WLAN5GHz	902 112 6Mbps	902 110 6Mbpg	802 112 6Mbps	802 11a 6Mbps	802 11a 6Mbps	60	Axial (Z)	-8.19	-49.87	41.68	T4	-50.24	2	PASS
19	WLANSGHZ	802.11a 6Mbps	802.11a 6Mbps	802.11a 6Mbps	802.11a 6Mbps	60	Transversal (Y)	-16.02	-49.98	33.96	T4	-50.17	2	FASS	
-00	WILANIE OLI-	000.44 004	000 44 - 014	900 11a 6Mbna	902 44a CMbpa	104	Axial (Z)	-8.22	-51.28	43.06	T4	-50.32	0	D4 00	
20	WLAN5GHz	802.11a 6Mbps	ps 124	Transversal (Y)	-15.92	-49.78	33.86	T4	-50.23	2	PASS				
24	WI ANECH 2 902 112 6Mbps	157	Axial (Z)	-8.02	-50.95	42.93	T4	-50.27	2	DAGG					
21	WLAN5GHz 802.11a 6Mbps	Hz 802.11a 6Mbps	802.11a 6Mbps	157	Transversal (Y)	-15.91	-49.35	33.44	T4	-50.11	2	PASS			

TEL: 886-3-327-3456 Page: 20 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

11. T-Coil testing for OTT VoIP Application

General Notes:

 According to the ANSI C63.19 2011 section 7.3.2, test middle channel of each frequency band for HAC testing for each orientation to determine worst HAC T-Coil rating.

Report No.: HA850813-03B

- 2. The google Duo and SIP calling VoIP application are pre-installed on this device. According to KDB 285076 D02, all air interfaces via a data connection with VoIP application need to be considered HAC testing.
- 3. The test setup used for OTT VoIP call is the DUT connect to the CMW500 and via the data application unit on CMW500 connection to the Internet, the Auxiliary EUT is connected to the WiFi access point, the channel/Modulation/Frequency bands/data rate is configured on the CMW500 for the DUT unit. For the Auxiliary VoIP unit which is used to configure the audio codec rate and determine the audio input level of -20dBm0 based on the KDB 285076 D02v03 requirement.
- 4. <u>Codec Investigation:</u> For a voice service/air interface, investigate the variations of codec configurations (WB, NB bit rate) and document the parameters (ABM1, ABM2, S+N/N, frequency response) for that voice service. It is only necessary to document this for one channel/band, the following tests results which the worst case codec would be remarked to be used for the testing for the handset.
- 5. Air Interface Investigation:
 - a. Use the worst-case codec test and document a limited set of bands/channel/bandwidths. Observe the effect of changing the band and bandwidth to ensure that there are no unexpected variations. Using the knowledge of the observed variations, it is necessary to report only a set band/channel/bandwidth for each orientation for a voice service/air interface.
 - b. Due to OTT service and CMRS IP service are all be established over the internet protocol for the voice service, and on both services use the identical RF air interface for the WIFI and LTE, therefore according to VoLTE and VoWiFi test results of air interface investigation, the worst configuration and frequency band of air interface was used for OTT T-Coil testing.
 - -LTE FDD worst configuration and band: LTE Band 25/20MHz/QPSK/1RB Size
 - -LTE TDD worst configuration and band: LTE Band 41/20MHz/QPSK/1RB Size
 - -WLAN2.4GHz worst configuration: 802.11b /1Mbps
 - -WLAN5GHz worst configuration and Band: WLAN 5.8GHz /11a/6Mbps

<Codec Investigation>

EDGE

ОТТ	VoIP (Codec(Google	Duo)		VolP	Codec(SIP Ca	alling)		Onion totion	Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	7.04	7.7	6.26	-8.86	-8.9	-8.94	-7.92	-8.9		GSM850 / 189
ABM 2 (dBA/m)	-28.92	-28.41	-29.4	-35.62	-35.72	-35.56	-34.31	-35.65	Axial	
Signal Quality (dB)	35.96	36.11	35.66	26.76	26.82	26.62	26.39	26.75	Axiai	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

HSPA

ОТТ	VoIP	Codec(Google	Duo)		VolP	Codec(SIP Ca	ılling)			Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	9.36	8.27	7.09	4.55	4.85	5.42	-2.01	-3.96		UMTS B2 / 9400
ABM 2 (dBA/m)	-28.63	-27.33	-27.96	-24.05	-23.06	-24.17	-28.69	-31.03	Axial	
Signal Quality (dB)	37.99	35.6	35.05	28.6	27.91	29.59	26.68	27.07		
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

TEL: 886-3-327-3456 Page: 21 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

1XEVDO Rev A

ОТТ	VoIP (Codec(Google	Duo)		VolP	Codec(SIP Ca	ılling)			Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	1.49	1.29	1.05	3.39	3.58	3.23	3.34	3.67		BC0 / 384
ABM 2 (dBA/m)	-30.79	-31.31	-31.11	-22.05	-21.95	-22.16	-22.01	-21.77	Axial	
Signal Quality (dB)	32.28	32.6	32.16	25.44	25.53	25.39	25.35	25.44	Axiai	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Report No.: HA850813-03B

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

LTE FDD

ОТТ	VoIP (Codec(Google	Duo)		VolP	Codec(SIP Ca	alling)			Band / BW / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	7.38	9.34	9.23	1.27	1.41	1.72	0.93	1.25		B25 / 20M / 26340
ABM 2 (dBA/m)	-26.77	-23.64	-23.6	-22.76	-22.65	-22.8	-22.76	-22.75		
Signal Quality (dB)	34.15	32.98	32.83	24.03	24.06	24.52	23.69	24	Axial	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

LTE TDD

ОТТ	VoIP (Codec(Google	Duo)		VolP	Codec(SIP Ca	alling)		0	Band / BW / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	8.49	10.12	10.1	-0.63	-2.82	-2.01	-2.99	-2.29		B41 / 20M / 40620
ABM 2 (dBA/m)	-24.89	-22.54	-22.26	-28.89	-28.66	-28.19	-27.1	-27.73		
Signal Quality (dB)	33.38	32.66	32.36	28.26	25.84	26.18	24.11	25.44	Axial	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

WLAN

OTT	VoIP	Codec(Google	Duo)		VolP	Codec(SIP Ca	ılling)			Band / Channel
Codec	Opus 6kbps	Opus 40kbps	Opus 75kbps	AMR NB 12.2 Kbit/s	GSM 13Kbit/s	GSM_EFR 12.2 Kbit/s	PCMA 64 Kbit/s	PCMU 64 Kbit/s	Orientation	
ABM 1 (dBA/m)	8.2	11.2	11.61	-15.56	-14.53	-6.26	-0.85	-6.42		WLAN2.4G / 6
ABM 2 (dBA/m)	-27.17	-22.05	-21.06	-42.03	-41.1	-35.55	-26.54	-34.1	Audal	
Signal Quality (dB)	35.37	33.25	32.67	26.47	26.57	29.29	25.69	27.68	Axial	
Freq. Response	Pass	Pass	Pass	Pass	Pass	Pass	Pass	Pass		

Remark: According to codec investigation, the worst codec bitrate is PCMA 64Kbits

TEL: 886-3-327-3456 Page: 22 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

<Air Interface Investigation>

Plot No.	Air Interface	Mode	Channel	Probe Position	ABM1 dB (A/m)	ABM2 dB (A/m)	Signal Quality dB	T Rating	Ambient Noise dB (A/m)	Freq. Response Variation dB	Frequency Response				
22	GSM850	EDGE 2 Tx slots	189	Axial (Z)	-7.92	-34.31	26.39	Т3	-50.33	2	PASS				
22	GSIVIOSO	EDGE 2 1X SIOIS	109	Transversal (Y)	1.46	-25.54	27.00	Т3	-50.25	2	FASS				
23	GSM1900	EDGE 2 Tx slots	661	Axial (Z)	5.21	-20.17	25.38	Т3	-50.36	2	PASS				
23	G3W1900	LDGL 2 TX SIOIS	001	Transversal (Y)	-0.15	-25.80	25.65	T3	-50.26	2	FAGG				
24	WCDMA II HS	HSPA	9400	Axial (Z)	-2.01	-28.69	26.68	Т3	-50.31	2	PASS				
24	WCDIVIA II	WODWAII	5400	Transversal (Y)	-3.24	-29.16	25.92	Т3	-50.28	2	FAGG				
25	WCDMA IV	HSPA	1413	Axial (Z)	-2.89	-28.58	25.69	T3	-50.26	2	PASS				
25	WCDIVIA IV		ПОРА	1413	Transversal (Y)	0.07	-25.48	25.55	Т3	-50.27	2	FASS			
26	26 WCDMA V HSPA	HSPA	LOD.	ПСВА	HCDA	LICDA	4182	Axial (Z)	-3.85	-29.42	25.57	Т3	-50.26	2	PASS
20			4102	Transversal (Y)	0.10	-25.81	25.91	Т3	-50.29	2	PASS				
27	27 CDMA BC0	RTAP 153.6Kbps	384	Axial (Z)	3.34	-22.01	25.35	Т3	-50.25	2	PASS				
21	CDIVIA BC0	KTAF 155.0Kbps		Transversal (Y)	1.25	-25.16	26.41	Т3	-50.31	2					
28	CDMA BC1	RTAP 153.6Kbps	600	Axial (Z)	-2.91	-27.93	25.02	T3	-50.25	2	PASS				
20	CDIVIA BCT	KTAP 155.6KDps	600	Transversal (Y)	-8.13	-32.81	24.68	Т3	-50.22						
29	CDMA BC10	RTAP 153.6Kbps	580	Axial (Z)	-1.52	-28.23	26.71	Т3	-50.25	2	PASS				
29	CDIVIA BC10	KTAP 155.6KDps	360	Transversal (Y)	-1.33	-28.95	27.62	Т3	-50.23	2	PASS				
30	LTE Band 25	20 QPSK 1 0	26340	Axial (Z)	0.93	-22.76	23.69	Т3	-50.36	2	PASS				
30	LTE Ballu 25	20_QP3K_1_0	20340	Transversal (Y)	-8.21	-32.28	24.07	T3	-50.21	2	FASS				
31	LTE Band 41	20 QPSK 1 0	40620	Axial (Z)	-2.99	-27.10	24.11	Т3	-50.31	2	PASS				
31	LTE Ballu 41	20_QP3K_1_0	40020	Transversal (Y)	1.61	-24.97	26.58	Т3	-50.21	2	PASS				
32	WLAN2.4GHz	000 11h 1Mhna	6	Axial (Z)	-0.85	-26.54	25.69	Т3	-50.33	0	DAGG				
32	WLAN2.4GHZ	802.11b 1Mbps	6	Transversal (Y)	-10.16	-38.07	27.91	Т3	-50.24	2	PASS				
22	VALLANISCHI-	902 110 6Mb==	157	Axial (Z)	0.33	-37.62	37.95	T4	-50.28	4.05	PASS				
33	33 WLAN5GHz	802.11a 6Mbps	157	Transversal (Y)	-7.82	-36.29	28.47	Т3	-50.20	1.65	PASS				

Report No.: HA850813-03B

Remark:

1. Phone Condition: Mute on; Backlight off; Max Volume

2. The detail frequency response results please refer to appendix A.

3. Test Engineer: Tom Jiang

TEL: 886-3-327-3456 Page: 23 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

12. <u>Uncertainty Assessment</u>

The evaluation of uncertainty by the statistical analysis of a series of observations is termed a Type A evaluation of uncertainty. The evaluation of uncertainty by means other than the statistical analysis of a series of observation is termed a Type B evaluation of uncertainty. Each component of uncertainty, however evaluated, is represented by an estimated standard deviation, termed standard uncertainty, which is determined by the positive square root of the estimated variance. The combined standard uncertainty of the measurement result represents the estimated standard deviation of the result. It is obtained by combining the individual standard uncertainties of both Type A and Type B evaluation using the usual "root-sum-squares" (RSS) methods of combining standard deviations by taking the positive square root of the estimated variances. Expanded uncertainty is a measure of uncertainty that defines an interval about the measurement result within which the measured value is confidently believed to lie. It is obtained by multiplying the combined standard uncertainty by a coverage factor. For purpose of this document, a coverage factor two is used, which corresponds to confidence interval of about 95 %. The DASY uncertainty Budget is showed in Table 8.2.

Report No.: HA850813-03B

Error Description	Uncertainty Value (±%)	Probability Distribution	Divisor	Ci (ABM1)	Ci (ABM2)	Standard Uncertainty (ABM1)	Standard Uncertainty (ABM2)
		Probe Sen	sitivity				
Reference Level	3.0	Normal	1	1	1	± 3.0 %	± 3.0 %
AMCC Geometry	0.4	Rectangular	√3	1	1	± 0.2 %	± 0.2 %
AMCC Current	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Probe Positioning During Calibrate	0.1	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
Noise Contribution	0.7	Rectangular	√3	0.0143	1	± 0.0 %	± 0.4 %
Frequency Slope	5.9	Rectangular	√3	0.1	1	± 0.3 %	± 3.5 %
		Probe Sy	stem				
Repeatability / Drift	1.0	Rectangular	√3	1	1	± 0.6 %	± 0.6 %
Linearity / Dynamic Range	0.6	Rectangular	√3	1	1	± 0.4 %	± 0.4 %
Acoustic Noise	1.0	Rectangular	√3	0.1	1	± 0.1 %	± 0.6 %
Probe Angle	2.3	Rectangular	√3	1	1	± 1.4 %	± 1.4 %
Spectral Processing	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
Integration Time	0.6	Normal	1	1	5	± 0.6 %	± 3.0 %
Field Disturbation	0.2	Rectangular	√3	1	1	± 0.1 %	± 0.1 %
		Test Siç	gnal				
Reference Signal Spectral Response	0.6	Rectangular	√3	0	1	± 0.0 %	± 0.4 %
		Position	ning				
Probe Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
Phantom Thickness	0.9	Rectangular	√3	1	1	± 0.5 %	± 0.5 %
EUT Positioning	1.9	Rectangular	√3	1	1	± 1.1 %	± 1.1 %
		External Con	tributions				
RF Interference	0.0	Rectangular	√3	1	0.3	± 0.0 %	± 0.0 %
Test Signal Variation	2.0	Rectangular	√3	1	1	± 1.2 %	± 1.2 %
	Combined Star	ndard Uncertainty				± 4.1 %	± 6.1 %
		K	= 2				
		± 8.1 %	± 12.3 %				

Table 8.2 Uncertainty Budget of audio band magnetic measurement

TEL: 886-3-327-3456 Page: 24 of 25 FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018

13. References

[1] ANSI C63.19-2011, "American National Standard for Methods of Measurement of Compatibility between Wireless Communications Devices and Hearing Aids", 27 May 2011.

Report No.: HA850813-03B

- [2] FCC KDB 285076 D01v05, "Equipment Authorization Guidance for Hearing Aid Compatibility", Sep 2017
- [3] FCC KDB 285076 D02v03, "Guidance for performing T-Coil tests for air interfaces supporting voice over IP (e.g., LTE and WiFi) to support CMRS based telephone services", Sep 2017
- [4] FCC KDB 285076 D03v01, "Hearing aid compatibility frequently asked questions", Sep 2017
- [5] SPEAG DASY System Handbook

TEL: 886-3-327-3456 Page: 25 of 25
FAX: 886-3-328-4978 Issued Date: Jul. 10, 2018