



AIRCRAFT MAINTENANCE MANUAL

EWIS COMPONENTS IN THE CENTER FUSELAGE I (LOWER SIDE) - INSPECTION/CHECK

EFFECTIVITY: ALL

1. General

- A. This section gives the procedures to do the detailed visual inspection of the EWIS components in the center fuselage I, lower side.
- B. Zones: 131/132.
- C. Zone Boundaries ([AMM MPP 06-41-00/100 AMM MPP 06-41-00/100](#)).
- D. The procedures in this section are given in the sequence below. The tasks identified with (♦) are part of the Scheduled Maintenance Requirements Document (SMRD).

TASK NUMBER	DESCRIPTION	EFFECTIVITY
05-40-14-200-801-A ♦	EWIS COMPONENTS IN THE CENTER FUSELAGE I (LOWER SIDE) - DETAILED VISUAL INSPECTION	ALL

TASK 05-40-14-200-801-A
EFFECTIVITY: ALL

2. EWIS COMPONENTS IN THE CENTER FUSELAGE I (LOWER SIDE) - DETAILED VISUAL INSPECTION

A. General

- (1) This procedure obeys the EWIS ICA requirement.
- (2) This task gives the instructions to do SMRD Task Number: 20-00-00-220-012-A00.
- (3) You must do the internal detailed visual inspection of center fuselage I, at zones 131/132, in the EWIS components of APU and engines generators power cables, hydraulic pumps power cables, and wiring bundles.
- (4) The function of the internal detailed visual inspection is to find damage, failure, or irregular conditions that can be easily seen.
- (5) Do not unlac or displace the electrical wiring and components, during the inspections.
- (6) Refer to the preparation subtask for access panel information.

B. References

<i>REFERENCE</i>	<i>DESIGNATION</i>
AMM MPP 06-41-02/100	-
AMM TASK 25-81-01-000-801-A/400	-
AMM TASK 25-81-01-000-802-A/400	-
AMM TASK 25-81-01-000-803-A/400	-
AMM TASK 25-81-01-400-801-A/400	-
AMM TASK 25-81-01-400-802-A/400	-
AMM TASK 25-81-01-400-803-A/400	-
AMM TASK 53-01-02-000-801-A/400	-
AMM TASK 53-01-02-000-802-A/400	-
AMM TASK 53-01-02-400-801-A/400	-
AMM TASK 53-01-02-400-802-A/400	-
WM 20-22-00	-

C. Zones and Accesses

<i>ZONE</i>	<i>PANEL/DOOR</i>	<i>LOCATION</i>
131		Passenger cabin - LH
132		Passenger cabin - RH

D. Tools and Equipment

<i>ITEM</i>	<i>DESCRIPTION</i>	<i>PURPOSE</i>	<i>QTY</i>
Standard	Flashlight	To make the inspection of the area easier	



AIRCRAFT
MAINTENANCE MANUAL

- E. Auxiliary Items
Not Applicable
- F. Consumable Materials
Not Applicable
- G. Expandable Parts
Not Applicable
- H. Persons Recommended

QTY	FUNCTION	PLACE
1	Does the task	Center fuselage I - lower side

I. Preparation

SUBTASK 841-002-A

- (1) Identify the passenger-cabin floor panels of center fuselage I, at sub-zone 230 (AMM MPP 06-41-02/100) that give access to zones 131/132.
- (2) Remove the passenger-cabin floor panels from center fuselage I at sub-zone 230 to access zones 131/132. Refer to AMM TASK 53-01-02-000-801-A/400 (applicable to EMB-140 and EMB-145 models) or AMM TASK 53-01-02-000-802-A/400 (applicable to EMB-135 model).
- (3) Remove, if necessary, the thermoacoustic insulation from center fuselage I, at zones 131/132 (AMM TASK 25-81-01-000-801-A/400, AMM TASK 25-81-01-000-802-A/400 or AMM TASK 25-81-01-000-803-A/400, as applicable).

J. EWIS Components in the Center Fuselage I (Lower Side) - Detailed Visual Inspection ([Figure 601](#))

SUBTASK 212-002-A

- (1) Do a detailed visual inspection on the APU and engines generators power cables, hydraulic pumps power cables, wiring bundles, and connected EWIS components at Center Fuselage I, lower side, for signs of damage, adequate installation, chafing and general condition. Refer to WM 20-22-00.

K. Follow-on



SUBTASK 842-002-A

- (1) If the thermoacoustic insulation was previously removed, install it at zones 131/132 (AMM TASK 25-81-01-400-801-A/400, AMM TASK 25-81-01-400-802-A/400 or AMM TASK 25-81-01-400-803-A/400) as applicable.
- (2) Install the passenger-cabin floor panels to center fuselage I, at sub-zone 230 related to zones 131/132. Refer to AMM TASK 53-01-02-400-801-A/400 (applicable to EMB-140 and EMB-145 models) or AMM TASK 53-01-02-400-802-A/400 (applicable to EMB-135 model).

EFFECTIVITY: ALL

EWIS Components in the Center Fuselage I (Lower Side) - Detailed Visual Inspection

Figure 601

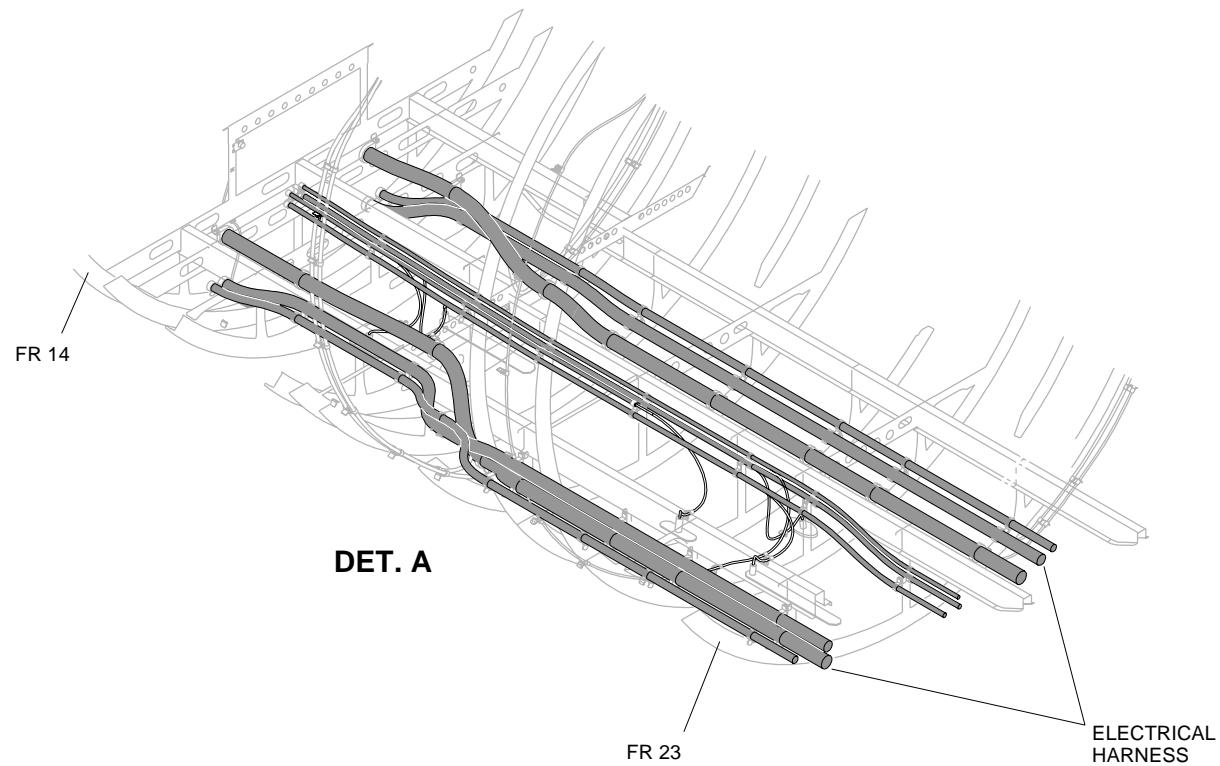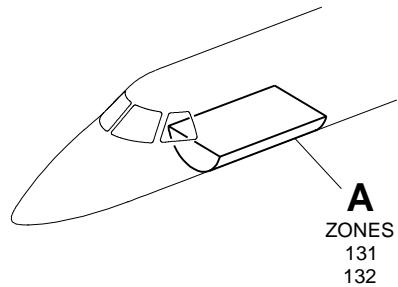

EM145AMM050770A.DGN