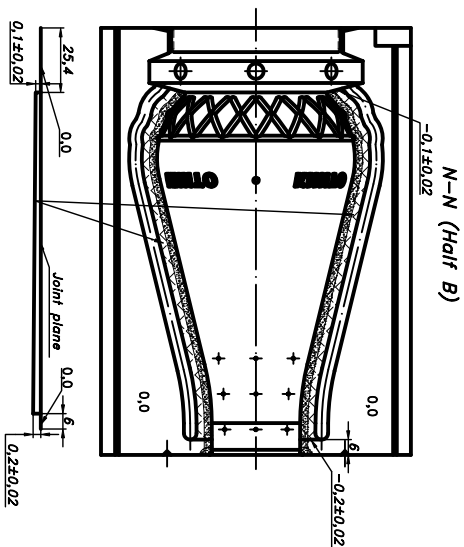
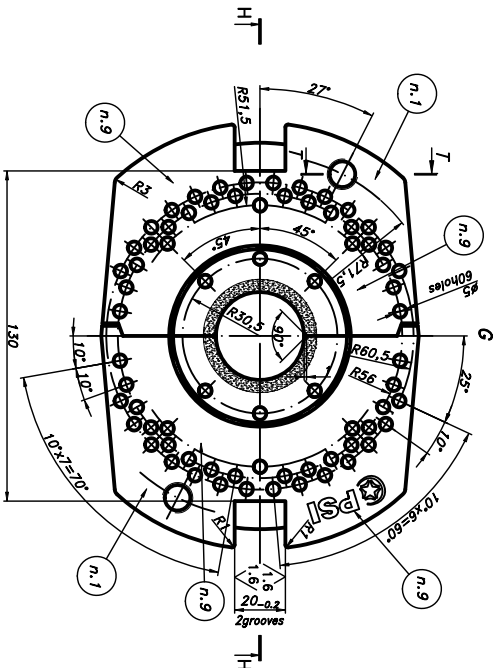
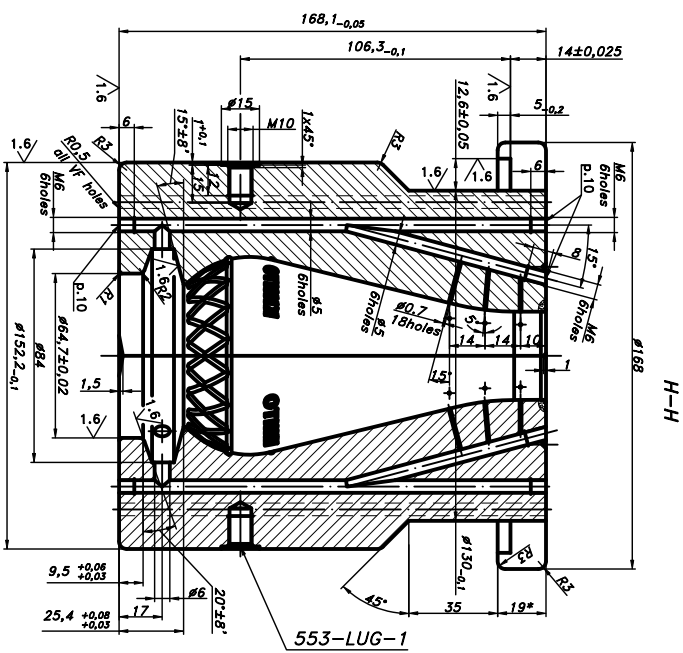
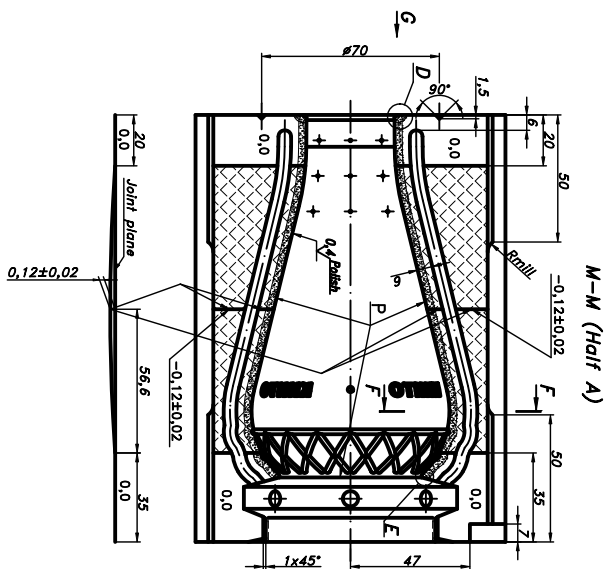
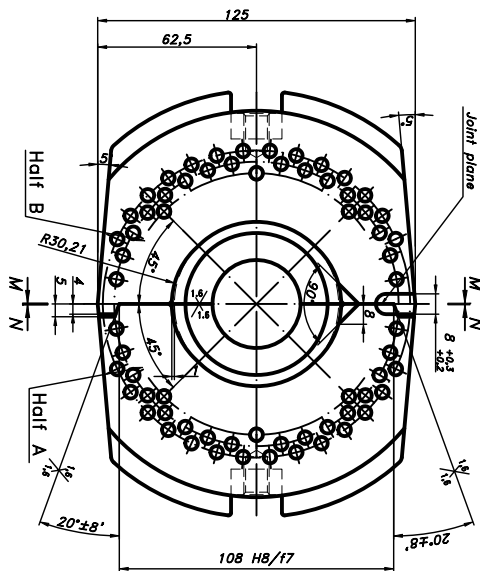


1. Both halves of mould (A & B) must be worked with same ordinal number and used together.
2. Gap in mould joint must be not more than 0,5mm.
3. Positional tolerance of forming cavity axis T 0,1mm, Base – joint plane
4. Allowed deviation of forming cavity dimensions is not more than ±0,55mm, except for dimensions that are specially shown.

8. Hardness of fer welding HRC35..40.
9. Mark: VT-280
Mark: 553
Mark ordinal number (n=8) & PSI logo.
Depth of marking-0,2...0,3 mm.
10. Cap holes with screws M5x8 and punch.

[illegible]