The Quality of an Electrical Contact is Determined By:

1. CONTACT SURFACE CONDITIONS

The surface has to be flat but not polished. Another important point: cleaning the surfaces before connection. They must be oxide and grease free.

2. CONTACT SURFACE(S) - OVERLAP

The overlap (H) should be not less than 5 times the thickness (e) of the thinnest of the conductors.

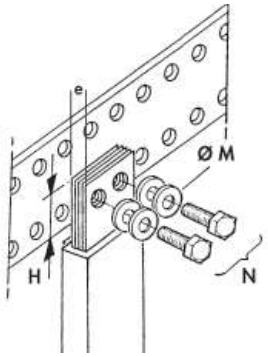

3. CLAMPING TORQUE CALCULATION

With a class coated bichromated bolt (SAE Grade 5), using "Belleville and Flat" washers tightened with a torque wrench, without lubrication.

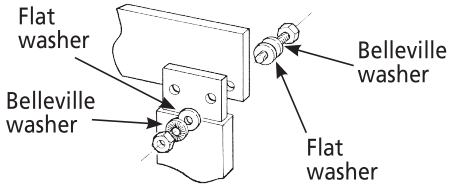

Bolt size	1/4"-20	5/16"-18	3/8"-16	7/16"-14	1/2"-13	9/16"-12	5/8"-11
Torque (foot-pounds)	9	18	31	50	75	110	150
Alt - Metric							
Bolt size	M6	M8		M10	M12	M14	M16
Torque (newton-meters)	13	30		60	110	174	274

- SAE Grade 5 hardware can be used except where otherwise designated by the designer of the pieces installed
- Belleville and Flat washers to provide resistance to vibration
- Slotted holes are acceptable in applications where additional forming is anticipated during installation

Two Ways to Connect in Parallel:

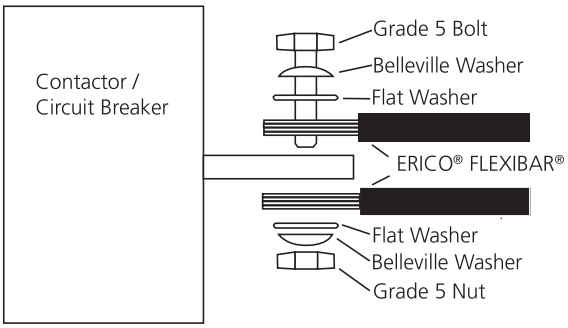

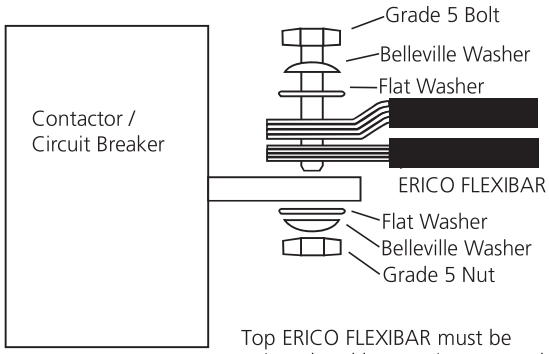

Top ERICO FLEXIBAR must be stripped and bent to insure good contact area

Install with Grade 5 or better hardware and torque