



Code: **G36**


Guide Bush, Bronze Coated & Short Type

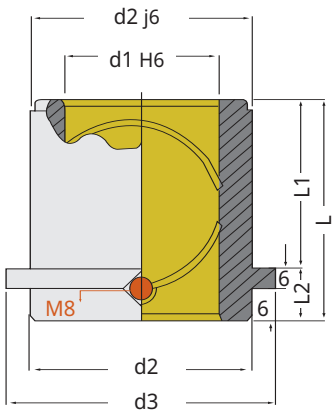

G100
Clamping Detail

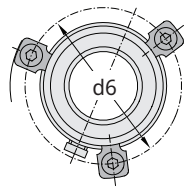

4 pcs. clamp for d1 = 38 mm and larger sizes.

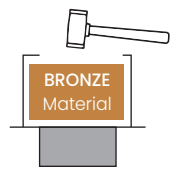

Positioning :
Pls. do not make direct fitting. Precision assembly recommended with bronze / brass.

d1	L	d2	d3	L1	L2
19 20	35	32	40	23	12
24 25	35	40	48	23	12
32 30	42	48	56	30	12
38 40	52	58	66	37	15
48 50	65	70	80	47	18
60 63	80	85	95	60	20
80	80	105	118	60	20

Mounting Details:

Code: G36		Code: G35	
d1	d6	d1	d6
20	48.8	20	48.8
25	56.8	25	56.8
30	64.8	30	64.8
40	74.8	40	74.8
50	86.8	50	86.8
63	101.8	63	101.8
80	121.8	80	121.8

Order: **G36.** d1 x L x L1


Material: 1.1213 (Cf53)
Bronze: SnBz 10 **HB** 160 - 180

It has helical lubrication and inner lubrication system, its position can be lubricated with grease nipple from outside. Finally, equal distance to all lubrication points is ensured. Due to oil intake feature of bronze coated to inside it, there is no need for frequent lubrication, recommended operating speed is 15-30 mt / min. If some conditions such as lubrication clearance, stroke length, radial load and heat distribution are provided, to reach speed as 600 - 800 stroke per minute is possible.




Code: **G35**

Guide Bush, Bronze Coated & Long Type

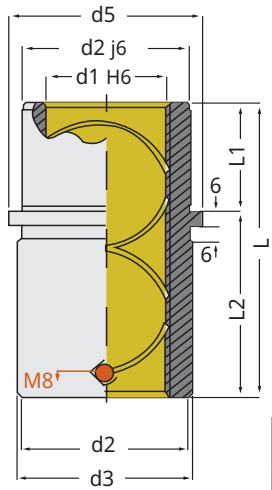


G100
Clamping Detail

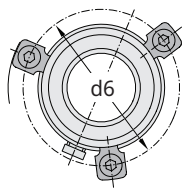

4 pcs. clamp for d1 = 38 mm and larger sizes.

Mounting Example

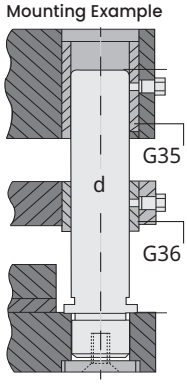

IMPORTANT!
Pls. lubricate from grease nipple on bush occasionally.

d1	L	d2	d3	d5	L1	L2
19 20	43 59	32	39	40	23	20 36
24 25	59 79	40	46	48	23	36 56
32 30	75 93	48	53	56	30	45 63
38 40	82 108	58	63	66	37	45 71
48 50	97 127	70	77	80	47	50 80
60 63	116 150	85	92	95	60	56 90
80	120 150	105	115	118	60	60 90


Order: **G35.** d1 x L x L1

Material: 1.1213 (Cf53)
Bronze: SnBz 10 **HB** 160 - 180

To prevent reverse closing of the die, 3pcs main dimensions (d1) can be used together with 1pcs intermediate dimension (d1: 19 - 24 - 32 - 38 - 48 - 60 mm).


Hardened steel bushing absorbs strong side thrust. Thus, vibrationless rigid operation is ensured and bronze bush is protected against strong thrust made from end head, inner layer coated bronze with centrifugal technique is resistant against abrasion factor with its high quality. In addition with its excellent heat dissipation feature is ensured rapid distribution of excessive friction temperature.



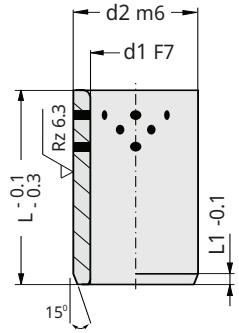



Working Direction

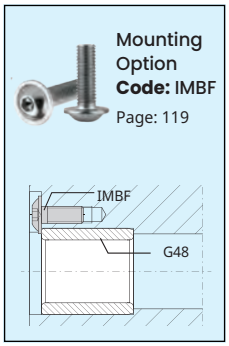

Guide Bush - Plain / Self-Lubricating

Code: **G48**

* Hole tolerance for shrink fit: H7

They are self-lubricating bushes, especially suitable for use in straight pillars of die systems and machines such as hydraulic presses and injection moulding machines. They are compatible with areas where magnetic effects are undesirable and have a wide range of applications in industrial use.

Large Stock Availability


d1	d2	L	L1
8	12	8	2
		10	
		15	
10	14	10	2
		12	
		15	
		20	
12	18	10	2
		12	
		15	
		20	
		25	
		30	
15	22	12	2
		16	
		20	
		25	
		30	
		35	
		40	
16	22	12	2
		16	
		20	
		25	
		30	
		35	
		40	
18	24 28 30	20	4
		25	
		30	
		35	
		40	
		50	
20	24 28 30	20	4
		25	
		30	
		35	
		40	
		50	
24	33 35	20	4
		25	
		30	
		35	
		40	
		50	

d1	d2	L	L1
25	33 35	20	4
		25	
		30	
		35	
		40	
		50	
30	38 40 45	20	4
		25	
		30	
		35	
		40	
		50	
		60	
35	40 45	20	4
		25	
		30	
		35	
		40	
		50	
		60	
38	50 55	25	4
		30	
		35	
		40	
		50	
		60	
		80	
40	50 55	25	4
		30	
		35	
		40	
		50	
		60	
		80	
42	55 60	30	4
		35	
		40	
		50	
		60	
45	55 60	30	4
		35	
		40	
		50	
		60	

d1	d2	L	L1
48	60 62 65	30	4
		40	
		50	
		60	
		70	
		80	
		100	
50	60 62 65	30	4
		40	
		50	
		60	
		70	
		80	
		100	
60	74 75	40	4
		50	
		60	
		80	
		100	
80	96 100	40	4
		60	
		80	
		100	
		120	
		140	
100	120	50	4
		60	
		80	
		100	
		120	
		140	
		160	
120	140	50	4
		60	
		80	
		100	
		120	
		140	
		160	

d1	d2	L	L1
150	170	50	4
		60	
		80	
		100	
		120	
		140	
		160	
160	180	50	4
		60	
		80	
		100	
		120	
		140	
		160	

Mounting Example

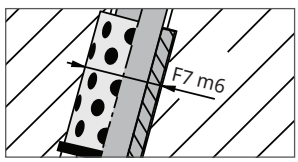

Order:
G48. d1 x d2 x L

Material:
Bronze + graphite inserts

Customised Guide Units

Upon request, TECINMAK manufactures highly complex and precise guide elements based on customer specifications and provides measurement protocols if needed. This includes both the reworking of catalogue products and the production of entirely new items.






Working Direction


Code: **G45**

Guide Bush with Centre Collar, Self-Lubricating

DIN 9834 / ISO 9448


Heat Resistance: < 150°C

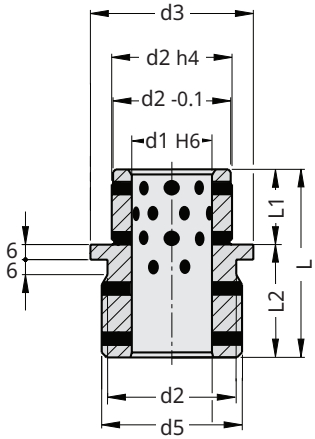

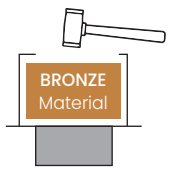


Positioning :
Pls. do not make direct fitting. Precision assembly recommended with bronze / brass.

d1	L	d2	d3	d5	d6	L1	L2
19	32	32	40	-	57.4	20	12
20	50			34			30
	70						50
24	35	40	48	-	65.4	23	12
25	60			42			37
	80						57
32	42	48	56	-	73.4	30	12
30	75			50			45
	95						65
38	50	58	66	-	83.4	35	15
40	80			60			45
	110						75
48	65	70	80	-	97.4	45	20
50	90			74			45
	120						75

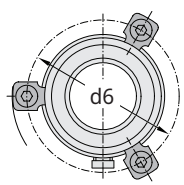



G101A Clamping Detail

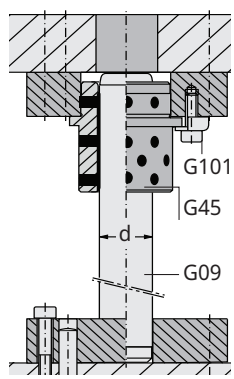

Order: **G45.** d1 x L


Material:
Bronze + Graphite inserts

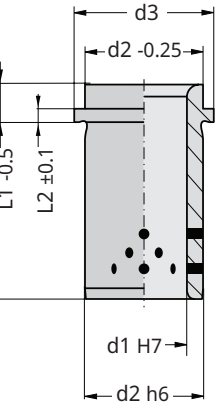

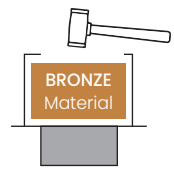


Positioning :
Pls. do not make direct fitting. Precision assembly recommended with bronze / brass.

d1	L	d2	d3	L1	L2	d6
20	32	28	34	12	6.3	53.4 (G102 Form A)
25	40	32	40	10		57.4 (G102 Form A)
30	50	40	50	12		65.4 (G102 Form A)
32	50	40	50	12		65.4
40	63	50	63	15		G102B or G120C
50	71	63	71	17		
63	80	80	90	19	10	122.4 (G102 Form D)
80	100	100	112	22		142.4 (G102 Form D)
100	125	125	140	21		167.4 (G102 Form D)
125	160	160	180	30		202.4 (G102 Form D)
160	200	200	220	32		242.4 (G102 Form D)

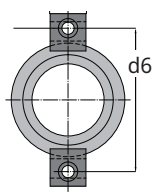



G102 Clamping Detail

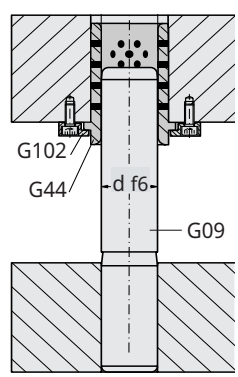

Order: **G44.** d1 x L

Material:
Bronze + Graphite inserts






Working Direction

Guide Bush, Headed - NAAMS

Code: **G41**

Self-Lubricating

Heat Resistance: < 150°C

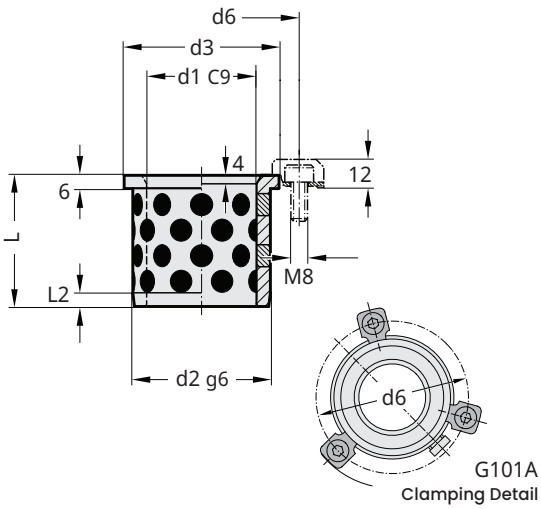

G101A
Clamping Detail


d1	L	d2	d3	L2	d6
25	40	32	40	4	57.4
32	50	40	50	4	67.4
40	55	50	63	5	80.4
50	63	63	71	6	88.4
63	75	80	90	8	107.4
80	90	100	112	10	129.4
100	115	125	140	12	157.4
125	138	160	180	12	197.4



Positioning :
Pls. do not make direct fitting.
Precision assembly recommended with bronze / brass.

Order: **G41.** d1 x L

Material:
Bronze + Graphite inserts

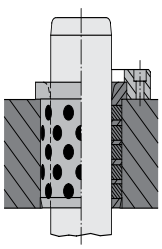






Working Direction

Guide Bush with Collar - NAAMS

Code: **G40**

Self-Lubricating

Heat Resistance: < 150°C

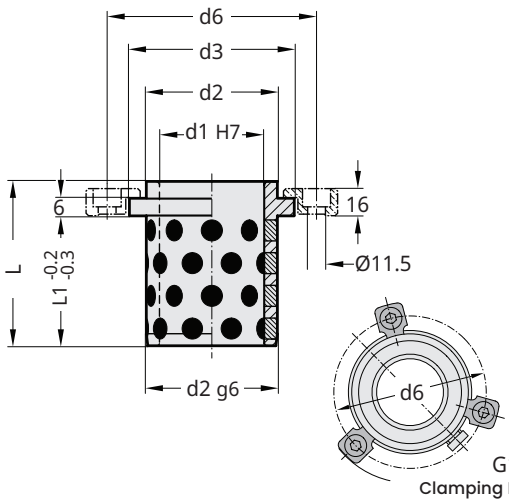

G101A
Clamping Detail


d1	L	d2	d3	d6	L1
20	40	28	34	51.4	30
25	40	32	40	57.4	30
30	50	40	50	67.4	40
32	50	40	50	67.4	40
40	63	50	63	80.4	50
50	71	63	71	88.4	56
63	80	80	90	107.4	63
80	100	100	112	129.4	80
100	125	125	140	157.4	106
125	160	160	180	197.4	132




Positioning :
Pls. do not make direct fitting.
Precision assembly recommended with bronze / brass.

Order: **G40.** d1 x L

Material:
Bronze + Graphite inserts

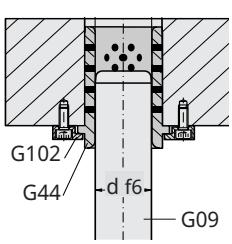



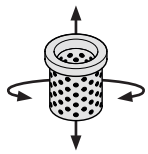


Working Direction


Guide Bush Headed

Code: **G42**

Self-Lubricating

Heat Resistance: < 150°C

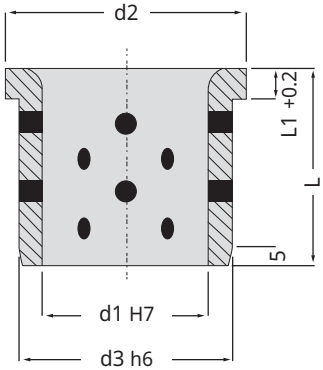

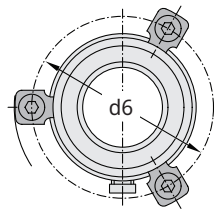

G102E
Clamping Detail

d1	L	d3	d2	L1	d6
20	35	28	36	8	49.4
25	40	32	40		53.4
30	55	40	50		63.4
32	55	40	50		63.4
40	70	50	60		73.4
42	70	50	60		73.4
50	75	63	75	12	95.4
52	75	63	75		95.4
63	80	80	90		110.4
80	100	100	110		130.4
100	125	125	135		155.4

G102 E - 40

G102 E - 63

Order: **G42.** d1 x L

Material: Bronze + Graphite inserts




Thrust Washer - Perforated


Code: **G107**

Self-Lubricating

Heat Resistance: < 150°C

* Spare part for in-die applications
* Spare part in core systems etc. in injection moulds

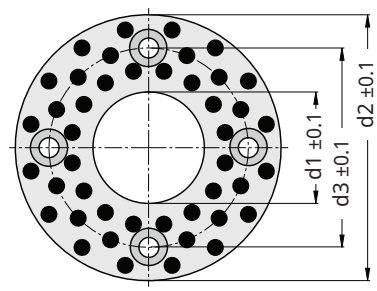

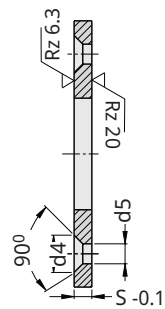

d1	d2	d3	S	d4	d5	Hole
12.2	40	28	3	6.9	3	2
16.2	50	28	3	6.9	3	2
20.2	50	35	5	11.5	5.5	2
25.2	55	40	5	11.5	5.5	2
30.2	60	45	5	11.5	5.5	2
35.2	70	50	5	11.5	5.5	2
40.2	80	60	7	13.8	6.6	2
45.3	90	67.5	7	13.8	6.6	2
50.3	100	75	8	13.8	6.6	4
60.3	120	90	8	18.3	9	4
70.3	130	100	10	18.3	9	4
80.3	150	120	10	18.3	9	4

Order: **G107.** d1 x d2


Material: Bronze + Graphite inserts

NEW



Bronze Bush - Plain


Code: **G48 - 1**

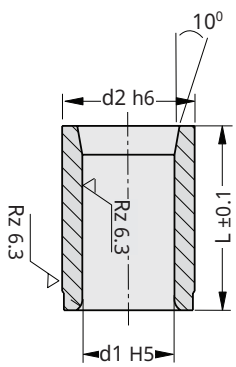

d1	L	d2
10	14	14
	20	
12	20	17
	25	
16	25	22
	32	

Order: **G48 - 1.** d1 x L

Mounting Example

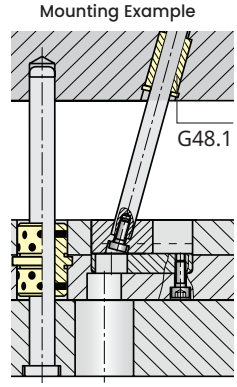






Working Direction

Guide Bush, Bronze

Code: **G86**

Heat Resistance: < 150°C

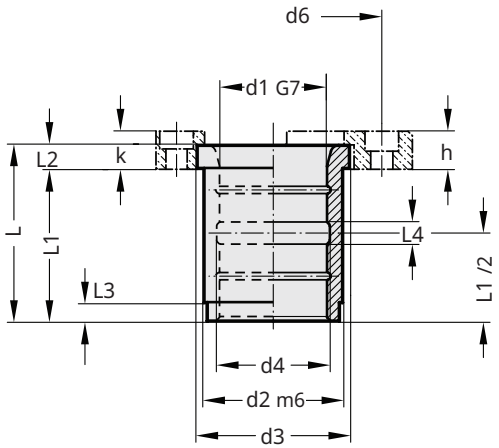

d1	L	d2	d3	d4	d6	L1	L2	L3	L4	h	k
20	32	28	32	22	-	28	4	3	5	10	-
25	40	35	40	27	-	35	5	5	5	10	-
32	50	44	50	34	-	44	6	8	5	12	-
40	63	52	60	42	73.4	55	8	8	8	12	12
50	80	63	71	52	87.4	70	10	8	10	16	16
63	100	80	90	65	110.4	88	12	10	12	20	20
80	125	100	112	82	132.4	109	16	10	16	25	25
100	160	125	140	102	160.4	140	20	10	20	32	32



Positioning :
Pls. do not make direct fitting.
Precision assembly recommended with bronze / brass.

Order: **G86.** d1 x L

3D CAD FILES GUVENAL






Working Direction

Guide Bush, Headed - CNOMO

Code: **G43**

Self-Lubricating

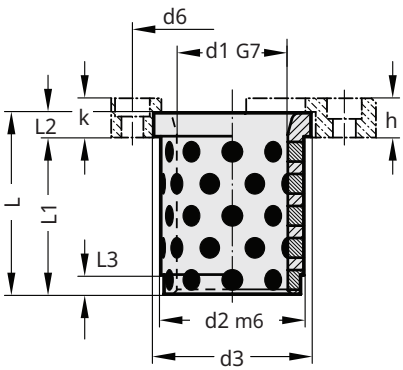

d1	L	d2	d3	d6	L1	L2	L3	h	k
20	32	28	32	-	28	4	3	10	-
25	40	35	40	-	35	5	5	10	-
32	50	44	50	-	44	6	5	12	-
40	63	52	60	73.4	55	8	8	12	12
50	80	63	71	87.4	70	10	8	16	16
63	100	80	90	110.4	88	12	10	20	20
80	125	100	112	132.4	109	16	10	25	25
100	160	125	140	160.4	140	20	10	32	32



Positioning :
Pls. do not make direct fitting.
Precision assembly recommended with bronze / brass.

Order: **G43.** d1 x L

3D CAD FILES GUVENAL