



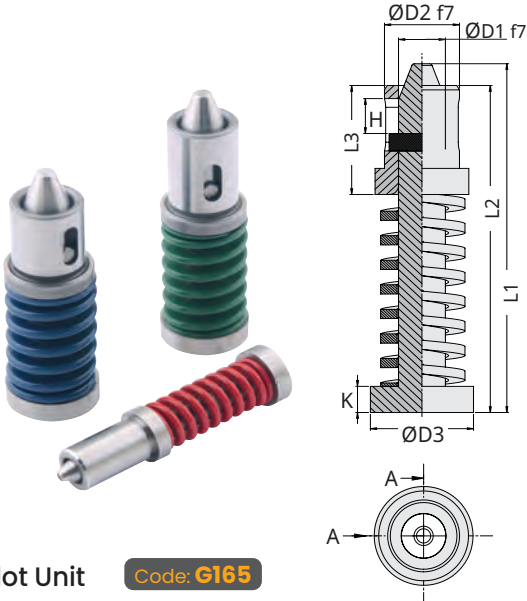

Pilot Unit

Code: **G165**

"G165" is used for centering of the moving sheet metal in progressive dies in each step. It is a compact and useful product.

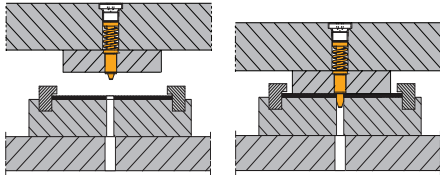


1N = 0.1 daN = 0.102 kgf

Order Code	F0 (N) preloaded	F1 (N) pressed	D1	L1	D2	D3	L2	L3	K	H
G165.05401	11	30	5	40	8	11	36	12	3	4.5
G165.05402	25	70								
G165.05403	30	84								
G165.05404	40	112								
G165.05405	55	155								
G165.05441	11	30	5	44	8	11	40	16	3	4.5
G165.05442	25	70								
G165.05443	30	84								
G165.05444	40	112								
G165.05445	55	155								
G165.08481	44	122	8	48	12	16	41	16	4	4.5
G165.08482	58	164								
G165.08483	79	220								
G165.08484	123	346								
G165.08485	165	460								
G165.08486	189	530	8	52	12	16	45	20	4	4.5
G165.08521	44	122								
G165.08522	58	164								
G165.08523	79	220								
G165.08524	123	346								
G165.08525	165	460	9.8	63.2	15	18	53	28	4	3.5
G165.08526	189	530								
G165.10631	140	391								
G165.10632	245	680								
G165.10633	540	1512								



Mounting Example

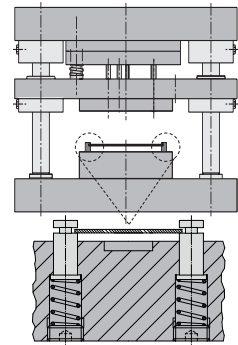


Sheet Lifting Pin

Code: **G23**

It is used to align and lifting sheet in progressive / multi-stage forming dies. G145 - Compression spring set screw and round steel spring can be used for mounting.

d1	L1	d2	d3	M	D
8	20	5	10	M12 x1.5	10.5
	25				
	32				
	40				
10	25	6	12	M14 x1.5	12.5
	32				
	40				
	50				
13	25	7	16	M18 x1.5	16.5
	32				
	40				
	50				
16	32	8	20	M22 x1.5	20.5
	40				
	50				

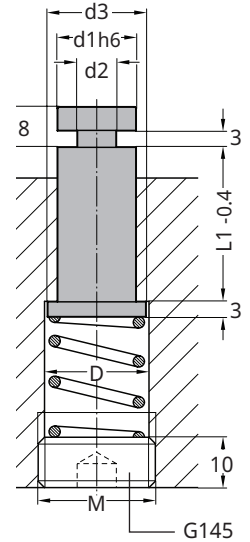

Order:
G23. d1 x L1



Material: 1.7131 (16MnCr5)
Hardness: 58 - 60 HRC




Round Steel Spring

Code: **G23S**

L: Spring length / die plate selection as per dimension.

d1	d2	d3	L
10.5	8.5	1.5	40
12.5	10.5	1.5	55
16.5	13	2	40
21	17	2.5	40

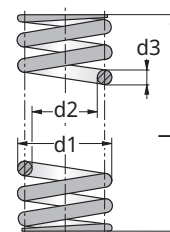

Order:
G23S. d1 x L



Compression Spring Set Screw

Code: **G145**

Page: 298

