

JOB COMPLETION & SIGN-OFF

Job Card No: 2026-0087 | Associated WO: WO-2026-0087 | Date: 01-OCT-2026 | Status: COMPLETED

PART A — JOB & EQUIPMENT PARTICULARS

CLIENT AINUSHAMSI ENERGY LTD	SITE INDUSTRIAL AREA DEPOT	SITE CONTACT ENG. HASSAN OMAR
EQUIPMENT ID GEN-CUM-03	EQUIPMENT TYPE DIESEL GENERATOR	DESCRIPTION CUMMINS C550D5
MANUFACTURER CUMMINS	SERIAL NO. H22045678	PRODUCT HANDLED DIESEL (AGO)
LOCATION ON SITE BACKUP POWER HOUSE	WORK TYPE CORRECTIVE MAINTENANCE	LEAD TECHNICIAN BRIAN OGUTA
WORK START DATE 01-OCT-2026	ARRIVAL 7:45 AM	START 8:10 AM
WORK END DATE 01-OCT-2026	COMPLETE / DEPARTURE 4:20 PM 4:45 PM	ASSISTING TECHNICIAN SAMUEL KIPTUM

PART B — JOB HAZARD ANALYSIS & MITIGATION

#	HAZARD	RISK	CONTROL MEASURES	VERIFIED
1	Unexpected start-up / residual energy	High	LOTO on start circuit; battery disconnect; verify zero energy	YES
2	Fuel splash / diesel fire risk	High	No hot work; extinguisher staged; spill kit ready	YES
3	Rotating machinery (fan/alternator)	High	Guards in place; lockout before panel open	YES
4	High voltage (415 V)	High	Qualified persons only; insulated tools; PPE arc-rated	YES
5	Exhaust / CO exposure	Medium	Work with doors open; gas monitor active	YES
6	Heavy lifting (radiator / alternator)	Medium	Team lift; certified hoist if required	YES
7	Noise / hearing damage	Low	Hearing protection in power house	YES

PPE CONFIRMED HELMET, GOGGLES, FR COVERALL,	WAS TOOLBOX TALK CONDUCTED? YES	TOOLBOX START / END 8:00 AM – 8:10 AM
--	------------------------------------	--

JOB SAFETY AND HEALTH ACKNOWLEDGEMENT

By signing below, I certify that I have conducted a pre-job safety assessment and am wearing all required Personal Protective Equipment (PPE) for this task. I acknowledge that I have reviewed the safety hazards associated with this work order, understand the safe operating procedures, and agree to perform the work in compliance with company health and safety standards.

TECHNICIAN'S NAME:

BRIAN OGUTA

SUPERVISOR'S NAME:

JAMES MWANGI

(pad)

(file)

REPORTED PROBLEM

CUMMINS C550D5 STANDBY GENERATOR FAILED TO START ON UTILITY OUTAGE (30-SEP-2026, 22:15). SITE REPORTED REPEATED CRANK WITHOUT FIRE. OIL PRESSURE WARNING LAMP ILLUMINATED. UNIT LAST SERVICED 4 MONTHS AGO. REQUEST FULL DIAGNOSIS, CORRECTIVE REPAIR AND RETURN TO STANDBY READINESS.

PART C — SCOPE OF WORK & DELIVERABLES**SCOPE SUMMARY**

Diagnose no-start condition on Cummins C550D5; restore reliable auto-start; service fuel and cooling systems; document findings for client.

SCOPE STEPS

1. Isolate genset and apply LOTO.
2. Check battery, starter, fuel supply and sensors.
3. Replace defective components as required.
4. Functional test under load.
5. Update service log and photos.

DELIVERABLES

Completed job card; QC results; parts list with warranty; photographic evidence; recommendations for next service interval.

PART D — SUMMARY OF WORK DONE AND FINDINGS**ARRIVAL & PREPARATION**

Site briefing with Eng. Hassan Omar. LOTO applied on ATS and battery isolator. Power house ventilated. Toolbox talk completed 08:00–08:10.

AS-FOUND & DIAGNOSIS

Battery bank at 22.4 V (low). Starter solenoid intermittent. Primary fuel filter clogged; water found in filter bowl. Oil pressure sender reading erratic. Coolant level 15% low. Control panel fault history: low oil pressure ×3, under-voltage ×1.

ROOT CAUSE

Combined low battery state of charge, restricted fuel supply from fouled filter, and faulty oil pressure sender causing protective shutdown during crank attempts.

CORRECTIVE ACTION

Charged and load-tested batteries; replaced starter solenoid; replaced primary and secondary fuel filters; drained water separator; replaced oil pressure sender; topped coolant; cleaned air filter; exercised ATS in test mode.

POST-REPAIR VERIFICATION

Manual start successful (8 s to rated speed). Auto-start on simulated utility fail: OK. 30-minute load bank run at 60% — stable oil pressure, coolant temp 82°C, no alarms. Unit returned to AUTO.

PART E — QUALITY CONTROL TESTS AND RESULTS

QC INSPECTION / TESTING	ACCEPTANCE CRITERIA	OBSERVATION / RESULT	REMARKS
Battery voltage (static)	"e 24.0 V	CONFORMING (C)	25.2 V after charge
Starter crank current	Within OEM band	CONFORMING (C)	Normal draw
Fuel supply pressure	"e 0.3 bar at pump	CONFORMING (C)	0.45 bar
Oil pressure @ rated speed	"e 2.5 bar	CONFORMING (C)	3.1 bar
Coolant temperature stable	75–95 °C under load	CONFORMING (C)	82 °C @ 60% load
Auto-start on utility fail	Start < 15 s	CONFORMING (C)	11 s to rated
ATS transfer & retransfer	Clean transfer, no hunt	CONFORMING (C)	Pass ×2 cycles

PART F — LIST OF SPARE PARTS USED

NAME & PART NUMBER	QTY	STATUS	VENDOR	INSTALLATION DATE	WARRANTY START DATE	WARRANTY END DATE
Fuel filter primary FS1000	1	NEW	Cummins Genuine	01-OCT-2026	01-OCT-2026	01-OCT-2027
Fuel filter secondary FF5470	1	NEW	Cummins Genuine	01-OCT-2026	01-OCT-2026	01-OCT-2027
Oil pressure sender 3967251	1	NEW	Cummins Genuine	01-OCT-2026	01-OCT-2026	01-OCT-2027
Starter solenoid 5363120	1	NEW	Cummins Genuine	01-OCT-2026	01-OCT-2026	01-OCT-2027
Coolant concentrate (4 L)	1	NEW	Fleetguard	01-OCT-2026	01-OCT-2026	01-APR-2027
Air filter element AF26137	1	RECONDITIONED	Local stock	01-OCT-2026	01-OCT-2026	01-APR-2027
Battery terminal kit	1	NEW	Local stock	01-OCT-2026	01-OCT-2026	01-OCT-2027

PART G — TECHNICIAN'S RECOMMENDATIONS

RECOMMENDATIONS

1. Schedule full 500-hour service within 60 days.
2. Install battery charger monitor / low-voltage alarm on BMS.
3. Monthly no-load exercise run minimum 30 minutes.
4. Keep dual fuel-filter stock on site for emergency change-out.
5. Train site staff on water-separator daily drain check.

PART H — EQUIPMENT FINAL STATUS

EQUIPMENT FINAL STATUS

RETURNED TO SERVICE — FULLY OPERATIONAL

Unit returned to AUTO standby. All QC checks conforming. Next service due at 500 operating hours or by 01-DEC-2026, whichever first.

TECHNICIAN DECLARATION

I confirm the work described was performed in accordance with FSW procedures and the recorded QC results. Both pad and file signature methods were available for sign-off.

PART I — SIGNATURES & CLIENT ACCEPTANCE

LEAD TECHNICIAN

BRIAN OGUTA

Date: 01-OCT-2026 (pad + file)

CLIENT / SITE REPRESENTATIVE

ENG. HASSAN OMAR · Site Engineer


Date: 01-OCT-2026 (pad + file)




FORECOURT WORKS LIMITED — COMMITMENT TO EXCELLENCE


This Job Completion form is part of our formal documentation regime.

Photo 1 — Power house exterior

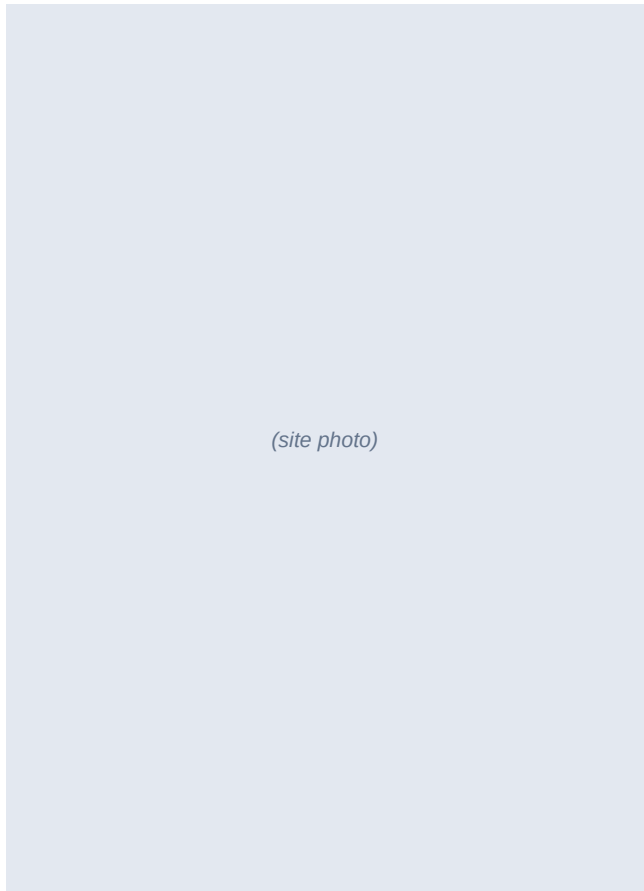


(site photo)

Photo 2 — Genset nameplate C550D5

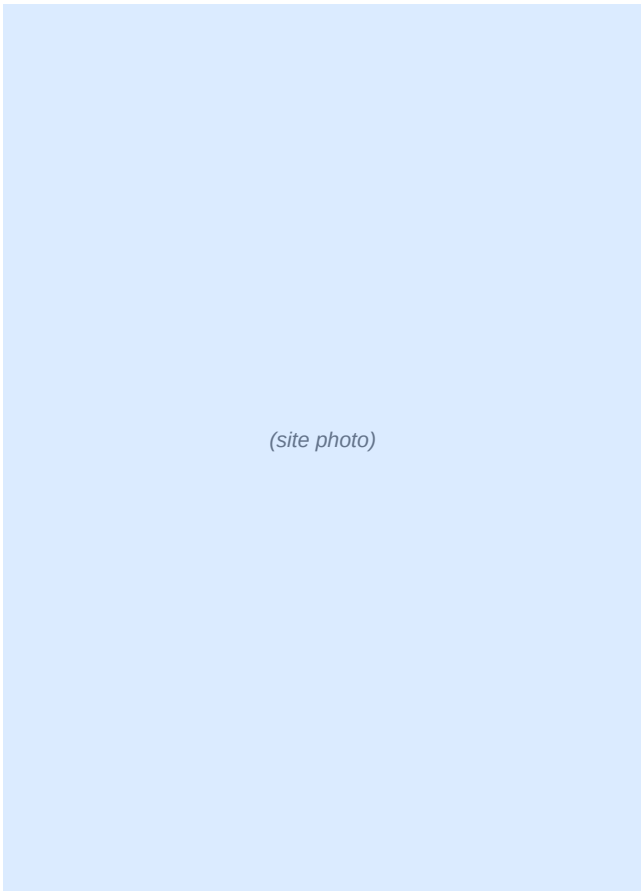


(site photo)

Photo 3 — As-found battery bank

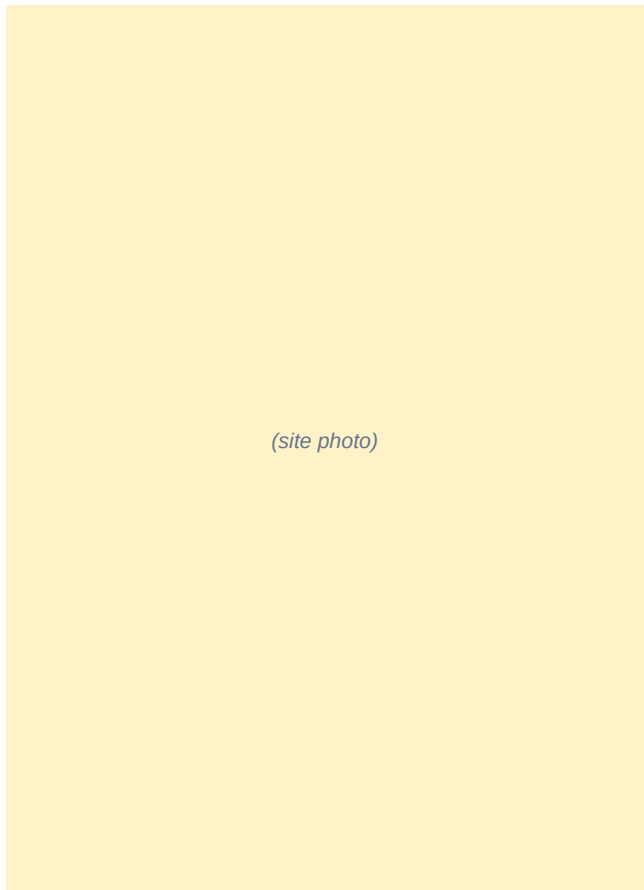


(site photo)

Photo 4 — Clogged primary filter

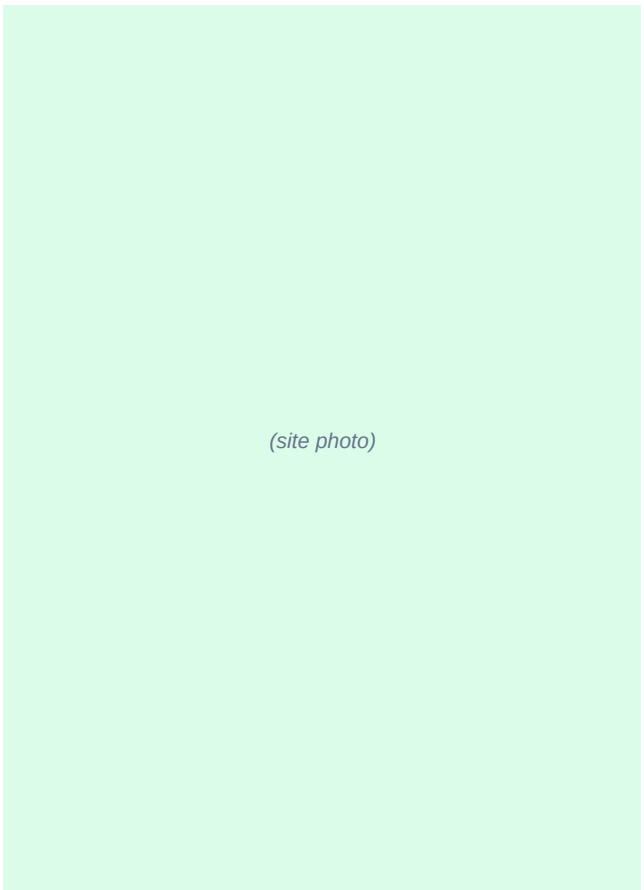


(site photo)

Photo 5 — Water in separator bowl

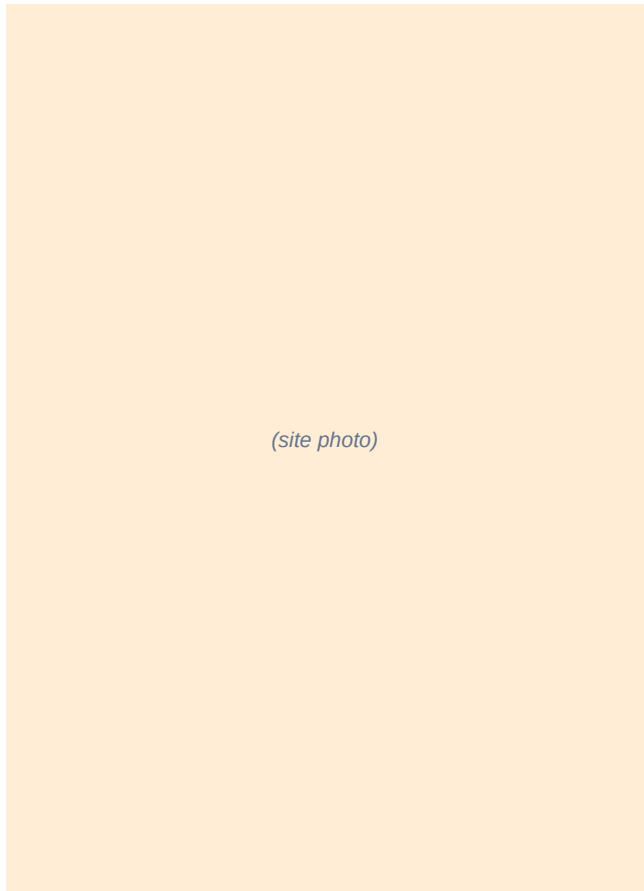


(site photo)

Photo 6 — New filters installed

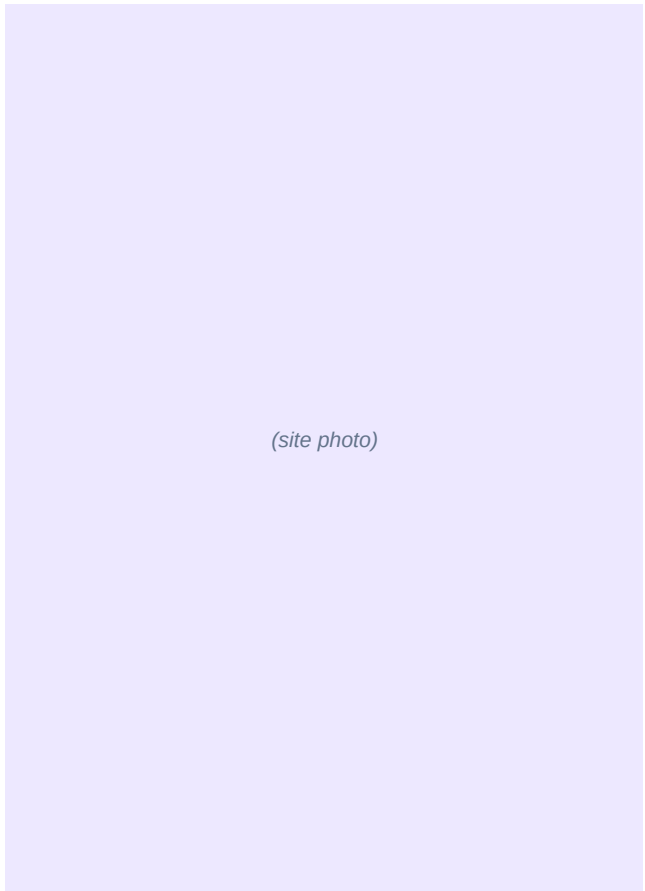


(site photo)

Photo 7 — Oil pressure sender replaced

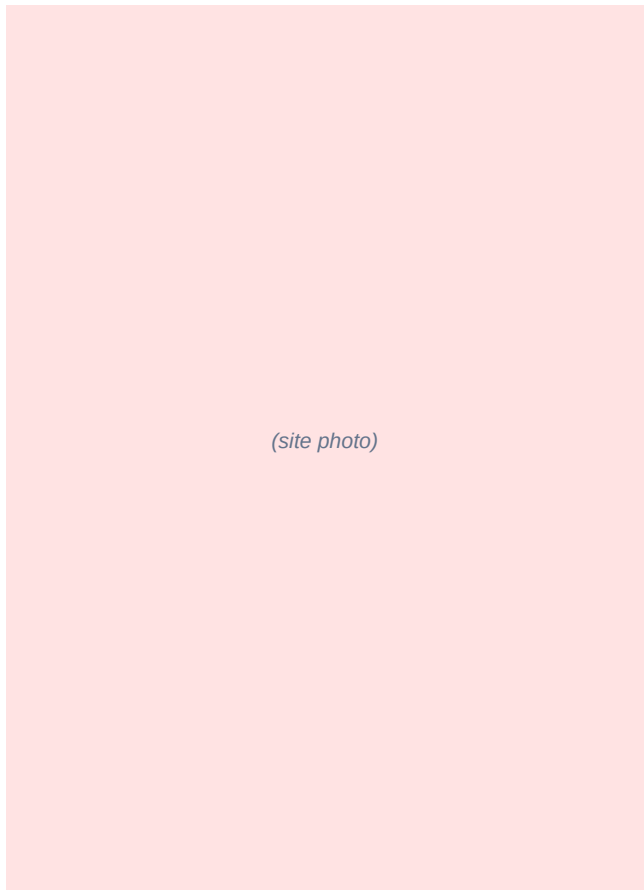

(site photo)

Photo 8 — Load bank test 60%

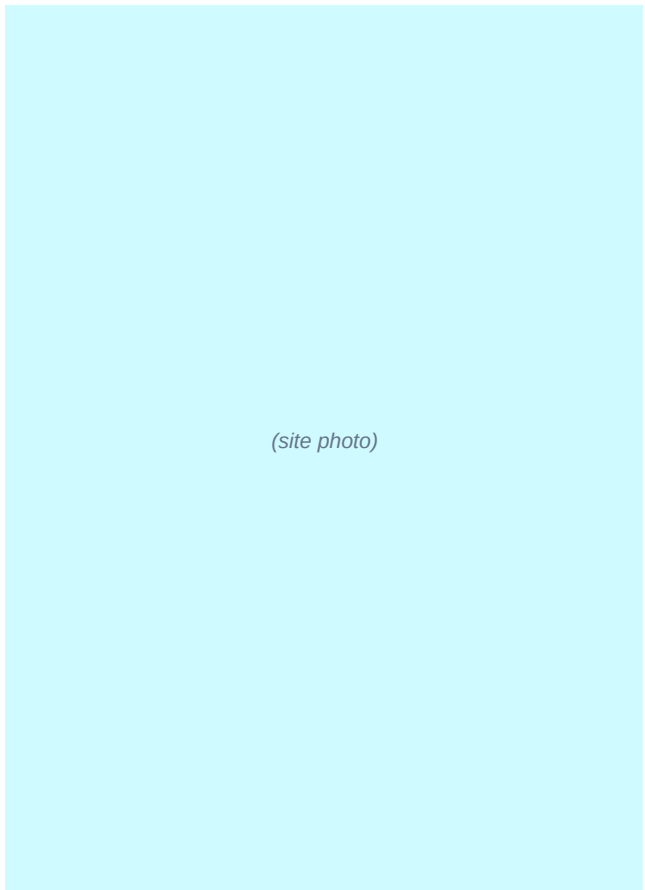

(site photo)

Photo 9 — Control panel AUTO mode

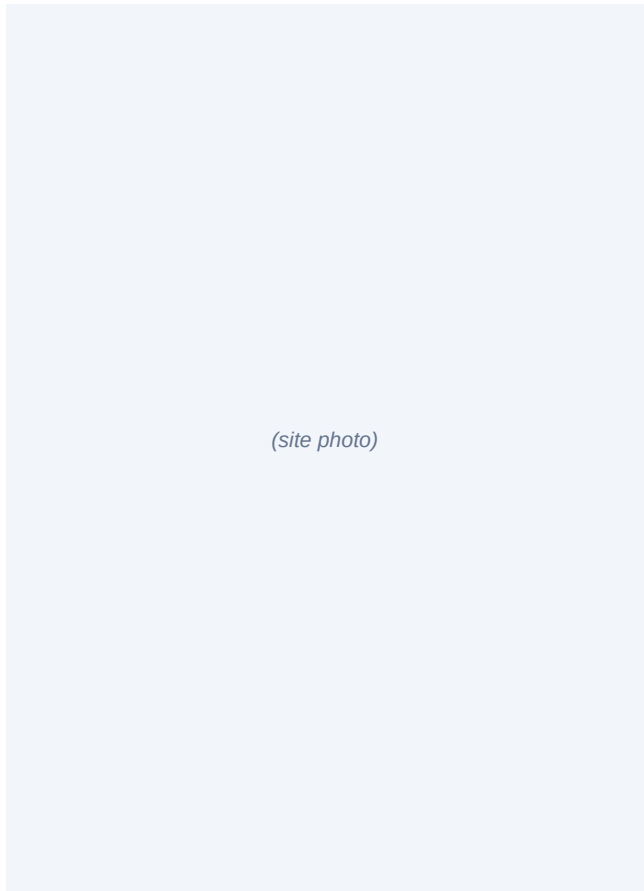


Photo 10

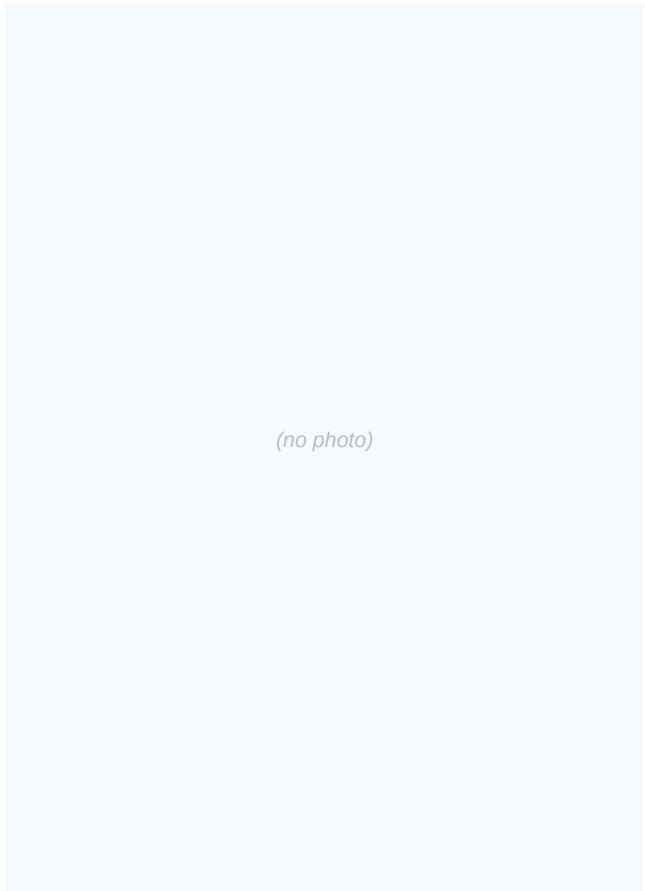


Photo 11

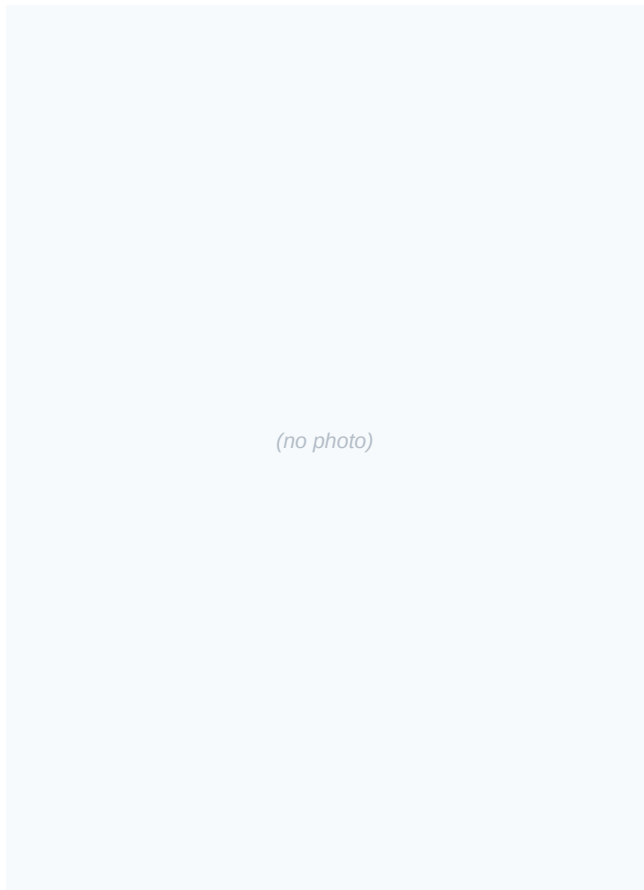


Photo 12

