


- **Get File Path:** places the path and the name of the selected file in parenthesis on the input bar.
- **Special Symbols:** accesses text symbols that are not available on the keyboard. Enter the number of the character you want to use to put it in the input bar. The special characters are: _ ^ ~ { } \ | < >

4.4 Full Machine Backup

The backup function makes a copy of your machine's settings, programs, and other data so that you can easily restore them.

You create and load backup files with the **System** [F4] drop-down menu.

F4.8: [F4] Menu Selections

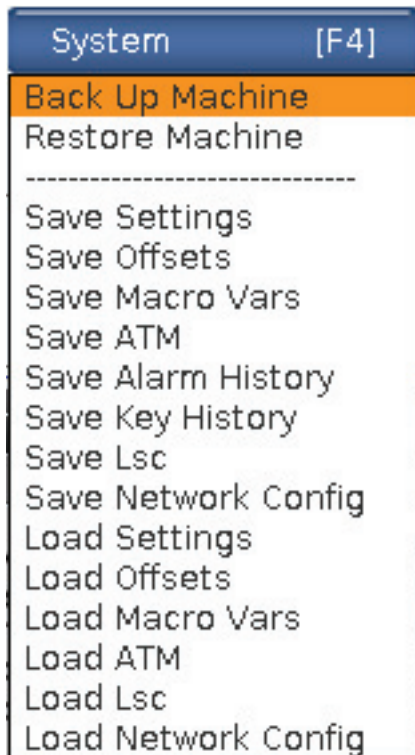

To create a full machine backup:

1. Press **[LIST PROGRAM]**.
2. Navigate to the **USB** or **Network Device**.
3. Press **[F4]**.
4. Select **Backup Machine** and press **[ENTER]**.

Backup Machine Pop-up Menu

Backup Machine

System Data (1.0 MB) ☐

User Data (1.2 MB) ☐

Programs (4.8 KB) ☐

Select [ENTER]

Select All [F2]

Clear all [F3]

Backup [F4]

Exit[CANCEL]

Estimated size to zip: 0 B

5. Highlight the data to back up and press **[ENTER]** to apply a check mark. Press **[F2]** to select all data. Press **[F3]** to clear all check marks.
6. Press **[F4]**.

The control saves the backup you selected in a zip file labeled **HaasBackup (mm-dd-yyyy) .zip** where mm is the month, dd is the day, and yyyy is the year.

T4.1: Default File Names in the Zip File

Selected Backup	Data Saved	Name of File (Folder)
System Data	Settings	(Serial Number)
System Data	Offsets	OFFSETS.OFS
System Data	Alarm History	AlarmHistory.txt
System Data	Advanced Tool Management (ATM)	ATM.ATM
System Data	Key History	KeyHistory.HIS
Programs	Memory Files and Folders	(Memory)
User Data	User Data Files and Folders	(User Data)

4.4.1 Selected Machine Data Backup

To back up selected information from your machine:

1. If a USB is used, insert a USB memory device into the **[USB]** port on the right side of the control pendant. If **Net Share** is used, make sure **Net Share** is correctly set up.
2. Using the **[LEFT]** and **[RIGHT]** cursors navigate to **usb** in the Device Manager.
3. Open the destination directory. If you want to create a new directory for your backup data, refer to page **89** for instructions.
4. Press **[F4]**.
5. Select the menu option for the data you want to back up, and press **[ENTER]**.
6. Type a filename in the **Save As** pop-up menu. Press **[ENTER]**. The message *SAVED* is displayed after saving is complete. If the name exists you can overwrite or type a new name.

The file types for backups are listed in the following table.

T4.2: Menu Selection and File Name for Backup

F4 Menu Selection	Save	Load	Created File
Settings	yes	yes	USB0/serialnumber/CONFIGURATION/ serialnumber_us.xml
Offsets	yes	yes	filename.OFS
Macro Vars	yes	yes	filename.VAR
ATM	yes	yes	filename.ATM
Lsc	yes	yes	filename.LSC
Network Config	yes	yes	filename.xml
Alarm History	yes	no	filename.txt
Key History	yes	no	filename.HIS

**NOTE:**

When you back up settings, the Control does not prompt for a file name. It saves the file in a subdirectory:

- USB0/machine serial number/CONFIGURATION/machine serial number_us.xml

4.4.2 Restoring a Full Machine Backup

This procedure tells you how to restore your machine data from the backup on a USB memory device.

1. Insert the USB memory device with the backup files into the USB port on the right side of the control pendant.
2. Navigate to **USB** in the Device Manager.
3. Press **[EMERGENCY STOP]**.
4. Open the directory that contains the backup you want to restore.
5. Highlight the HaasBackup zip file to load.
6. Press **[F4]**.
7. Select **Restore Machine** and press **[ENTER]**.

The Restore Machine pop-up window shows what types of data can be selected to restore.

F4.9: Restore Machine Pop-up menu (example shows an all data backup)

Restore Machine	
System Data	☒
User Data	☒
Programs	☒
Offsets	☒
Macros	☒
ATM	☒
Network	☒

Select [ENTER]

Select All [F2]

Clear all [F3]

Restore [F4]

Exit[CANCEL]

Warning: User Data and Memory will be erased before a restore

8. Highlight the data to restore and press **[ENTER]** to apply a check mark. Press **[F2]** to select all data. Press **[F3]** to clear all selectors.