KNOWLEDGE SHARING

Question/Issue/Symptom/Problem:

How to Complete Calibration on TSX Gen 2 & Advanced Series ULT Freezers.

Resolution/Answer:


Follow Steps Below:

1. Install a calibrated sensor into the top of the RTD bracket as indicated in the photos.






2. Close inner and outer doors. Route calibrated sensor probe wire as indicated in the photo.

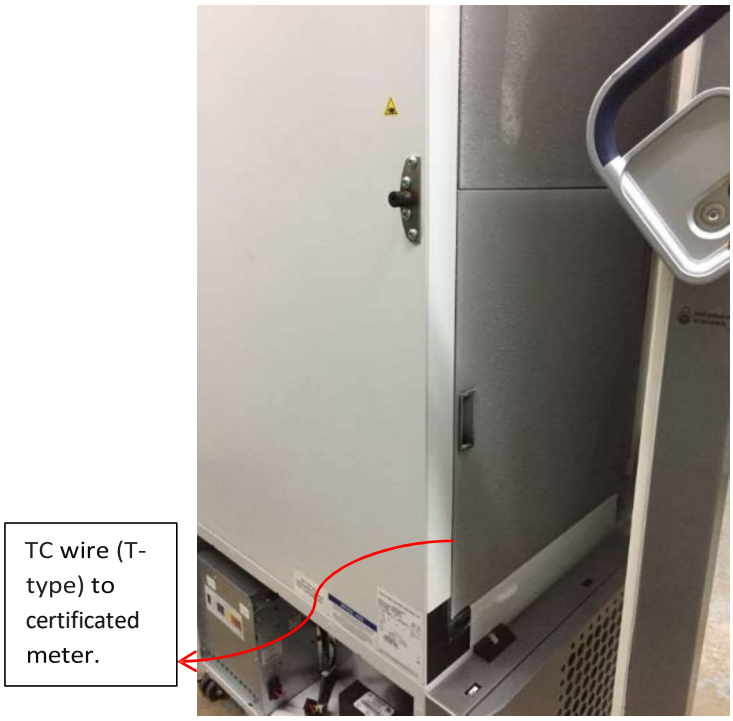


3. Allow the unit to stabilize at the set point for at least one hour. Then, calculate the required offset value. The available adjustment range is from -10°C to +10°C.

4. From the Settings Screen shown below press the Gear Icon, then the Controls Icon.

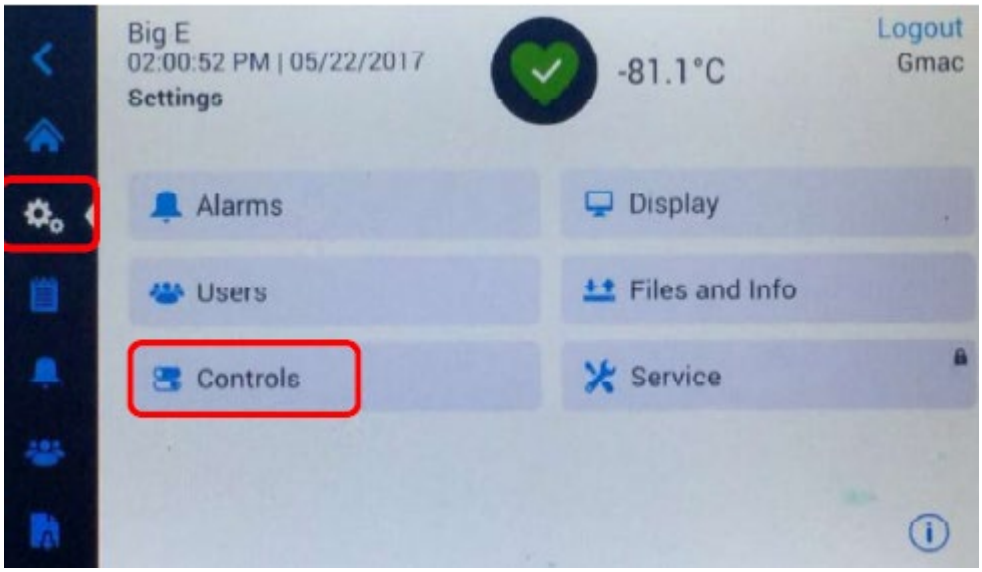


5. Now press the Temperature Offset Icon.

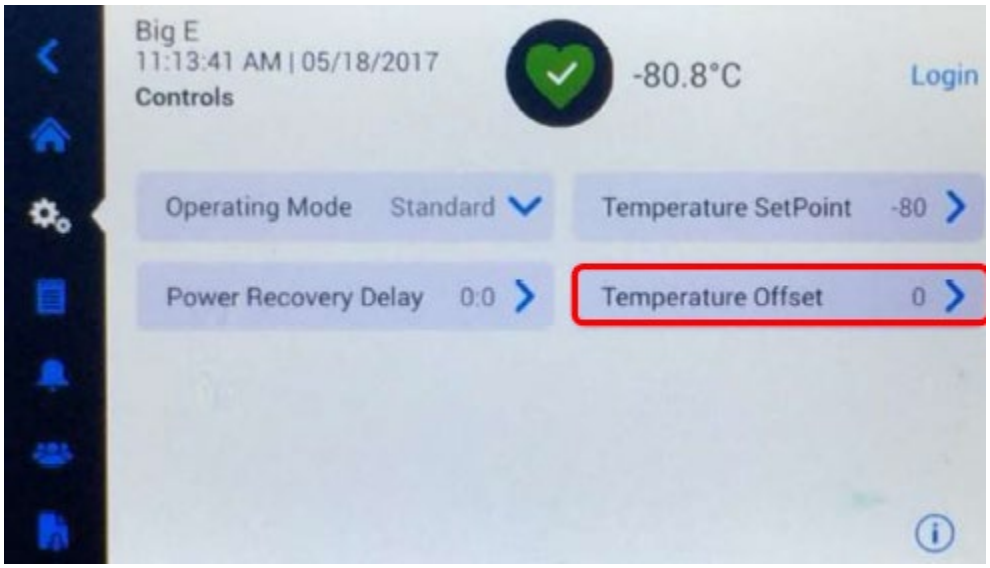


6. From the Temperature Offset Screen, Press or scroll to select the offset values.



7. From the Temperature Offset Screen, press the Save Icon. Then Press OK to complete the adjustment.

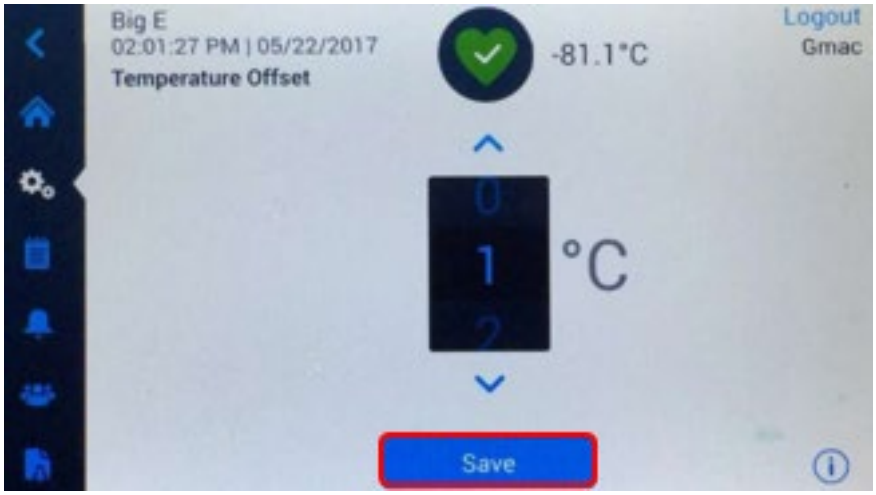

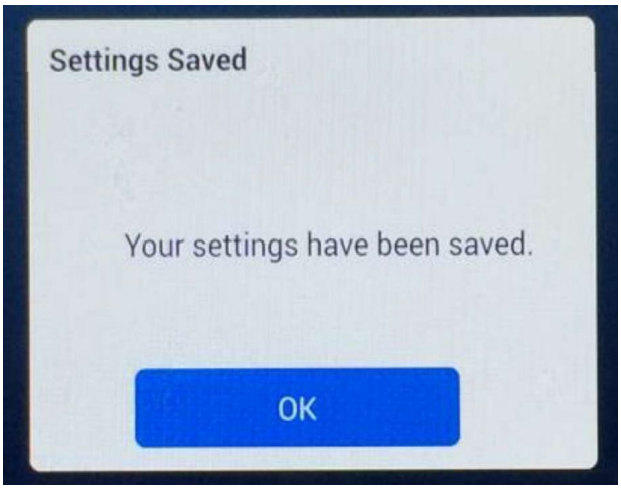

8. After completing the calibration, monitor for an hour before performing further calibration. Note that a variation of up to 2°C may be observed when an external probe is placed next to the freezer control probe. This variation is within specifications and is due to the optimization of the control system to ensure temperature uniformity throughout the chamber.

Title:

Calibrating TSX Gen 2 & Advanced HC Series ULT Freezers Instructions.

Audience:

Public

Author:

Alex Franklin