Fatigue Homework 2

February 21, 2023

Gabe Morris

Contents

1			3
	1.1	Given	3
	1.2	Find	3
	1.3	Solution	3
		1.3.1 Part A	3
		1.3.2 Part B	4
		1.3.3 Part C	4
		1.3.4 Part D	4
2			5
	2.1	Given	5
	2.2	Find	5
	2.3	Solution	5
		2.3.1 Part A	7
		2.3.2 Part B	7
		2.3.3 Part C	8
		2.3.4 Part D	9
3			11
	3.1	Given and Find	11
	3.2	Solution	11
		3.2.1 Part A	
		3.2.2 Part B	12
		3.2.3 Part C	
		324 Part D	1/1

1

1.1 Given

Fatigue testing can take an appreciable amount of time.

1.2 Find

Calculate the number of hours, days, or weeks it would take to apply 10^6 , 10^7 , and 10^8 cycles for test frequencies of

- A) 1 Hz (approximate speed of Wohler's original work). One of Wohler's tests ran for $1.3 \cdot 10^8$ cycles. How long did the test run?
- B) 30 Hz (speed of many common test machines).
- C) 150 Hz (speed of some rotating beam test machines).
- D) 20 kHz at 10^8 , 10^9 , and 10^{10} cycles instead.

1.3 Solution

If the elapsed time is t (seconds), the following relationship is true:

$$t = \frac{N_f}{f}$$

where N_f is the number of cycles till failure and f is the testing frequency in Hz.

```
[2]: def t_elapsed(Nf_, f_, days=True):
    t_ = Nf_/f_
    if days:
        print(f'{t_*1/86_400: .3f} days')
    else:
        print(f'{t_*1/3600: .3f} hours')
```

1.3.1 Part A

```
[3]: # 1, 10, and 100 million cycles at 1 Hz

t_elapsed(1e6, 1)

t_elapsed(1e7, 1)

t_elapsed(1e8, 1)

11.574 days

115.741 days

1157.407 days

For 1.3 · 10<sup>8</sup> cycles,
```

1.3.2 Part B

```
[5]: # 1, 10, and 100 million cycles at 30 Hz
t_elapsed(1e6, 30, days=False)
t_elapsed(1e7, 30)
t_elapsed(1e8, 30)
```

9.259 hours 3.858 days

38.580 days

1.3.3 Part C

```
[6]: # 1, 10, and 100 million cycles at 150 Hz
t_elapsed(1e6, 150, days=False)
t_elapsed(1e7, 150, days=False)
t_elapsed(1e8, 150)
```

1.852 hours

18.519 hours

7.716 days

1.3.4 Part D

```
[7]: # 100, 1000, and 10000 million cycles at 20,000 Hz

t_elapsed(1e8, 20_000, days=False)

t_elapsed(1e9, 20_000, days=False)

t_elapsed(1e10, 20_000)
```

1.389 hours

13.889 hours

5.787 days

2

2.1 Given

An as-forged 2 inch diameter 1040 steel rod has an ultimate tensile strength S_u of 100 ksi and a yield strength S_u of 75 ksi and is subjected to constant amplitude cyclic bending.

2.2 Find

Determine the following using appropriate approximation models:

- A) the fully reversed fatigue strength at 10^6 cycles
- B) S_a and S_m for 10^6 cycles if R = -0.2
- C) S_a and S_m for 10^4 cycles if R = 0.2
- D) Plot the Constant Life Diagram for B and C. Use the yield strength S_y value for S_y' . Plot the constant stress ratio lines on the diagram.

2.3 Solution

We use Basquin's equation to find the fatigue strength at some cycle number,

$$S_{Nf} = A(N_f)^B$$

A and B maybe determined by assuming the following boundary conditions:


- At 1 cycle, the fatigue strength is the tensile stress (100 ksi)
- At 10⁶ cycles, the fatigue strength is the endurance limit

 S_{Nf} is for fully reversed cycles. The Goodman relationship is used to characterize the loading conditions for when the mean stress is not zero,

$$\frac{S_a}{S_{Nf}} + \frac{S_m}{S_u} = 1$$

Finding the Endurance Limit

The starting endurance limit is approximated as $0.5S_u = 50 \, ksi$. Since the size of the rod is large, a correction factor of 0.8 will be applied (page 80 in the text) as well as a factor of 0.35 from the surface finish below.

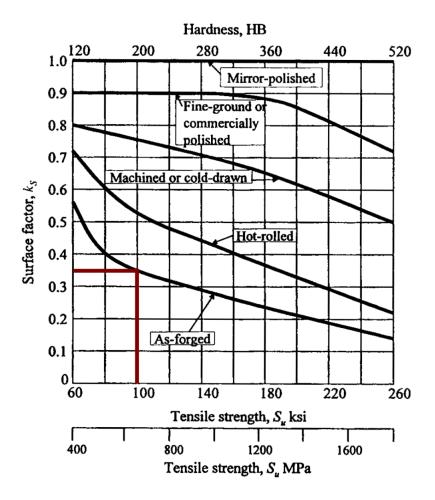

Therefore,

$$S_f = 0.35 \cdot 0.8 \cdot 50 = 14\,ksi$$

The first condition is used to determine A in the Basquin equation (A=100). The second condition results in $B = \frac{1}{6} \log \left(\frac{S_f}{S_u} \right) = -0.14$.


```
[8]: # Plotting the Basquin curve
A, B = 100, 1/6*np.log10(14/100)

Nf = np.linspace(1, 1_000_000, 1_000_000)
S_Nf = lambda Nf_: A*Nf_**B

fig, ax = plt.subplots()
ax.set_xlabel('Number of Cycles Till Failure ($N_f$)')
ax.set_ylabel('Fatigue Strength ($S_{Nf}$ in $ksi$)')
ax.set_xscale('log')
# ax.set_yscale('log')

ax.plot(Nf, S_Nf(Nf))
```

plt.show()

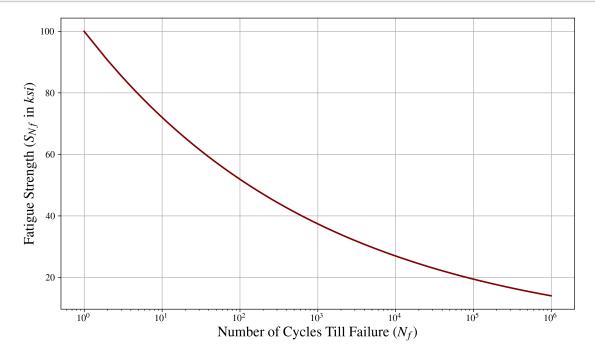

2.3.1 Part A

The fully reversed fatigue strength at 10^6 cycles is the fatigue limit, since this analysis used the common assumption that the fatigue limit is reached at 1 million cycles. Therefore, the fully reversed fatigue strength is 14 ksi for 1 million cycles.

2.3.2 Part B

The Goodman relationship along with the three additional equations below yield four equations and four unknowns.

$$\frac{S_a}{14} + \frac{S_m}{100} = 1$$

$$-0.2 = \frac{S_{min}}{S_{max}}$$

$$S_{max} = S_a + S_m$$

$$S_m = \frac{S_{max}}{2} + \frac{S_{min}}{2}$$

[10]: # Solving
sol = sp.solve([eq1, eq2, eq3, eq4], dict=True)[0]
for key, value in sol.items():
 display(sp.Eq(key, value))

 $S_a = 12.8048780487805$

 $S_m = 8.53658536585366$

 $S_{max} = 21.3414634146341$

 $S_{min} = -4.26829268292683 \\$

2.3.3 Part C

[11]: # Get S_Nf S_Nf(1e4) # ksi

[11]: 26.961994997758502

The process above is repeated with slightly different values. The value of the fatigue strength at 10^4 cycles is $S_{Nf}=27\,ksi$.

$$\begin{split} \frac{S_a}{27} + \frac{S_m}{100} &= 1 \\ 0.2 &= \frac{S_{min}}{S_{max}} \\ S_{max} &= S_a + S_m \\ S_m &= \frac{S_{max}}{2} + \frac{S_{min}}{2} \end{split}$$

 $S_a = 19.2170818505338$

```
\begin{split} S_m &= 28.8256227758007 \\ S_{max} &= 48.0427046263345 \\ S_{min} &= 9.6085409252669 \end{split}
```

2.3.4 Part D

The function below will create a constant life diagram. Automating this process may prove to be useful in the future.

```
[14]: def constant_life(Sy_, Sy_p, Su_, *lines):
         # lines needs to be a dictionary containing the following keys:
         \# S_Nf, S_m, S_a, cycles, is (optional), and color
         fig_, ax_ = plt.subplots()
         ax_.set_xlabel('$S_m$')
         ax_.set_ylabel('$S_a$')
         ax .set title('Constant Life Diagram')
         # Plot Triangle
         ax_.plot([Sy_, 0], [0, Sy_p], color='black', zorder=2)
         ax_.plot([-Sy_, 0], [0, Sy_p], color='black', zorder=2)
         ax_scatter([Sy_, -Sy_], [0, 0], color='black', zorder=3,_
       →label=f'$S_y={Sy_}$', marker='o')
         ax_.scatter(0, Sy_p, color='black', marker='s', zorder=3,_
       →label=rf'$S^\prime_y={Sy_p}$')
         ax_.scatter(Su_, 0, color='black', marker='^', zorder=3,_
       \Rightarrowlabel=f'$S_u={Su_}$')
         # Plot line information
         for line in lines:
             x_{=} (line['S_Nf'] - Sy_p)/(Sy_p/Sy_ + line['S_Nf']/Su_)
             ax_plot([Su_x_1], [0, Sy_p/Sy_*x_+ Sy_p], color=line['color'],_u
       ax_.plot([0, line['S_m']], [0, line['S_a']], zorder=2,__


→color=line['color'], label=f'$R={(line["S_m"] - line["S_a"])/(line["S_m"] +__
       ⇔line["S_a"]):.3f}$', ls=':')
             ax_scatter(0, line['S_Nf'], label=f'$S_{{Nf}}={line["S_Nf"]}$', __
       ⇔zorder=3, marker='o', color=line['color'])
             ax_.scatter(line['S_m'], line['S_a'], color=line['color'], zorder=3,__
       →marker='x', label=f'{line["S_m"], line["S_a"]}')
         ax_.legend()
         return fig_, ax_
     line1 = dict(S_Nf=14, S_m=8.537, S_a=12.805, cycles=r'$10^6$', color='darkgrey')
```

```
line2 = dict(S_Nf=26.96199, S_m=28.826, S_a=19.217, cycles=r'$10^4$',u

color='maroon')

constant_life(75, 75, 100, line1, line2)

plt.show()
```

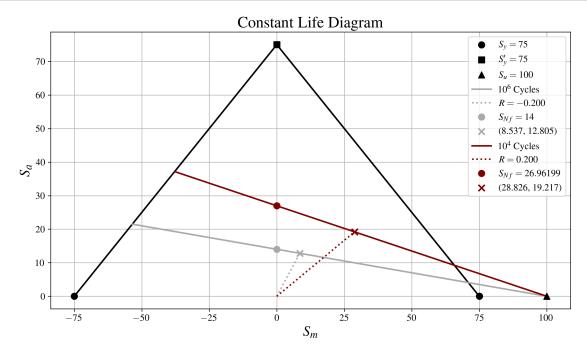

The points are below the yielding lines indicating that failure will not occur.


3

3.1 Given and Find

Repeat the previous problem, but using a machined surface. Comment on the effect of the surface.

3.2 Solution

All the information is the same except the endurance limit will change significantly.

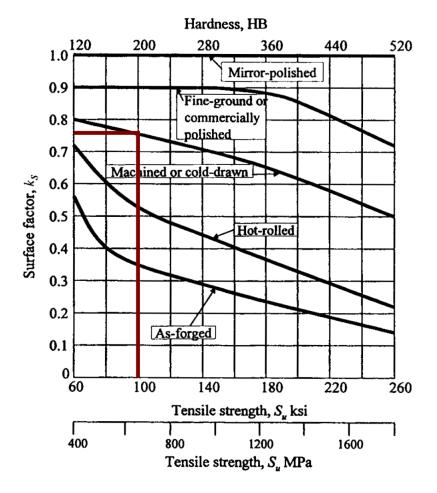

The new endurance limit is $S_f = 0.75 \cdot 0.8 \cdot 50 = 30 \, ksi$.


```
[15]: # Plotting and comparing the curves
A, B2 = 100, 1/6*np.log10(30/100)

S_Nf2 = lambda Nf_: A*Nf_**B2

fig, ax = plt.subplots()
ax.set_xlabel('Number of Cycles Till Failure ($N_f$)')
```

```
ax.set_ylabel('Fatigue Strength ($S_{Nf}$ in $ksi$)')
ax.set_xscale('log')
# ax.set_yscale('log')

ax.plot(Nf, S_Nf(Nf), label='As-Forged Surface')
ax.plot(Nf, S_Nf2(Nf), label='Machined Surface')
ax.legend()
plt.show()
```

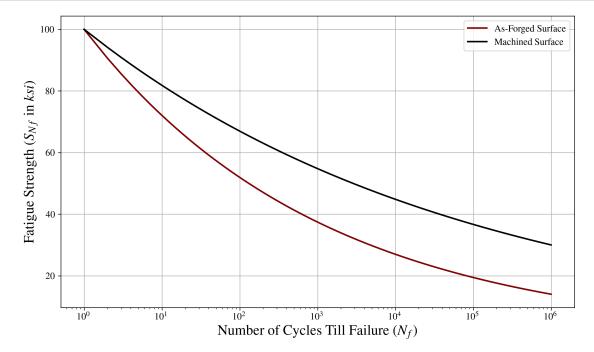

3.2.1 Part A

The fully reversed fatigue strength is 30 ksi for 1 million cycles, since it's common for metals to reach the fatigue limit at 1 million cycles.

3.2.2 Part B

$$\frac{S_a}{30} + \frac{S_m}{100} = 1$$

$$-0.2 = \frac{S_{min}}{S_{max}}$$

$$S_{max} = S_a + S_m$$

$$S_m = \frac{S_{max}}{2} + \frac{S_{min}}{2}$$

[17]: # Solving

sol = sp.solve([eq1, eq2, eq3, eq4], dict=True)[0]
for key, value in sol.items():
 display(sp.Eq(key, value))

$$S_a = 25.0$$

 $S_m = 16.66666666666667$

 $S_{max} = 41.6666666666667$

 $S_{min} = -8.333333333333333$

3.2.3 Part C

[18]: S_Nf2(1e4) # ksa

[18]: 44.81404746557165

$$0.022314455304146S_a + \frac{S_m}{100} = 1$$

$$0.2 = \frac{S_{min}}{S_{max}}$$

$$S_{max} = S_a + S_m$$

$$S_m = \frac{S_{max}}{2} + \frac{S_{min}}{2}$$

sol = sp.solve([eq1, eq2, eq3, eq4], dict=True)[0]
for key, value in sol.items():
 display(sp.Eq(key, value))

$$S_a = 26.7992656424732$$


 $S_m = 40.1988984637097$

 $S_{max} = 66.9981641061829$

```
S_{min} = 13.3996328212366
```

3.2.4 Part D

```
[21]: line1 = dict(S_Nf=30, S_m=16.667, S_a=25, cycles=r'$10^6$', color='darkgrey') line2 = dict(S_Nf=44.814, S_m=40.199, S_a=26.799, cycles=r'$10^4$', \( \text{scolor='maroon'} \) constant_life(75, 75, 100, line1, line2) plt.show()
```

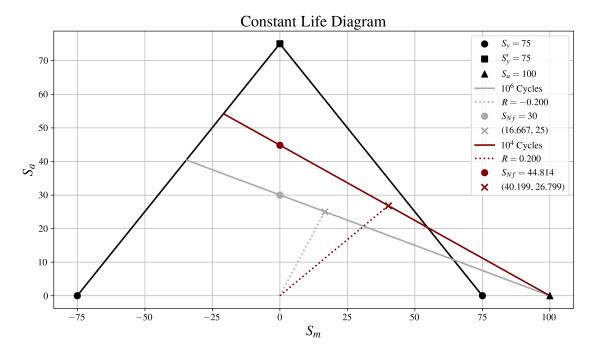

The effect of machining the surface is that the endurance limit is increased significantly. As seen from the S-N diagram, the increase in the endurance limit decreases the rate of stress with respect to the number of cycles. That is, infinite life is far more achievable, and the material will not fail in higher stress environments.