Smart Material Chapter 4 Solutions

September 16, 2024

Gabe Morris

```
[1]: # toc
import sympy as sp
import numpy as np
import matplotlib.pyplot as plt

plt.style.use('maroon_ipynb.mplstyle')
```

Contents

Problem 4.1																			3
Solution							•		•			 				 •			3
Problem 4.2																			4
Solution										 		 				 			4
Part A										 		 				 			4
Part B												 							4
Problem 4.4																			5
Solution										 		 							5
Problem 4.5																			6
Solution										 		 							6
Problem 4.6																			7
Solution												 							7
Problem 4.9																			10
Solution										 		 				 			10
Part A																			
Part B																			
Problem 4.10																			11
Solution																			
Part A																			
Part B																			
1 (41 (-12)										 		 				 			1 4

Compute the stress required to produce 100 microstrain in APC 856 when the applied electric field is held constant at zero Compute the stress required to produce 100 microstrain when the electric displacement is held equal to zero.

Property	Unit	Symbol	APC 856	PZT-5H	PVDF
Relative dielectric constant	unitless	ε_r	4100	3800	12–13
Curie temperature	°C	T_c	150	250	
Coupling coefficient	unitless	k_{33}	0.73	0.75	
		k_{31}	0.36		0.12
		k_{15}	0.65		
Strain coefficient	10^{-12} C/N or m/V	d_{33}	620	650	-33
		$-d_{31}$	260	320	-23
		d_{15}	710		
Elastic compliance	$10^{-12} \text{ m}^2/\text{N}$	$\mathbf{s}_{11}^{\mathrm{E}}$	15	16.1	250-500
-	,	$\begin{array}{c} \mathbf{s_{11}^E} \\ \mathbf{s_{33}^E} \end{array}$	17	20	
Density	g/cm ³	ρ	7.5	7.8	1.78

Solution

We can use the constitutive equations.

$$S = sT + dE$$

$$D = dT + \epsilon E$$

[2]: 5882352.941176471

For finding the open circuit stress, we need the open circuit compliance.

$$s^D = s^E (1 - k^2)$$

[3]: 12593348.193484202

A new composition of piezoelectric material is found to have a compliance at zero electric field of $18.2\mu m^2/N$, a piezoelectric strain coefficient of 330pm/V, and a relative permittivity of 1500.

- a. Write the one-dimensional constitutive relationship for the material with strain and electric displacement as the dependent variables.
- b. Write the one-dimensional constitutive relationship with stress and electric field as the dependent variables.

Solution

Part A

```
[4]: S, D, s, d, eps, T, E = sp.symbols(r'S D s d \epsilon T E')
A = sp.Matrix([[s, d], [d, eps]])
x = sp.Matrix([T, E])
b = sp.Matrix([S, D])
eq = sp.Eq(b, sp.MatMul(A, x))
eq
```

[4]:
$$\begin{bmatrix} S \\ D \end{bmatrix} = \begin{bmatrix} s & d \\ d & \epsilon \end{bmatrix} \begin{bmatrix} T \\ E \end{bmatrix}$$
$$\epsilon = \epsilon_r \cdot \epsilon_o$$

[5]:
$$\begin{bmatrix} S \\ D \end{bmatrix} = \begin{bmatrix} 1.82 \cdot 10^{-5} & 3.3 \cdot 10^{-10} \\ 3.3 \cdot 10^{-10} & 1.3281 \cdot 10^{-8} \end{bmatrix} \begin{bmatrix} T \\ E \end{bmatrix}$$

Part B

```
[6]: eq = sp.Eq(x, sp.MatMul(A.inv(), b))
eq
```

[6]:
$$\begin{bmatrix} T \\ E \end{bmatrix} = \begin{bmatrix} \frac{\epsilon}{\epsilon s - d^2} & -\frac{d}{\epsilon s - d^2} \\ -\frac{d}{\epsilon s - d^2} & \frac{s}{\epsilon s - d^2} \end{bmatrix} \begin{bmatrix} S \\ D \end{bmatrix}$$

[7]: eq.subs(subs)

[7]:
$$\begin{bmatrix} T \\ E \end{bmatrix} = \begin{bmatrix} 54945.0796995757 & -1365.24932616971 \\ -1365.24932616971 & 75295568.8978449 \end{bmatrix} \begin{bmatrix} S \\ D \end{bmatrix}$$

The short-circuit mechanical compliance of a piezoelectric material has been measured to be $20 \mu m^2/N$ and the open-circuit mechanical compliance has been measured to be $16.2 \mu m^2/N$. If the stress-free relative permittivity is equal to 2800, compute the relative permittivity of the material when the strain is constrained to be zero.

Solution

We can use the equation for the open circuit compliance to find the piezoelectric coupling coefficient, and apply that to the no strain permittivity relationship.

$$s^D=s^E(1-k^2)\,$$

$$\epsilon^S = \epsilon^T (1 - k^2)$$

[8]: 0.43588989435406744

```
[9]: epsS = epsT*(1 - k**2) epsS
```

[9]: 2268.0

Compute the sensitivity between strain and electric displacement for a piezoelectric material whose material parameters are $s^E=16\mu m^2/N$ and d=220pm/V, with a relative permittivity of 1800. Assume that the signal conditioning circuit for the sensor maintains a zero electric field.

Solution

The sensitivity is going to be defined as the ratio between electric displacement and strain. With the zero electric field,

$$S=s^ET$$

$$D = dT$$

These equations can be re-arranged to find the sensitivity.

$$\frac{D}{S} = \frac{d}{s^E}$$

[10]: 13.75

Beginning with equation 4.55, write the constitutive relationships for a piezoelectric material with an electric field applied in the direction of polarization (the 3 direction). Assume that the applied stress is zero except for the 1 and 2 material directions.

Solution

Equation 4.55 is

$$\left\{\begin{array}{c} \mathbf{D}_{1} \\ \mathbf{D}_{2} \\ \mathbf{D}_{3} \end{array}\right\} = \left[\begin{array}{ccccc} 0 & 0 & 0 & 0 & d_{15} & 0 \\ 0 & 0 & 0 & d_{24} & 0 & 0 \\ d_{13} & d_{23} & d_{33} & 0 & 0 & 0 \end{array}\right] \left\{\begin{array}{c} \mathbf{T}_{1} \\ \mathbf{T}_{2} \\ \mathbf{T}_{3} \\ \mathbf{T}_{4} \\ \mathbf{T}_{5} \\ \mathbf{T}_{6} \end{array}\right\} + \left[\begin{array}{cccc} \varepsilon_{11} & 0 & 0 \\ 0 & \varepsilon_{22} & 0 \\ 0 & 0 & \varepsilon_{33} \end{array}\right] \left\{\begin{array}{c} \mathbf{E}_{1} \\ \mathbf{E}_{2} \\ \mathbf{E}_{3} \end{array}\right\}$$

```
[11]: S1, S2, S3, S4, S5, S6 = sp.symbols(r'S1:7')
     T1, T2, T3, T4, T5, T6 = sp.symbols(r'T1:7')
     E1, E2, E3 = sp.symbols(r'E1:4')
     D1, D2, D3 = sp.symbols(r'D1 D2 D3')
     eps11, eps22, eps33 = sp.symbols(r'\varepsilon_{11} \varepsilon_{22}_\u
      d13, d23, d33, d24, d15 = sp.symbols(r'd13 d23 d33 d24 d15')
     Y1E, Y3E, G23E, G13E, G12E = sp.symbols(r'Y_1^E Y_3^E G_{23}^E G_{13}^E)
      G {12}^E')
     nu12, nu13, nu23, nu31, nu32 = sp.symbols(r'\nu_{12} \nu_{13} \nu_{23} \nu_{31})
      sE = sp.Matrix([
          [1/Y1E, -nu12/Y1E, -nu13/Y1E, 0, 0, 0],
          [-nu12/Y1E, 1/Y1E, -nu23/Y1E, 0, 0, 0],
          [-nu31/Y3E, -nu32/Y3E, 1/Y3E, 0, 0, 0],
          [0, 0, 0, 1/G23E, 0, 0],
          [0, 0, 0, 0, 1/G13E, 0],
          [0, 0, 0, 0, 0, 1/G12E]
     ])
     S = sp.Matrix([S1, S2, S3, S4, S5, S6])
```

```
T = sp.Matrix([T1, T2, T3, T4, T5, T6])
d = sp.Matrix([
    [0, 0, d13],
    [0, 0, d23],
    [0, 0, d33],
    [0, d24, 0],
    [d15, 0, 0],
    [0, 0, 0]
])
E = sp.Matrix([E1, E2, E3])
D = sp.Matrix([D1, D2, D3])
eps = sp.Matrix([
    [eps11, 0, 0],
    [0, eps22, 0],
    [0, 0, eps33]
])
eq1 = sp.Eq(S, sp.Add(sp.MatMul(sE, T), sp.MatMul(d, E)))
eq2 = sp.Eq(D, sp.Add(sp.MatMul(d.transpose(), T), sp.MatMul(eps, E)))
display(eq1, eq2)
```

$$\begin{bmatrix} S_1 \\ S_2 \\ S_3 \\ S_4 \\ S_5 \\ S_6 \end{bmatrix} = \begin{bmatrix} 0 & 0 & d_{13} \\ 0 & 0 & d_{23} \\ 0 & 0 & d_{33} \\ 0 & d_{24} & 0 \\ d_{15} & 0 & 0 \\ 0 & 0 & 0 \end{bmatrix} \begin{bmatrix} E_1 \\ E_2 \\ E_3 \end{bmatrix} + \begin{bmatrix} \frac{\frac{1}{Y_E}}{Y_E} & -\frac{y_{12}}{Y_E} & -\frac{y_{13}}{Y_E} & 0 & 0 & 0 \\ -\frac{y_{12}}{Y_E} & \frac{1}{Y_E} & -\frac{y_{23}}{Y_E} & 0 & 0 & 0 \\ -\frac{y_{13}}{Y_S} & -\frac{y_{32}}{Y_S} & \frac{1}{Y_S} & 0 & 0 & 0 \\ 0 & 0 & 0 & \frac{1}{G_{23}} & 0 & 0 \\ 0 & 0 & 0 & 0 & \frac{1}{G_{13}} & 0 \\ 0 & 0 & 0 & 0 & 0 & \frac{1}{G_{13}} \end{bmatrix} \begin{bmatrix} T_1 \\ T_2 \\ T_3 \\ T_5 \\ T_6 \end{bmatrix}$$

$$\begin{bmatrix} D_1 \\ D_2 \\ D_3 \end{bmatrix} = \begin{bmatrix} \varepsilon_{11} & 0 & 0 \\ 0 & \varepsilon_{22} & 0 \\ 0 & 0 & \varepsilon_{33} \end{bmatrix} \begin{bmatrix} E_1 \\ E_2 \\ E_3 \end{bmatrix} + \begin{bmatrix} 0 & 0 & 0 & 0 & d_{15} & 0 \\ 0 & 0 & 0 & d_{24} & 0 & 0 \\ d_{13} & d_{23} & d_{33} & 0 & 0 & 0 \end{bmatrix} \begin{bmatrix} I_1 \\ T_2 \\ T_3 \\ T_4 \\ T_5 \\ T_6 \end{bmatrix}$$

```
[12]: subs = {T3: 0, T4: 0, T5: 0, T6: 0, E1: 0, E2: 0}
eq1 = eq1.subs(subs)
eq2 = eq2.subs(subs)
display(eq1, eq2)
```

$$\begin{bmatrix} S_1 \\ S_2 \\ S_3 \\ S_4 \\ S_5 \\ S_6 \end{bmatrix} = \begin{bmatrix} 0 & 0 & d_{13} \\ 0 & 0 & d_{23} \\ 0 & 0 & d_{33} \\ 0 & d_{24} & 0 \\ d_{15} & 0 & 0 & 0 \end{bmatrix} \begin{bmatrix} 0 \\ 0 \\ E_3 \end{bmatrix} + \begin{bmatrix} \frac{1}{Y_1^E} & -\frac{\nu_{12}}{Y_1^E} & -\frac{\nu_{13}}{Y_1^E} & 0 & 0 & 0 \\ -\frac{\nu_{12}}{Y_1^E} & \frac{1}{Y_1^E} & -\frac{\nu_{23}}{Y_2^E} & 0 & 0 & 0 \\ -\frac{\nu_{13}}{Y_1^E} & -\frac{\nu_{32}}{Y_2^E} & \frac{1}{Y_1^E} & 0 & 0 & 0 \\ 0 & 0 & 0 & 0 & \frac{1}{G_{13}^E} & 0 & 0 \\ 0 & 0 & 0 & 0 & 0 & \frac{1}{G_{13}^E} & 0 \\ 0 & 0 & 0 & 0 & 0 & \frac{1}{G_{13}^E} \end{bmatrix} \begin{bmatrix} T_1 \\ T_2 \\ 0 \\ 0 \\ 0 \\ 0 \end{bmatrix}$$

$$\begin{bmatrix} D_1 \\ D_2 \\ D_3 \end{bmatrix} = \begin{bmatrix} \varepsilon_{11} & 0 & 0 \\ 0 & \varepsilon_{22} & 0 \\ 0 & 0 & \varepsilon_{33} \end{bmatrix} \begin{bmatrix} 0 \\ 0 \\ E_3 \end{bmatrix} + \begin{bmatrix} 0 & 0 & 0 & 0 & d_{15} & 0 \\ 0 & 0 & 0 & d_{24} & 0 & 0 \\ d_{13} & d_{23} & d_{33} & 0 & 0 & 0 \end{bmatrix} \begin{bmatrix} T_1 \\ T_2 \\ 0 \\ 0 \\ 0 \\ 0 \end{bmatrix}$$

[13]: display(eq1.doit(), eq2.doit())

$$\begin{bmatrix} S_1 \\ S_2 \\ S_3 \\ S_4 \\ S_5 \\ S_6 \end{bmatrix} = \begin{bmatrix} E_3 d_{13} + \frac{T_1}{Y_-^E} - \frac{T_2 \nu_{12}}{Y_-^E} \\ E_3 d_{23} - \frac{T_1 \nu_{12}}{Y_-^E} + \frac{T_2}{Y_-^E} \\ E_3 d_{33} - \frac{T_1 \nu_{31}}{Y_-^E} - \frac{T_2 \nu_{32}}{Y_-^E} \\ 0 \\ 0 \\ 0 \end{bmatrix}$$

$$\begin{bmatrix} D_1 \\ D_2 \\ D_3 \end{bmatrix} = \begin{bmatrix} 0 \\ 0 \\ E_3 \varepsilon_{33} + T_1 d_{13} + T_2 d_{23} \end{bmatrix}$$

So, the final equations would be,

$$\begin{split} S_1 &= E_3 d_{13} + \frac{T_1}{Y_1^E} - \frac{T_2 \nu_{12}}{Y_1^E} \\ S_2 &= E_3 d_{23} - \frac{T_1 \nu_{12}}{Y_1^E} + \frac{T_2}{Y_1^E} \\ S_3 &= E_3 d_{33} - \frac{T_1 \nu_{31}}{Y_3^E} - \frac{T_2 \nu_{32}}{Y_3^E} \\ D_3 &= E_3 \varepsilon_{33} + T_1 d_{13} + T_2 d_{23} \end{split}$$

A piezoelectric material operating in the 33 mode has the material properties $d_{33}=450pm/V$ and $Y_3^E=63GPa$.

- a. Compute the blocked stress and free strain under the application of an electric field of 0.75MV/m.
- b. Compute the voltage required to achieve this blocked stress or free displacement for a wafer that is $250\mu m$ thick.

Solution

Part A

The blocking stress as a result of zeroing displacement is

$$T_{bl}=d_{33}Y_3^EE_3\\$$

The free strain as a result of zeroing stress is

$$S_{fr} = d_{33}E_3$$

```
[15]: d33, Y3E, E3 = 450e-12, 63e9, 0.75e6

T_bl = d33*Y3E*E3

T_bl # Pa
```

[15]: 21262500.0

```
[16]: S_fr = d33*E3
S_fr
```

[16]: 0.0003375

Part B

```
[17]: # Voltage = Electric field * thickness
V = E3*250e-6
V # V
```

[17]: 187.5

		PZT-A	PZT-B	PZT-C	PZT-D	PZT-E
ε_{33}		1400	1400	1100	5440	1800
ε_{11}		1350	1300	1400	5000	2000
$egin{array}{c} arepsilon_{11} \ s_{11}^{ m E} \end{array}$	$(\mu \mathrm{m}^2/\mathrm{N})$	12.7	13.1	11.2	14.8	16.5
$s_{33}^{ m E}$	$(\mu \rm m^2/N)$	15.4	15.6	15.2	18.1	19.9
d_{13}	(pm/V)	-133	-132	-99	-287	-198
d_{33}	(pm/V)	302	296	226	635	417

For each material above,

- a. Plot the blocked stress and free strain on a single plot.
- b. Compute the volumetric energy density of each type of material for operation in the 33 mode for an electric field of 1MV/m.

Solution

Part A

```
[18]: d33 = np.array([302, 296, 226, 635, 417])*1e-12
      s33 = np.array([15.4, 15.6, 15.2, 18.1, 19.9])*1e-12
      materials = ['PZT-A', 'PZT-B', 'PZT-C', 'PZT-D', 'PZT-E']
      Y33 = 1/s33 \# Pa
      fig, ax = plt.subplots()
      E = 1e6 \# V/m
      for d, Y, mat in zip(d33, Y33, materials):
          T = d*Y*E*1e-6 # MPa
          S = d*E*1e6 # microstrain
          ax.plot([0, S], [T, 0], label=mat)
          print(mat)
          print('Blocking Stress:', T, 'MPa')
          print('Free Strain:', S, 'microstrain')
          print()
      ax.legend()
      ax.set_xlabel('Strain (microstrain)')
      ax.set_ylabel('Stress (MPa)')
      plt.show()
```

PZT-A

Blocking Stress: 19.610389610389607 MPa Free Strain: 301.99999999999 microstrain

PZT-B

Blocking Stress: 18.974358974358974 MPa

Free Strain: 296.0 microstrain

PZT-C

Blocking Stress: 14.868421052631579 MPa

Free Strain: 226.0 microstrain


PZT-D

Blocking Stress: 35.0828729281768 MPa Free Strain: 634.9999999999 microstrain

PZT-E

Blocking Stress: 20.954773869346738 MPa

Free Strain: 417.0 microstrain

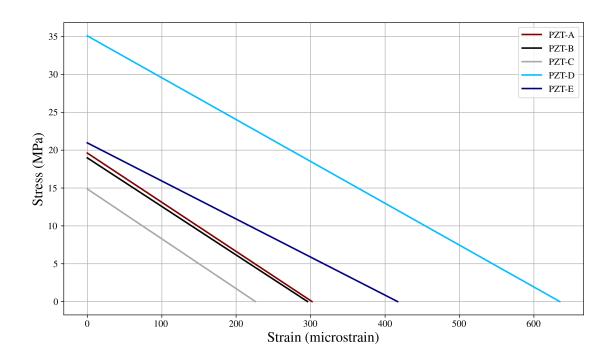

Part B

The volumetric energy density is given by

$$E_v = \frac{1}{2} Y_3^E d_{33}^2 E_3^2$$

This is the area under the line in the graph above. The $\frac{1}{2}Y_3^Ed_{33}^2$ term is a good metric for showing that a PZT material can provide more mechanical work for a given electric field.

[19]: $E_v = 0.5*Y33*d33**2*E**2$ $E_v/1000 \# kJ/m^3$

[19]: array([2.96116883, 2.80820513, 1.68013158, 11.13881215, 4.36907035])

Note that the soft PZT material exhibits the highest volumetric energy density.