Honeywell

HIH-4000 Series

Humidity Sensors

The HIH-4000 Series Humidity Sensors are designed specifically for high volume OEM (Original Equipment Manufacturer) users. Direct input to a controller or other device is made possible by this sensor's linear voltage output. With a typical current draw of only 200 μA , the HIH-4000 Series is often ideally suited for low drain, battery operated systems. Tight sensor interchangeability reduces or eliminates OEM production calibration costs. Individual sensor calibration data is available.

The HIH-4000 Series delivers instrumentation-quality RH (Relative Humidity) sensing performance in a competitively priced, solderable SIP (Single In-line Package). Available in two lead spacing configurations, the RH sensor is a laser trimmed, thermoset polymer capacitive sensing element with on-chip integrated signal conditioning. The sensing element's multilayer construction provides excellent resistance to most application hazards such as wetting, dust, dirt, oils and common environmental chemicals.

FEATURES

- Molded thermoset plastic housing
- Linear voltage output vs %RH
- Laser trimmed interchangeability
- · Low power design
- High accuracy
- Fast response time
- Stable, low drift performance
- · Chemically resistant

TYPICAL APPLICATIONS

- Refrigeration equipment
- HVAC equipment
- · Medical equipment
- Drying
- Metrology
- Battery-powered systems
- OEM assemblies

HIH-4000 Series

TABLE 1. PERFORMANCE SPECIFICATIONS (At 5 Vdc supply and 25 °C [77 °F] unless otherwise noted.)

(%RH performance specifications include test system measurement errors (±0.5 % typical.)

Parameter	Minimum	Typical	Maximum	Unit
Interchangeability (best fit straight line)	_	_	_	_
0 % to 60 %	-5	-	5	%RH
60 % to 100 %	-8	_	8	%RH
Interchangeability (2nd order curve)	_	±3.5	_	%RH
Accuracy¹ (best fit straight line)	=	±3.5	_	%RH
Accuracy (2nd order curve)	_	±2.5	_	%RH
Hysterisis	_	3	_	%RH
Repeatability	=	±0.5	_	%RH
Settling time	_	_	70	ms
Response time (1/e in slow moving air)	_	15	_	S
Stability ² (@ 50 %RH)	_	±1.2 (per year)	_	%RH
Stability ³ (@ 50 %RH)	_	±0.5 (per year)	_	%RH
Voltage supply	4	_	5.8	Vdc
Current supply	=	-	500	μA
Voltage output (1 st order fit)	V _{out} =V _{supply} (0.0062(sensor RH)+0.16)			
Voltage output (2nd order curve fit)	V _{out} =0.00003(sensor RH) ² +0.0281(sensor RH)+0.820, typical @ 25 °C			
Temperature compensation	V _{out} =(0.0305+0.000044T-0.0000011T ²)(Sensor RH)+(0.9237-			
	0.0041T+0.000040T ²), T=Temperature in °C			
Operating temperature	-40[-40]	See Figure 1.	85[185]	°C[°F]
Operating humidity	0	See Figure 2.	100	%RH
Storage temperature	-40[-40]	_	125[257]	°C[°F]
Storage humidity	See Figure 2. %RH			

Notes:

- 1. For HIH-4000-003 and -004 only.
- 2. Specification includes testing outside of recommended operating zone.
- 3. Specification includes testing for recommended operating zone only.

NOTICE

- Do not expose sensor to condensing environments.
 Exposure to condensing environments will cause sensor output to indicate 0 %RH.
- Sensor is light sensitive. For best performance, shield sensor from bright light.
- Sensor is static sensitive. Sensor connection protected to 15 kV maximum.
- Sensor output is ratiometric to supply voltage.

Failure to comply with these instructions could result in death or serious injury.



FACTORY CALIBRATION DATA

HIH-4000 Sensors may be ordered with a calibration and data printout (Table 2). See order guide on back page.

TABLE 2. EXAMPLE DATA PRINTOUT

TABLE 2. EXAMPLE DATA PRINTOUT			
Model	HIH-4000-001		
Channel	92		
Wafer	030996M		
MRP	337313		
Calculated values at 5 V V _{out} @ 0 %RH V _{out} @ 75.3 %RH	0.958 V 3.268 V		
Linear output for 2 %RH accuracy @ 25 °C Zero offset Slope RH	0.958 V 30.680 mV/%RH (V _{out} -zero offset)/slope (V _{out} -0.958)/0.0307		
Ratiometric response for 0 % to 100 %RH V _{out}	V _{supply} (0.1915 to 0.8130)		

Humidity Sensors

FIGURE 1. RECOMMENDED OPERATING CONDITIONS

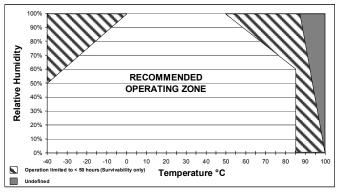


FIGURE 2. STORAGE ENVIRONMENT

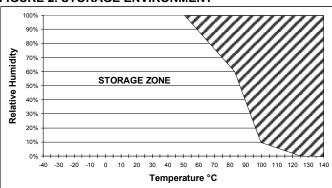


FIGURE 3. MOUNTING DIMENSIONS

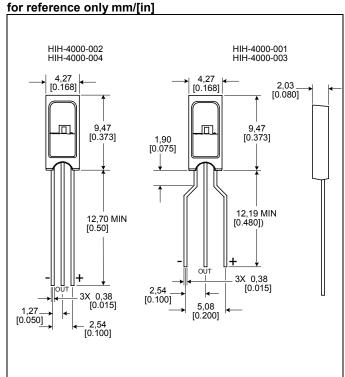


FIGURE 4. TYPICAL BEST FIT STRAIGHT LINE


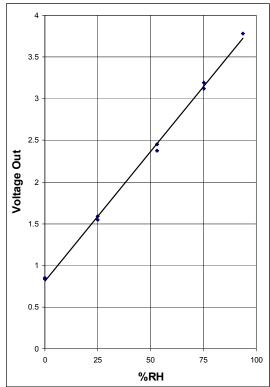


FIGURE 5. TYPICAL 2nd ORDER CURVE FIT

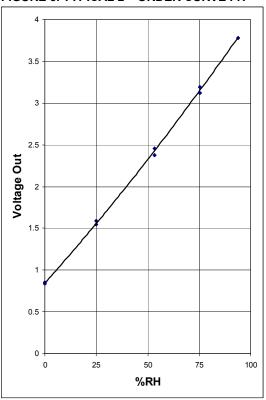

ORDER GUIDE

Catalog Listing	Description
HIH-4000-001	Integrated circuitry humidity sensor,
	0.100 in lead pitch SIP
HIH-4000-002	Integrated circuitry humidity sensor,
	0.050 in lead pitch SIP
HIH-4000-003	Integrated circuitry humidity sensor,
	0.100 in lead pitch SIP with calibration
	and data printout
HIH-4000-004	Integrated circuitry humidity sensor,
	0.050 in lead pitch SIP with calibration
	and data printout

WARNING

MISUSE OF DOCUMENTATION

- The information presented in this product sheet is for reference only. Do not use this document as a product installation guide.
- Complete installation, operation, and maintenance information is provided in the instructions supplied with each product.

Failure to comply with these instructions could result in death or serious injury.



WARNING

PERSONAL INJURY

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

Failure to comply with these instructions could result in death or serious injury.

WARRANTY/REMEDY

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items it finds defective. The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.

While we provide application assistance personally, through our literature and the Honeywell web site, it is up to the customer to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this printing. However, we assume no responsibility for its use.

SALES AND SERVICE

Honeywell serves its customers through a worldwide network of sales offices, representatives and distributors. For application assistance, current specifications, pricing or name of the nearest Authorized Distributor, contact your local sales office or:

E-mail: info.sc@honeywell.com

Internet: www.honeywell.com/sensing

Phone and Fax:

Asia Pacific +65 6355-2828

+65 6445-3033 Fax

Europe +44 (0) 1698 481481

+44 (0) 1698 481676 Fax

Latin America +1-305-805-8188

+1-305-883-8257 Fax

USA/Canada +1-800-537-6945

+1-815-235-6847

+1-815-235-6545 Fax

Automation and Control Solutions

Sensing and Control Honeywell 11 West Spring Street Freeport, Illinois 61032 www.honeywell.com/sensing

