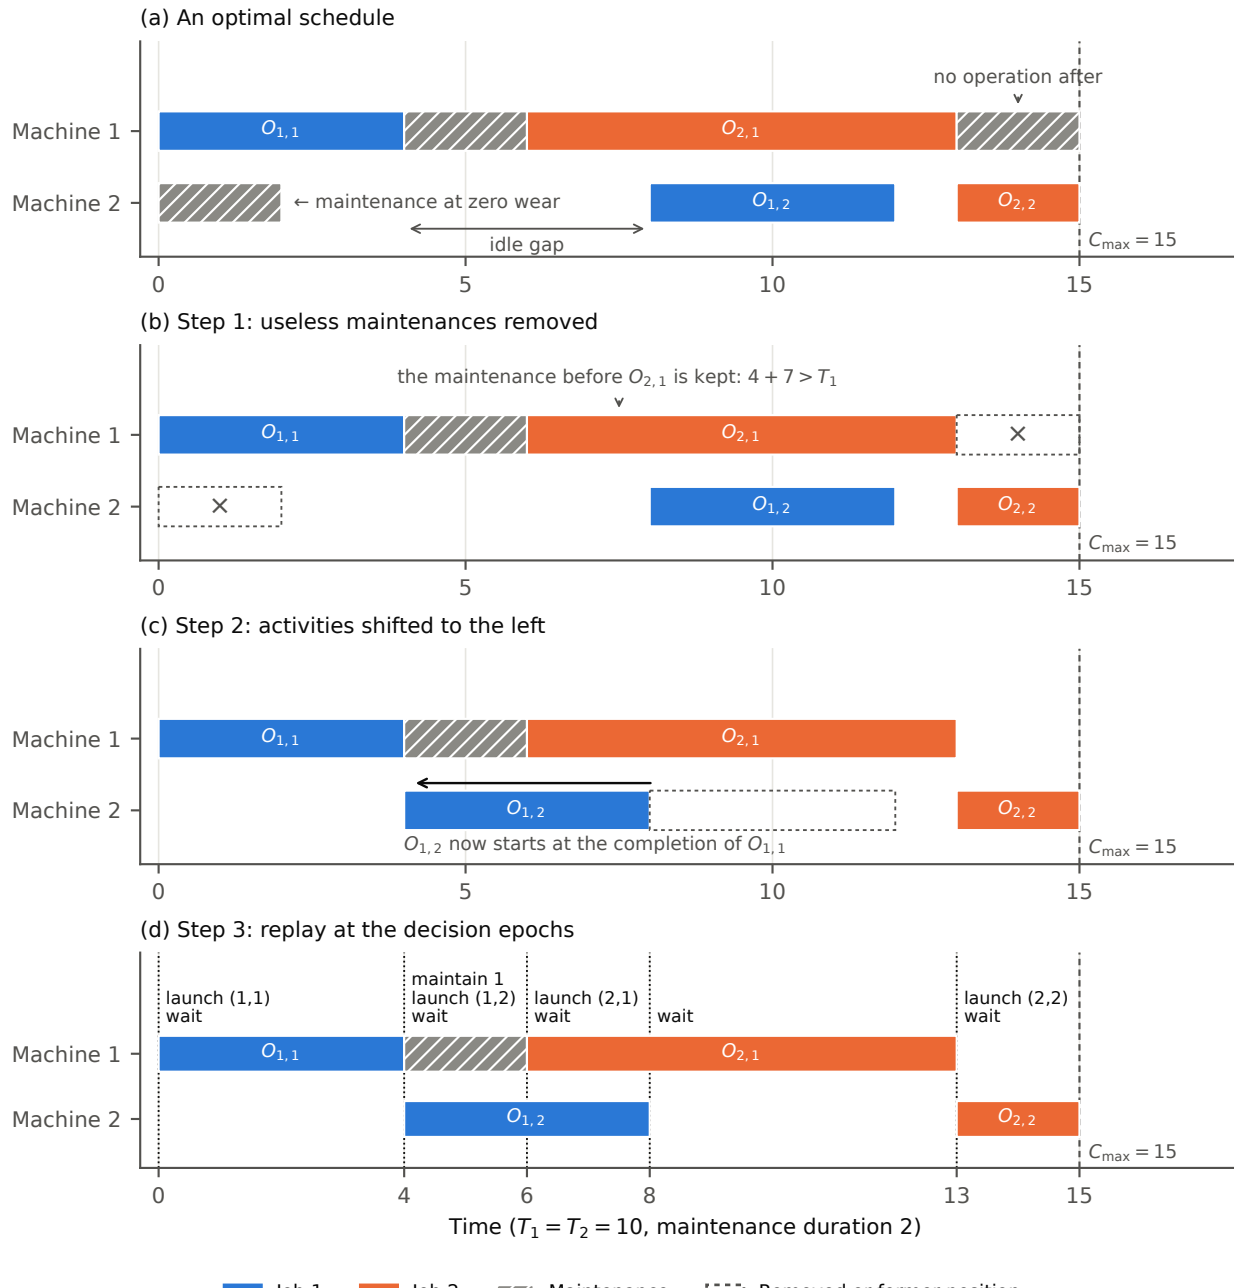
(a) An optimal schedule
Machine 1
Machine 2
$O_{1,1}$
$O_{2,1}$
no operation after
← maintenance at zero wear
$O_{1,2}$
$O_{2,2}$
idle gap
$C_{max} = 15$
0
5
10
15
(b) Step 1: useless maintenances removed
the maintenance before $O_{2,1}$ is kept: $4 + 7 > T_1$
(c) Step 2: activities shifted to the left
$O_{1,2}$ now starts at the completion of $O_{1,1}$
(d) Step 3: replay at the decision epochs
launch (1,1)
wait
maintain 1
launch (1,2)
wait
launch (2,1)
wait
wait
launch (2,2)
wait
Time ($T_1 = T_2 = 10$, maintenance duration 2)
Job 1
Job 2
Maintenance
Removed or former position