

3319 W. Earll Drive, Phoenix, Arizona 85017
 Phone: 800-445-7930 Fax: 602-252-4639
<http://webtrieve.alstribology.com> ****email: aoa@alstribology.com

Customer Name:	GEORGE FAHMY	Tail Number:	N890GF	Comp Serial No:	36H171895
Address:	11 Morera Ln Morgan Hill CA 95037 USA	Aircraft Make:	Vans	Comp Name:	Single Engine
Phone:		Aircraft Model:	RV-7	Comp Make:	Lycoming
Fax:		Serial No:		Comp Model:	O-360
		UIN:	0C270C2		

Sample No.	44150385634	44150376373
SIF No.	AOAA10038381	AOAA10038258
Date Sampled	05-Sep-26	24-Apr-26
Date Tested	16-Sep-26	06-May-26
Oil Brand	Shell	Shell
Oil Type	AeroShell 100	AeroShell 100
Oil Grade	SAE 50	SAE 50
Oil Hrs	25	13
Oil Added		
Hrs Since New		13
Rebuild Hrs		13

Metals (ppm)

Chromium (Cr)	15.70	12.73
Molybdenum (Mo)	<1	<1
Aluminium (Al)	8	10
Iron (Fe)	104.11	24.29
Copper (Cu)	12.85	13.67
Nickel (Ni)	3	2
Tin (Sn)	2	2
Lead (Pb)	1490.41	600.42
Silver (Ag)	<1	<1
Titanium (Ti)	<1	<1

Contaminants (ppm)

Silicon (Si)	22	28
Water (%)	<0.05	<0.05

Additives (ppm)

Magnesium (Mg)	2	3
Calcium (Ca)	4	11
Phosphorus (P)	14	90
Zinc (Zn)	7	20
Boron (B)	<5	<5

Physical Tests

Viscosity (cSt 100C)	20.7	20.4
PQ Index	10	<10

LEGEND



Sample No.


Diagnosis/Recommendations

44150385634

Engine time unknown. Wear metals appear high for oil time. Abrasive and other contaminant levels are acceptable. Viscosity within specified operating range. Action: Check oil filter for chips. Resample next oil change to check wear trend.

44150376373

No abnormal wear detected for new engine. Abrasive and other contaminant levels are acceptable. Viscosity within specified operating range. Action: Resample next recommended service interval to further monitor.

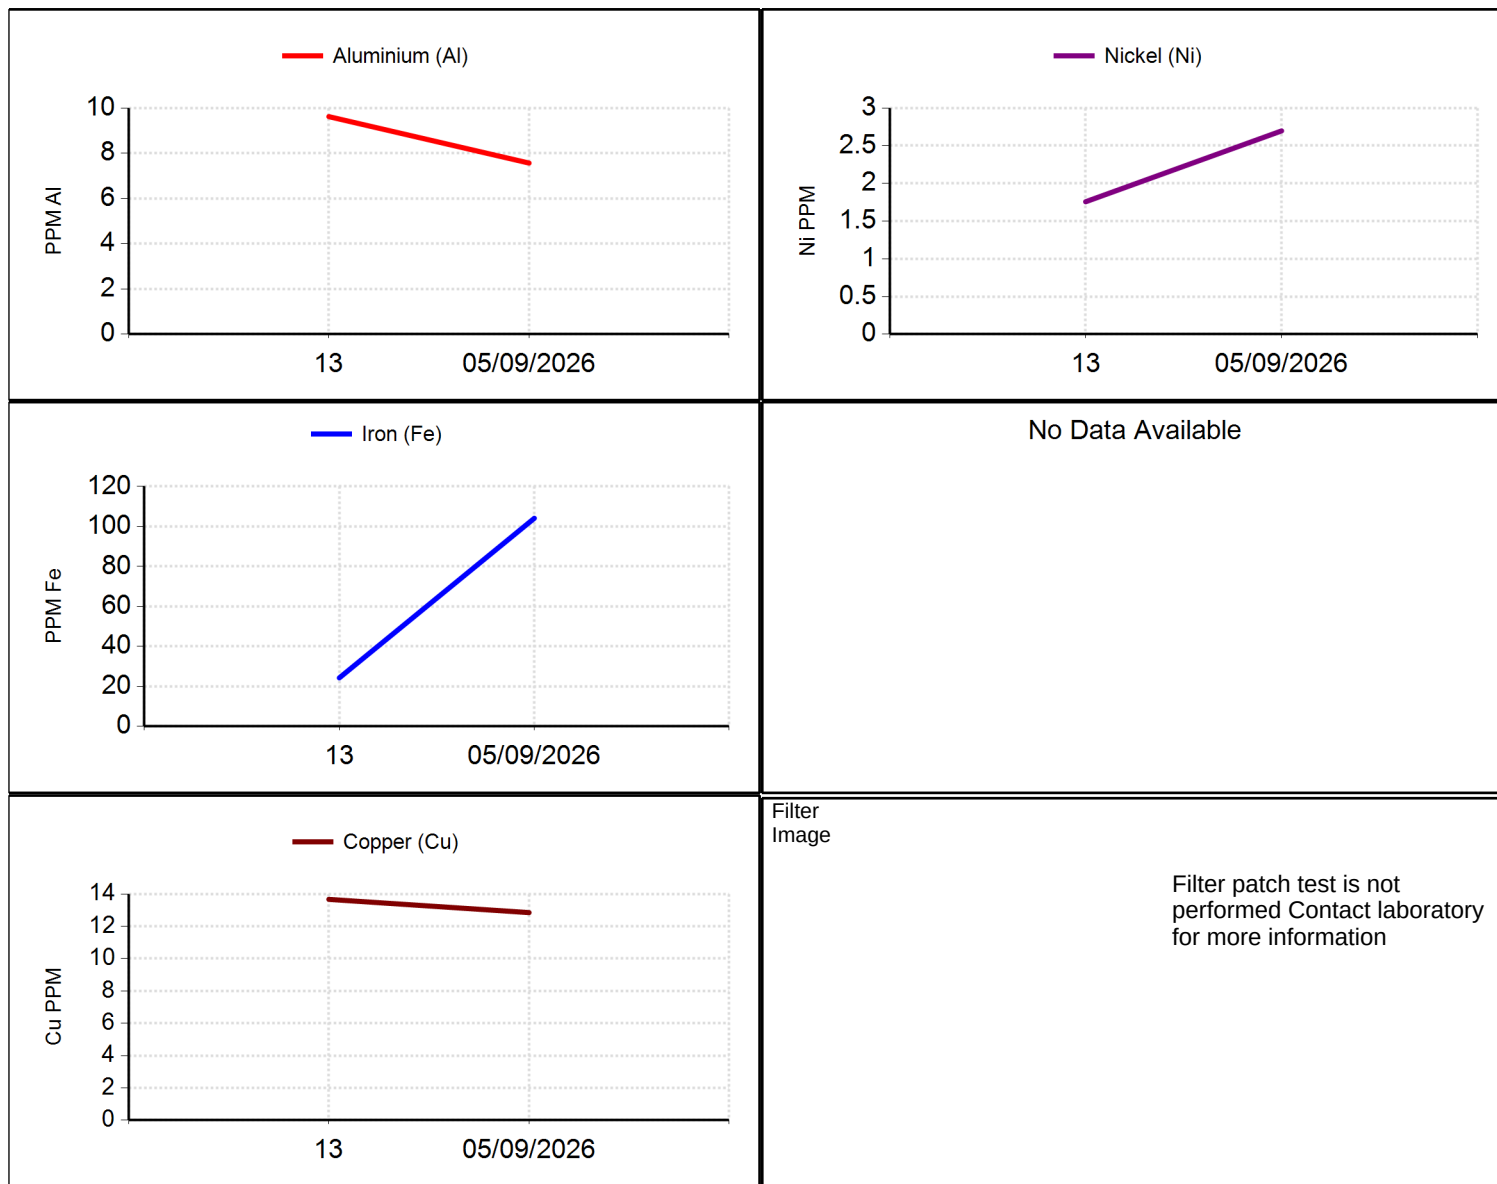

Since services are based on samples and information supplied by others, and since corrective actions, if any, are necessarily taken by others, these services are rendered without any warranty or liability of any kind beyond the actual amount paid to ALS Laboratory group for the services. Reported recommendations are based on interpretations of the generated test results and historical data. Certain test results appearing in this report may have been tested at other ALS laboratories within the Tribology divisional network.

George Fahmy
Attn: George Fahmy
11 Morera Ln
Morgan Hill CA 95037
USA

**TEST
METHODS:**

Acid Number:	ASTM D974/D664
ICP:	ASTM D5185
Viscosity:	ASTM D445 / D7279
Water by Crackle:	ASTM E203 Mod / In House

0037 v1.10