



ElementOne

Troubleshooting Guide

Version 1.31.2

July 2026

Contents

Chapter 1. Copyright.....	3
Chapter 2. Introduction.....	4
Chapter 3. Troubleshooting.....	5
Unable to Browse ElementOne Web Console.....	5
Unable to Register Devices with ElementOne.....	8
Unable to Synchronize Devices with ElementOne.....	14
Unable to Update Components on a Device with ElementOne.....	20
Unable to Update Components on ElementOne.....	28
ElementOne Service has Failed (Result: exit-code).....	31
Unable to Upload SSL Certificate to ElementOne.....	34
Unable to Activate or Renew Licenses on ElementOne.....	35
Chapter 4. Report Issues to TXOne.....	40
Chapter 5. Contact Us.....	46

Chapter 1. Copyright

TXOne Networks Incorporated reserves the right to make changes to this document and to the product described herein without notice. Before installing and using the product, review the readme files, release notes, and/or the latest version of the applicable documentation, which are available at <https://help.txone.com/> and <https://my.txone.com/>.

TXOne Networks, TXOne Portable Inspector, TXOne Virtual Portable Inspector, TXOne ElementOne, and TXOne Safe Port are registered trademarks of TXOne Networks Incorporated. All other product names may be trademarks or registered trademarks of their owners.

Copyright ©2026 TXOne Networks Incorporated. All rights reserved. No part of this publication may be reproduced, photocopied, stored in a retrieval system, or transmitted without the express prior written consent of TXOne Networks Incorporated.

Chapter 2. Introduction

This troubleshooting guide provides instructions on how to troubleshoot issues in ElementOne.

Chapter 3. Troubleshooting


Unable to Browse ElementOne Web Console

If you are unable to browse the ElementOne web console, you can follow the steps below to troubleshoot.

1. Reload the browser

Reload the browser or try to browse ElementOne later.

You can click the command button or the encircled icon to reload the browser.

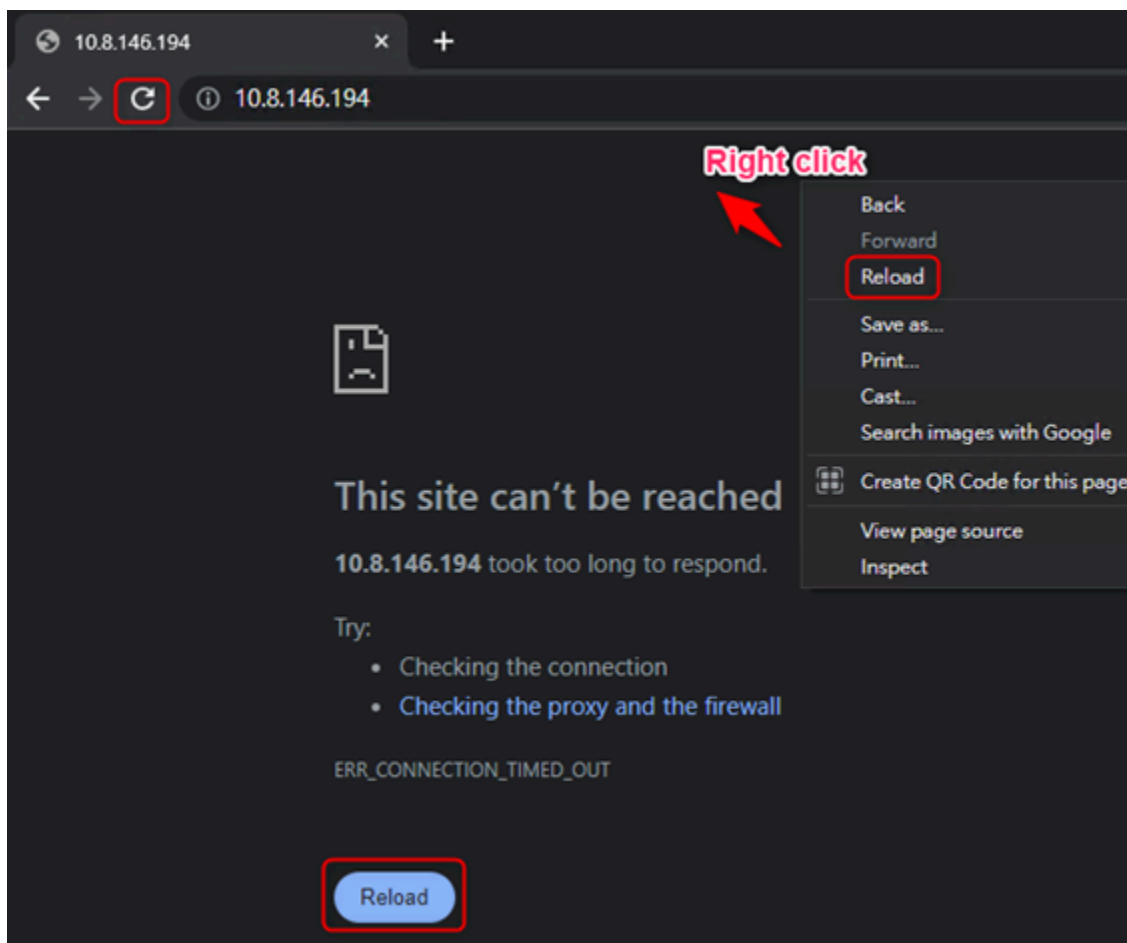

2. Check network status

1. Check ElementOne environment.

You can check the ElementOne service on Vshell.

```

$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25   IP: 192.168.3.178      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068f1d-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1

```


The interface status is up and has expected ip address.

ElementOne service is active (running).

a. Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then activate the virtual machine.

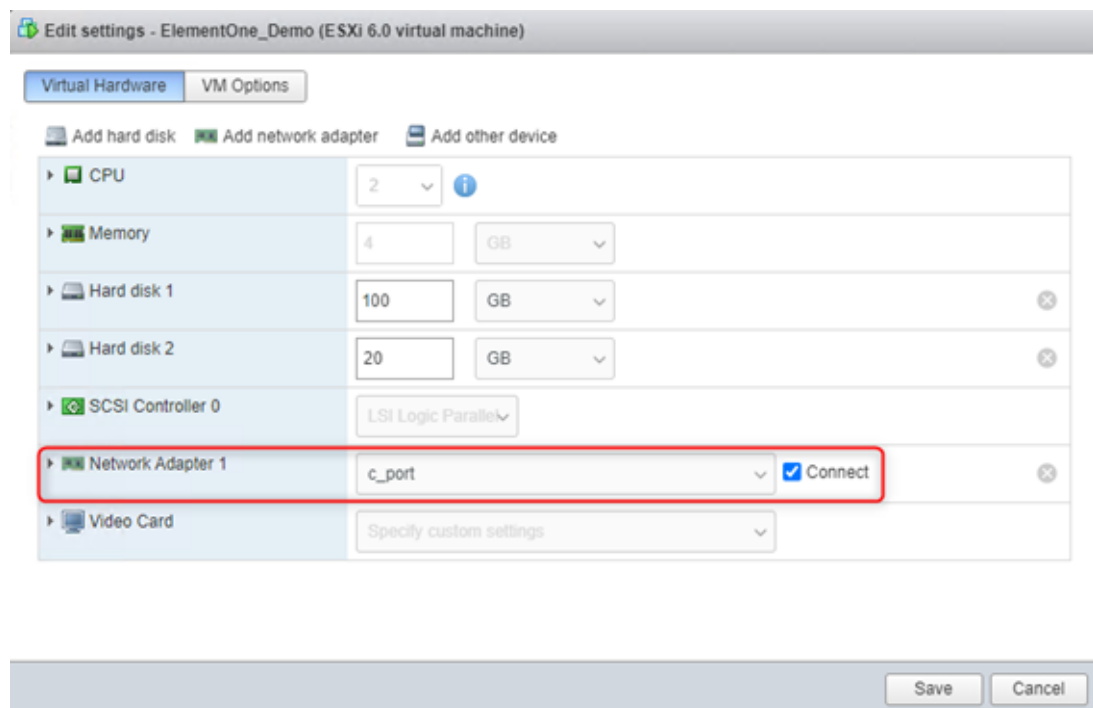

b. ElementOne service

If ElementOne service is not 'active (running)', you can refer to the following topic to troubleshoot.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

2. Ensure the network between client and ElementOne is connected.

You can test the client reachability on Vshell.

- Destination is reachable

```
$ ping -t 192.168.3.121
PING 192.168.3.121 (192.168.3.121) 56(84) bytes of data.
64 bytes from 192.168.3.121: icmp_seq=1 ttl=64 time=0.453 ms
64 bytes from 192.168.3.121: icmp_seq=2 ttl=64 time=0.279 ms
64 bytes from 192.168.3.121: icmp_seq=3 ttl=64 time=0.236 ms

--- 192.168.3.121 ping statistics ---
3 packets transmitted, 3 received, 0% packet loss, time 2028ms
rtt min/avg/max/mdev = 0.236/0.322/0.453/0.093 ms
```

- Destination is unreachable

```
$ ping -t 192.168.3.120
PING 192.168.3.120 (192.168.3.120) 56(84) bytes of data.
From 192.168.3.158 icmp_seq=1 Destination Host Unreachable
From 192.168.3.158 icmp_seq=2 Destination Host Unreachable
From 192.168.3.158 icmp_seq=3 Destination Host Unreachable

--- 192.168.3.120 ping statistics ---
3 packets transmitted, 0 received, +3 errors, 100% packet loss, time 2031ms
pipe 3
exit status 1
```

3. Check if the web console port, which is 443, is blocked.

If the web console port (TCP/443) is blocked, contact the network administrator to ensure that port 443 is unblocked.

3. Report issues to TXOne

If you are still unable to browse the ElementOne web console, go to the link below to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

Unable to Register Devices with ElementOne

When you are unable to register your device with ElementOne, you can take the steps below to troubleshoot.

1. Check the product

	Products
Can register with ElementOne	• Portable Inspector • Portable Inspector Pro • Safe Port

2. Check network status

1. Check ElementOne environment.

You can check the ElementOne service on Vshell.

```

$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25  IP: 192.168.3.178      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068f1d-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1

```


The interface status is up and has expected ip address.

ElementOne service is active (running).

a. Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then activate the virtual machine.

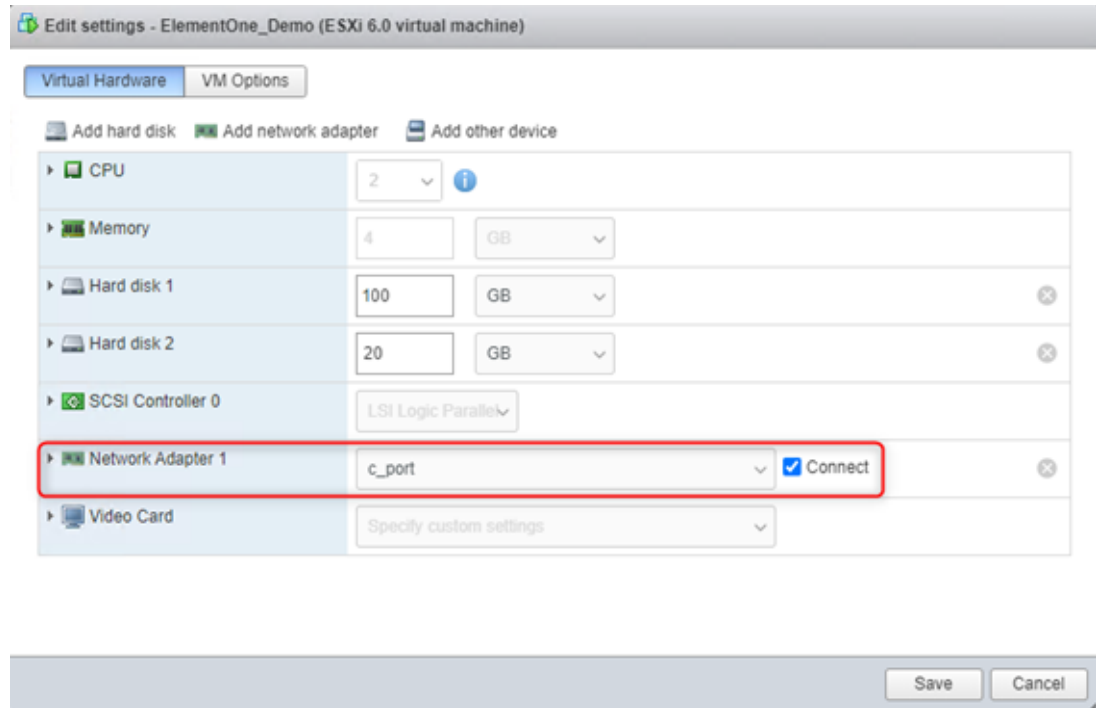

b. ElementOne service

If the ElementOne service is not 'active (running)', you can refer to the following link to troubleshoot it.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

2. Ensure the network between the client and ElementOne is connected.

You can test the client reachability on Vshell.

- Destination is reachable

```
$ ping -t 192.168.3.121
PING 192.168.3.121 (192.168.3.121) 56(84) bytes of data.
64 bytes from 192.168.3.121: icmp_seq=1 ttl=64 time=0.453 ms
64 bytes from 192.168.3.121: icmp_seq=2 ttl=64 time=0.279 ms
64 bytes from 192.168.3.121: icmp_seq=3 ttl=64 time=0.236 ms

--- 192.168.3.121 ping statistics ---
3 packets transmitted, 3 received, 0% packet loss, time 2028ms
rtt min/avg/max/mdev = 0.236/0.322/0.453/0.093 ms
```

- Destination is unreachable

```
$ ping -t 192.168.3.120
PING 192.168.3.120 (192.168.3.120) 56(84) bytes of data.
From 192.168.3.158 icmp_seq=1 Destination Host Unreachable
From 192.168.3.158 icmp_seq=2 Destination Host Unreachable
From 192.168.3.158 icmp_seq=3 Destination Host Unreachable

--- 192.168.3.120 ping statistics ---
3 packets transmitted, 0 received, +3 errors, 100% packet loss, time 2031ms
pipe 3
exit status 1
```

3. Make sure the device port is not blocked.

The default device port is TCP 3030. You can check the device port on Vshell.

Then contact the network administrator to make sure that the device port is not blocked.

```
$ elementone deviceport show
Device port: 3030
```

4. Restart ElementOne service.

After updating the device port, the ElementOne service needs to be restarted for the changes to take effect.

The devices cannot be registered to ElementOne until the ElementOne service is restarted.

You can restart the ElementOne service on Vshell.


```
$ elementone deviceport update -p 2222
Restart the ElementOne service to take effect.

$ elementone service restart
Active: active (running) since Fri 2023-09-22 04:12:49 UTC; 4ms ago
```

3. Check registration information

1. Check the registration information to see if it is correct.


If a user regenerates the password on ElementOne, the previous password cannot be used to register the device.

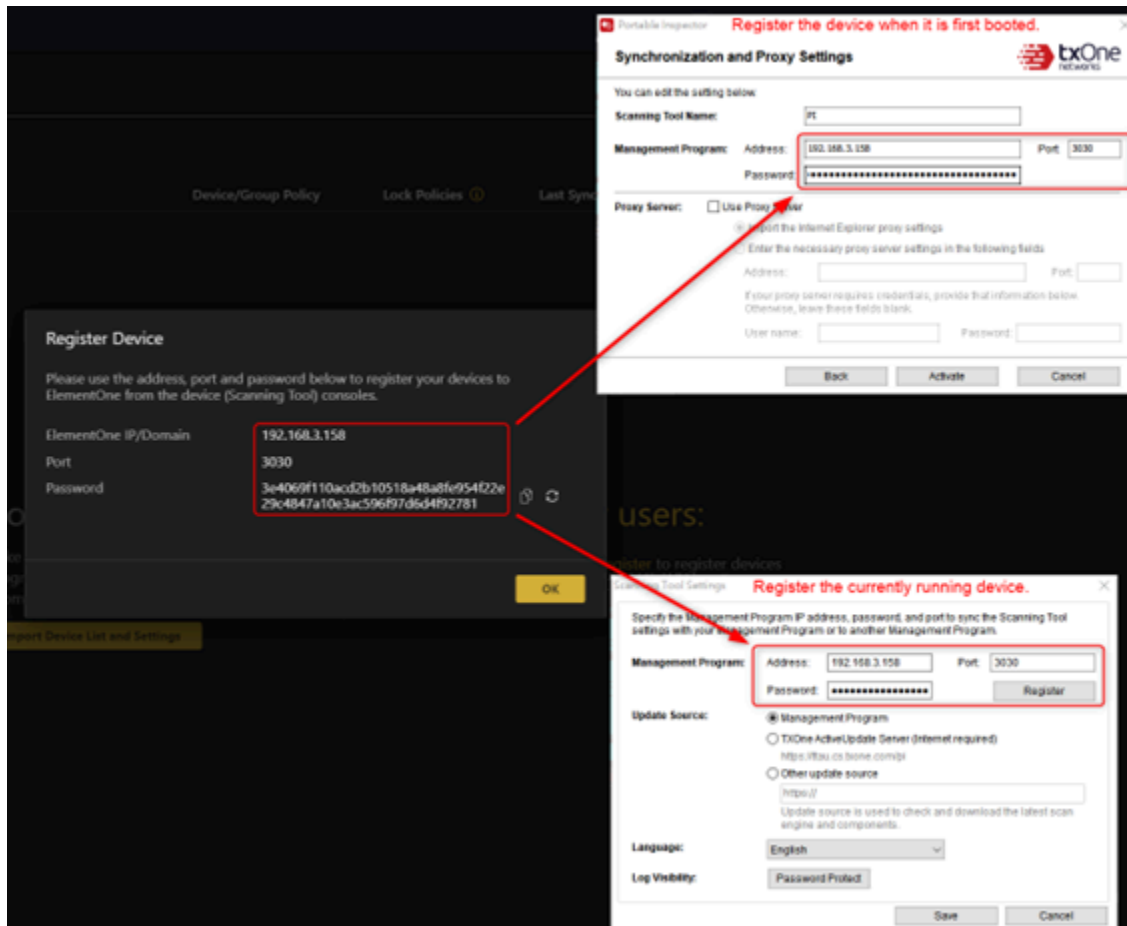

2. Check the product license on ElementOne.

Before registering a device with ElementOne, ensure that the license has been activated and is not expired on ElementOne.

- Register Portable Inspector with ElementOne.

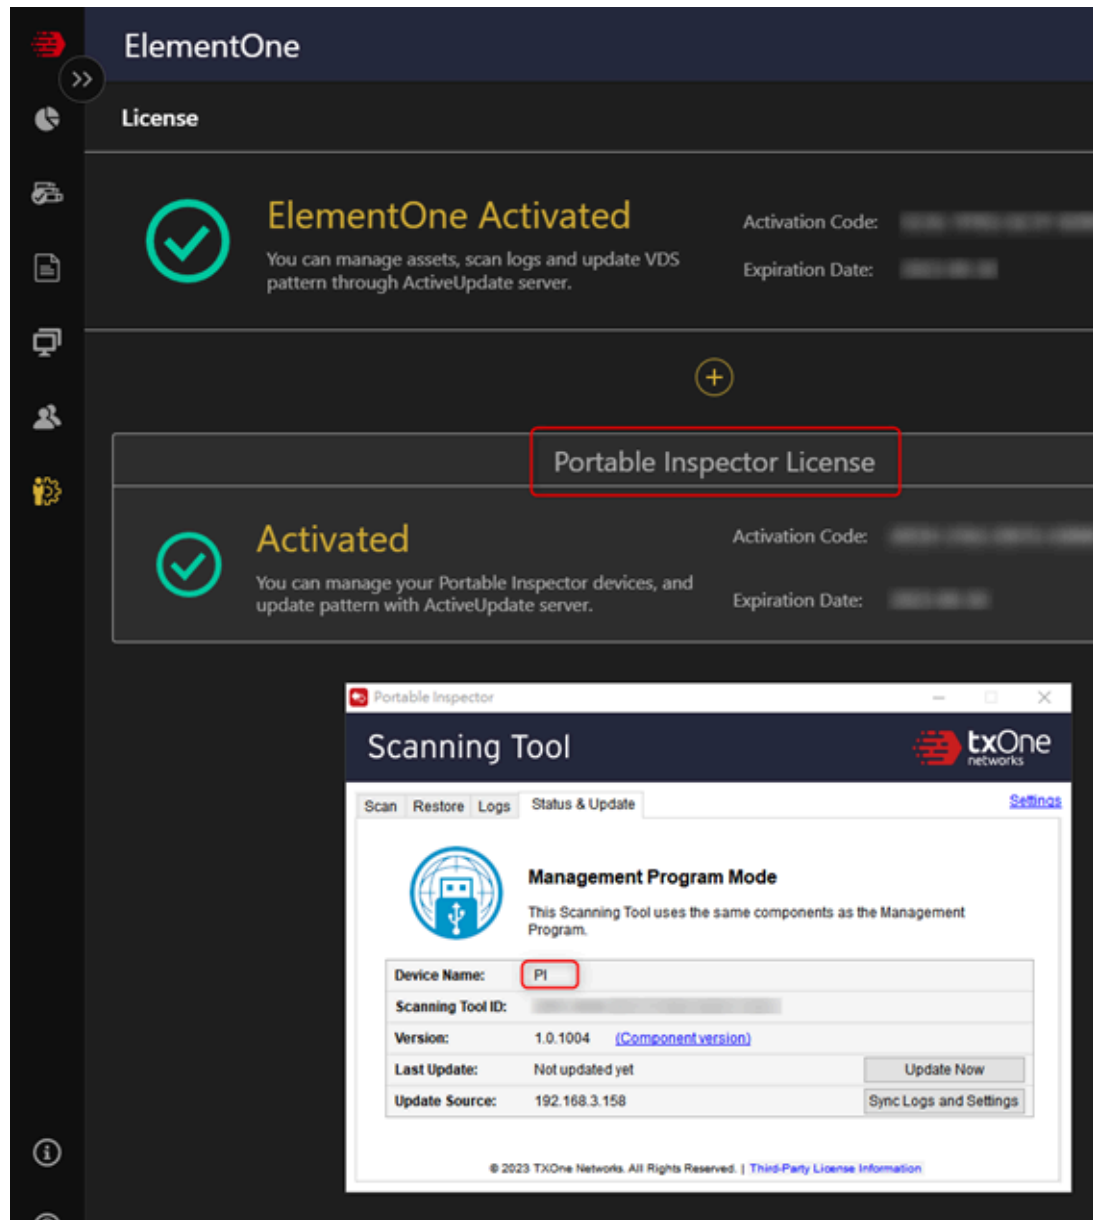

- Register Portable Inspector Pro with ElementOne.

The image shows the ElementOne web interface and a screenshot of the Portable Inspector application.


ElementOne License Page:

- ElementOne Activated:** You can manage assets, scan logs and update VDS pattern through ActiveUpdate server. Activation Code: [redacted], Expiration Date: [redacted].
- Portable Inspector Pro License:** (Highlighted with a red box)
- Activated:** You can manage your Portable Inspector Pro devices, and update pattern with ActiveUpdate server. Activation Code: [redacted], Expiration Date: [redacted].

Portable Inspector Scanning Tool:

- Management Program Mode:** This Scanning Tool uses the same components as the Management Program.
- Device Name:** PI Pro (Highlighted with a red box)
- Scanning Tool ID:** [redacted]
- Version:** 1.0.1004 (Component version)
- Last Update:** Not updated yet
- Update Source:** 192.168.3.158
- Buttons:** Update Now, Sync Logs and Settings
- Footer:** © 2023 TXOne Networks. All Rights Reserved. | Third-Party License Information

- Register Safe Port with ElementOne.

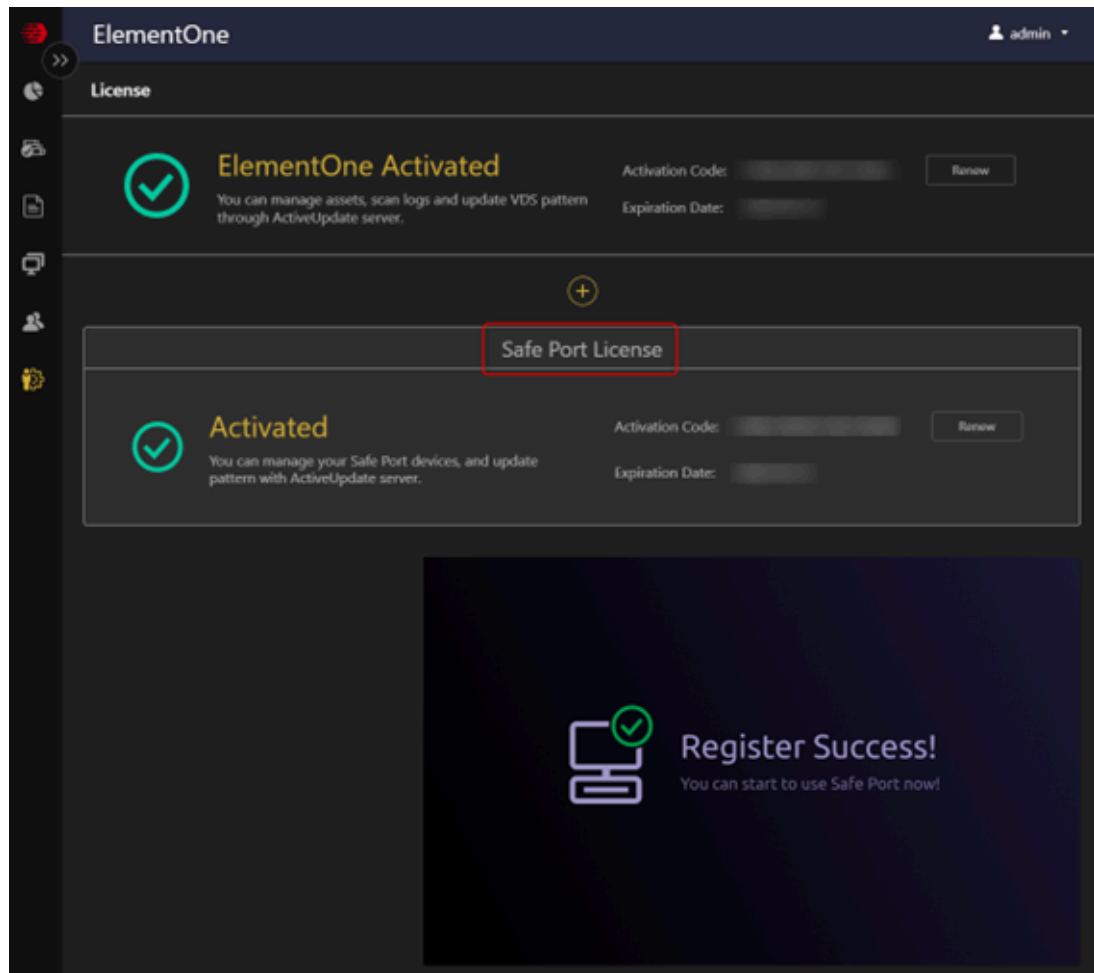

4. Report issues to TXOne

If you are still unable to register devices with ElementOne, go to the link below to report the issue to us.


[Report Issues to TXOne \(on page 40\)](#)

Unable to Synchronize Devices with ElementOne

If you are unable to synchronize your device with ElementOne, you can follow the steps below to troubleshoot.

1. Check if the device is registered on ElementOne

Check if the update source is set to ElementOne's IP address and verify if the device is successfully registered on ElementOne.

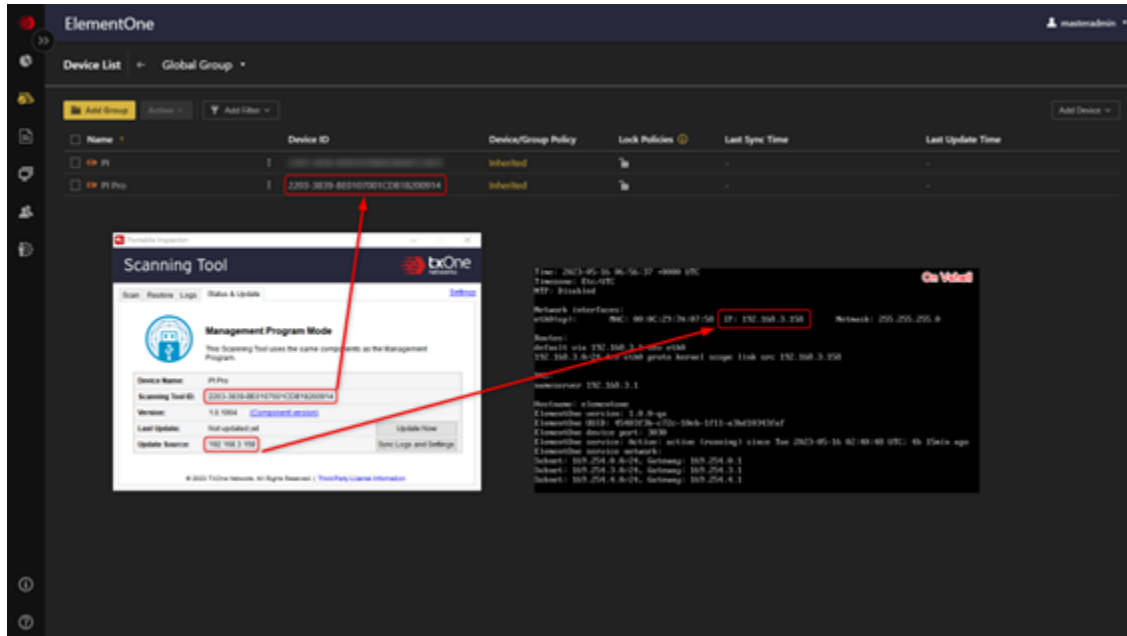

Here are some situations where the device needs to be registered with ElementOne again:

- The device has been reset to factory.

Performing reset to factory on the device will not erase the device from ElementOne.


However, it will purge the settings on the device, including the certificate required for communicating with ElementOne.

The device will need to register itself with ElementOne again in order to obtain the certificate.


2. Check the license

Before synchronizing the device with ElementOne, ensure that the license has been activated and is not expired on ElementOne.

- Register Portable Inspector with ElementOne.

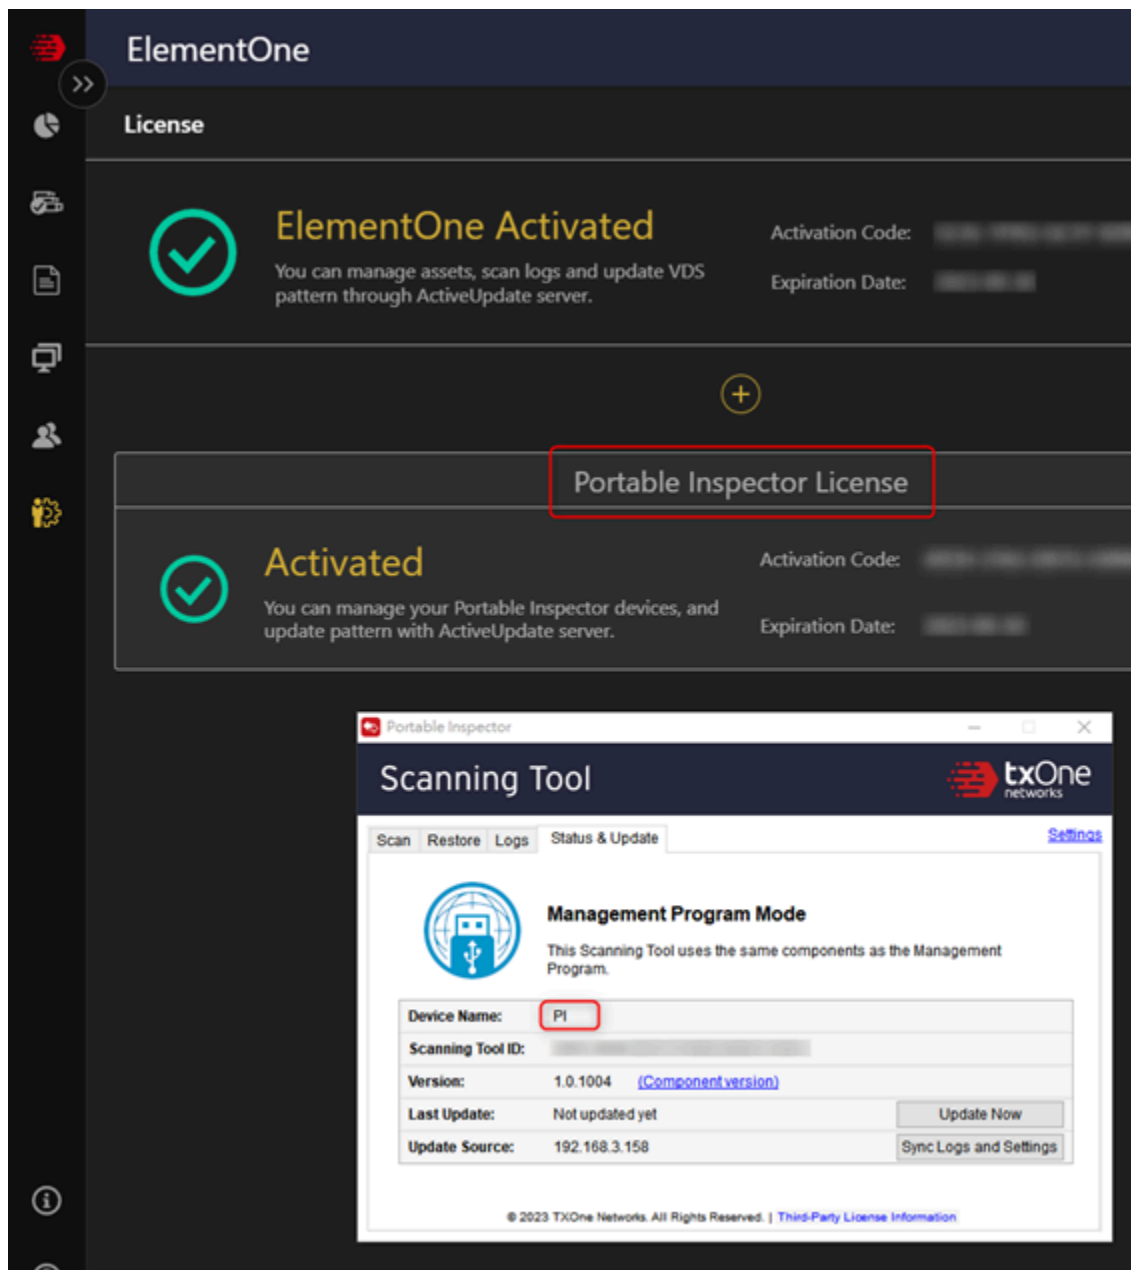


- Register Portable Inspector Pro with ElementOne.

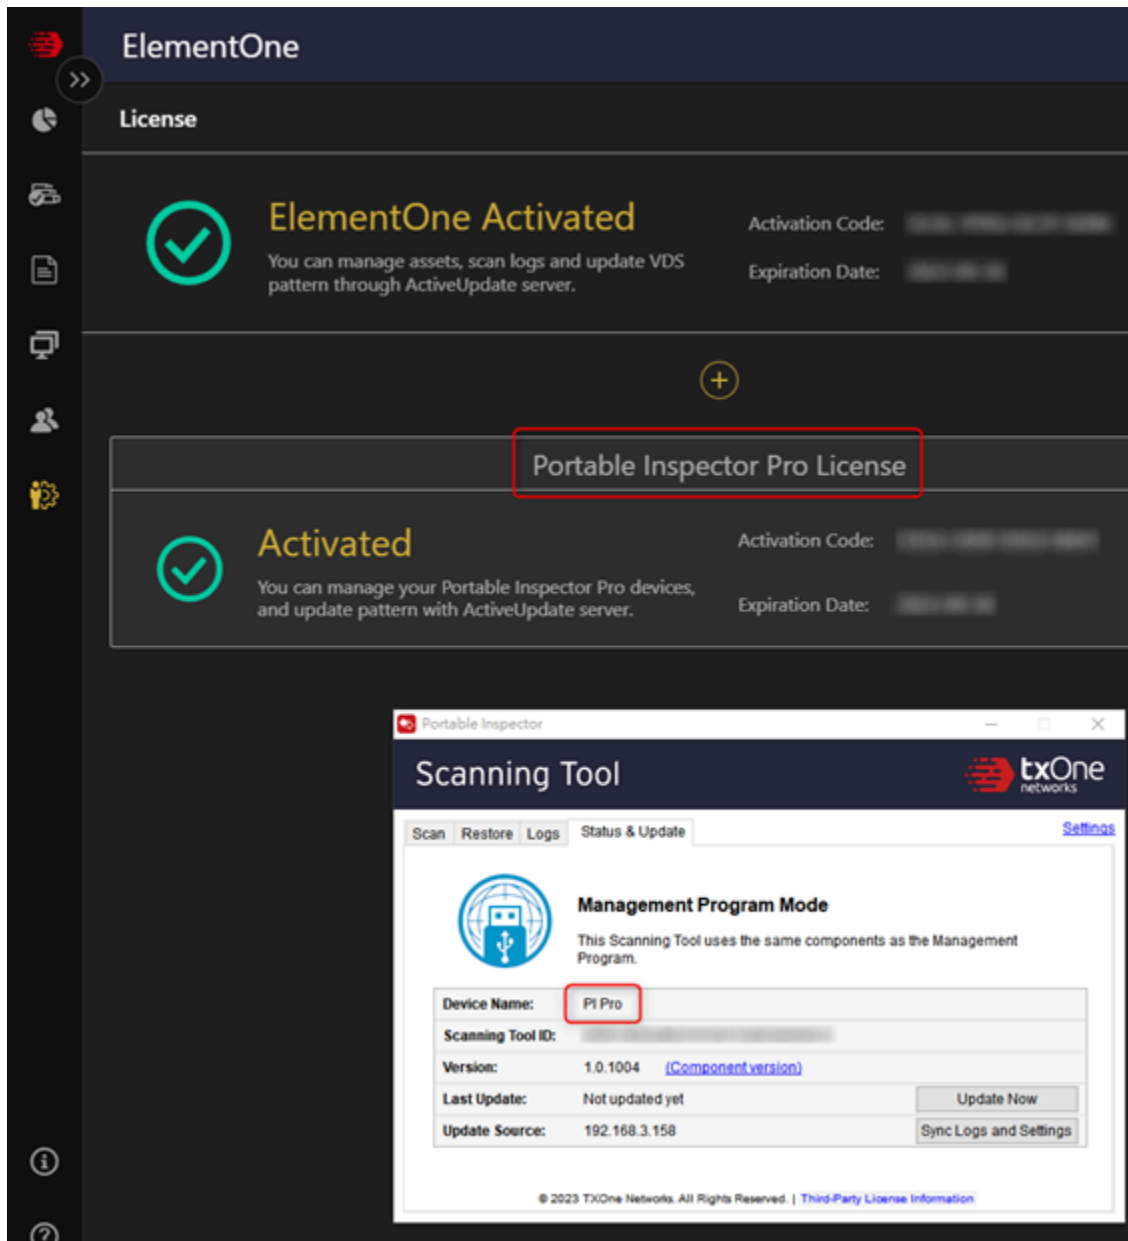

3. Check the system time on the host

The host, to which the device is plugged, has a system time. If that system time falls outside the valid period of the certificate on ElementOne, the device will be unable to synchronize with ElementOne.

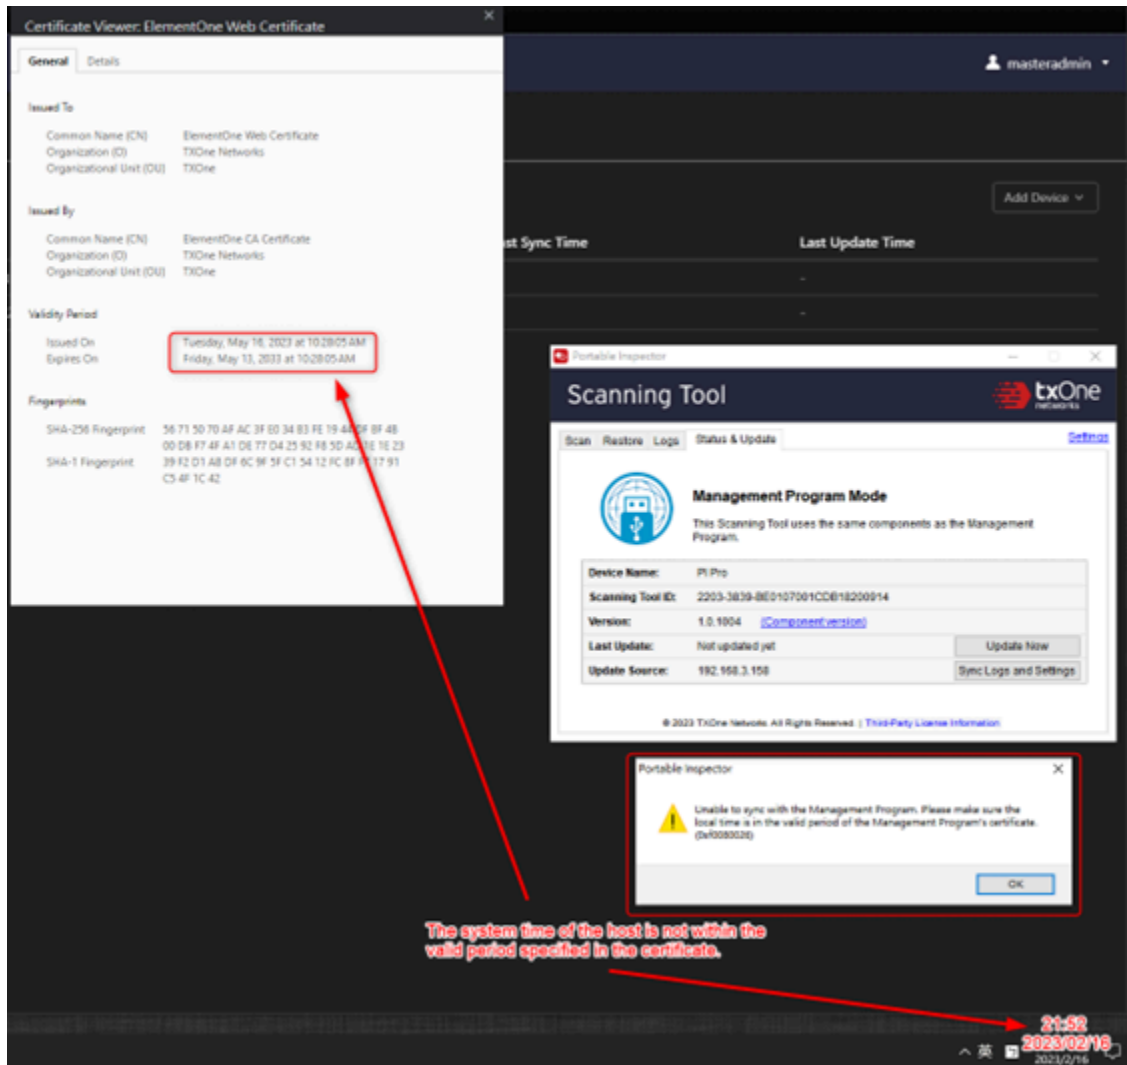

4. Check the network status

1. Check ElementOne environment.

You can check the ElementOne service on Vshell.

```

$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25   IP: 192.168.3.178      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068fid-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1

```

The interface status is up and has expected ip address.

ElementOne service is active (running).

a. Time

If the user sets the time manually during the OOBIE, and the manually set time does not match the current UTC time, ElementOne will generate certificates according to the manually set time.

To resolve this issue, the user must create a new ElementOne virtual machine (VM) and complete the OOBIE process with the correct system time.

Additionally, ensure that the host machine also has the correct system time.


Usually, the validity period of the web console certificate and the device certificate is the same. Therefore, if the user has not performed the 'import certificate' function on ElementOne, you can check the web console certificate to determine the validity period of the certificate for device registration.

To check the certificate for device registration, you can find the information is included in the debug file.

b. Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then re-activate the virtual machine.

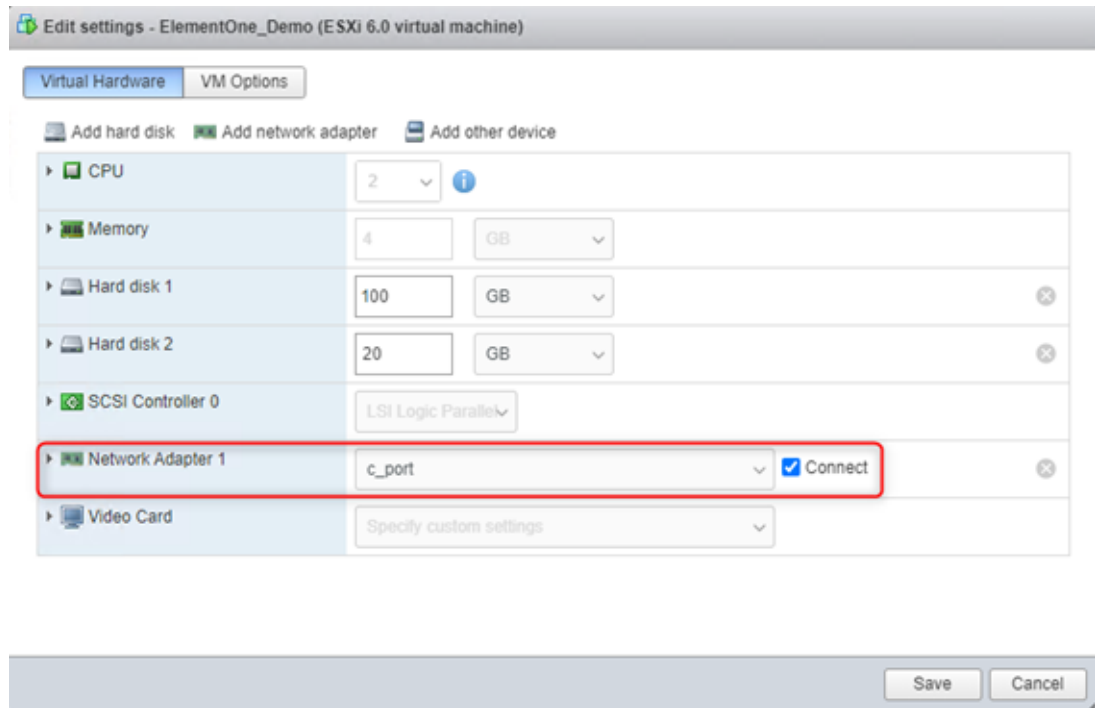

c. ElementOne service

If the ElementOne service is not 'active (running)', you can refer to this link to troubleshoot it.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

5. Report issues to TXOne

If you are still unable to synchronize devices with ElementOne, refer to this topic to report the issue to us.


[Report Issues to TXOne \(on page 40\)](#)

Unable to Update Components on a Device with ElementOne

If you are unable to update components on a device with ElementOne, you can follow the steps below to troubleshoot.

1. Check if the device is registered on ElementOne.

Check if the update source is set to ElementOne's IP address and verify if the device is successfully registered on ElementOne.

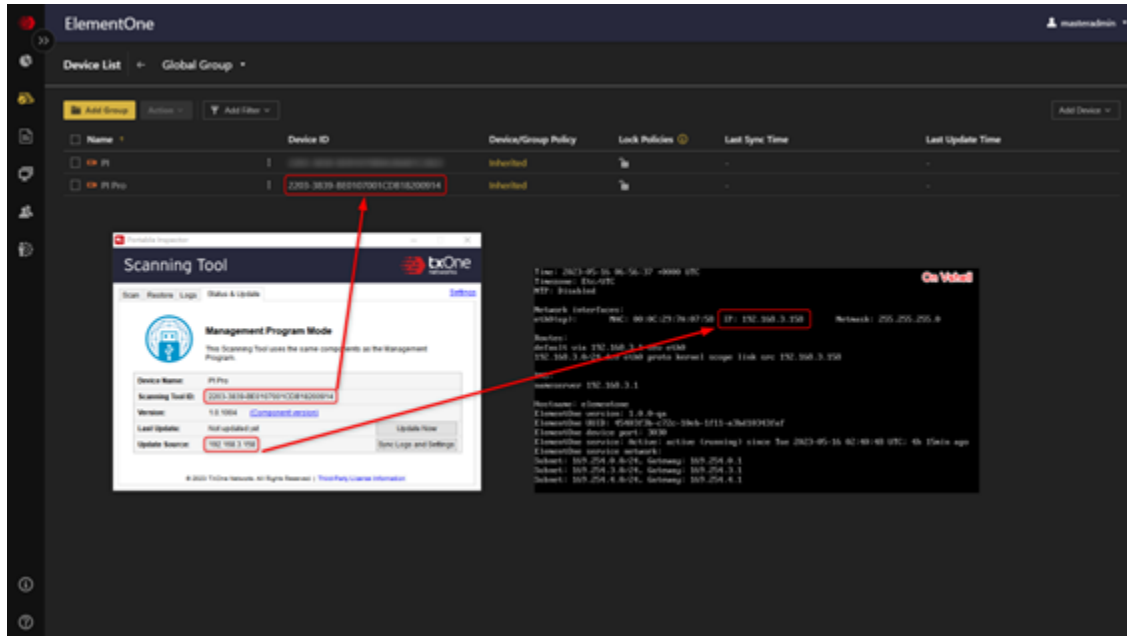

Here are some situations where the device needs to be registered with ElementOne again:

- The device has been reset to factory.

Performing reset to factory on the device will not erase the device from ElementOne.


However, it will purge the settings on the device, including the certificate required for communicating with ElementOne.

The device will need to register again with ElementOne to obtain the certificate.


2. Check the license

Before updating components on a device with ElementOne, ensure that the license has been activated and is not expired on ElementOne.

- Register Portable Inspector with ElementOne.

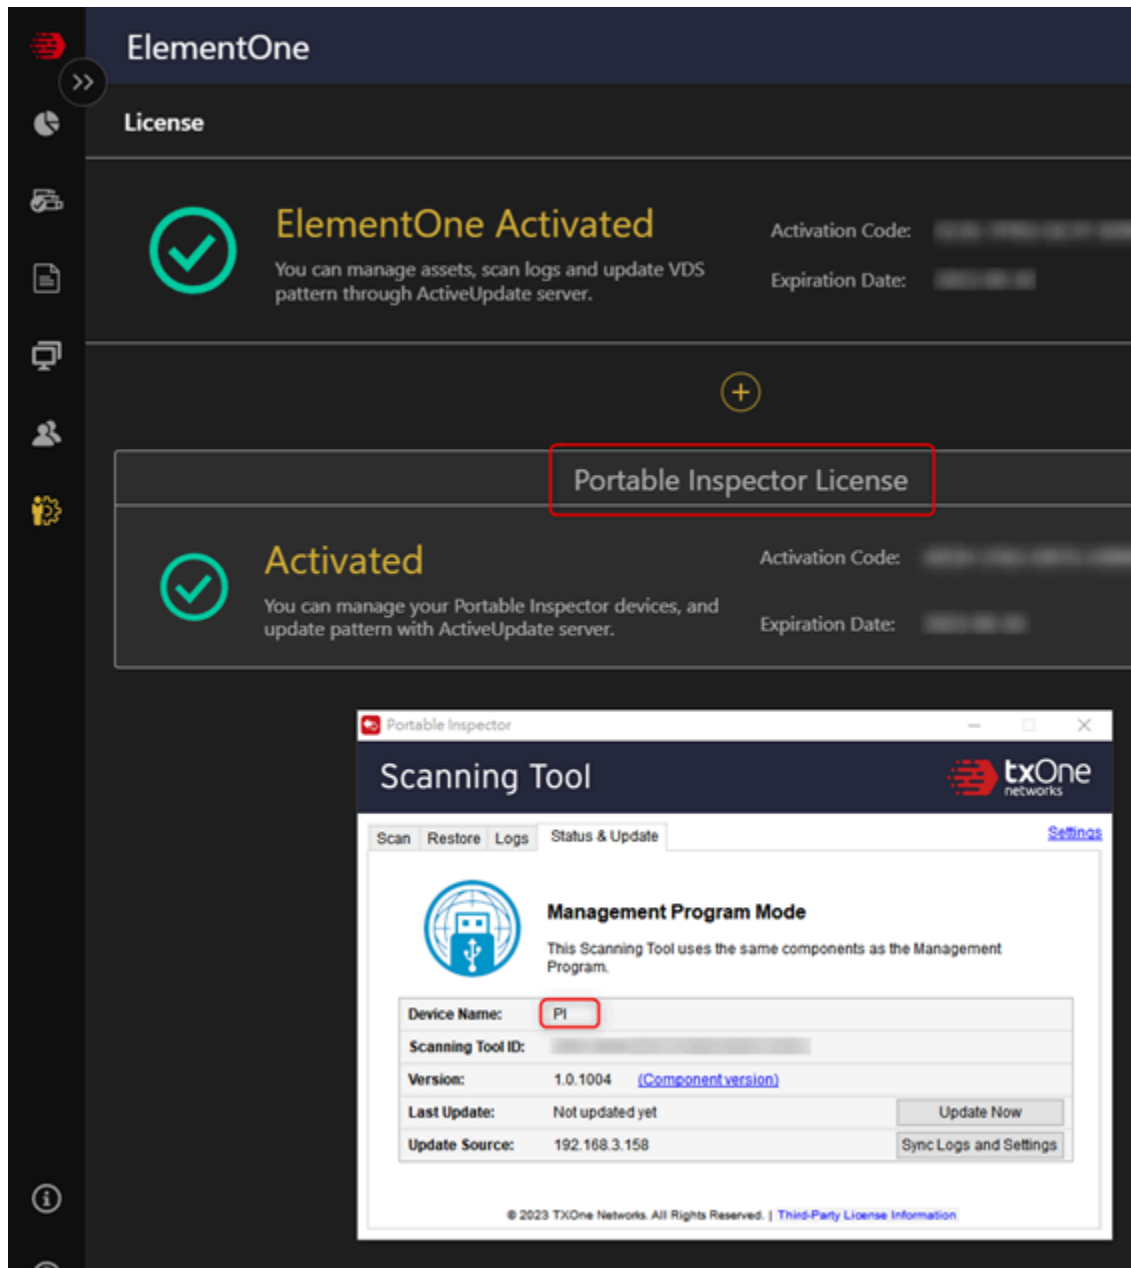


- Register Portable Inspector Pro with ElementOne.

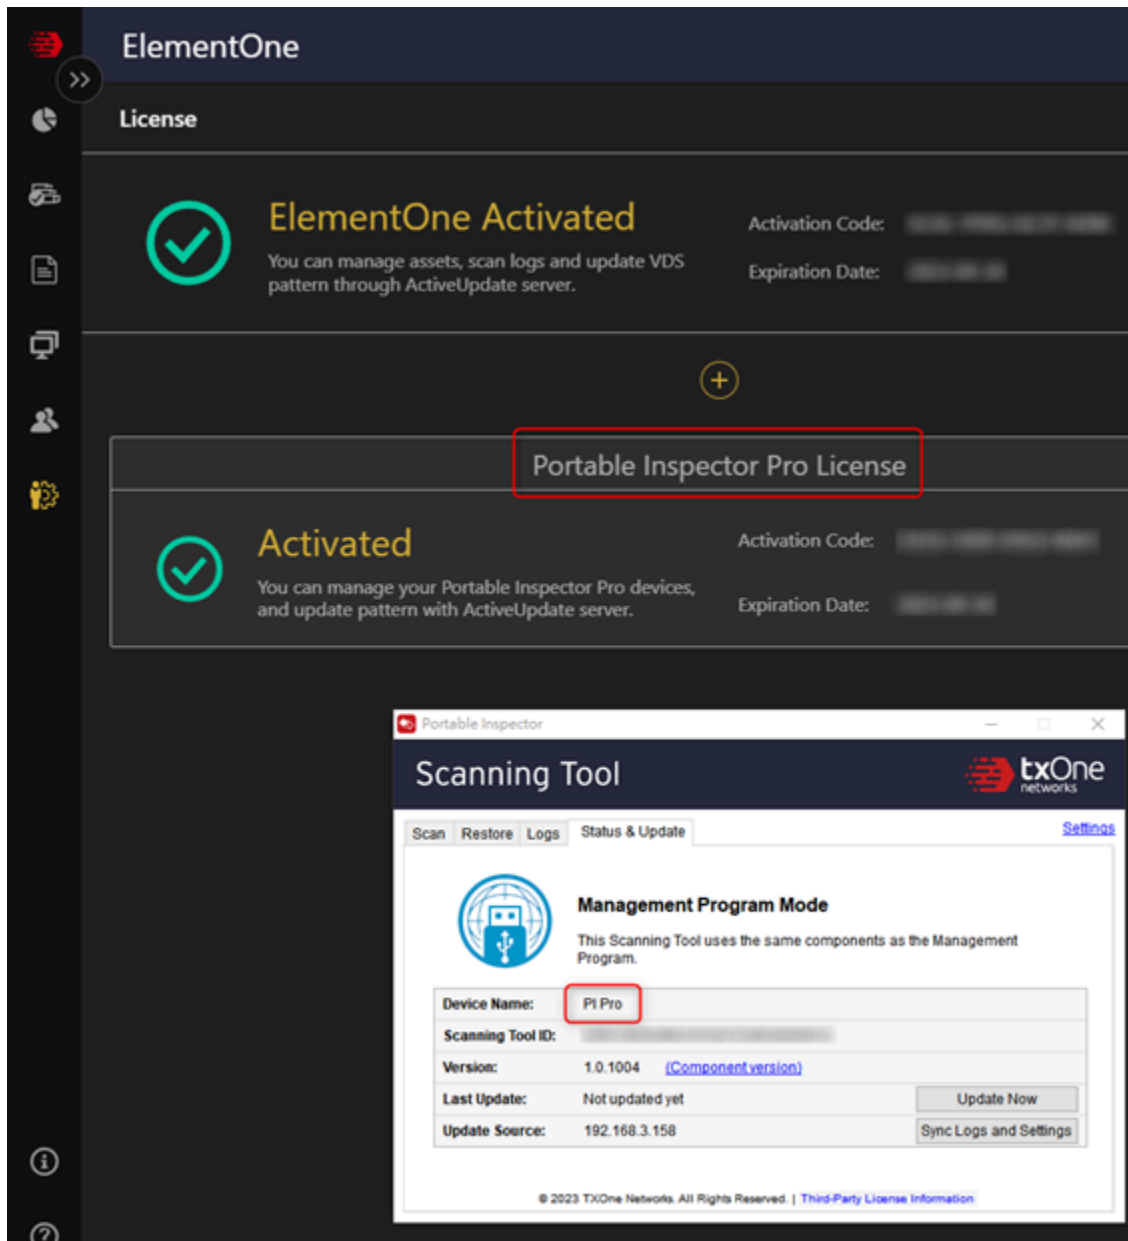

3. Check the system time on the host

The host, to which the device is plugged, has a system time. If that system time falls outside the valid period of the certificate on ElementOne, the device will be unable to synchronize with ElementOne.

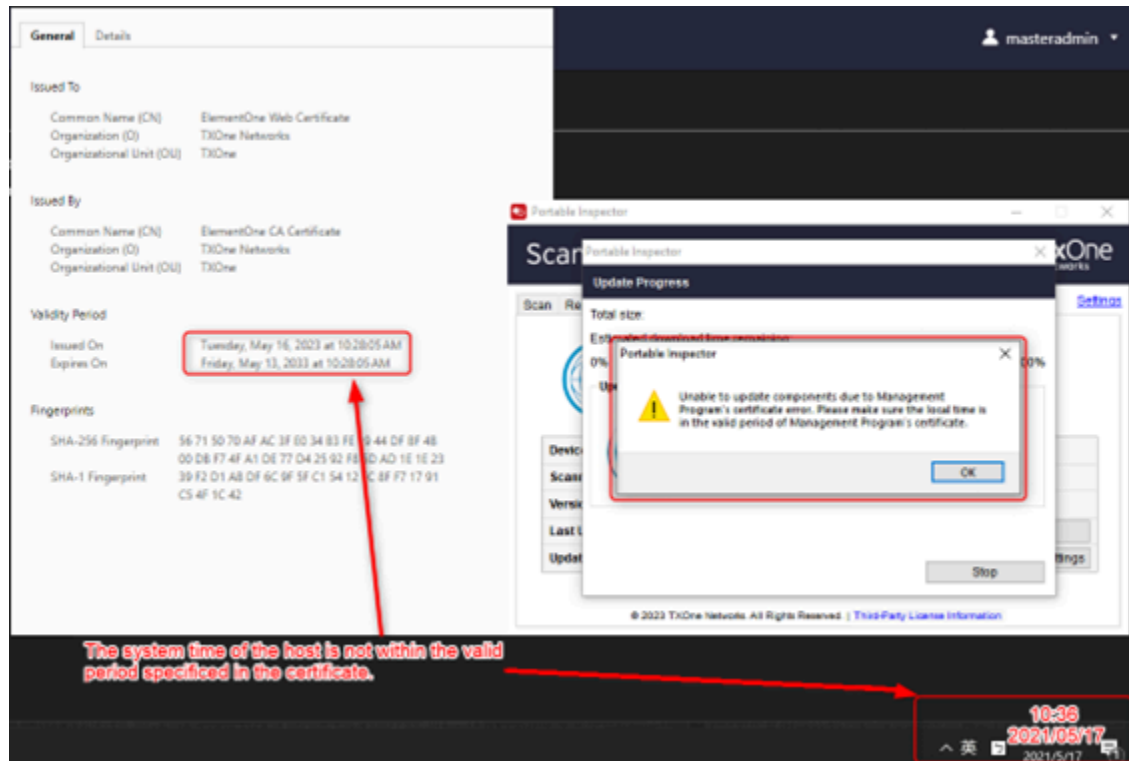

4. Check the network status

1. Check ElementOne environment.

You can check the ElementOne service on Vshell.

```
$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25  IP: 192.168.3.178      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068f1d-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1
```

NTP is enabled, and it reflects the current time.

The interface status is up and has expected ip address.

ElementOne service is active (running).

- Time

If the user sets the time manually during the OOB, and the manually set time does not match the current UTC time, ElementOne will generate certificates with the manually set time.

To resolve this issue, the user must create a new ElementOne virtual machine (VM) and complete the OOB process with the correct system time.

Additionally, ensure that the host machine also has the correct system time.

Usually, the valid period of the web console certificate and the device certificate is the same. Therefore, if the user has not performed the 'import certificate' function on ElementOne, you can check the web console certificate to determine the valid period of the certificate for device registration.

To check the certificate for device registration, you can find the information in the debug file.


To collect the debug file, you can refer to this topic and send it to us.

[Report Issues to TXOne \(on page 40\)](#)

- Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then activate the virtual machine.

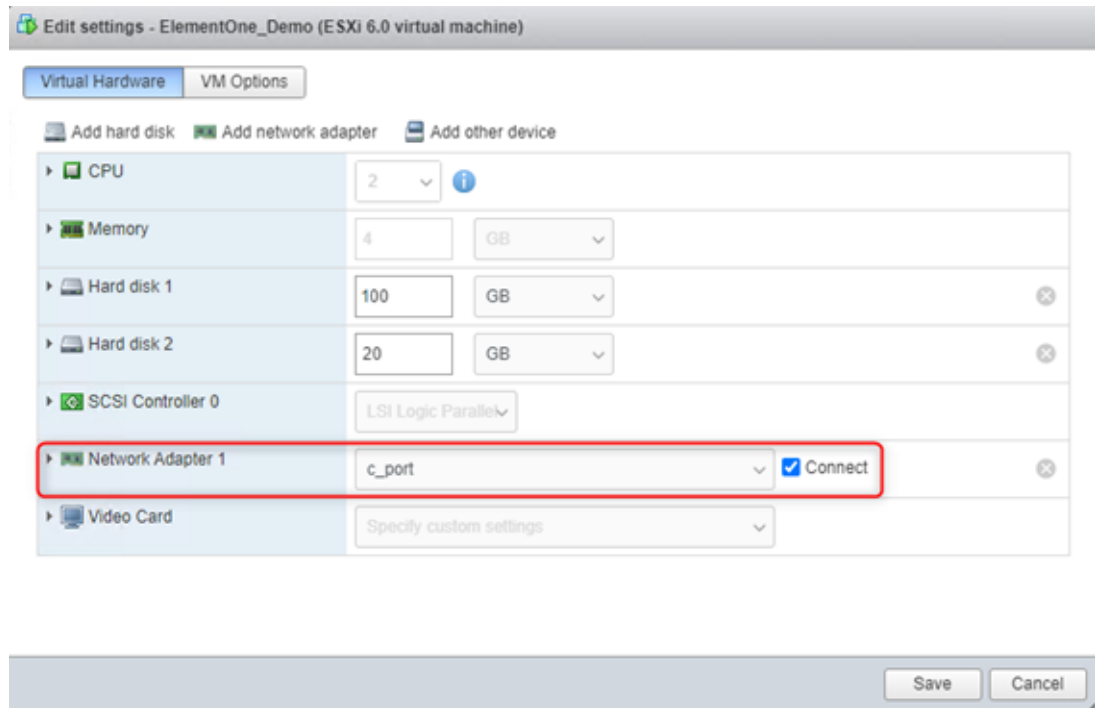

- ElementOne service

If the ElementOne service is not 'active (running)', you can refer to this link to troubleshoot it.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

2. Check the network between client and ElementOne is connected.

You can test the client reachability on Vshell.

- Destination is reachable

```
$ ping -t 192.168.3.121
PING 192.168.3.121 (192.168.3.121) 56(84) bytes of data.
64 bytes from 192.168.3.121: icmp_seq=1 ttl=64 time=0.453 ms
64 bytes from 192.168.3.121: icmp_seq=2 ttl=64 time=0.279 ms
64 bytes from 192.168.3.121: icmp_seq=3 ttl=64 time=0.236 ms
--- 192.168.3.121 ping statistics ---
3 packets transmitted, 3 received, 0% packet loss, time 2028ms
rtt min/avg/max/mdev = 0.236/0.322/0.453/0.093 ms
```

- Destination is unreachable

```
$ ping -t 192.168.3.120
PING 192.168.3.120 (192.168.3.120) 56(84) bytes of data.
From 192.168.3.158 icmp_seq=1 Destination Host Unreachable
From 192.168.3.158 icmp_seq=2 Destination Host Unreachable
From 192.168.3.158 icmp_seq=3 Destination Host Unreachable

--- 192.168.3.120 ping statistics ---
3 packets transmitted, 0 received, +3 errors, 100% packet loss, time 2031ms
pipe 3
exit status 1
```

3. Make sure that the device port is not blocked.

The default device port is 3030. You can check the device port on Vshell.

Then contact the network administrator to make sure the device port is not blocked.

```
$ elementone deviceport show
Device port: 3030
```

4. Restart ElementOne service.

After updating the device port, ElementOne service needs to be restarted for the changes to be applied.

The devices cannot perform component updates with ElementOne until the ElementOne service has been restarted.

You can restart the ElementOne service on Vshell.

```
$ elementone deviceport update -p 2222
Restart the ElementOne service to take effect.

$ elementone service restart
Active: active (running) since Fri 2023-09-22 04:12:49 UTC; 4ms ago
```

5. Report issues to TXOne

If you are still unable to update components on a device with ElementOne, refer to this topic to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

Unable to Update Components on ElementOne

If you are unable to update components on ElementOne, you can follow the steps below to troubleshoot it.

1. Check the License

Check whether at least one valid license (either Portable Inspector, Portable Inspector Pro or Safe Port) is activated on ElementOne.

The components on ElementOne rely on product licenses to get updates from the TXOne active update server.

2. Check the network status

1. Check ElementOne environment.

You can check the ElementOne service on Vshell.

```
$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25  IP: 192.168.3.178      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068fid-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1
```

◦ Time

If the user sets the time manually during the OOB, and the manually set time does not match the current UTC time, it will prevent ElementOne from communicating with the active update server.

This failure occurs because the system time of ElementOne is not within the valid period of the certificate on the active update server.

To resolve this issue, the user must modify the system time on ElementOne via Vshell.

- a. Enable the NTP with specific NTP server domain or address.

```
$ env time ntp enable -s time.google.com
Time: 2023-05-17 02:55:45 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: time.google.com
```


- b. Disable the NTP and set up time manually.

```
$ env time manual -y 2023 -m 05 -d 17 -H 02 -M 56
Time: 2023-05-17 02:56:00 +0000 UTC
Timezone: Etc/UTC
NTP: Disabled
```

- Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then activate the virtual machine.

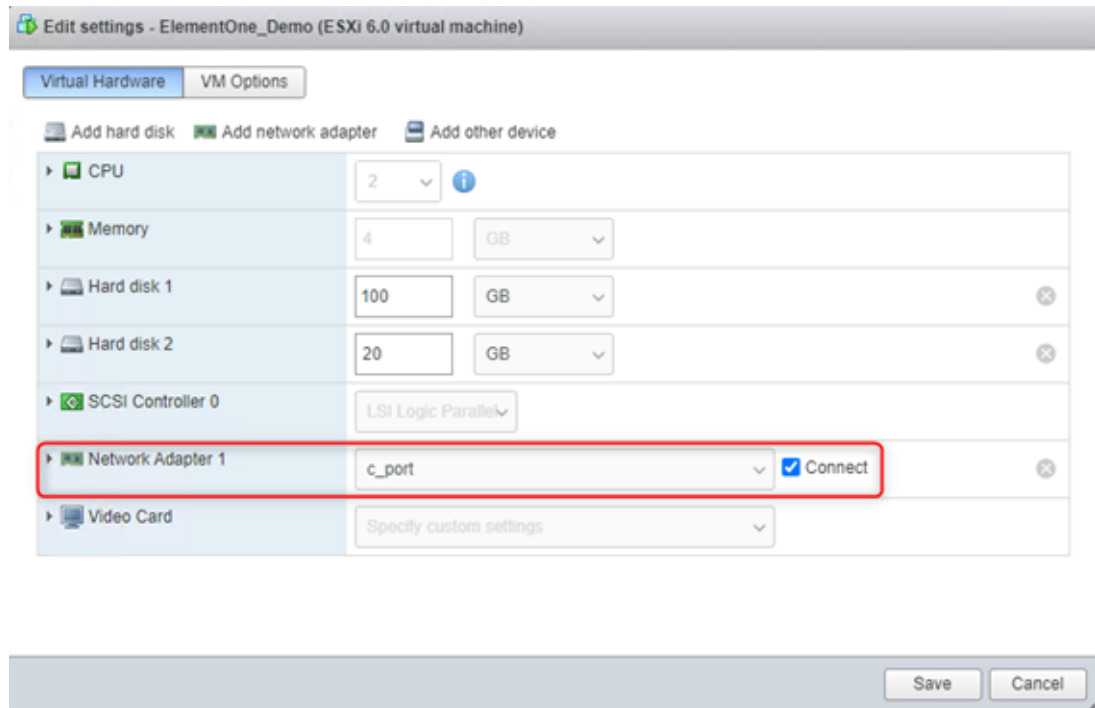

- ElementOne service

If the ElementOne service is not 'active (running)', you can refer to this link to troubleshoot it.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

2. Check if the network between the active update server and ElementOne is connected.

You can test the domain reachability on Vshell.

The DNS of the environment should be able to resolve the domains below:

- ttau.cs.txone.com

DNS has successfully resolved the domain.

The destination can be reached through ping.

```
$ ping -t ttau.cs.txone.com
PING ttau.cs.txone.com (13.35.24.129) 56(84) bytes of data.
64 bytes from server-13-35-24-129.tpe51.r.cloudfront.net (13.35.24.129): icmp_seq=1 ttl=243 time=10.
4 ms
64 bytes from server-13-35-24-129.tpe51.r.cloudfront.net (13.35.24.129): icmp_seq=2 ttl=243 time=11.
3 ms
64 bytes from server-13-35-24-129.tpe51.r.cloudfront.net (13.35.24.129): icmp_seq=3 ttl=243 time=11.
0 ms
--- ttau.cs.txone.com ping statistics ---
3 packets transmitted, 3 received, 0% packet loss, time 2003ms
rtt min/avg/max/ndev = 10.426/10.886/11.278/0.351 ms
```

If ElementOne cannot resolve the domain, you can update specific DNS on Vshell, then try again.

```
$ ping -t ttau.cs.txone.com
ping: ttau.cs.txone.com: Temporary failure in name resolution
exit status 2
```

After updating the DNS server, ping the active update server again.

```
$ resolv update -d 192.168.3.1 -d 1.1.1.1 -d 8.8.8.8
DNS:
nameserver 192.168.3.1
nameserver 1.1.1.1
nameserver 8.8.8.8
$ ping -t ttau.cs.txone.com
PING ttau.cs.txone.com (99.86.178.82) 56(84) bytes of data.
64 bytes from server-99-86-178-82.ku150.r.cloudfront.net (99.86.178.82): icmp_seq=1 ttl=238 time=62.4 ns
64 bytes from server-99-86-178-82.ku150.r.cloudfront.net (99.86.178.82): icmp_seq=2 ttl=238 time=65.8 ns
64 bytes from server-99-86-178-82.ku150.r.cloudfront.net (99.86.178.82): icmp_seq=3 ttl=238 time=61.2 ns

--- ttau.cs.txone.com ping statistics ---
3 packets transmitted, 3 received, 0% packet loss, time 2002ms
rtt min/avg/max/mdev = 61.224/63.164/65.840/1.955 ms
```

3. Report issues to TXOne

If you are still unable to update components on ElementOne, refer to this topic to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

ElementOne Service has Failed (Result: exit-code)

When you encounter this issue, you can troubleshoot it by referring to the steps below.

- Abnormal network interfaces and ElementOne service status

```

Time: 2023-05-15 14:25:15 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces: 
Routes: 
DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: Not available
ElementOne device port: 3030
ElementOne service: Active: failed (Result: exit-code) since Mon 2023-05-15 14:22:59 UTC: 2min 16s ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1

```

- Abnormal ElementOne service status

```

$ env ls
Time: 2023-05-16 09:25:00 +0000 UTC
Timezone: Etc/UTC
NTP: Disabled

Network interfaces:
eth0(up):      MAC: 00:0C:29:7A:07:58   IP: 192.168.3.158      Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.158

DNS:
nameserver 192.168.3.1

Hostname: elementone
ElementOne version: 1.0.0-qa
ElementOne UUID: 45403f3b-c72c-10eb-1f11-a3bd10343faf
ElementOne device port: 3030
ElementOne service: Active: failed (Result: exit-code) since Tue 2023-05-16 09:24:13 UTC: 47s ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1

```

1. Check the data disk

ElementOne service cannot be activated when the data disk is not present.


Ensure that the data disk exists.

```

$ elementone service status
[!] Unable to retrieve data disk space information. Please verify the VM configuration and try again.
[!] The data disk space is insufficient. Please increase its capacity to 20GB or more and try again.
Active: failed (Result: exit-code) since Thu 2023-09-21 22:01:50 UTC: 1min 19s ago

```

The second disk is added to the VM.

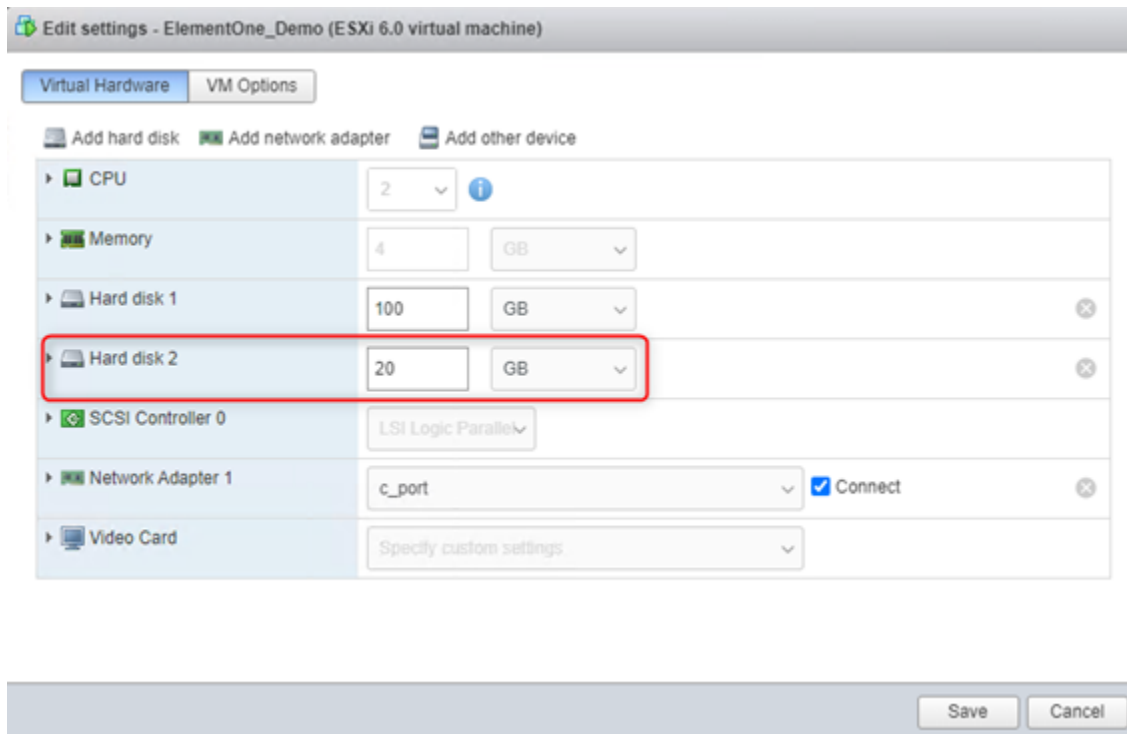

2. Restart the ElementOne service

You can try to restart the ElementOne service on Vshell.

- When ElementOne service succeeds after restart.

```
$ elementone service restart
Active: active (running) since Wed 2023-05-17 04:09:06 UTC; 4ms ago
```

- When ElementOne service fails after restart.

```
$ elementone service status
[!] Unable to retrieve data disk space information. Please verify the VM configuration and try again.
[!] The data disk space is insufficient. Please increase its capacity to 20GB or more and try again.
Active: failed (Result: exit-code) since Thu 2023-09-21 22:01:50 UTC; 1min 19s ago
```

3. Report issues to TXOne

If you are still unable to activate the ElementOne service, refer to this topic to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

Unable to Upload SSL Certificate to ElementOne

If you encounter issues when uploading SSL Certificate to ElementOne, follow these steps to troubleshoot it.

1. Check the Status of a Certificate

- `file your_certificate.pem`
- `openssl x509 -in your_certificate.pem -text -noout`

2. Verify the Private Key

- `file your_key.pem`
- `head -n 1 your_key.pem`
- `openssl rsa -in your_key.pem -check --noout`

3. Compare the Private Key with the Certificate

- `openssl x509 -noout -modulus -in your_certificate.pem | openssl md5`
- `openssl rsa -noout -modulus -in your_key.pem | openssl md5`

Both MD5 checksums should be identical.

4. Convert the Certificate and Private Key from PKCS #12 to PKCS #8

- Extract the certificate into a PEM file

```
openssl pkcs12 -in [your.pfx] -out cert.pem -clcerts -nokeys -nodes
```

- Extract the private key into a PKCS#8 formatted PEM file

```
openssl pkcs12 -in [your.pfx] -out key.pem -nocerts -nodes
```

5. Convert the Private Key from PKCS #8 to PKCS #1

- Convert the key

```
openssl rsa -traditional -in private_key_extracted.pem -out private_key_extracted-pkcs1.pem
```

- Check the result

```
head -n 1 private_key_extracted-pkcs1.pem
```

The result should be:

- PKCS#1

```
-----BEGIN RSA PRIVATE KEY-----
```

- PKCS#8

```
-----BEGIN PRIVATE KEY-----
```

or

```
-----BEGIN ENCRYPTED PRIVATE KEY-----
```

6. Report issues to TXOne

If you are still unable to upload the SSL Certificate, refer to this topic to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

Unable to Activate or Renew Licenses on ElementOne

If you are unable to activate or renew your licenses on ElementOne, you can follow the steps below to troubleshoot it.

1. Check the License

1. Check the order of license activation.

After activating the ElementOne license, you can activate one license each for Portable Inspector and Portable Inspector Pro.

2. Check the product whose license you're trying to renew.

When you click 'Renew' on the Portable Inspector or Portable Inspector Pro license, you can only renew the license for the same product.

3. Check if the current date is before the start date of the license.

If the license has a specific start date and the current date is before that start date, the license cannot be activated on ElementOne.

2. Check the network status

1. Check the network status.

You can check the ElementOne service on Vshell.

```

$ env ls
Time: 2023-05-15 14:13:10 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: 2.debian.pool.ntp.org

Network interfaces:
eth0(up):      MAC: 00:0C:29:1A:3D:25   IP: 192.168.3.178   Netmask: 255.255.255.0

Routes:
default via 192.168.3.1 dev eth0
192.168.3.0/24 dev eth0 proto kernel scope link src 192.168.3.178

DNS:
nameserver 192.168.3.1
nameserver 8.8.8.8

Hostname: elementone
ElementOne version: 1.0.1
ElementOne UUID: e9068f1d-da4c-36c3-d474-25aa9f7693fb
ElementOne device port: 3030
ElementOne service: Active: active (running) since Mon 2023-05-15 13:58:10 UTC; 15min ago
ElementOne service network:
Subnet: 169.254.0.0/24, Gateway: 169.254.0.1
Subnet: 169.254.2.0/24, Gateway: 169.254.2.1
Subnet: 169.254.1.0/24, Gateway: 169.254.1.1

```

NTP is enabled, and it reflects the current time.

The interface status is up and has expected ip address.

ElementOne service is active (running).

- Time

If the user sets the time manually during the OOB, and the manually set time does not match the current UTC time, it will prevent ElementOne from communicating with the license activation server.

This failure occurs because the system time of ElementOne is not within the valid period of the certificate on the license activation server.

To resolve this issue, the user must modify the system time on ElementOne via Vshell.

- Enable the NTP with specific NTP server domain or address.

```

$ env time ntp enable -s time.google.com
Time: 2023-05-17 02:55:45 +0000 UTC
Timezone: Etc/UTC
NTP: Enabled
NTP server: time.google.com

```

- Disable the NTP and manually set the time.

```

$ env time manual -y 2023 -m 05 -d 17 -H 02 -M 56
Time: 2023-05-17 02:56:00 +0000 UTC
Timezone: Etc/UTC
NTP: Disabled

```


- c. Restart the ElementOne service to apply the settings.

```
$ elementone service restart
Active: active (running) since Wed 2023-05-17 04:09:06 UTC; 4ms ago
```

- Network interfaces

If the network interfaces are empty, check the virtual machine settings on the hypervisor.

If the network adapter does not exist, shut down the virtual machine, add a network adapter, and then activate the virtual machine.

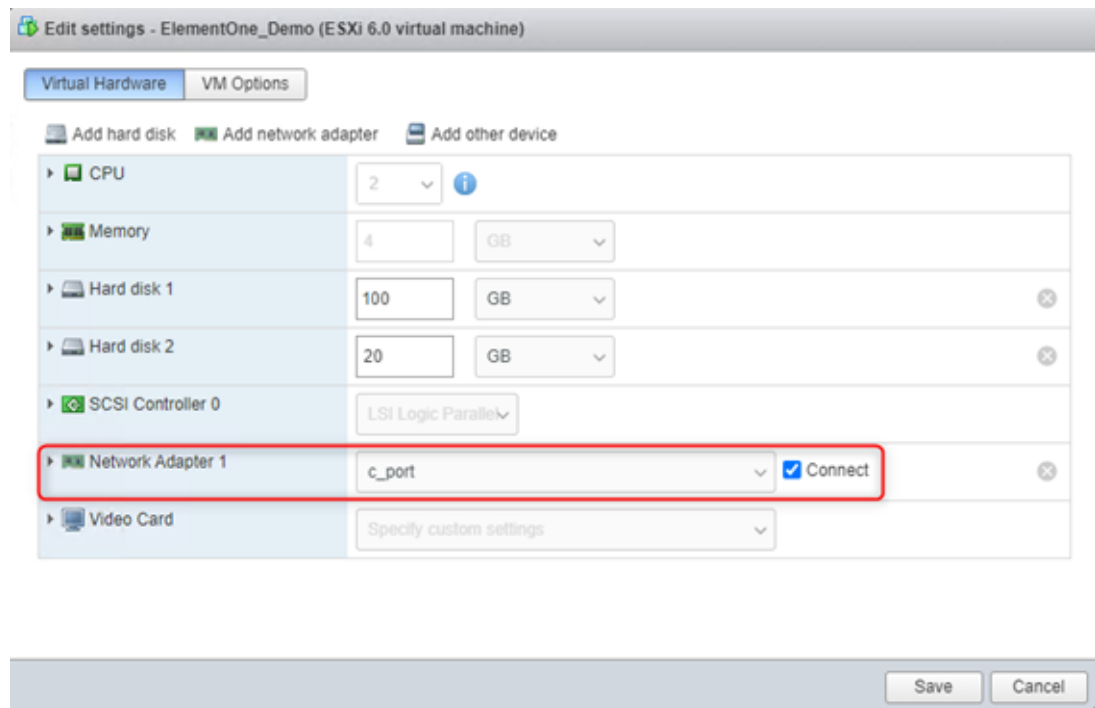

- ElementOne service

If the ElementOne service is not 'active (running)', you can refer to this link to troubleshoot it.

[ElementOne Service has failed \(Result: exit-code\) \(on page 31\)](#)

2. Check if the network between the license activation server and ElementOne is connected.

You can test the domain reachability on Vshell.

The DNS of the environment should be able to resolve domains as below:

- odc.cs.txone-networks.com

**Note:**

This license activation server will not respond to any ping requests.

- DNS has successfully resolved the domain.

```
$ ping -t odc.cs.txone-networks.com
PING odc.cs.txone-networks.com (52.38.18.178) 56(84) bytes of data.
--- odc.cs.txone-networks.com ping statistics ---
3 packets transmitted, 0 received, 100% packet loss, time 2052ms
```

- DNS has successfully resolved the domain.

The destination can be reached through ping.

```
$ ping -t licenseupdate.trendmicro.com
PING licenseupdate.trendmicro.com (66.180.84.8) 56(84) bytes of data.
64 bytes from 66.180.84.8 (66.180.84.8): icmp_seq=1 ttl=238 time=151 ms
64 bytes from 66.180.84.8 (66.180.84.8): icmp_seq=2 ttl=238 time=153 ms
64 bytes from 66.180.84.8 (66.180.84.8): icmp_seq=3 ttl=238 time=152 ms
```

If ElementOne cannot resolve the domain, you can update specific DNS on Vshell, then try again.

- Cannot resolve the domain

```
$ ping -t odc.cs.txone-networks.com
ping: odc.cs.txone-networks.com: Temporary failure in name resolution
exit status 2
```

After updating the DNS server, ping the license activation server again.

```
$ resolv update -d 192.168.3.1 -d 1.1.1.1 -d 8.8.8.8
DNS:
nameserver 192.168.3.1
nameserver 1.1.1.1
nameserver 8.8.8.8
$ ping -t odc.cs.txone-networks.com
PING odc.cs.txone-networks.com (54.184.178.40) 56(84) bytes of data.
--- odc.cs.txone-networks.com ping statistics ---
3 packets transmitted, 0 received, 100% packet loss, time 2048ms
exit status 1
```

3. Report issues to TXOne

If you are still unable to activate or renew licenses on ElementOne, refer to this topic to report the issue to us.

[Report Issues to TXOne \(on page 40\)](#)

Chapter 4. Report Issues to TXOne

When encountering issues while using ElementOne, please follow these steps to collect the necessary information and report it to us:

1. Reproduce the issue and take note of the exact steps taken leading up to the problem.
2. Take a screenshot or record a video of any error messages or unexpected behavior.
3. Collect the HAR file from the Chrome browser.
4. Collect a debug log from ElementOne.
5. Send all this information to us for further assistance.




Note:

If you are unable to obtain the debug file via web or Vshell, please contact your provider for further information.

1. Collect HAR File on Chrome


This file can help us determine if the root cause of the issue is caused by the user interface.

1. Press 'F12' key on your browser to display the develop tools console.
2. Click the 'Network' tab.

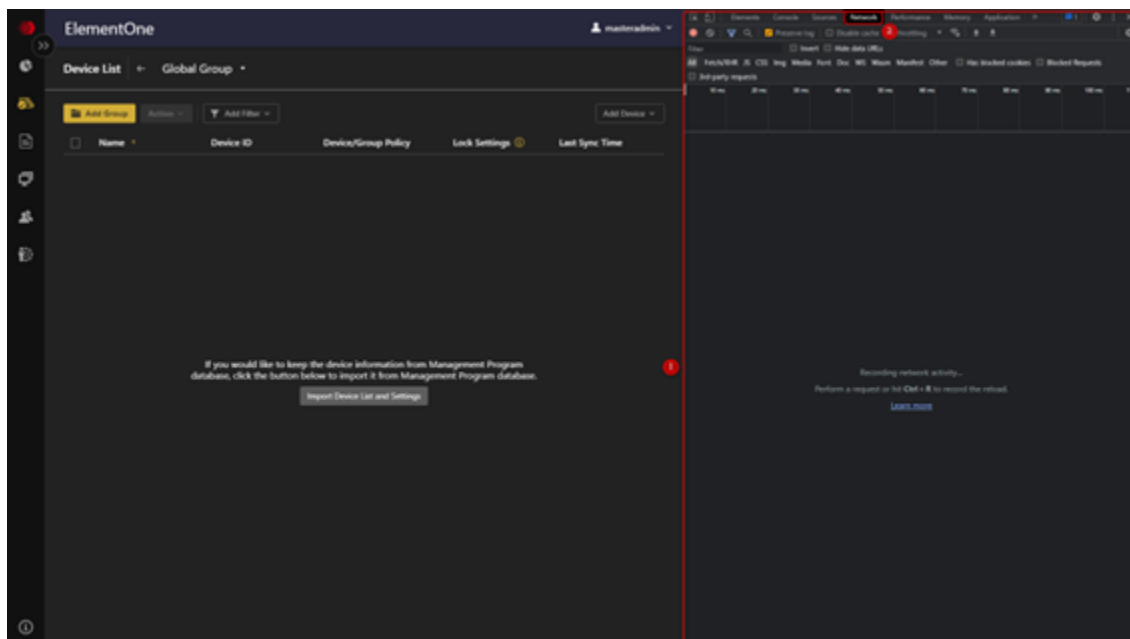


3. Reproduce the issue, and you will see items pop up in the development tools console.

4. After reproducing, click the 'Export' icon to export the HAR file.

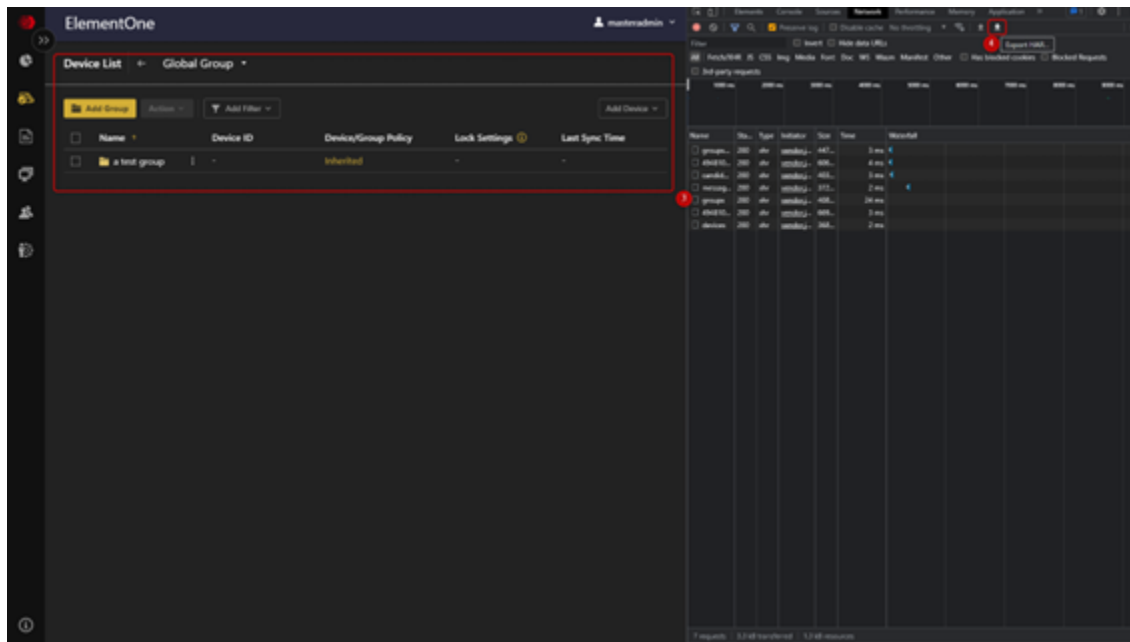

5. Input the file name.


6. Click 'Save'.

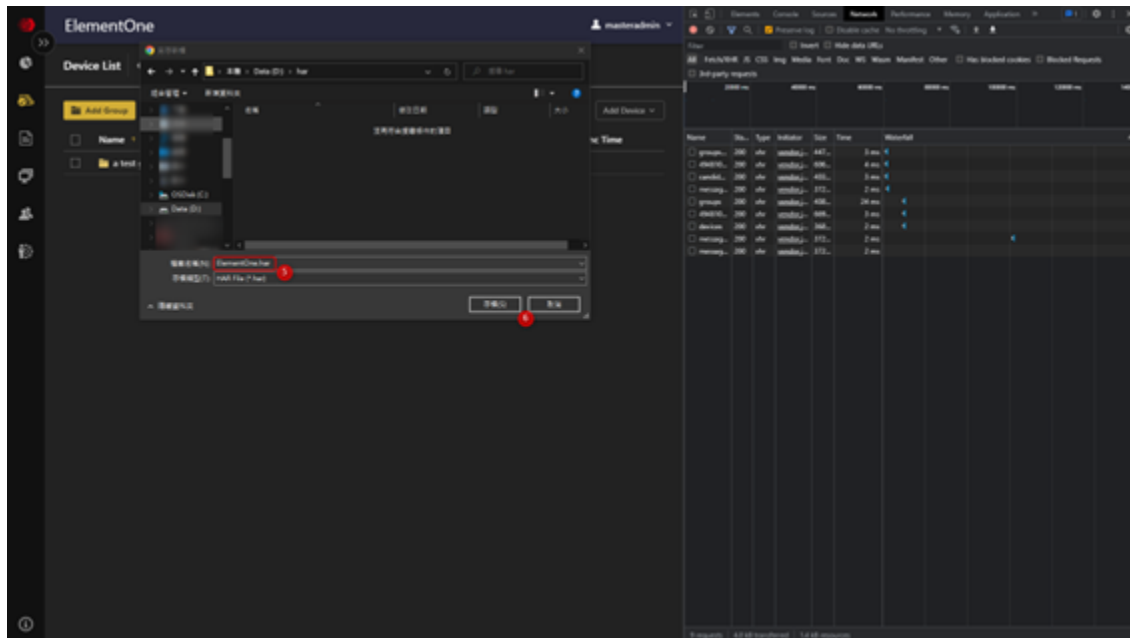

2. Collect Debug Log File via ElementOne Web Console

This file can help us determine if the root cause of the issue is caused by ElementOne service.

1. Log in to the ElementOne Web UI with master admin or admin user account. After login, modify URL to 'https://[ElementOne_IP]/api/web/system/logs' then press 'Enter'.

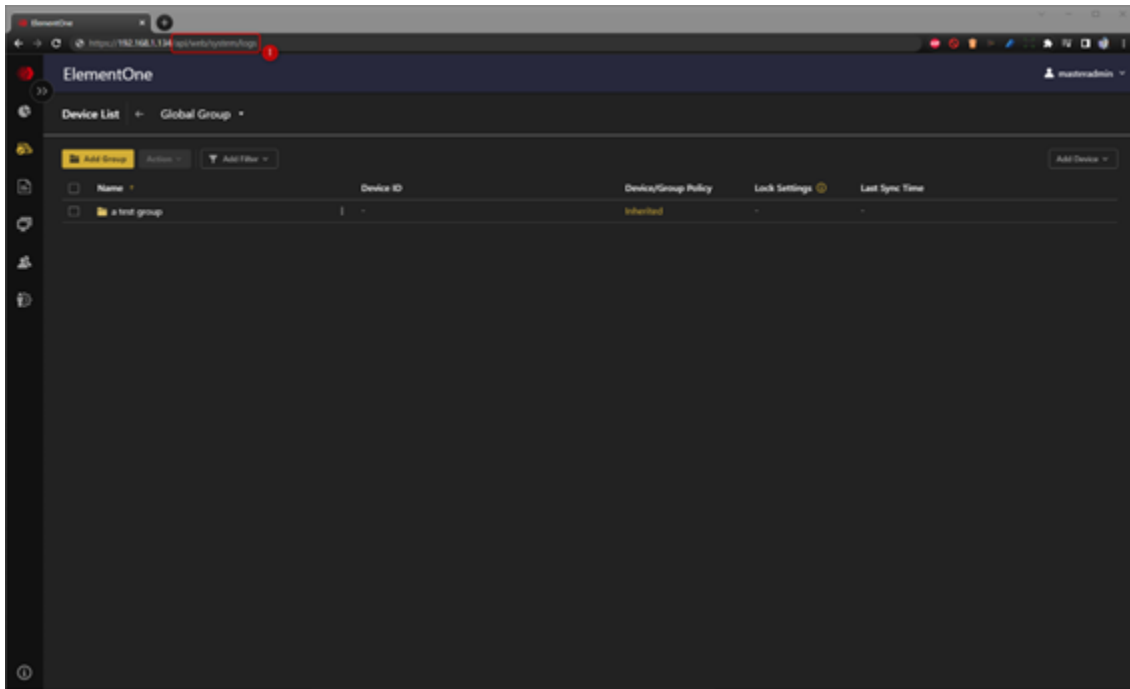

2. Wait for about 1 minute. The browser will display a 'save as' dialog box.




Note:

When downloading a debug log file from the web, please note that there is a timeout limitation of 30 minutes.


If the operation period in your environment is long, the log file generation may take longer than 30 minutes.

In cases the download fails on the web, you can generate the debug log file using Vshell instead.

3. Select the destination folder.
4. Click 'Save'.

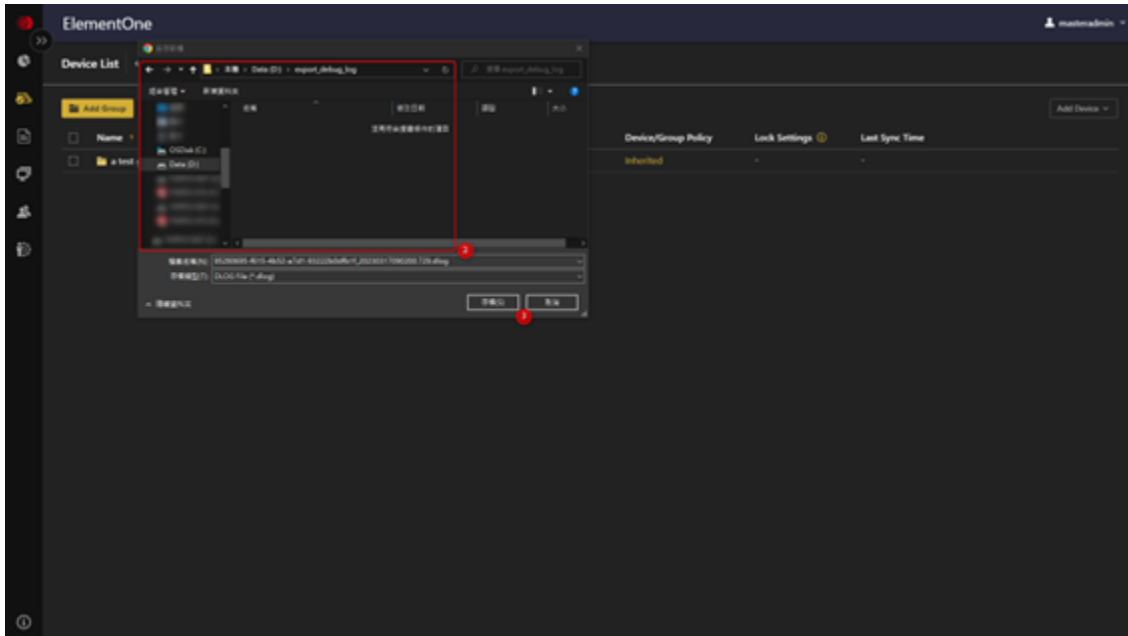

5. You can see that the log file has been downloaded.

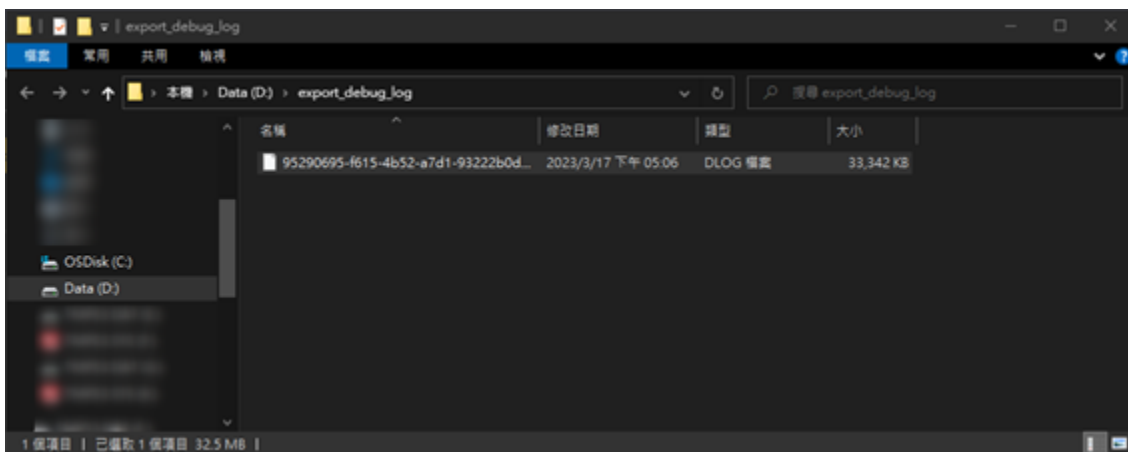

3. Collect Debug Log File via ElementOne Vshell

If you are unable to collect the debug file via web, you can collect it via Vshell.


In this case, you will need to prepare another host that has SSH service to receive the debug log file from ElementOne.

1. Send debug log file to Linux host.

- a. On Vshell, input the following command with parameters.


```
dlog scp -u <linux_username> -a <linux_ip_address> -f <destination_folder>
```

- b. Input password and then press Enter.

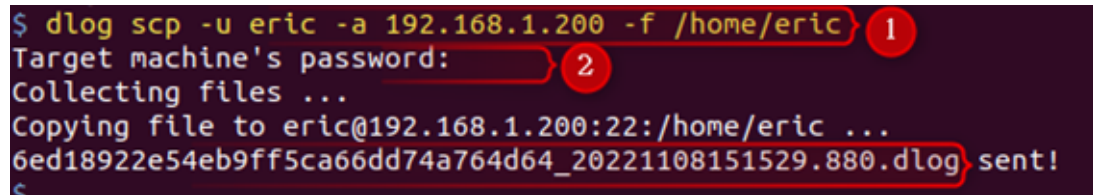

```
$ dlog scp -u eric -a 192.168.1.200 -f /home/eric 1
Target machine's password: 2
Collecting files ...
Copying file to eric@192.168.1.200:22:/home/eric ...
6ed18922e54eb9ff5ca66dd74a764d64_20221108151529.880.dlog sent!
```

- c. You will find the debug log file in the destination folder on the Linux client.

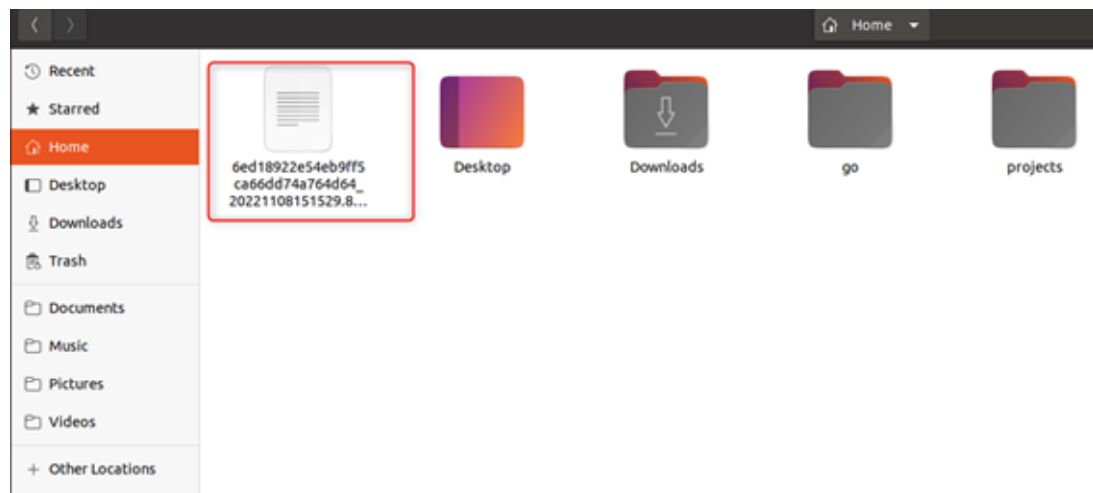


2. Send debug file to Windows host.

- a. On Vshell, input the following command with parameters.


```
dlog scp -u <windows_username> -a <windows_ip_address> -f <destination_folder>
```

- b. Input password and then press Enter.

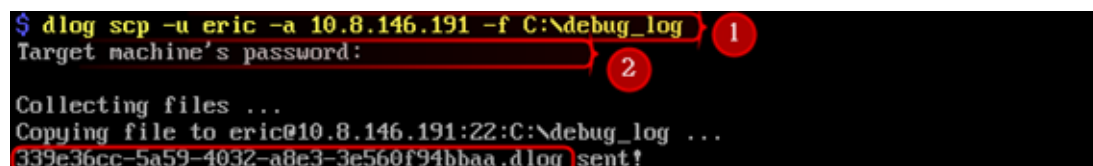

```
$ dlog scp -u eric -a 10.8.146.191 -f C:\debug_log 1
Target machine's password: 2
Collecting files ...
Copying file to eric@10.8.146.191:22:C:\debug_log ...
339e36cc-5a59-4032-a8e3-3e560f94bbaa.dlog sent!
```

- c. You will find the debug log file in the destination folder of the Windows client.

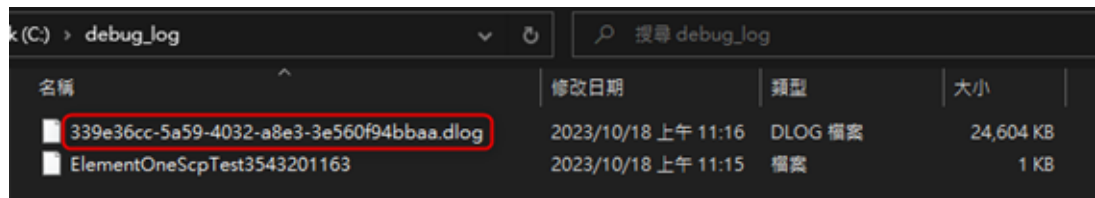

Chapter 5. Contact Us

For support and additional information, visit the following websites:

- Worldwide support offices: <https://www.txone.com/contact/>
- TXOne Networks product documentation: <https://help.txone.com/docs>
- MyTXOne: <https://my.txone.com>