
F1 — what the tactile sensor is, and where it goes

Source-geometry allocation and nominal stack; fitted copper and physical qualification pending

Contact surface: two nail matrices + four TPU matrices = 64 intended locations

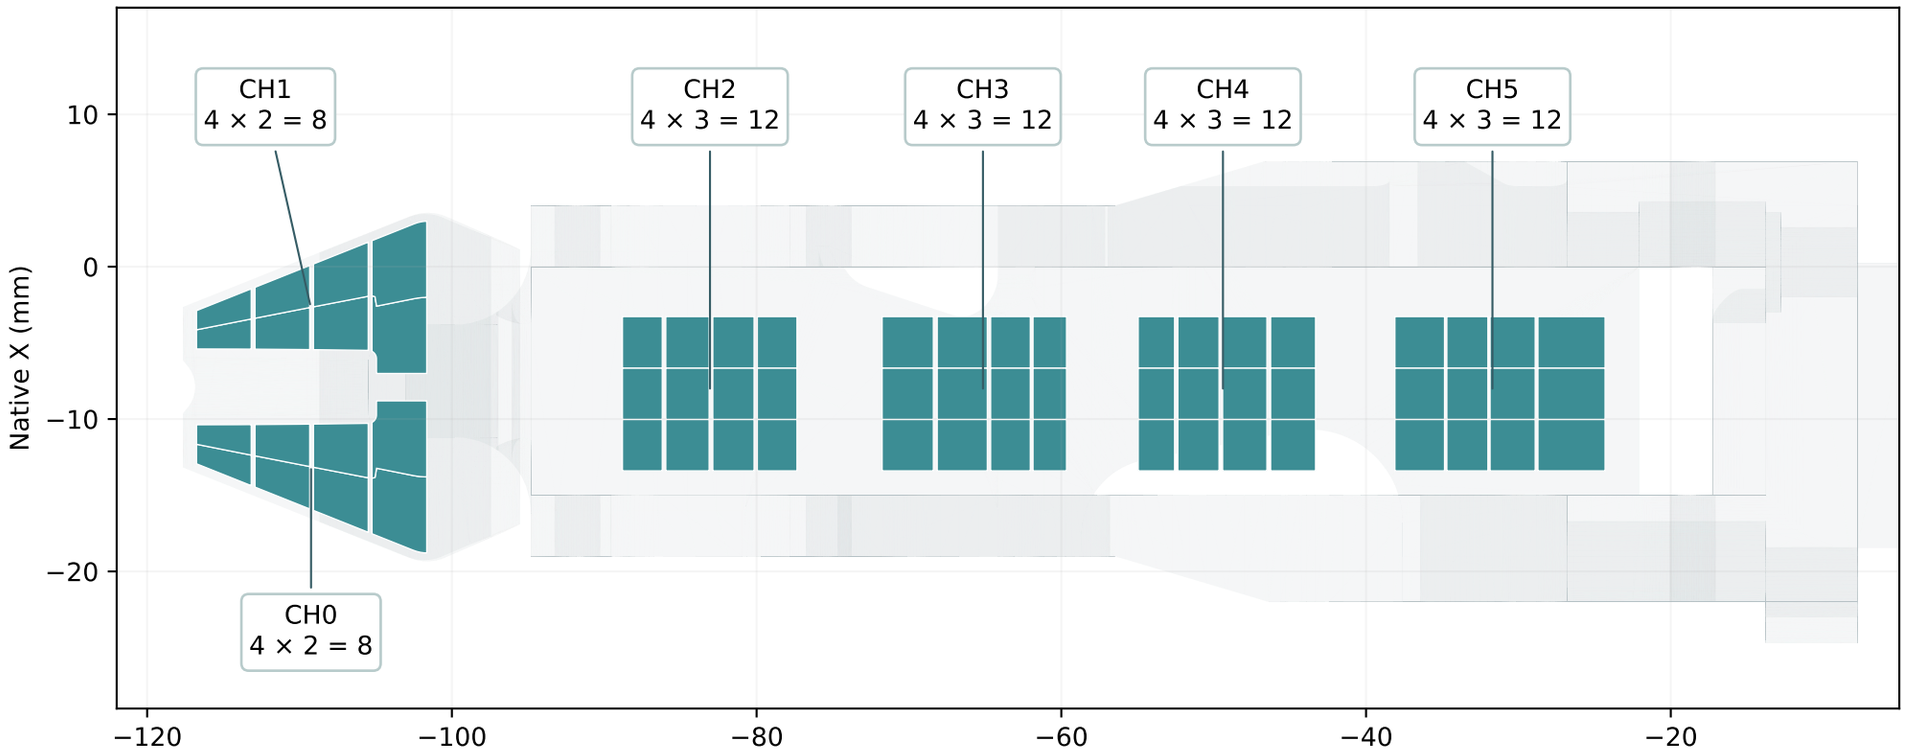

Sensor = the film/electrode laminate

Object	contact
Protective cover	0.10 / 0.40 mm
Row electrode foil	0.145 / 0.060 mm in active area
Conductive pressure film	0.10 mm — this is the sensing material
Column electrode foil	0.060 mm in active area
Mounting layer	0.05 / 0.10 mm
Original nail / TPU	retained contact support

Fixed electronics

Finger side: 12 FH12 foil connectors
Wrist/base: OPA392 readout + ADS8866
Pico records raw electrical values

No ADC or rigid PCB goes in these pads.
Force calibration and physical tests remain.

Numbers are nail / TPU targets. Layer drawing is enlarged, not to thickness scale.
Adhesive stays out of the film–copper sensing interfaces. Keep six film islands separate.