Chapter 14

Planning Reliability Demonstration Tests

W. Q. Meeker, L. A. Escobar, and F. G. Pascual Iowa State University, Louisiana State University, and Washington State University.

Copyright 2021 W. Q. Meeker, L. A. Escobar, and F. G. Pascual.

Based on Meeker, Escobar, and Pascual (2021): Statistical Methods for Reliability Data, Second Edition, John Wiley & Sons Inc.

May 24, 2021 11h 0min

Chapter 14 Planning Reliability Demonstration Tests

Topics discussed in this chapter are:

- The basic ideas behind reliability demonstration tests.
- The tradeoff between sample size and test length.
- How to compute probability of successful demonstration.

Chapter 14

Segment 1

Criteria and Other Basic Ideas Behind Reliability Demonstration Tests

Possible Criteria for Doing a Demonstration

- Consider the following three demonstrations:
 - ▶ Demonstrate that $S(t_e)$, the reliability at time t_e is at least S^{\dagger} . The demonstration is successful if $S(t_e) \geq S^{\dagger}$.
 - ▶ Demonstrate that $F(t_e)$, the proportion failing at time t_e is less than F^{\dagger} . The demonstration is successful if $\widetilde{F}(t_e) \leq F^{\dagger}$.
 - ▶ Demonstrate that t_p , the p quantile of the failure-time distribution, is at least t_p^{\dagger} . The demonstration is successful if $t_p \geq t_p^{\dagger}$.
- ullet With appropriate choice of t_e and p, these are all equivalent.
- Following tradition and common use, we will discuss the reliability demonstration that $S(t_e) > S^{\dagger}$.

Basic Ideas

- Want to demonstrate reliability $S(t_e) = \Pr(T > t_e)$ is at least S^{\dagger} (e.g., $S^{\dagger} = 0.99$ or $S^{\dagger} = 0.999$) for a given log-location-scale distribution (e.g., Weibull).
- Test a **small number of units** for a **long time** (e.g., continuous testing for a large number of operations hours).
- ullet Denote the sample size by n and the censoring time by t_c .
- ullet Pass the test if there are r_c or fewer failures up to t_c .
- **Required:** Specification of the log-location-scale distribution shape parameter σ (or Weibull shape parameter)—generally done in a conservative way. Larger (smaller) values of σ (β) are conservative.

Data and Distribution

- The number of units **surviving** until t_c is X. The realized value of X is x. The observed number of **failures** in the demonstration test is r = (n x).
- To simplify test plan specification, ignore the failure times and use the fact that X has a binomial distribution with parameters n and $S(t_c)$.
- Because σ is given, little information is lost by ignoring the failure times.
- The ML estimate of $S(t_c)$ is $\hat{S}(t_c) = x/n$.

Important Relationship Between $S(t_e)$ and $S(t_c)$

• Let $k=t_c/t_e$ be the test-length factor (i.e., $t_c=kt_e$). Typically, $t_c>t_e$ so k>1.

• Then, using the assumed failure-time distribution,

$$S(t_e) = 1 - \Phi\{\Phi^{-1}[1 - S(t_c)] - \log(k^{1/\sigma})\}$$

and

$$S(t_c) = 1 - \Phi \{ \Phi^{-1}[1 - S(t_e)] + \log(k^{1/\sigma}) \}.$$

• $S(t_e)$ and $S(t_c)$ are monotone increasing functions of each other.

Decision Rule

• A conservative lower $100(1-\alpha)\%$ confidence bound for $S(t_c) = \Pr(T > t_c)$ is (see Meeker, Hahn, and Escobar, 2017, page 103)

$$S(t_c) = \text{qbeta}(\alpha; x, n - x + 1)$$

= $\text{qbeta}(\alpha; n - r, r + 1).$

• Using the assumed log-location-scale distribution, the given value of σ , and using $k=t_c/t_e$, a conservative lower $100(1-\alpha)\%$ confidence bound for $S(t_e)=\Pr(T>t_e)$ is

$$\underline{S}(t_e) = 1 - \Phi \left\{ \Phi^{-1} \left[1 - \underline{S}(t_c) \right] - \log(k^{1/\sigma}) \right\},\,$$

• The demonstration is successful if $\tilde{S}(t_e) > S^{\dagger}$.

Chapter 14

Segment 2

Required Sample Size n for a Given Test-Length Factor k

Required Test-Length Factor k for a Given Sample Size n

Required Sample Size n for a Given Test-Length Factor k

- For a given value of r, say r_c , α , and $k = t_c/t_e$, the required sample size is the smallest n for which $\mathcal{L}(t_e) \geq S^{\dagger}$.
- ullet The required sample size can obtained by rounding up to the next integer number the solution n to

qbeta
$$(\alpha; n - r_c, r_c + 1) = 1 - \Phi[\Phi^{-1}(1 - S^{\dagger}) + \log(k^{1/\sigma})].$$

- There is a tradeoff between k and n (longer tests allow smaller sample size).
- For a given value of k, the required sample size is an increasing function of r_c .
- Taking $r_c = 0$ gives what is known as the "minimum-sample-size test."

Required Test-Length Factor k for a Given Sample Size n

• Using the previous result, for a given values of α , r_c and n, the required test-length factor is

$$k = \exp\left(\sigma\left\{\Phi^{-1}\left[1 - \mathcal{Z}(t_c)\right] - \Phi^{-1}\left(1 - S^{\dagger}\right)\right\}\right)$$
$$= \left(\frac{t_{[1-\mathcal{Z}(t_c)]}}{t_{[1-S^{\dagger}]}}\right)^{\sigma},$$

confirming that k is unitless. Note that $S(t_c)$ is a function of the given values of α , r_c and n.

ullet For the Weibull distribution with $r_c=0$ and $eta=1/\sigma$ there are simplifications giving

$$k = \left[\frac{\log(\alpha)}{n\log(S^{\dagger})}\right]^{1/\beta}.$$

Special Results for the Minimum-Sample-Size Tests

 \bullet For the case of zero failures, $r_c = 0$ and

$$S(t_c) = \text{qbeta}(\alpha, n - r_c, r_c + 1) = \text{qbeta}(\alpha; n, 1) = \alpha^{1/n}$$
.

This leads to the simplification

$$n = \frac{\log(\alpha)}{\log\left\{1 - \Phi\left[\Phi^{-1}\left(1 - S^{\dagger}\right) + \log(k^{1/\sigma})\right]\right\}}.$$

• For the case $r_c=0$ and the Weibull distribution, $\Phi(z)=1-\exp[-\exp(z)]$ and $\sigma=1/\beta$. Then the required sample size simplifies to

$$n = \frac{\log(\alpha)}{k^{\beta}\log(S^{\dagger})}.$$

• Minimum-sample-size tests tend to have a small probability of successful demonstration, unless $S(t_e) >> S^{\dagger}$.


Common Implementation of the Zero-Failure Minimum Sample Size Test

Use a Weibull distribution with $\beta=1$ (constant hazard, or exponential distribution), as this is **conservative** if we are **sure** that the failure mode is wearout


$$n = \frac{1}{k} \times \frac{\log(\alpha)}{\log(S^{\dagger})}.$$

- Test run until $k \times t_e$ for demonstration with $100(1-\alpha)\%$ confidence.
- Requires the assumption that there is no infant mortality.
- Is conservative if $\beta > 1$.
- Smaller sample sizes are possible if you can bound β higher.
- Probability of successful demonstration is small unless $S(t_e) >> S^{\dagger}$.
- It is generally better to use a test that allows a few failures.


Zero-failure Weibull 95% Reliability Demonstration for $S^\dagger=0.9$ with Given β

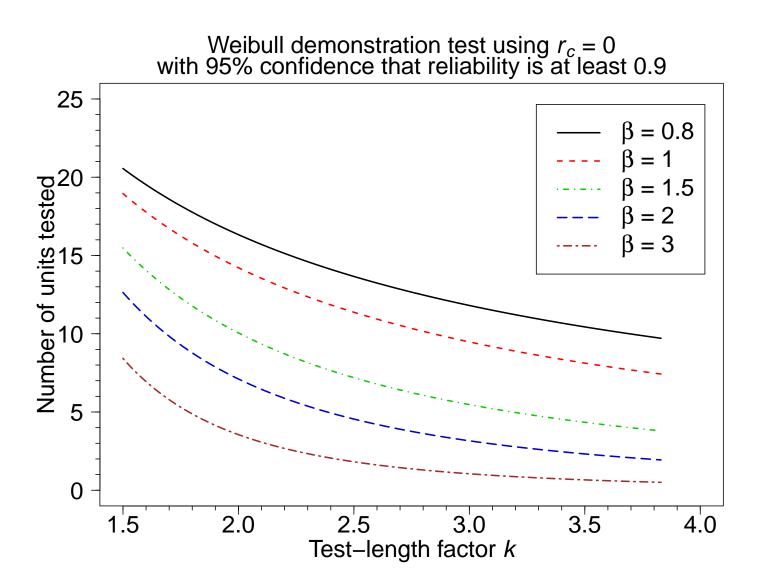


Zero-Failure Weibull 95% Reliability Demonstration for $S^{\dagger}=0.99$ with Given β

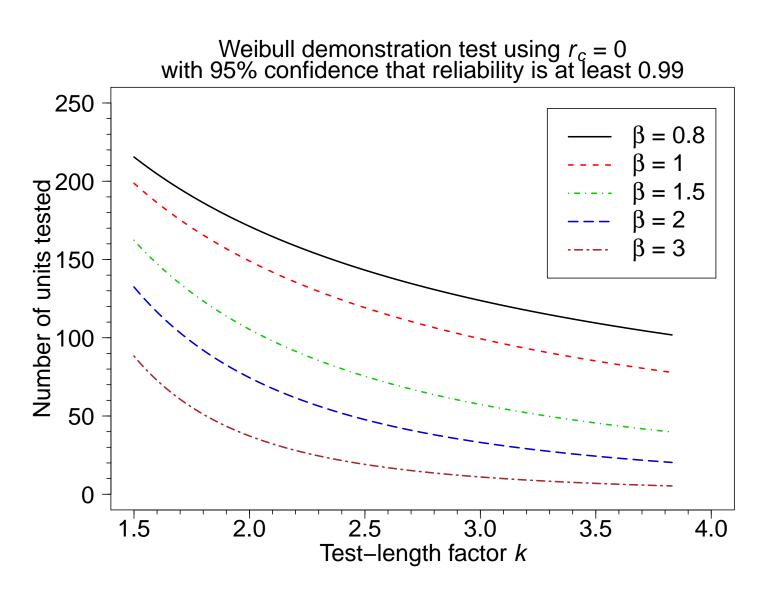


Zero-Failure Weibull 95% Reliability Demonstration for $S^{\dagger}=0.999$ with Given β

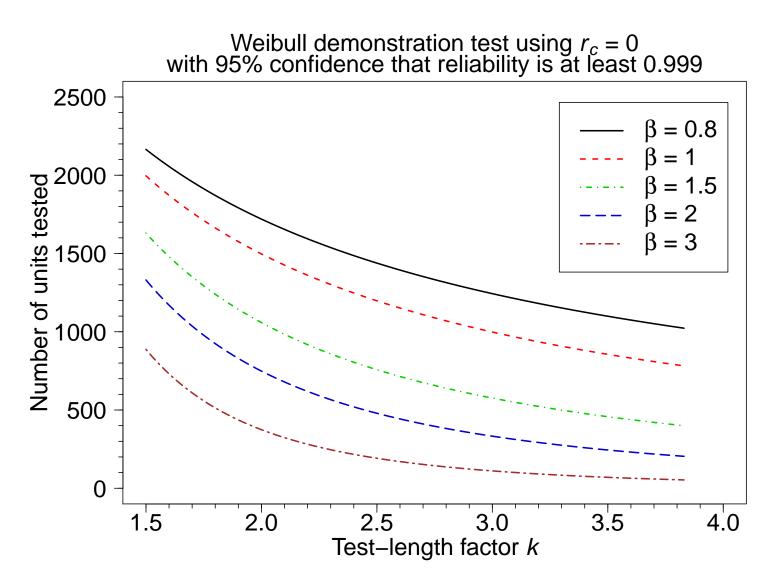


Zero-Failure Lognormal 95% Reliability Demonstration for $S^\dagger=0.99$ with Given σ

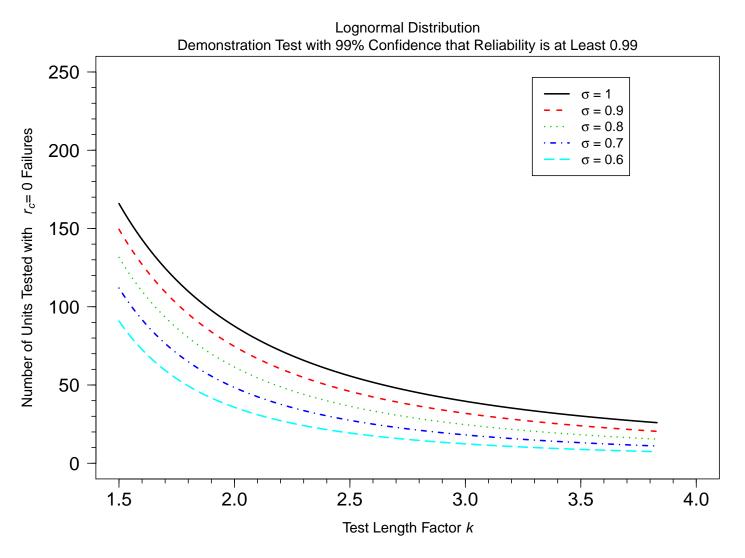

One-Failure Lognormal 95% Reliability Demonstration for $S^{\dagger}=0.99$ with Given σ

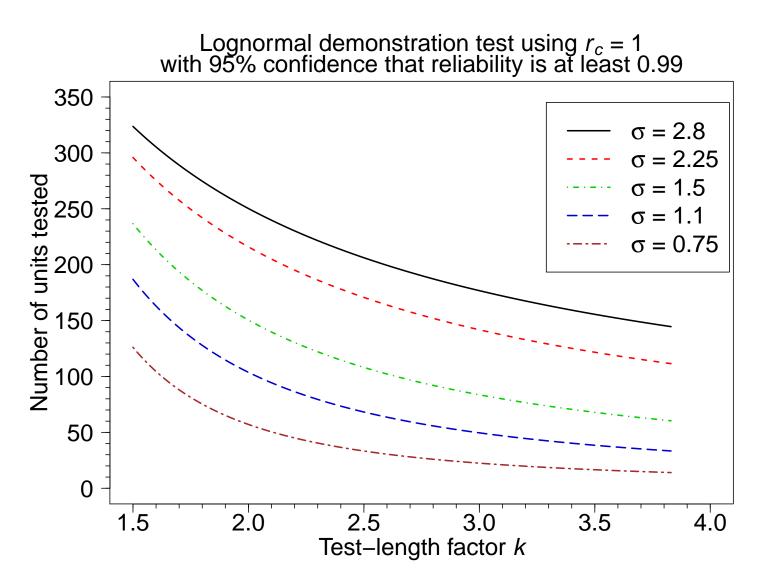

Two-Failure Lognormal 95% Reliability Demonstration for $S^{\dagger}=0.99$ with Given σ

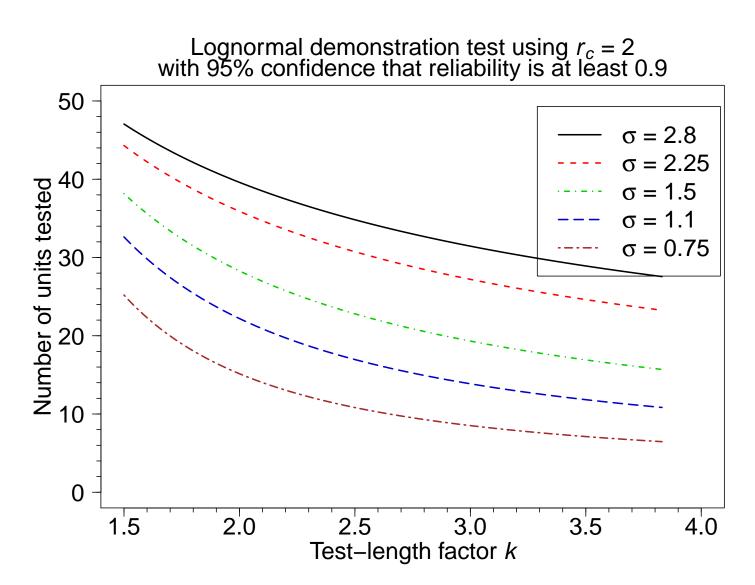

Chapter 14

Segment 3

Probability of Successful Demonstration

Probability of Successful Demonstration

• The probability of a successful demonstration (a.k.a., power) for a demonstration test allowing at most r_c failures, as a function of $S(t_e)$, is

$$PrSD(r_c) = Pr(n - X \le r_c) = pbinom[r_c; n, 1 - S(t_c)]$$

= 1 - pbeta[1 - S(t_c); r_c + 1, n - r_c]


where $S(t_c) = 1 - \Phi \{ \Phi^{-1}[1 - S(t_e)] + \log(k^{1/\sigma}) \}$. The pbeta expression allow computation with non-integer n.

- $PrSD(r_c)$ is an increasing function of r_c .
- If $r_c = 0$, then $PrSD(0) = [S(t_c)]^n$.
- If $r_c = 0$, with the **Weibull** distribution and $\beta = 1/\sigma$, then


$$PrSD(0) = [S(t_e)]^{\log(\alpha)/\log(S^{\dagger})},$$

which, interestingly, does not depend on n, k, or β .


Weibull Reliability Demonstration with k=4, $r_c=0$, $\beta=1$, and $S^{\dagger}=0.99$ for Different Confidence Levels

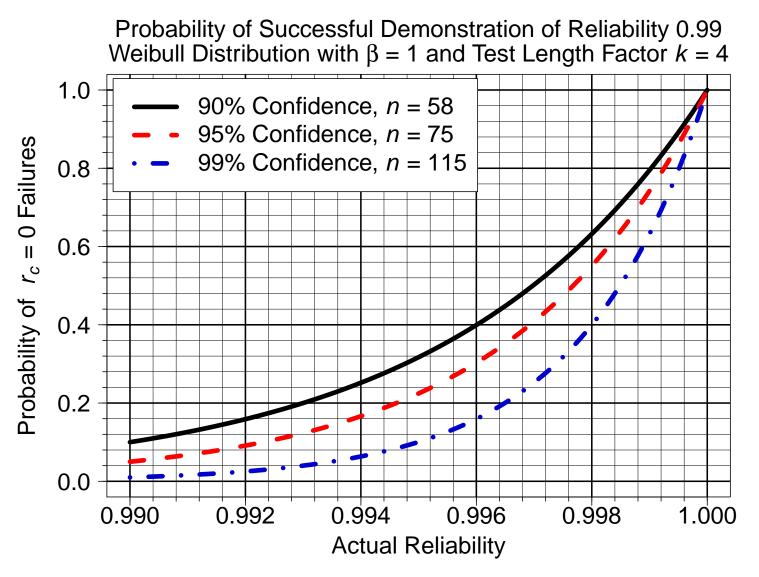


Weibull Reliability Demonstration with k=4, $r_c=1$, $\beta=1$, and $S^{\dagger}=0.99$ for Different Confidence Levels

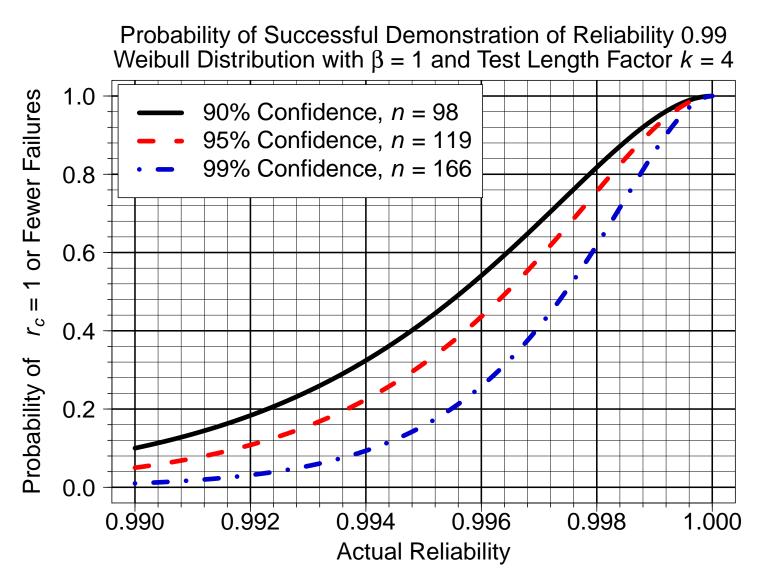

Weibull Reliability Demonstration with k=4, $r_c=2$, $\beta=1$, and $S^{\dagger}=0.99$ for Different Confidence Levels

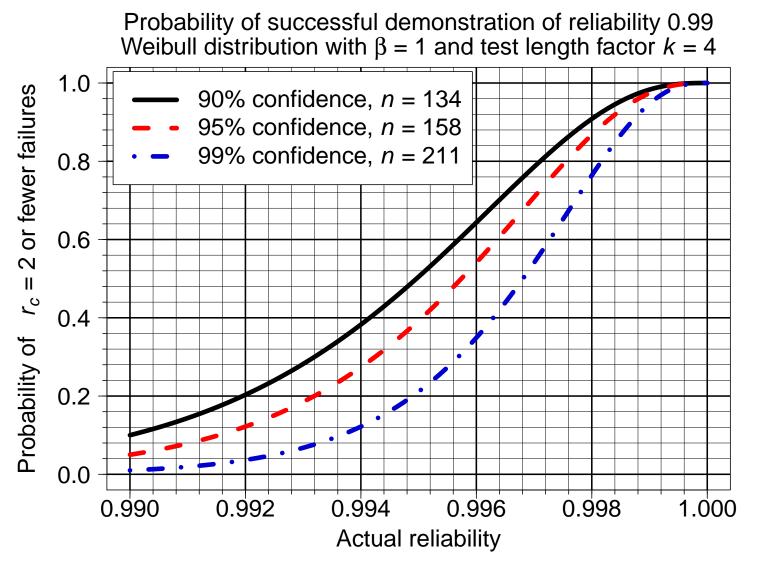

Weibull Reliability Demonstration with k=4, $r_c=4$, $\beta=1$, and $S^{\dagger}=0.99$ for Different Confidence Levels

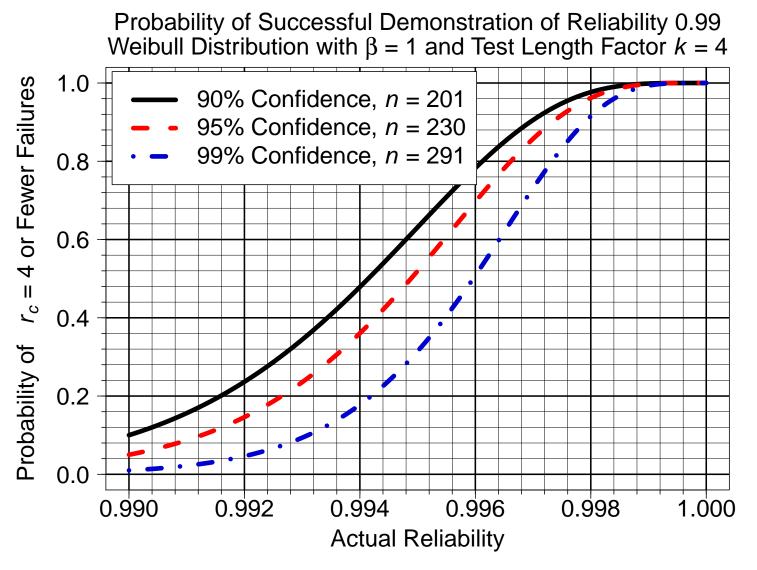

Reliability Demonstration Tests Summary

- Reliability demonstration tests are a useful alternative to life tests aimed at estimation because they generally require smaller sample sizes.
- There is a tradeoff between sample size n and test length, controlled by k. Generally, there is a need to test for a number of hours/cycles that is substantially larger than the design life of the product, usually by acceleration.
- Zero-failure minimum-sample-size tests may appear to be attractive, but tend to have a small probability of successful demonstration, unless $S(t_e) >> S^{\dagger}$.
- It is generally better to use a test that allows a few failures.

References

Meeker, W. Q., L. A. Escobar, and F. G. Pascual (2021). Statistical Methods for Reliability Data (Second Edition). Wiley. [1]