

CYLW / YLW
KELOWNAMVD
(B737-NG)19-3
10 JAN 24
EFF: 21 MAR 24

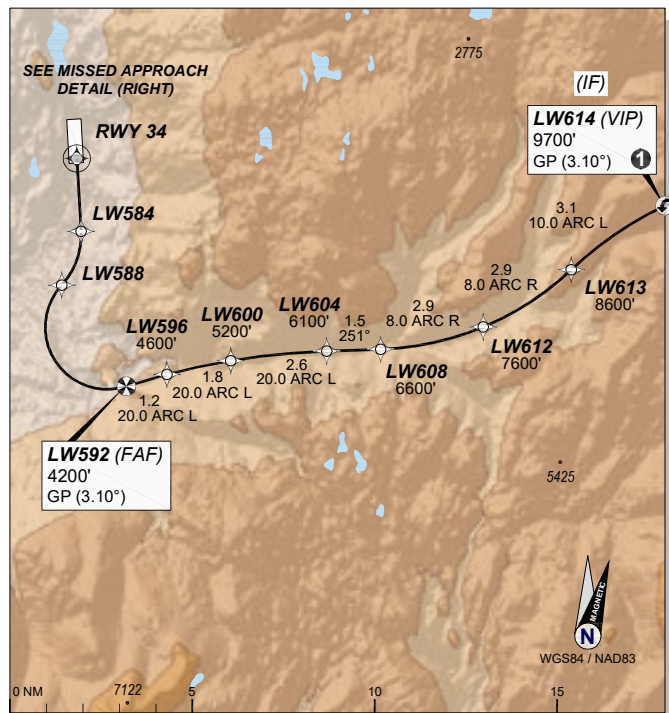
WESTJET

KELOWNA, BC
RNAV (RNP) W RWY 34

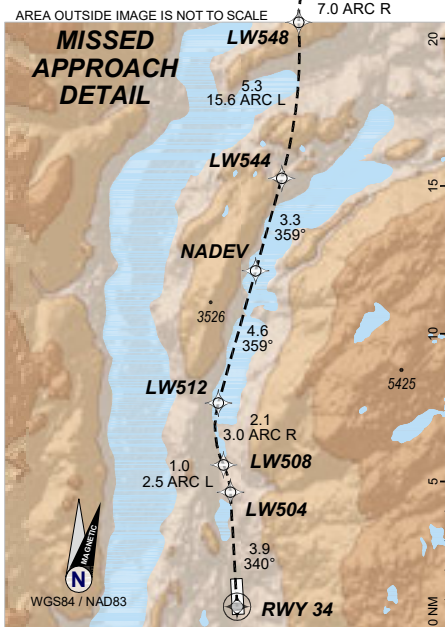
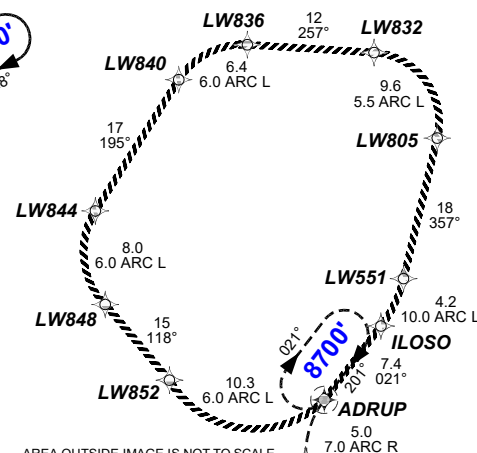
GE PROPRIETARY INFORMATION

ATIS 127.5	VANCOUVER Center 133.5	*KELOWNA Tower 119.6	*KELOWNA Ground 121.7	PENTICTON Radio (Remote ASS) MF 119.6 when Twr inop	
RNAV (RNP) RNV W 34	FMS Rwy Heading 340°	Apt Elev. 1420' TDZE 1369'	EBDOV (IAF) 11000'A	LW592 (FAF) 4200' (3.10°)	Trans Level FL180

① VNAV PATH must be annunciated beyond this point.

SPECIAL AIRCREW
AUTHORIZATION REQUIRED9700'
MSA ARP

AREA OUTSIDE IMAGE IS NOT TO SCALE

MISSED APPROACH:Climb to **8700'** via the RNAV (RNP) Missed Approach track to **ADRUP** and hold as published. Maximum holding speed **230 KIAS**.**ENGINE OUT MISSED APPROACH:**If unable to cross **ADRUP** at **8700'**, advise ATC, and climb to **8700'** via the RNAV (RNP) Engine Out Missed Approach track back to **ADRUP** and hold as published. Maximum holding speed **230 KIAS**.**APPROACH:**

- Verify GPS predictions provide the necessary ANP requirements for the approach
- Alt Set: INCHES
- Approach not authorized when airport temperature below -21 degrees C or above 44 degrees C.
- Approach not authorized using remote altimeter setting

REQUIRED EQUIPMENT:

- EGPWS (Set TERR)
- (2) FMCS
- (2) GPS
- (2) IRS in NAV Mode
- (2) PFD/ND Displays
- (2) Flight Director Displays
- (1) A/P Channel in LNAV/VNAV
- (1) Radio Altimeter operating with associated Flight Director

FMS:

- DME/DME off
- RNP lateral (as required)
- RNP vertical 125'
- Enter wind correction

Notes:

- VGSI not coincident with the RNAV glidepath.

202401100204COPYRIGHT 2024 GE Aerospace Aviation Software

RWY 34			
TCH 50'			
TDZE 1369'			
	2.0	2.0	3.6
	2.0	1.6	4.5
	2.0	2.0	1.7
	2.0	3.6	8.1
RNP 0.10	RNP 0.15	RNP 0.20	RNP 0.30
DA(H) 1715' (346')	DA(H) 1760' (391')	DA(H) 1791' (422')	DA(H) 1871' (502')
C	C	C	C
1	1 1/4	1 1/4	1 1/2
D	D	D	D

Revision: GE Aerospace name revision, Mag Var updates.

EFF 21 MAR 24

RESTRICTED

RESTRICTED