

CYLW / YLW  
KELOWNAMVD  
(B737-NG)19-2  
10 JAN 24  
EFF: 21 MAR 24

WESTJET

KELOWNA, BC  
RNAV (RNP) X RWY 34


GE PROPRIETARY INFORMATION

|                               |                                     |                                             |                                    |                                                                  |                              |
|-------------------------------|-------------------------------------|---------------------------------------------|------------------------------------|------------------------------------------------------------------|------------------------------|
| ATIS<br><b>127.5</b>          | VANCOUVER<br>Center<br><b>133.5</b> | *KELOWNA<br>Tower<br><b>119.6</b>           | *KELOWNA<br>Ground<br><b>121.7</b> | PENTICTON Radio<br>(Remote ASS)<br>MF <b>119.6</b> when Twr inop |                              |
| RNAV (RNP)<br><b>RNV X 34</b> | FMS Rwy Heading<br><b>340°</b>      | Apt Elev. <b>1420'</b><br>TDZE <b>1369'</b> | BEPIB (IAF)<br><b>8200'A</b>       | EBNAD (IAF)<br><b>9000'A</b>                                     | ADRP (IAF)<br><b>10000'A</b> |

**LW624 (FAF)**  
**2900' (3.10°)**

Trans Level  
**FL180**

① VNAV PATH must be annunciated beyond this point. (LW696 for ADRUP transition, LS664 for BEPIB transition, LW812 for EBNAD transition)

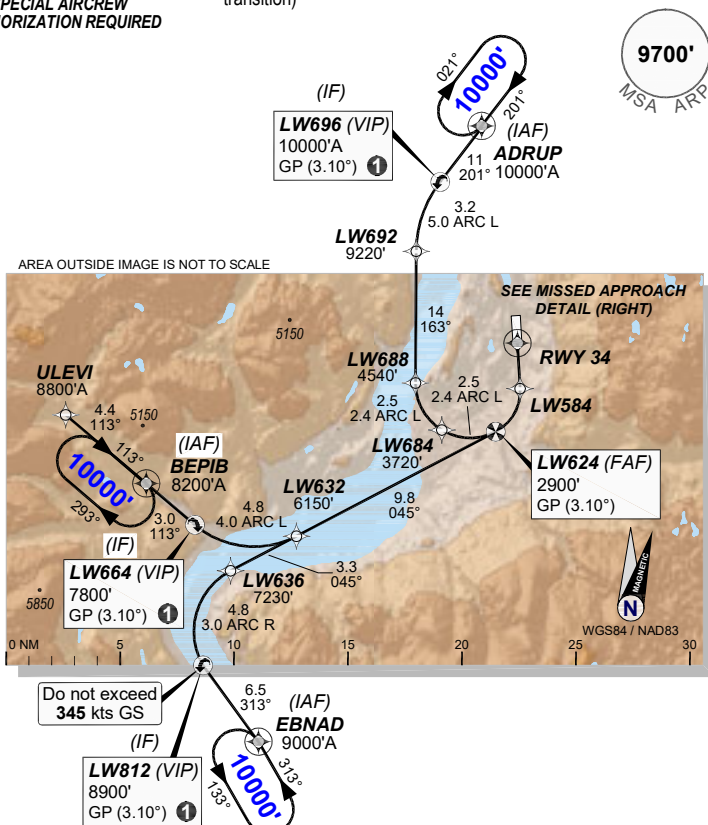SPECIAL AIRCREW  
AUTHORIZATION REQUIRED


|                    |  |                             |  |                              |  |
|--------------------|--|-----------------------------|--|------------------------------|--|
| RWY 34             |  | LW584<br>GP 2090'<br>(721') |  | LW624<br>GP 2900'<br>(1531') |  |
| TCH<br>50'         |  | 340°                        |  | (3.10°)                      |  |
| TDZE<br>1369'      |  | 2.0                         |  | 2.3                          |  |
|                    |  | 2.0                         |  | 4.3                          |  |
| RNP 0.10           |  | RNP 0.15                    |  | RNP 0.20                     |  |
| DA(H) 1715' (346') |  | DA(H) 1760' (391')          |  | DA(H) 1791' (422')           |  |
| C 1                |  | C 1 1/4                     |  | C 1 1/4                      |  |
| D 1                |  | D 1 1/4                     |  | D 1 1/2                      |  |

## MISSED APPROACH:

Climb to 8700' via the RNAV (RNP) Missed Approach track to ADRUP and hold as published. Maximum holding speed 230 KIAS.

## ENGINE OUT MISSED APPROACH:

If unable to cross ADRUP at 8700', advise ATC, and climb to 8700' via the RNAV (RNP) Engine Out Missed Approach track back to ADRUP and hold as published. Maximum holding speed 230 KIAS.

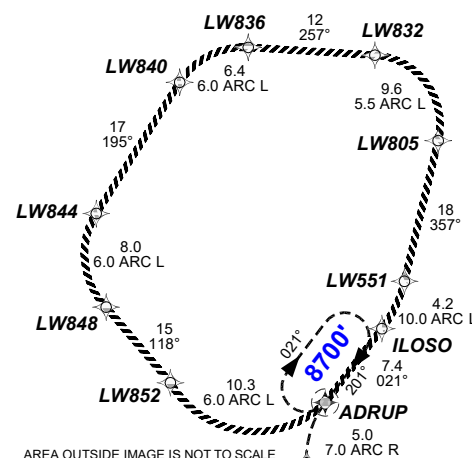

## APPROACH:

- Verify GPS predictions provide the necessary ANP requirements for the approach
- Alt Set: INCHES
- Approach not authorized when airport temperature below -21 degrees C or above 44 degrees C.
- Approach not authorized using remote altimeter setting

## REQUIRED EQUIPMENT:

- EGPWS (Set TERR)
- (2) FMCS
- (2) GPS
- (2) IRS in NAV Mode
- (2) PFD/ND Displays
- (2) Flight Director Displays
- (1) A/P Channel in LNAV/VNAV
- (1) Radio Altimeter operating with associated Flight Director

## FMS:

- DME/DME off
- RNP lateral (as required)
- RNP vertical 125'
- Enter wind correction

## Notes:

- VGSI not coincident with the RNAV glidepath.