


ILS RWY 35L

510650N 1140113W VAR 15°E

ATIS – 128.22	ARR – 126.52 (W) 125.9 (E) 123.85 127.15	TWR – 118.4 (W) 118.7 (E) 236.6	GND – 121.9 (W) 125.35 (E) 275.8	TDZL
SAFE ALT 100 NM 13,800	LOC IYC 111.5	APCH CRS 345°	GP BOVIX 4820	LDA 12675

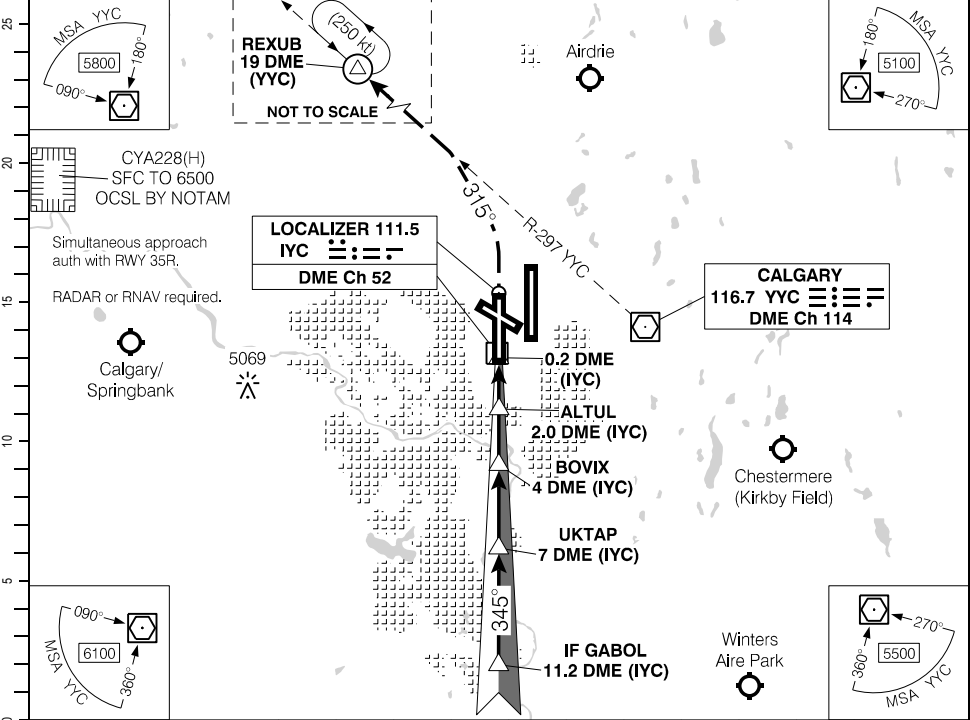

DIST FROM DME (IYC)	1.1	2	3	4	5	6	7	8	9.3	10	11.2	
ALT (3.00° APCH PATH)	3900	4180	4500	4820	5140	5460	5770	6090	6500	6730	7110	
MISSED APPROACH Climb to 4100 hdg 345° . Then climbing LEFT turn to 7000 hdg 315° . Intercept OBD "YYC" R-297 to REXUB. As required shuttle climb.												
ELEV 3606 TDZE 3542												
0.2 DME (IYC)												
ALTUL 4180												
BOVIX GP 4820												
UKTAP 5780												
GP 3.00°												
GABOL 7110												
6500												
Procedure turn NOT AUTHORIZED.												
MDA 4000 (LOC only)												
4800												
5200												
1.8												
2.0												
3.1												
4.2												
CATEGORY	A	B	C	D								
ILS/DME	3742	(200)	½ RVR 26									
LOC/DME	3900	(358)	1 RVR 50									
Knots	70	370										
ft/min	90	480										
Min:Sec	110	580										
	130	690										
	150	800										

ILS RWY 35L

EFF 27 NOV 25