
WASHINGTON COUNTY OREGON AI	DA Curb Ramp New Cons	struction Inspection	on Form (Con	mbination)	
NW 307th Ave	23885.56		NW Bartlett Loop		
North-South Road Name	Project No. Sheet No.	Intersection No.	East-West Road N	lame o: -)
	Calibration Date	7/2/2024 (mm/dd	d/yy)	k - ')' - ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '	
Ramp Style C	RAMP RUN 1	Pas	ss Fail	1	2
* The passing value for Gutter Flow Slope (GFS)	Running Slope 1	8.5 ≤ 8.3%	> 8.3% ■	Corner Position Positions	A 18
depends on the Intersection Condition Type. At a	Length 1	3.5		Position 3 Positions	2A 1
Midblock (MB), GFS must be ≤ Slope of the Road, at	Cross Slope 1	1.5 ≤ 2.0%	> 2.0%		2
Signalized or Uncontrolled (SU), GFS must be \leq 5.0%, and at Stop or Yield (SY), GFS must be 2.0%.	Detectable Warning (Y/N)	Y	N	1	3
* ¹ If Back of Ramp Obstruction is Yes, turn space	Lip Height	0 ≤ 1/4"	> 1/4"	3A North	
length Y must be minimum 5.0 feet.	Gutter Flow Slope	0.3 ≤ *	>*	1	2
* ² Clear Space area is the width of Ramp Run 1 and extends 4.0' into the roadway.	Curb Running Slope (avg)	5.22 ≤ 8.3 %	> *8.3%	1 4 Ramp	
•	Counter Slope (+/-)*2	5.8 ≤ 5.0%	> 5.0%	Ramp Positions	
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)				Position 5	
Pass Fail	RAMP RUN 2	Pas			p (required for
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $\geq 5.0'$	Running Slope 2	8.8 ≤ 8.3%	> 8.3%	private o	development)
	Length 2	5.5			
	Cross Slope 2	1.9 ≤ 2.0%	> 2.0%		
Detectable warning extends full width of ramp throat opening	RAMP RUN 3 Pass Fail				
	Running Slope 3	4.0 ≤ 8.3%	> 8.3%		
	Length 3	4.75			
B	Cross Slope 3	2.3 ≤ 2.0%	> 2.0%		
Flare Slope Run 3 Run 2	TURN SPACE Pass Fail		Comments:		
I non y	Width X	2.4 ≥ 4.0'	< 4.0' ■	TD	
Counter slope Souther Flow slope	Length Y	5.2 ≥4.0'*1 ■	1 < 4.0'*1		
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N) N ≥5.0'*1	< 5.0'* ¹		
	Slope X	3.1 ≤2.0%	> 2.0%		
COMBINATION RAMP (C)	Slope Y	1.1 ≤2.0%	> 2.0%		
Pedestrian Access Route (to measure Clear Width)	MISCELLANEOUS Traversab	le Pas	ss Fail		=
Detectable Warning Surface Cross Slope (2.0% max.)	Flare Slope 1	11.2 ≤ 10%	> 10%		_
Running Slope (8.3% max.)	Flare Slope 2	2.7 ≤ 10%	> 10%	Inspector's Signature	Date (mm/dd/y
Counter Slope (5.0% max.) Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*	Clear Width (feet)	≥ 4.0'	< 4.0'	Darrell Wyant	52638
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'.	Horizontal Gaps (Y/N)	≤ 1/2"		Print name clearly	Certification N
Gutter Flow Slope (as directed)				3J Consulting	_
	Intersection Control Type	SY Slope of Ro	Juu 0.0	Company/Agency	



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed



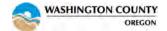

