
NW Main		23885.56	NW	Lenox
North-South Road Name		Project No. Sheet No. I	ntersection No. East-	-West Road Na
		Calibration Date	(mm/dd/yy)	
	PL	RAMP RUN 1	Pass	Fail
	Ramp Style	Running Slope 1	≤ 2.0%  > 2.0%	Corr
*The passing value for Gutter Flow Slope (GFS)		Cross Slope 1	≤ 2.0% > 2.0%	Posi
depends on the Intersection Cont	rol Type. At a	Detectable Warning	Y N	
Midblock (MB), GFS must be ≤ Slo Road, at Signalized or Uncontrolle	•	Lip Height	≤ 1/4" ■ > 1/4"	
must be $\leq 5.0\%$ , and at Stop		Gutter Flow Slope 5.3	≤ * > *	
or Yield (SY), GFS must be ≤ 2.0%.		Curb Running Slope(avg) 8.1	≤ 8.3% ■ > 8.3%>	. 🔲
*1 If Back of Ramp Obstruction is space length Y must be minimum	Yes, turn 5.0 ft.	Counter Slope (+/-)*2	≤ 5.0%  ■ >  5.0%	
*2 Clear Space area is the width of Ramp Run 1 and extends 4.0 ft into the roadway.		Det. warning full width of ramp	Y N	Ram Posi
		RAMP RUN 2	Pass	Fail
		Running Slope 2	≤ 8.3% > 8.3%	
See also <u>Standard Drawings</u> to assess provisions not shown:		Length 2 7.0	05	
(inlets, alignment, etc.)		Cross Slope 2	≤ 2.0%  > 2.0%	
Carrier Street		RAMP RUN 3	Pass	Fail
		Running Slope 3	≤ 8.3% ■ > 8.3%	
B Pan 3 X35		I		

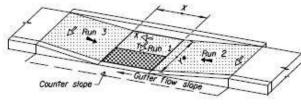

## PARALLEL RAMP (PL)

## PARALLEL RAMP (PL)

Pedestrian Access Route (to measure Clear Width)

Detectable Warning Surface

Cross Slope (2.0% max.)

Running Slope (8.3% max.)

Counter Slope (5.0% max.)

Turning Space (X & Y) (2.0% max. /  $4' \times 4'$  min.)\* \* If constrained at back of walk, min. Y length is 5'.

Gutter Flow Slope (as directed)

Calibration Date	(mm/dd/yy)		Use Washington County corner numbering system.	
RAMP RUN 1	Pass	Fail	2	
Running Slope 1	≤ 2.0% > 2.0%		Corner Corner Positions	
Cross Slope 1	≤ 2.0%  > 2.0%		Position 3	
Detectable Warning	Y N			
Lip Height	≤ 1/4" ■ > 1/4"		(3A )	
Gutter Flow Slope	5.3 ≤* >*		North 2	
Curb Running Slope(avg)	8.1 ≤ 8.3% <b>■</b> > 8.3%>			
Counter Slope (+/-)*2	6.9 ≤ 5.0%  <b>■</b> >  5.0%		Ramp 1 Positions	
Det. warning full width of ramp	Y		Ramp Position	
RAMP RUN 2	Pass	Fail	PE Stamp (required for	
Running Slope 2	≤ 8.3% > 8.3%		private development)	
Length 2	7.05			
Cross Slope 2	≤ 2.0%  > 2.0%			
RAMP RUN 3	Pass	Fail		
Running Slope 3	3.6 ≤ 8.3% ■ > 8.3%			
Length 3	7.2			
Cross Slope 3	0.8 ≤ 2.0% ■ > 2.0%		Comments:	
TURN SPACE Pass F		Fail		
Width X	4.9 ≥ 4.0'		DWS IITD Fails RR 1	
Length Y	6.1 ≥ 4.0'*1 <b>■</b> < 4.0'*1			
Back of Ramp Obstruction (Y/N)	≥ 5.0'*1  < 5.0'*1			
Slope X (Cross Slope 1)	≤ 2.0% > 2.0%			
Slope Y (Running Slope 1)	≤ 2.0% > 2.0%			
MISCELLANEOUS	Pass	Fail	Inspector's Signature Date (mm/dd/yy)	
Clear Width (feet)	4.9 ≥ 4.0' < 4.0'		Darrell Wyant 52638	
Intersection Control Type	Slope of Rd. 5.0		Print name clearly Certification No.	
Horizontal Gaps	○ ≤ 1/2" <b>■</b> > 1/2"		3J Consulting Company/Agency	

East-West Road Name

See https://www.oregon.gov/odot/Engineering/Documents \_RoadwayEng/ADA\_ExhibitA.pdf for more corner styles.



## **ADA Curb Ramp Images**

Attached photos must be in .pdf format in order to be placed





