
WASHINGTON COUNTY OREGON ADA Curb Ramp New Construction Inspection Form (Combination)					
NW 307th Ave	23885.56		NW Bartlett Loop		
North-South Road Name	Project No. Sheet No.	Intersection No.	East-West Road N	ame o: -	)
	Calibration Date	7/2/2024 (mm/dd	/yy)	k - ')' - ∪ ‡ #	
Ramp Style C	RAMP RUN 1	Pas	s Fail	2	2
* The passing value for Gutter Flow Slope (GFS)	Running Slope 1	6.6 ≤ 8.3%	> 8.3%	Corner Position Positions	A 1
depends on the Intersection Condition Type. At a	Length 1	3.5		3 5	2A 1
Midblock (MB), GFS must be $\leq$ Slope of the Road, at Signalized or Uncontrolled (SU), GFS must be $\leq$ 5.0%,	Cross Slope 1	1.6 ≤ 2.0%	> 2.0%	1	
and at Stop or Yield (SY), GFS must be 2.0%.	Detectable Warning (Y/N)	Y	N	1	3
* 1 If Back of Ramp Obstruction is Yes, turn space	Lip Height	0.5 ≤ 1/4"	> 1/4"	3A North	
length Y must be minimum 5.0 feet.  * <sup>2</sup> Clear Space area is the width of Ramp Run 1 and	Gutter Flow Slope	0.7 ≤ *	>*	1	
extends 4.0' into the roadway.	Curb Running Slope (avg)	3.5 ≤ 8.3%	> *8.3%	1 4 Ramp 1	
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	6.1 ≤  5.0%	>  5.0%	Ramp Positions	
Pass Fail	RAMP RUN 2	Pas	s Fail	PE Stamp	(required for
1 033 1 011	Running Slope 2	0.8 ≤ 8.3%	> 8.3%	private d	evelopment)
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $ \ge 5.0'$	Length 2	5.65			
	Cross Slope 2	≥ 2.0%	> 2.0%		
<u></u>	RAMP RUN 3 Pass Fail				
Detectable warning extends full width of ramp	Running Slope 3	0.7 ≤ 8.3%	> 8.3%		
throat opening	Length 3	4.6			
Flore Slope B Run 3 / Run 2	Cross Slope 3	1.7 ≤ 2.0%	> 2.0%		
	TURN SPACE Pass Fail		Comments:		
I no s	Width X	5 ≥ 4.0'	< 4.0'	TD	
Counter slope Gulter Now slope	Length Y	3.8 ≥4.0'*1	< 4.0'*1 <b>■</b>		
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N)	) N ≥5.0'*1 ■	< 5.0'*1		
COMBINATION RAMP (C)	Slope X	1.1 ≤2.0%	> 2.0%		
Pedestrian Access Route (to measure Clear Width)	Slope Y	1.9 ≤2.0%			
Detectable Warning Surface	MISCELLANEOUS Traversable				
Cross Slope (2.0% max.)	Flare Slope 1	4.8 ≤ 10%	> 10%		
Running Slope (8.3% max.)	Flare Slope 2	5.0 ≤ 10%	> 10%	Inspector's Signature	Date (mm/dd/
Counter Slope (5.0% max.)  Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*	Clear Width (feet)	3.8 ≥ 4.0'	< 4.0'	Darrell Wyant Print name clearly	52638 Certification N
* If constrained at back of walk, min. Y length is 5'.  Gutter Flow Slope (as directed)	Horizontal Gaps (Y/N)	≤ 1/2"	1/2"	3J Consulting	Certification
	Intersection Control Type	SY Slope of Ro	ad 0.0	Company/Agency	



## **ADA Curb Ramp Images**

Attached photos must be in .pdf format in order to be placed



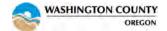

