WASHINGTON COUNTY OREGON AD	A Curb Ramp New Cons	truction Inspection Form	(Combination)
NW 306th	23885.56	NW Kaybern	
North-South Road Name	Project No. Sheet No. Calibration Date	Intersection No. East-West 7/16/2024 (mm/dd/yy)	Road Name o: -) k - ') - ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '
Ramp Style C	RAMP RUN 1	Pass	Fail 1
* The passing value for Gutter Flow Slope (GFS) depends on the Intersection Condition Type. At a Midblock (MB), GFS must be ≤ Slope of the Road, at Signalized or Uncontrolled (SU), GFS must be ≤ 5.0%, and at Stop or Yield (SY), GFS must be 2.0%. * ¹If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet. * ² Clear Space area is the width of Ramp Run 1 and extends 4.0' into the roadway.	Running Slope 1 Length 1 Cross Slope 1 Detectable Warning (Y/N) Lip Height Gutter Flow Slope Curb Running Slope (avg)	8.1 $\leq 8.3\%$ $> 8.3\%$ 3.5 $> 2.0\%$ 1.3 $\leq 2.0\%$ $> 2.0\%$ Y $> 1\%$ N 0 $\leq 1/4$ " $> 1/4$ " 1.1 $\leq *$ $> *$ 4.06 $\leq 8.3\%$ $> *8.3\%$	Corner Positions 3 A 2 North Ramp
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	3.4 ≤ 5.0% ► > 5.0%	Ramp Position Positions
Pass Fail	RAMP RUN 2	Pass	PE Stamp (required for
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $\geq 5.0'$	Running Slope 2 Length 2 Cross Slope 2	3.5 ≤ 8.3% ► > 8.3% 6.3 > 2.8 ≤ 2.0% > 2.0%	private development)
Detectable warning extends full width of ramp throat opening	RAMP RUN 3 Running Slope 3 Length 3	Pass 6.7 ≤ 8.3% ■ > 8.3% 7.2	
8	Cross Slope 3	1.9 ≤ 2.0% ■ > 2.0%	
Flore Slope Run 3 Prun 2	TURN SPACE	Pass	Fail Comments:
Counter slope Gutter now show	Width X Length Y	5.0 $\geq 4.0'$ \blacksquare $< 4.0'$ 5.0 $\geq 4.0'*1$ \blacksquare $< 4.0'*1$	
COMPINATION DAMP (C)	Back of Ramp Obstruction (Y/N		
COMBINATION RAMP (C)	Slope X	22 ≤2.0% >2.0%	
Pedestrian Access Route (to measure Clear Width)	Slope Y MISCELLANEOUS Traversab	1.5 ≤2.0% > 2.0% le Pass	Fail
Detectable Warning Surface Cross Slope (2.0% max.)	Flare Slope 1	7.8 ≤ 10% ■ > 10%	
Running Slope (8.3% max.) Counter Slope (5.0% max.)	Flare Slope 2	8.6 ≤ 10% ■ > 10%	Inspector's Signature Darrell Wyant 52638
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'.	Clear Width (feet)	5.0 ≥ 4.0' < 4.0'	Print name clearly Certification N
Gutter Flow Slope (on directed)	Horizontal Gaps (Y/N)	≤ 1/2" ■ 1/2"	0.10 16

Gutter Flow Slope (as directed)

Horizontal Gaps (Y/N)


Intersection Control Type

SU

Slope of Road 1.2

3J Consulting

Company/Agency

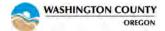

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





