


ADA Curb Ramp New Construction Inspection Form (Perpendicular)

1	lw 292 ave	24952.54				Nw w	est u	inion rd
No	orth-South Road Name	Project No. Shee	et No.	ntersection N	о.	East-W	est Ro	oad Name
		Calibration Date	8/6/2024	(mm/dd/	' yy)			k - ') ' - ' ' ' ' ' ' ' ' ' ' ' ' ' ' '
	Ramp Style PR	RAMP RUN 1		≤ 8.3%	Pass	>8.3%	Fail	Corner
•	ssing value for Gutter Flow Slope (GFS) s on the Intersection Control Type. At a	Running Slope 1 Length 1 Cross Slope 1	9.45	≤ 2.0%		>2.0%		Corner Position 3 Positions 2A
Signalize	k (MB), GFS must be ≤ Slope of the Road, at ed or Uncontrolled (SU), GFS must be ≤	Detectable Warning (Y,N)		≤ 2.0% Y		>2.0% N		3A 3
	ad at Stop or Yield (SY), GFS must be ≤ 2.0%. of Ramp Obstruction is Yes, turn space	Lip Height Gutter Flow Slope	1.5	1/4" ≤ *		>1/4" >*		North 2
	e area is the width of Ramp Run 1 and	Curb Running Slope (avg)	2.3	≤ 8.3%		>8.3%		2 Ramp Positions
See als	4.0 ft into the roadway. Standard Drawings to assess provisions not shown: alignment, etc.)	Counter Slope (+/-) *2 Longest distance from corner to back of curb	0.5	< 5.0'		> 5.0% ≥ 5.0'		Pe Stamp (require private developri
/*		(see dwg on BT form) Detectable warning extends full width of ramp throat opening		Y		N		
	Aun 1 / Se	TURN SPACE LANDING Width X	G NON	NE	Pass	< 4.0'	Fail	
Counter	slope Sope	Length Y		≥ 4.0'*1		< 4.0'*1		Comments: IITD not full width rr1 icrr turn space
Р	RPENDICULAR RAMP (PR)	Back of Ramp Obstruction (Y/N) Slope X		≥ 5.0'*1 ≤2.0%		< 5.0'*1 >2.0%		width less than 4'
	Pedestrian Access Route (to measure Clear Width) Detectable Warning Surface	Slope Y		≤2.0%		>2.0%		
(Cross Slope (2.0% max.) Running Slope (8.3% max.)	MISCELLANEOUS Traversa	ble	≤ 10%	Pass	< 10%	Fail	Inspector's Signature Date (r
← <i>A</i>	Counter Slope (5.0% max.)	Flare Slope 2		≤ 10%		<10%		Darrell Wyant 526
Ţ	Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'. Gutter Flow Slope (as directed)	Clear Width (feet) Intersection Control Type	SY	≥ 4.0' Slope of	Road	< 4.0'	Ш	Print name clearly Certific
	Gutter Flow Slope (as directed)	Horizontal Gaps		≤1/2"		> 1/2"		3J Consulting Company/Agency

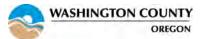

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





