
WASHINGTON COUNTY OREGON AD	A Curb Ramp New Cons	truction Inspec	tion Form (Co	mbination)	
Nw 288 ter	24952.54		Nw carver st		
North-South Road Name	Project No. Sheet No.	Intersection No.	East-West Road	Name o :	-)
	Calibration Date	8/13/2024 (mm/	/dd/yy)	k - ') - U ‡ #	
Ramp Style C	RAMP RUN 1	P	ass Fail		2
* The passing value for Gutter Flow Slope (GFS)	Running Slope 1	≤ 8.3%	> 8.3%	Position	Corner ositions
depends on the Intersection Condition Type. At a	Length 1	5.1		3	5 2A
Midblock (MB), GFS must be \leq Slope of the Road, at Signalized or Uncontrolled (SU), GFS must be \leq 5.0%,	Cross Slope 1	≤ 2.0%	> 2.0%		
and at Stop or Yield (SY), GFS must be 2.0%.	Detectable Warning (Y/N)	Y	N		3
* ¹ If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet.	Lip Height	≤ 1/4"	> 1/4"	3A 2	North
* 2 Clear Space area is the width of Ramp Run 1 and	Gutter Flow Slope	0.6 ≤ *	> *		(A)
extends 4.0' into the roadway.	Curb Running Slope (avg)	1.28 ≤ 8.3%	> *8.3%	/ 510	Ramp 1
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	2.3 ≤ 5.0%	> 5.0%	Ramp Position	ositions
Pass Fail	RAMP RUN 2	P	ass Fail		PE Stamp (required for
1 033	Running Slope 2	8.0 ≤ 8.3%	> 8.3%		private development)
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $\geq 5.0'$	Length 2	4.8			
	Cross Slope 2	2.4 ≤ 2.0%	> 2.0%		
Detectable warning extends full width of ramp throat opening Flore Slope Run 1 Run 1	RAMP RUN 3 Pass Fail				
	Running Slope 3	7.3 ≤ 8.3%	> 8.3%		
	Length 3	5			
	Cross Slope 3	1.4 ≤ 2.0%	> 2.0%	[
	TURN SPACE Pass Fail				
	Width X	5.0 ≥ 4.0'	■ <4.0'	IITD	
Counter slope Gutter Now slope	Length Y	≥4.0'*1	■ <4.0'*1		
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N) ≥5.0'*1	< 5.0'*1		
COMBINATION RAMP (C)	Slope X	≤2.0%	> 2.0%		
Pedestrian Access Route (to measure Clear Width)	Slope Y	≤2.0%	> 2.0%		
Detectable Warning Surface	MISCELLANEOUS Traversab		Pass Fail		
	Flare Slope 1	≤ 10%	> 10%		
Running Slope (8.3% max.)	Flare Slope 2	≤ 10%	> 10%	Inspector's Signature	Date (mm/dd/y
Counter Slope (5.0% max.) Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*	Clear Width (feet)	≥ 4.0'	< 4.0'	Darrell Wyant Print name clearly	52638 Certification N
* If constrained at back of walk, min. Y length is 5'. Gutter Flow Slope (as directed)	Horizontal Gaps (Y/N)	≤ 1/2"	1/2"	3J Consulting	Certification is
	Intersection Control Type	Slope of	Road 0.2	Company/Agency	



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed



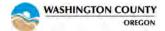

