WASHINGTO	ON COUNTY ADA	A Curb Ramp New Cons	truction Inspection	on Form (Co	mbination)	
NW Curtis		23885.56		NW Pacific		
	South Road Name	Project No. Sheet No.	Intersection No. 7/10/2024 (mm/dd	East-West Road /yy)	Name o: -)	
Ramp Style C		RAMP RUN 1	Pas	s Fail	4	
depends on the Midblock (MB), Signalized or Ur and at Stop or Y * 1If Back of Rar length Y must b	alue for Gutter Flow Slope (GFS) Intersection Condition Type. At a GFS must be ≤ Slope of the Road, at accontrolled (SU), GFS must be ≤ 5.0%, Yield (SY), GFS must be 2.0%. The Obstruction is Yes, turn space a minimum 5.0 feet. The Area is the width of Ramp Run 1 and	Running Slope 1 Length 1 Cross Slope 1 Detectable Warning (Y/N) Lip Height Gutter Flow Slope Curb Running Slope (avg)	3.5 ≤ 8.3% ■ 5.0 8.0 ≤ 2.0% Y ≤ 1/4" ■ 6.9 ≤ * 8.66 ≤ 8.3%	> 8.3% > 2.0% N > 1/4" > * > *8.3%	Corner Positions 3 Corner Positions 3 North	
See also Standard Drawings to assess provisions not shown: (inlets, alignment, etc.)		Counter Slope (+/-)*2	4.9 ≤ 5.0%	> 5.0%	Ramp Position Positions	
Pass Fail		RAMP RUN 2	Pas	1 -	PE Starry (required for	
Longest distance fro detectable warning corner to back of cu nearest inch)	< 5.0' ≥ 5.0'	Running Slope 2 Length 2 Cross Slope 2	16.2 ≤ 8.3% 4.75 3.1 ≤ 2.0%	> 8.3%	private development)	
Detectable warning extends full width of ramp Y N hroat opening		RAMP RUN 3 Running Slope 3 Length 3	Pas 3.2 ≤ 8.3% ■ 5.55	s Fail > 8.3%		
Flare Slope Run 3 Run 2 Run 2 Run 2 Counter slope COMBINATION RAMP (C)		Cross Slope 3 TURN SPACE	22 ≤ 2.0% Pas	> 2.0% a	Comments:	
		Width X Length Y	4.0 ≥ 4.0' ■ 1.65 ≥ 4.0'*1	< 4.0' < 4.0'*1 < 4.0'*1	Ramp run 2, Ramp run 3, clear width less than 3ft	
		Back of Ramp Obstruction (Y/N)		< 5.0'*1 ■		
	COMBINATION RAMP (C)	Slope X	8.2 ≤2.0%	> 2.0%		
F	Pedestrian Access Route (to measure Clear Width)	Slope Y MISCELLANEOUS Traversable	22 ≤2.0% Pas	> 2.0% =		
	Detectable Warning Surface Cross Slope (2.0% max.)	Flare Slope 1	11.2 ≤ 10%	> 10%		
← F	Running Slope (8.3% max.) Counter Slope (5.0% max.)	Flare Slope 2	3.2 ≤ 10%	> 10%	Inspector's Signature Date (mm/dd/y Darrell Wyant 52638	
_	furning Space (X & Y) (2.0% max. / 4' x 4' min.)* If constrained at back of walk, min. Y length is 5'.	Clear Width (feet)	1.65 ≥ 4.0'	< 4.0'	Print name clearly Certification N	
- 0	Butter Flow Slope (as directed)	Horizontal Gaps (Y/N)	≤ 1/2"	1/2"	3.I Consulting	

Intersection Control Type


Gutter Flow Slope (as directed)

SY

Slope of Road 6.6

3J Consulting

Company/Agency

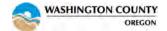

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





