
WASHINGTON COUNTY OREGON	DA Curb Ramp New Cons	struction Inspection Form (Cor	mbination)
NW Curtis	23885.56	NW Pacific	
North-South Road Name	Project No. Sheet No.	Intersection No. East-West Road N	lame o: -)
	Calibration Date	(mm/dd/yy)	k - ') ' - ' ' ' ' ' ' ' ' ' ' ' ' ' ' '
Ramp Style C	RAMP RUN 1	Pass Fail	2
* The passing value for Gutter Flow Slope (GFS) depends on the Intersection Condition Type. At a Midblock (MB), GFS must be ≤ Slope of the Road, at	Running Slope 1 Length 1	3.5 ≤ 8.3% > 8.3% 5.0	Corner Positions 3
Signalized or Uncontrolled (SU), GFS must be \leq 5.0%, and at Stop or Yield (SY), GFS must be 2.0%.	Cross Slope 1 Detectable Warning (Y/N)	8.0 \$ 2.0% \$ 2.0% \$ 1.0	3
* ¹ If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet.	Lip Height	6.9 ≤ * > * ■	3A North
* ² Clear Space area is the width of Ramp Run 1 and extends 4.0' into the roadway.	Gutter Flow Slope Curb Running Slope (avg)	6.9 ≤ * > * 8.66 ≤ 8.3% > *8.3%	4 Ramp 1
See also Standard Drawings to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	4.9 ≤ 5.0% > 5.0% ■	Ramp Position Positions
Pass Fa		Pass Fail	PE Stamp (required for
Longest distance from detectable warning corner to back of curb (to nearest inch) < 5.0' ≥ 5.0'	Running Slope 2 Length 2 Cross Slope 2	16.2 ≤ 8.3% > 8.3% ■ 4.75 3.1 ≤ 2.0% > 2.0% ■	private development)
Detectable warning extends full width of ramp throat opening	RAMP RUN 3 Running Slope 3 Length 3	Pass Fail 3.2 ≤ 8.3% ■ > 8.3%	
Flare Slope Run 3 Run 2 Run 2 Counter slope Counter slope	Cross Slope 3 TURN SPACE	2.2 ≤ 2.0% > 2.0% ■ Pass Fail	Comments:
	Width X Length Y	$\begin{array}{c ccccccccccccccccccccccccccccccccccc$	Ramp run 2, Ramp run 3, clear width less than 3ft
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N		
COMBINATION RAMP (C)	Slope X Slope Y	8.2 ≤2.0% > 2.0% ■ 2.2 ≤2.0% > 2.0% ■	
Pedestrian Access Route (to measure Clear Width)	MISCELLANEOUS Traversab		_
Detectable Warning Surface Cross Slope (2.0% max.)	Flare Slope 1	11.2 ≤ 10% > 10% ■	Deta : ///
Running Slope (8.3% max.) Counter Slope (5.0% max.)	Flare Slope 2	3.2 ≤ 10% ■ > 10% □ 1.65 ≥ 4.0' < 4.0'	Inspector's Signature Date (mm/dd/s) Darrell Wyant 52638
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'. Gutter Flow Slope (as directed)	Clear Width (feet) Horizontal Gaps (Y/N)	≤ 1/2" ■ 1/2"	Print name clearly Certification N

Intersection Control Type

Slope of Road 6.6

Company/Agency

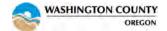

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





