	WASHINGTON COUNTY OREGON				
	NW Curtis St				
	North-South Road Name				
depe Midb Road must	passing value for Gutternds on the Intersection lock (MB), GFS must be, at Signalized or Unconbe $\leq 5.0\%$, and at Stopeld (SY), GFS must be ≤ 2				
* ¹ If space	Back of Ramp Obstruction e length Y must be minin				

ADA Curb Ramp New Construction Inspection Form (Parallel)

Project No. Sheet No.		Intersection No.	East	East-West Road Name		See https://www.oregon.gov/odot/Engineering/Documents _RoadwayEng/ADA_ExhibitA.pdf for more corner styles.		
	Calibration Date	7/2/2024 (mm	n/dd/yy)				on County corner num	
T	RAMP RUN 1		Pass	Fail	3	1		2
	Running Slope 1	2.7 ≤ 2.0%	> 2.0%		Corner	_ []	Corner Positions	
	Cross Slope 1	2.1 ≤ 2.0%	> 2.0%		Position	3	5 2	2A
	Detectable Warning	N Y	N			1		3
	Lip Height	0 ≤ 1/4"	> 1/4"		(3A	. 1	
	Gutter Flow Slope	1.6 < *	> *			2	North	2
	Curb Running Slope(avg)	4.6 ≤ 8.3%	> 8.3%>	>		4	Ramp 1	
	Counter Slope (+/-)*2	^{7.3} ≤ 5.0%	> 5.0%		1 Ramp	12	Positions	
	Det. warning full width of ramp	Υ	N		Position		5	
	RAMP RUN 2		Pass	Fail			PE Stamp (required for
	Running Slope 2	8.1 ≤ 8.3%	8.3%				private dev	velopment)
	Length 2	6.0						
	Cross Slope 2	1.8 ≤ 2.0%	= > 2.0%					
	RAMP RUN 3		Pass	Fail]			
	Running Slope 3	8.0 ≤ 8.3%	> 8.3%					
	Length 3	7.3						
	Cross Slope 3	1.3 ≤ 2.0%	> 2.0%		Cananaant			
	TURN SPACE		Pass		Comments	S.		
	Width X	5 ≥ 4.0'	4.0 '		IITD			
	Length Y	4.9 ≥ 4.0'*1	¹ ■ <4.0'* ¹	1				
	Back of Ramp Obstruction (Y/N)	N ≥ 5.0'*1	¹ ■ < 5.0'*¹	1				
	Slope X (Cross Slope 1)	2.7 ≤ 2.0%	> 2.0%					
	Slope Y (Running Slope 1)	2.1 ≤ 2.0%	> 2.0%					
	MISCELLANEOUS		Pass	Fail	Inspector's S	ignature		Date (mm/dd/yy)
	Clear Width (feet)	5.0 ≥ 4.0'	< 4.0'		Darrell \	•		52638
	Intersection Control Type	SY Slope o	of Rd. 0.2		Print name c	<u> </u>		Certification No.
	Horizontal Gaps	≤ 1/2"	> 1/2"		3J Consultin	<u> </u>		
	I .				□ COIIIDally/A	SCIICY		


NW Highland Ct

PL Ramp Style 23885.56

utter Flow Slope (GFS) tion Control Type. At a be ≤ Slope of the controlled (SU), GFS top e ≤ 2.0%.

- uction is Yes, turn ninimum 5.0 ft.
- *2 Clear Space area is the width of Ramp Run 1 and extends 4.0 ft into the roadway.

See also Standard Drawings to assess provisions not shown: (inlets, alignment, etc.)

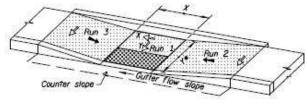

PARALLEL RAMP (PL)

PARALLEL RAMP (PL)

Pedestrian Access Route (to measure Clear Width)

Detectable Warning Surface

Cross Slope (2.0% max.) Running Slope (8.3% max.)

Counter Slope (5.0% max.)

Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*
* If constrained at back of walk, min. Y length is 5'.

Gutter Flow Slope (as directed)



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed



