WASHINGTON COUNTY OREGON	ADA Curb Ramp New Cons	struction Inspection Form (Co	mbination)
NW 307th Ave	23885.56	NW Bartlett Loop	
North-South Road Name	Project No. Sheet No.	Intersection No. East-West Road	Name o: -)
	Calibration Date	7/2/2024 (mm/dd/yy)	k - ')' - ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '
Ramp Style C	RAMP RUN 1	Pass Fail	
* The passing value for Gutter Flow Slope (GFS) depends on the Intersection Condition Type. At a	Running Slope 1 Length 1	6.6 ≤ 8.3% ■ > 8.3%	Corner Positions 2A
Midblock (MB), GFS must be ≤ Slope of the Road, at		1.6 ≤ 2.0% > 2.0%	2
Signalized or Uncontrolled (SU), GFS must be ≤ 5.0%	If ross sione i		3
and at Stop or Yield (SY), GFS must be 2.0%.	Detectable Warning (Y/N)	Y Y N	3A -
* ¹ If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet.	Lip Height	0.5 ≤ 1/4" > 1/4" ■ 0.7 < * ■ > *	North 2
* ² Clear Space area is the width of Ramp Run 1 and	Gutter Flow Slope		
extends 4.0' into the roadway.	Curb Running Slope _(avg)	3.5 ≤ 8.3%	1 Ramp 1
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)		6.1 ≤ 5.0% > 5.0% ■	Ramp Position Positions
Pass	Fail RAMP RUN 2	Pass Fail	PE Stamp (required for
Longest distance from detectable warning corner to back of curb (to nearest inch) < 5.0' ≥ 5.0'	Running Slope 2	○.8 ≤ 8.3% ■ > 8.3%	private development)
	Length 2	5.65	
	Cross Slope 2	≥ 2.0% > 2.0%	
	RAMP RUN 3	Pass Fail	
Detectable warning extends full width of ramp throat opening	Running Slope 3	0.7 ≤ 8.3% ■ > 8.3%	
	Length 3	4.6	
	Cross Slope 3	1.7 ≤ 2.0% ■ > 2.0%	
Flare Slope Run 3 FRun 2 PRun 2	TURN SPACE	Pass Fail	Comments:
	Width X	5 ≥ 4.0¹ ■ < 4.0¹	TD
Counter slope Counter slope	Length Y	3.8 ≥4.0'*1 <4.0'*1 ■	
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N	I) N ≥5.0'*1 ■ < 5.0'*1	
COMBINATION RAMP (C)	Slope X	1.1 ≤2.0% > 2.0%	
Pedestrian Access Route (to measure Clear Width)	Slope Y	1.9 ≤2.0% ■ > 2.0%	
Pedestrian Access Route (to measure Clear Width) Detectable Warning Surface	MISCELLANEOUS Traversab		-
Cross Slope (2.0% max.)	Flare Slope 1	4.8 ≤ 10% > 10%	Data (mm/dd/m
Running Slope (8.3% max.)	Flare Slope 2	5.0 ≤ 10% ■ > 10%	Inspector's Signature Date (mm/dd/y
Counter Slope (5.0% max.) Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* **If constrained at book of walk, min, Y length in 5'	Clear Width (feet)	3.8 ≥ 4.0' < 4.0'	Darrell Wyant 52638
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'.		./au 🗐	Print name clearly Certification N

Gutter Flow Slope (as directed)

Horizontal Gaps (Y/N)

Intersection Control Type

SY

≤ 1/2"


Slope of Road 0.0

1/2"

3J Consulting

Company/Agency

Certification No.

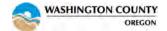

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





