WASHINGTON COUNTY OREGON ADA	A Curb Ramp New Constru	uction Inspection Form (Pa	rallel)
Main	24952.54	Comm	ercial
North-South Road Name	Project No. Sheet No.	Intersection No. East-We	st Road Name See https://www.oregon.gov/odot/Engineering/Documents
	Calibration Date	10/8/2024 (mm/dd/yy)	_RoadwayEng/ADA_ExhibitA.pdf for more corner styles Use Washington County corner numbering system.
PL	RAMP RUN 1	Pass Fa	2 2
Ramp Style	Running Slope 1	≤ 2.0%	Corner Positions Positions
*The passing value for Gutter Flow Slope (GFS)	Cross Slope 1	≤ 2.0% ■ > 2.0%	Position 3
depends on the Intersection Control Type. At a	Detectable Warning	Y Y N	
Midblock (MB), GFS must be ≤ Slope of the Road, at Signalized or Uncontrolled (SU), GFS	Lip Height	0.5 ≤ 1/4" > 1/4" ■	_ 3A _
must be \leq 5.0%, and at Stop or Yield (SY), GFS must be \leq 2.0%.	Gutter Flow Slope	≤* ■ >*	2 North
	Curb Running Slope(avg)	8.14 ≤ 8.3% ■ > 8.3%>	
*1 If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 ft.	Counter Slope (+/-)*2	<u>5.5</u> ≤ 5.0%	Davis in
*2 Clear Space area is the width of Ramp Run 1	Det. warning full width of ramp	Y Y N	Position 5
and extends 4.0 ft into the roadway.	RAMP RUN 2	Pass Fa	PE Stamp (required for
	Running Slope 2	≤ 8.3% ■ > 8.3%	private development)
See also Standard Drawings to assess provisions not shown:	Length 2	5.25	
(inlets, alignment, etc.)	Cross Slope 2	≤ 2.0% ■ > 2.0%	⅃ ┃
Comment and Comment and	RAMP RUN 3	Pass Fa	il
	Running Slope 3	≤ 8.3% ■ > 8.3%	
St Faun 3	Length 3	7.4	
Guilar en	Cross Slope 3	₃ ≤ 2.0% > 2.0% ■	-
Counter slope	TURN SPACE Pass Fail		Comments:
	Width X	4.95 ≥ 4.0' < 4.0'	Stop sign in rr2. IITD gt2. Water meters in rr2 and turn space. Crack in rr2.
PARALLEL RAMP (PL)	Length Y	6.0 ≥ 4.0'*1 ■ < 4.0'*1	
PARALLEL RAMP (PL)	Back of Ramp Obstruction (Y/N)	Y ≥ 5.0'*1 ■ < 5.0'*1	
Pedestrian Access Route (to measure Clear Width)	Slope X (Cross Slope 1)	≤ 2.0% ■ > 2.0%	7

Detectable Warning Surface

Cross Slope (2.0% max.)

Running Slope (8.3% max.)

Counter Slope (5.0% max.)

Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*
* If constrained at back of walk, min. Y length is 5'.

Gutter Flow Slope (as directed)

Fail	Inspector's Signature	Date (mm/dd/yy))
	Darrell Wyant	52638	

Darrell Wyant	52638
Print name clearly	Certification No

Company/Agency

≤ 2.0% ■ > 2.0%

Pass

Slope of Rd. 2.2

≤ 1/2" ■ > 1/2"

< 4.0'

≥ 4.0'

SY


Slope Y (Running Slope 1)

MISCELLANEOUS

Clear Width (feet)

Horizontal Gaps

Intersection Control Type

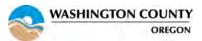

ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





