
| | WASHINGTON COUNTY | ADA Cui | | | |
|--|--|---------------|-----|--|--|
| | OREGON | ,,, | , | | |
| | Glencoe | | | | |
| | North-South Road Name | | | | |
| | | PL | RAN | | |
| | | Ramp Style | Run | | |
| *The passing value for Gutter Flow Slope (GFS) | | | | | |
| | depends on the Intersection Control Type. At a Midblock (MB), GFS must be ≤ Slope of the | | | | |
| Road, at Signalized or Uncontrolled (SU), GFS | | | | | |
| must be \leq 5.0%, and at Stop | | | | | |
| | Yield (SY), GFS must be \leq 2.0%. | | Cur | | |
| *1 If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 ft. | | | | | |
| *2 | amp Run 1 | Det | | | |
| an | Clear Space area is the width of R ad extends 4.0 ft into the roadway. | amp nan 1 | RAN | | |
| | | | Run | | |
| | ee also <u>Standard Drawings</u> to assess provision nlets, alignment, etc.) | ns not shown: | Len | | |
| (7) | ets, angetti, etti, | | Cro | | |

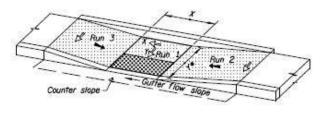

PARALLEL RAMP (PL)

PARALLEL RAMP (PL)

Pedestrian Access Route (to measure Clear Width)

Detectable Warning Surface

Cross Slope (2.0% max.)

Running Slope (8.3% max.)

Counter Slope (5.0% max.)

Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*
* If constrained at back of walk, min. Y length is 5'.

Gutter Flow Slope (as directed)

ADA Curb Ramp New Construction Inspection Form (Parallel)

24952.54

| Project No. Sheet No. | Intersection No. | East-West Ro | oad Name | See https://www.oregon | | |
|---------------------------------|--|--------------|------------------|------------------------|---------------------|------------------|
| Calibration Date | _ExhibitA.pdf for mo County corner numb | | | | | |
| RAMP RUN 1 | Pass | Fail | 3 | 1 111 | | 2 |
| Running Slope 1 | ≤ 2.0% > | 2.0% | Corner | | Corner Positions | |
| Cross Slope 1 | ≥ 2.0% > | 2.0% | Position | 3 | 5 | 2A |
| Detectable Warning | Y Y | N | | 1 | | 3 |
| Lip Height | 0 ≤ 1/4" > | 1/4" | (| 3A | . 1 | |
| Gutter Flow Slope | 1.8 ≤ * | >* | | 2 | North | 2 |
| Curb Running Slope(avg) | 13.42 ≤ 8.3% > | 8.3%> | | 4 | Ramp 1 | |
| Counter Slope (+/-)*2 | 6.7 ≤ 5.0% > | 5.0% | 1 | | Positions | Î |
| Det. warning full width of ramp | y Y | N | Ramp Position | | 5 | |
| RAMP RUN 2 Pass | | Fail | | | PE Stamp (r | equired for |
| Running Slope 2 | ≤ 8.3% > | 8.3% | | | private deve | elopment) |
| Length 2 | 16.4 | | | | | |
| Cross Slope 2 | ≥ 2.0% > | 2.0% | | | | |
| RAMP RUN 3 Pass F | | | | | | |
| Running Slope 3 | 0.9 ≤ 8.3% ■ > | 8.3% | | | | |
| Length 3 | 7.4 | | | | | |
| Cross Slope 3 | 1.9 ≤ 2.0% ■ > | 2.0% | Comment | ·· | | |
| TURN SPACE | Pass | Fail | | | | |
| Width X | 5.0 ≥ 4.0' | 34.0' | IIID,gra | ter than2" behi | ind curb | |
| Length Y | 4.95 ≥ 4.0'*1 ■ < | 4.0'*1 | | | | |
| Back of Ramp Obstruction (Y/N) | N ≥ 5.0'*1 < | 5.0'*1 | | | | |
| Slope X (Cross Slope 1) | 2.3 ≤ 2.0% > | 2.0% | | | | |
| Slope Y (Running Slope 1) | ≤ 2.0% > | 2.0% | | | | |
| MISCELLANEOUS Pass | | | Inspector's S | ignature | | Date (mm/dd/yy) |
| Clear Width (feet) | ≥ 4.0' | 34.0' | Darrell \ | | | 52638 |
| Intersection Control Type | SY Slope of Rd. | 1.4 | Print name o | learly | | Certification No |
| Horizontal Gaps | | 1/2" | 3J Consultin | | | |
| | | <u> </u> | Company/A | sericy | | |

Cottage



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





