
WASHINGTON COUNTY OREGON AD	A Curb Ramp New Cons	struction Inspection	on Form (Con	nbination)	
Nw 288 ter	24952.54		Nw carver st		
North-South Road Name	Project No. Sheet No.	Intersection No.	East-West Road N		-)
	Calibration Date	8/13/2024 (mm/dd	d/yy)	k - *) * - U ‡ #	
Ramp Style C	RAMP RUN 1	Pas		2	Corner 2
* The passing value for Gutter Flow Slope (GFS)	Running Slope 1	≤ 8.3%	> 8.3%	Position	Positions (
depends on the Intersection Condition Type. At a	Length 1	5.1		3	5 2A
Midblock (MB), GFS must be \leq Slope of the Road, at Signalized or Uncontrolled (SU), GFS must be \leq 5.0%,	Cross Slope 1	≤ 2.0%	> 2.0%	1	2
and at Stop or Yield (SY), GFS must be 2.0%.	Detectable Warning (Y/N)	Y	N		^
* ¹ If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet.	Lip Height	≤ 1/4"	> 1/4"	3A 2	North
* 2 Clear Space area is the width of Ramp Run 1 and	Gutter Flow Slope	0.6 ≤ *	> *	1	Á
extends 4.0' into the roadway.	Curb Running Slope (avg)	1.28 ≤ 8.3%	> *8.3%	1 4	Ramp 1
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	2.3 ≤ 5.0%	> 5.0%	Ramp Position	Positions
Pass Fail	RAMP RUN 2	Pas	ss Fail		PE Stamp (required for
1 033 1 011	Running Slope 2	8.0 ≤ 8.3%	> 8.3%		private development)
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $\ge 5.0'$	Length 2	4.8			
	Cross Slope 2	2.4 ≤ 2.0%	> 2.0%		
Detectable warning extends full width of ramp throat opening	RAMP RUN 3	Pas	s Fail		
	Running Slope 3	7.3 ≤ 8.3%	> 8.3%		
	Length 3	5			
Flore Slope	Cross Slope 3	1.4 ≤ 2.0%	> 2.0%		
Flare Slope	TURN SPACE	Pas	ss Fail	Comments:	
Pan I	Width X	5.0 ≥ 4.0'	< 4.0'	IITD	
Counter slope Souther flow slope	Length Y	4.85 ≥4.0'*1			
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N)≥5.0'* ¹	< 5.0'*1		
COMBINATION RAMP (C)	Slope X	≤2.0%	> 2.0%		
Bulletin Access But to the Committee	Slope Y	≤2.0%	> 2.0%		
Detectable Warning Surface	MISCELLANEOUS Traversab				
	Flare Slope 1	≤ 10%	> 10%		
Running Slope (8.3% max.) Counter Slope (5.0% max.)	Flare Slope 2	≤ 10%		Inspector's Signature Darrell Wyant	Date (mm/dd/
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)* * If constrained at back of walk, min. Y length is 5'.	Clear Width (feet)	≥ 4.0'	< 4.0'	Print name clearly	Certification I
 ★ If constrained at back of walk, min. Y length is 5'. Gutter Flow Slope (as directed) 	Horizontal Gaps (Y/N)	≤ 1/2"	1/2"	3J Consulting	
	Intersection Control Type	SU Slope of Ro	oad 0.2	Company/Agency	



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed



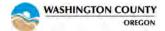

