
WASHINGTON COUNTY OREGON  ADA	A Curb Ramp New Cons	struction Inspection	on Form (Con	mbination)
NW 287th Ave	24952.54		NW Mays St	
North-South Road Name	Project No. Sheet No.	Intersection No.	East-West Road N	lame o: - )
	Calibration Date	8/13/2024 (mm/do	d/yy)	k - ') - ' ' ' ' ' ' ' ' ' ' ' ' ' ' ' '
Ramp Style C	RAMP RUN 1	Pas	ss Fail	midblock 2
* The passing value for Gutter Flow Slope (GFS) depends on the Intersection Condition Type. At a Midblock (MB), GFS must be ≤ Slope of the Road, at Signalized or Uncontrolled (SU), GFS must be ≤ 5.0%, and at Stop or Yield (SY), GFS must be 2.0%.  * ¹If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 feet.  * ² Clear Space area is the width of Ramp Run 1 and extends 4.0' into the roadway.	Running Slope 1 Length 1 Cross Slope 1 Detectable Warning (Y/N) Lip Height Gutter Flow Slope Curb Running Slope (avg)	2.6 ≤ 8.3% ■ 4.95  1.0 ≤ 2.0% ■ Y  0 ≤ 1/4" ■  0.7 ≤ *  4.78 ≤ 8.3%		Corner Positions 3 2A 1 North Ramp 1
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alignment, etc.)	Counter Slope (+/-)*2	4.9 ≤  5.0%		Ramp Position Positions
Pass Fail	RAMP RUN 2	Pas		PE Stamp (required for
Longest distance from detectable warning corner to back of curb (to nearest inch) $< 5.0'$ $\ge 5.0'$	Running Slope 2 Length 2 Cross Slope 2	9 ≤ 8.3% 4.5 ≤ 2.0%	> 8.3%	private development)
Detectable warning extends full width of ramp throat opening  Y  Y  N  Flare Slope	RAMP RUN 3  Running Slope 3  Length 3  Cross Slope 3  TURN SPACE	Pas  6.5 ≤ 8.3%   4.4  2.6 ≤ 2.0%   Pas	> 8.3%	- Comments:
Counter slope Cutter Traw slape	Width X Length Y	6 ≥ 4.0' ■ 4.9 ≥4.0'*1 ■	1 -	IITD
COMBINATION RAMP (C)	Back of Ramp Obstruction (Y/N		= =	
COMBINATION RAMP (C)	Slope X Slope Y	2.3 ≤2.0% 1 ≤2.0%	> 2.0% <b>=</b> > 2.0%	
Pedestrian Access Route (to measure Clear Width)  Detectable Warning Surface	MISCELLANEOUS Traversab			
Detectable Warning Surface  Cross Slope (2.0% max.)	Flare Slope 1	≤ 10%	> 10%	
Running Slope (8.3% max.) Counter Slope (5.0% max.)	Flare Slope 2	≤ 10%		Inspector's Signature  Darrell Wyant  52638
Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*  * If constrained at back of walk, min. Y length is 5'.	Clear Width (feet)	4.9 ≥ 4.0'	< 4.0'	Print name clearly Certification
Gutter Flow Slope (as directed)	Horizontal Gaps (Y/N) Intersection Control Type	≤ 1/2" ■ SU Slope of Ro		3J Consulting Company/Agency



## **ADA Curb Ramp Images**

Attached photos must be in .pdf format in order to be placed



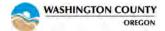

