
WASHINGTON COUNTY	ADA Cui	
OREGON		
Nw 313		
North-South Road Name		
PL	RAN	
Ramp Styl	e Run	
*The passing value for Gutter Flow Slope (GFS)	Cro	
depends on the Intersection Control Type. At a Midblock (MB), GFS must be ≤ Slope of the	Det	
Road, at Signalized or Uncontrolled (SU), GFS	Lip	
must be \leq 5.0%, and at Stop	Gut	
or Yield (SY), GFS must be ≤ 2.0%.	Cur	
*1 If Back of Ramp Obstruction is Yes, turn space length Y must be minimum 5.0 ft.	Cou	
*2 Clear Space area is the width of Ramp Run 1	Det	
and extends 4.0 ft into the roadway.	RAN	
	Run	
See also <u>Standard Drawings</u> to assess provisions not shown: (inlets, alianment, etc.)	Len	
(iniets, dilgilinent, etc.)	Cro	

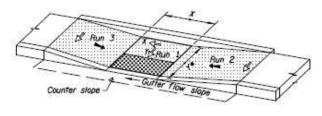

PARALLEL RAMP (PL)

PARALLEL RAMP (PL)

Pedestrian Access Route (to measure Clear Width)

Detectable Warning Surface

Cross Slope (2.0% max.)

← Running Slope (8.3% max.)

Counter Slope (5.0% max.)

Turning Space (X & Y) (2.0% max. / 4' x 4' min.)*
* If constrained at back of walk, min. Y length is 5'.

Gutter Flow Slope (as directed)

ADA Curb Ramp New Construction Inspection Form (Parallel)

24952.54

Project No. Sheet No.	Intersection N	lo.	East-West R	load Name		egon.gov/odot/Engine	
Calibration Date 9	/5/2024 (mm/dd/yy)				ADA_ExhibitA.pdf for r on County corner nun	
RAMP RUN 1		Pass	Fail	4	1		2
Running Slope 1	1.6 ≤ 2.0)% = > 2	0%	Corner	·	Corner Positions	
Cross Slope 1	1.3 ≤ 2.0	% 🔳 > 2	.0%	Position =	3	5 2	2A
Detectable Warning	Y		N []	_	1		3
Lip Height	0 ≤ 1/4	4" = > 1	./4"	(3A	Alth	
Gutter Flow Slope	0.5 ≤ *	>	*		2	North	2
Curb Running Slope(avg)	4 ≤ 8.3	% 🔳 > 8	3.3%>		4	Ramp	1
Counter Slope (+/-)*2	6.6 ≤ 5.09	% <u> </u>	5.0%	2	2	Positions	
Det. warning full width of ramp	Y		N	Ramp Position		5	
RAMP RUN 2		Pass	Fail			PE Stamp	(required for
Running Slope 2	6.6 ≤ 8.3	% 🔳 > 8	3.3%				velopment)
Length 2	6.8						
Cross Slope 2	1.4 ≤ 2.0	% ■ > 2	2.0%				
RAMP RUN 3		Pass	Fail				
Running Slope 3	3.6 ≤ 8.3	s% ■ > 8	8.3%				
Length 3	11.45						
Cross Slope 3	1.9 ≤ 2.0)% 🔳 > 2	2.0%	Comments	·•		
TURN SPACE		Pass	Fail	Comments) .		
Width X	5.1 ≥ 4.0	0'	4.0'				
Length Y	5.0 ≥ 4.0	'*1 < 4	1.0'*1				
Back of Ramp Obstruction (Y/N)	Y ≥ 5.0	'*1 < 5	5.0'*1				
Slope X (Cross Slope 1)	1.3 ≤ 2.09	%	2.0%				
Slope Y (Running Slope 1)	1.6 ≤ 2.09	%	2.0%				
MISCELLANEOUS		Pass	Fail	Inspector's Si	gnature		Date (mm/dd/yy)
Clear Width (feet)	5.1 ≥ 4.0)'	4.0'	Darrell V	•		52638
Intersection Control Type	SY Slope	e of Rd.	0	Print name cl			Certification No.
Horizontal Gaps	0 ≤ 1/2	2" 🔳 > 1	1/2"	3J Consultin			

Nw cottage



ADA Curb Ramp Images

Attached photos must be in .pdf format in order to be placed





