




TESLA MODEL X

From 2016—2021

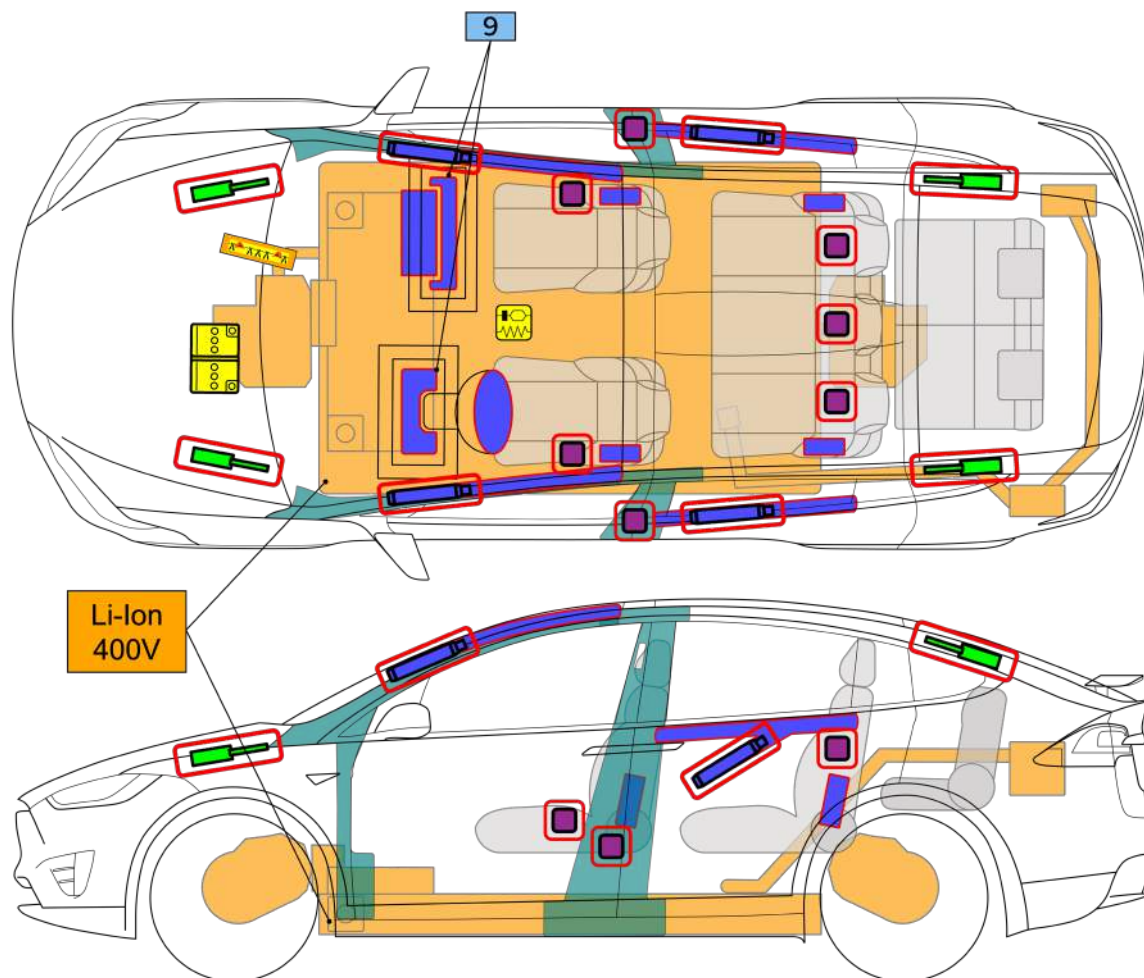

	Airbag		Stored gas inflator		Seatbelt pretensioner		SRS Control Unit		Pedestrian protection active system
	Automatic rollover protection system		Gas strut/pre-loaded spring		High strength zone		Zone requiring special attention		
	Battery low voltage		Ultra capacitor, low voltage		Fuel tank		Gas tank		Safety valve
	High voltage battery pack		High voltage power cable/component		High voltage disconnect		Fuse box disabling high voltage system		Ultra capacitor, high voltage



Cable cut



TESLA MODEL X
From 2016 — 2021

ID No.

TESLA-202012-002

Version No.

01

Page No.

01/04

1. Identification / recognition



WARNING LACK OF ENGINE NOISE DOES NOT MEAN VEHICLE IS OFF. SILENT MOVEMENT OR INSTANT RESTART CAPABILITY EXISTS UNTIL VEHICLE IS FULLY SHUT DOWN. WEAR APPROPRIATE PERSONAL PROTECTIVE EQUIPMENT (PPE).



NOTE: The Tesla emblem indicates a fully electric vehicle.

NOTE: The model name is located on the rear of the vehicle.

2. Immobilization / stabilization / lifting

IMMOBILIZATION


1. CHOCK WHEELS



2. PUT VEHICLE INTO **P**ARK POSITION



STABILIZATION/ LIFTING POINTS

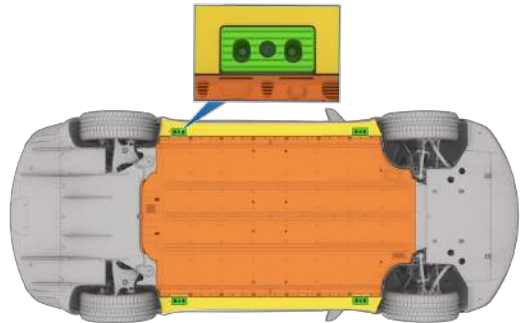


	Appropriate lift areas
	Safe stabilization points for Model X resting on its side
	High Voltage (HV) Battery

3. Disable direct hazards / safety regulations


ACCESS

1. Open the hood (see chapter 4).
2. Remove the access panel by pulling it upward to release the clips that hold it in place.

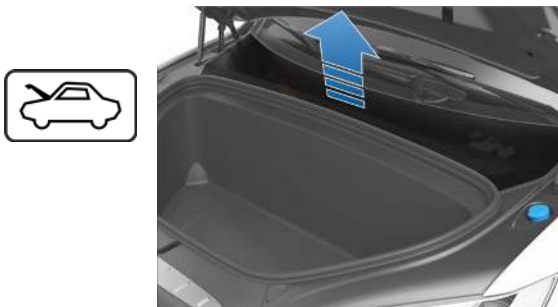

MAIN DISABLE METHOD

1. Double cut the first responder loop.
2. Disable the 12V battery.

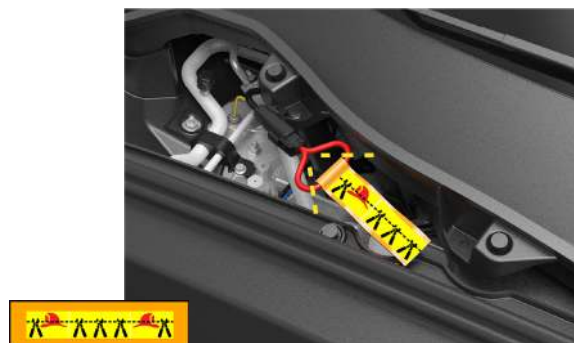

WARNING Not every high voltage component is labeled. Always wear appropriate PPE. Always double cut the first responder loop. Do not attempt to open the High Voltage (HV) battery.



4. Access to the occupants



WARNING Electrical and mechanical releases may be compromised after a collision.



NOTE: The seats and steering wheel are electrically powered and may not function after a collision.

NOTE: After a collision, the doors and liftgate may not unlock from the outside. Extrication may be required. See the Model X Emergency Response Guide for more information.

NOTE: The windshield, Falcon door top glass, rear liftgate glass on Model X are made of laminated safety glass. The side windows can be either tempered or laminated glass.

OPENING DOORS FROM OUTSIDE WITH POWER



OPENING FALCON DOORS FROM INSIDE WITHOUT POWER



OPENING LIFTGATE FROM OUTSIDE WITH POWER




OPENING FRONT DOORS FROM INSIDE WITHOUT POWER



OPENING THE HOOD

To open the hood, use one of the following methods:

- Touch the associated OPEN button on the touchscreen.
- Double-click the front trunk button on the key.
- Pull the release cables located in the tow attachment on the front bumper. Release the tow hook cover first to expose the straps, and then pull the straps, labeled A and B, in alphabetical order to open the primary and secondary latches.

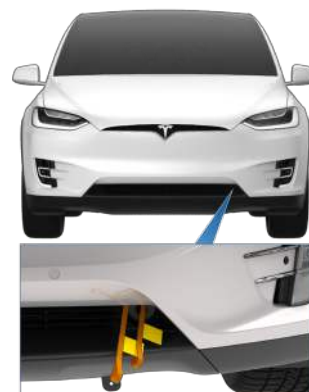

5. Stored energy / liquids / gases / solids

		12V
		400V



WARNING The cells in the HV battery are sealed and there is not enough electrolyte to create a pool of liquid. Clear liquid is likely water. The coolant is blue.



TESLA MODEL X
From 2016 – 2021

ID No.

TESLA-202012-001

Version No.

01

Page No.

03/04

6. In case of fire



DO NOT SUBMERGE VEHICLE TO EXTINGUISH/COOL BATTERY FIRE



USE COPIOUS AMOUNTS OF WATER



POSSIBLE BATTERY RE-IGNITION!

MONITOR HV BATTERY TEMPERATURE FOR AT LEAST 24 HOURS

7. In case of submersion

Treat a submerged Model X like any other submerged vehicle. Wear appropriate PPE for water rescue. Remove the vehicle from the water and continue with normal high voltage disabling. Vehicles submerged in salt water should be handled with a greater potential risk of an HV battery fire. Tilt the vehicle to back and forth to allow water to drain out and store flat.

8. Towing / transportation / storage

Use a towing truck with flatbed.

NO towing with running traction wheels.



WARNING POSSIBLE BATTERY RE-IGNITION! AFTER A FIRE INCIDENT, STORE OUTSIDE AT A SAFE DISTANCE (50 FT/15 M) FROM OTHER VEHICLES AND STRUCTURES!

9. Important additional information

First Responders and Second Responders with emergencies, call Tesla Roadside Assistance. Refer to <https://www.tesla.com/support/roadside-assistance> for the applicable hotline number.

First responder information can be found at <https://www.tesla.com/firstresponders>. First responders and training officers who have questions, contact firstrespondersafety@tesla.com.

Airbags



Knee airbags are only installed in North America and South Korea.

10. Explanation of pictograms



In some working environments, the Infrared (IR) device is referred to as a Thermal Imaging Camera (TIC).



TESLA MODEL X
From 2016 – 2021

ID No.

TESLA-202012-001

Version No.

01

Page No.

04/04