




Endera B Series 2023-

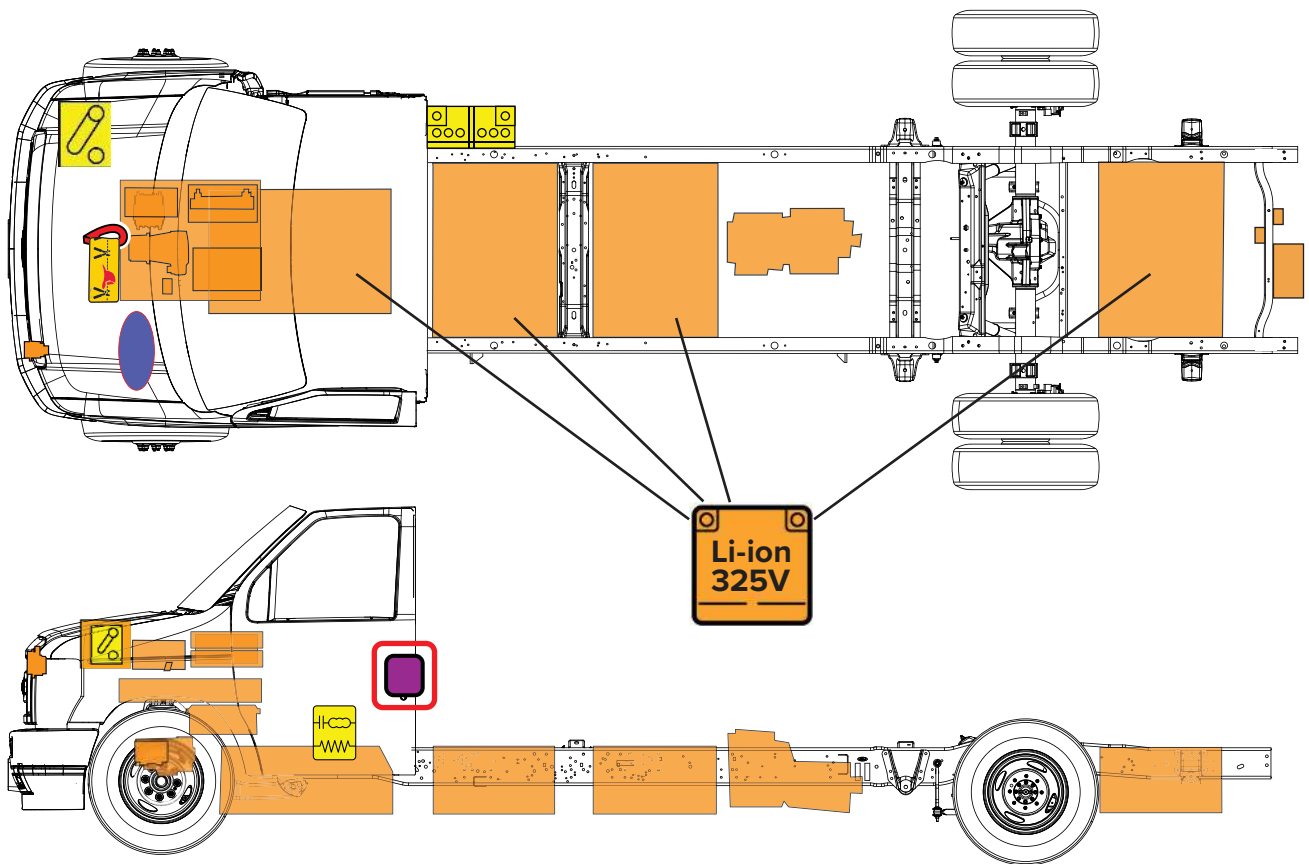

	Airbag		12V Battery (Low Voltage)		SRS Control Unit
	Emergency Responder Cut Loop		Seat Belt Tensioner/Pretensioner		High-Voltage Battery Pack
	Low-Voltage Disconnect		High-Voltage Disconnect		High-Voltage Power Cable/Component

	Identification Number	Version Number	Page Number
	TBD	01	1 of 4

1. Identification / Recognition



WARNING: Lack of engine noise does not mean the vehicle is off. The vehicle can move silently if the vehicle is not properly shut down. Always wear appropriate PPE.

EMBLEMS AND BADGING

Endera vehicles display the company logo and nameplate on the front and sides (decal styles vary by production batch). Some vehicles retain Ford grills. The Endera XR electric powertrain is identifiable by the charge port located in a driver-side cutout of the front grill.



FIRST RESPONDER INFORMATION LABEL



2. Immobilization / Stabilization / Lifting

IMMOBILIZE VEHICLE

- » Chock the wheels to prevent vehicle movement.
- » Set the manual parking brake. If the vehicle is in Park, a parking pawl will be engaged to stop the motor from rotating.



LIFTING POINTS



WARNING: Never raise the vehicle when the charge cable is connected.



CAUTION: The illustrated lifting points are the only approved lifting points for the vehicle. Lifting the vehicle at any other points may cause irreparable damage.



Use primary lifting points only. Do NOT lift the vehicle from any locations on the high-voltage batteries.



3. Disable Direct Hazards / Safety Regulations



WARNING: Always assume the vehicle's high-voltage system is powered up. Cutting, crushing, or touching high-voltage components can result in serious injury or death.



WARNING: Removing power from the high-voltage system does not dissipate voltage inside the battery packs. The battery packs remain live and dangerous. Contact with high-voltage battery pack circuit parts may result in serious personal injury or death.



WARNING: Electric vehicles damaged in a crash may have compromised high-voltage safety systems and present a potential electric shock hazard. Exercise caution and wear appropriate Personal Protective Equipment (PPE), including voltage-rated rubber gloves and boots.

PREFERRED PROCEDURE

- » Switch the ignition to the OFF position and remove the key from the ignition.
- » Open the hood to access the low-voltage isolation switch and vehicle service disconnect first responder cut loop.
- » Cut the loop twice as shown on the label. Ensure the two end cannot touch. Then, set the Low-Voltage Battery Disconnect switch to the OFF position.



CAUTION: Wait at least 10 seconds for airbag reserve energy to dissipate.

VEHICLE AT CHARGING STATION

1. Ensure the charging session is terminated at the charging station or press Stop on the charging station to terminate the session.
2. If the charging cable is locked while connected to the vehicle's charging port, terminating charging should unlock the cable. If necessary, press the emergency stop (E-Stop) button on the charging station.
3. Unplug the charging cable from the vehicle once the charging session has stopped and the lock is released.



4. Access to the Occupants

Refer to the front page for specific safety-related component locations.

- » The windshield and the roof glass are made of laminated glass
- » The side and rear windows are made of tempered glass

OPENING DOORS

If power is available, set door operation button to Open.

OPENING DOORS WITHOUT POWER

To open the rear door from the inside, turn the interior handle and push the door away from you.

To open the rear door from the outside, turn the handle and pull the door toward you.



WARNING: The vehicle contains high-strength cut zones defined by the manufacturer. Contact Ford or Endera for exact locations.



5. Stored Energy / Liquids / Gases / Solids



CAUTION: Coolant leaking inside the battery pack can become unstable and possibly pose a fire risk. Use a thermal imaging camera to check the battery pack temperature.

6. In Case of Fire



Potential for battery re-ignition. Check the battery pack temperature using a thermal imaging camera.



Use large amounts of water to cool the high-voltage batteries.

7. In Case of Submersion



WARNING: Electric vehicles submerged in water present a potential electric shock hazard. Exercise caution and wear appropriate Personal Protective Equipment (PPE), including voltage-rated rubber gloves and boots. Do not attempt to extract the vehicle until the high-voltage battery has discharged, indicated by the absence of bubbling or fizzing.



WARNING: Do not touch any High Voltage components or orange cables while removing the occupant(s). Do not remove the vehicle until you are sure the High Voltage battery is completely discharged.



WARNING: Submerged vehicles should only be handled while wearing the appropriate Personal Protective Equipment (PPE) for water rescue and vehicle extraction.



WARNING: Vehicles that have been submerged in water may have potential risk of a high-voltage electrical battery fire therefore should be handled with increased caution.

8. Towing / Transportation / Storage



CAUTION: Do not attempt to pull / tow vehicle with wheels on the ground as this may cause the vehicle to generate electricity and can cause potential damage.



WARNING: Tow truck drivers must be aware of the reignition potential of abused lithium-ion batteries. After transport, ensure the vehicle is kept in an open area or at least 50 feet away from flammable materials.

The vehicle must be fully placed on a flatbed tow truck when transporting. Set the gear to Neutral (N), disengage the parking brake, and turn off the vehicle. If the vehicle is non-operational, the drive shaft must be removed.

Chock the wheels to prevent movement.

NOTE: Call an authorized service center or the vehicle manufacturer, if necessary, to determine additional steps that should be taken to safely recover or transport the vehicle.

9. Important Additional Information

10. Explanation of Pictograms Used



Battery Technology



Flammable



Use Water



Electric Vehicle



Corrosive



Thermal Imaging Camera



Caution Sign



Toxic



Warning, Electricity



Lifting Points



Injury Risk



Warning Sign