


## EWR D&I ANNOTATION

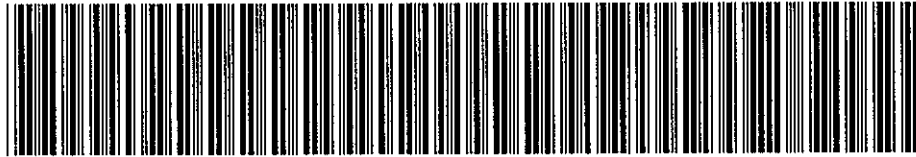

FAN-000001L092001DP101-3797

**Artemis # :** 000001L092001DP101**Record Created Date :****Printed Date :** 06/23/2010

**Description :** DI09-096. SEQ ID 101. 2009 Q2. DRIVER OF A 2007 COBALT WAS APPROACHING AN INTERSECTION WHEN ANOTHER VEHICLE ENTERED. COBALT T-BONED THE OTHER VEHICLE. FRONT END DAMAGE TO VEHICLE. PRE-CRASH DATA SHOWS VEHICLE AROUND 24 MPH. NO POLICE REPORT GIVEN. CUSTOMER ALLEGES AIR BAGS SHOULD HAVE DEPLOYED. VOQ-37. PURSUIT-0. TSB-0. RECALLS-0. \*RM



U.S. Department  
of Transportation  
**National Highway  
Traffic Safety  
Administration**

1200 New Jersey Avenue SE.  
Washington, DC 20590

**CERTIFIED MAIL**  
**RETURN RECEIPT REQUESTED**

December 16, 2009

Ms. Gay P. Kent  
General Motors Corp.  
Mail Code 480-210-G11  
30001 Van Dyke  
Warren, MI 48090

NVS-217kb  
DI09-096

Dear Ms. Kent:

The Office of Defects Investigation (ODI) of the National Highway Traffic Safety Administration (NHTSA) has received information about certain death and injury incidents reported by General Motors Corp. (GM) in its light early warning report from 2<sup>nd</sup> quarter of 2009. We are writing to request additional information about the following incidents:

| Selected Death and Injury Incidents                                                                                                                                                                                                                                                                                                                                                                                                                              |  |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--|
| For Reporting Category: L                                                                                                                                                                                                                                                                                                                                                                                                                                        |  |
| For the following Sequence IDs: 3, 7, 15, 39, 63, 78, 81, 82, 85, 87, 88, 89, 90, 91, 92, 93, 94, 95, 96, 98, 100, 101, 103, 105, 106, 107, 108, 109, 110, 131, 137, 145, 146, 148, 149, 158, 167, 168, 178, 209, 216, 219, 231, 243, 253, 254, 255, 256, 257, 258, 259, 261, 263, 264, 266, 270, 271, 276, 281, 282, 288, 289, 290, 291, 292, 293, 297, 299, 300, 311, 312, 327, 338, 339, 341, 343, 344, 345, 346, 348, 349, 351, 352, 354, 370, 382, 390, 391 |  |

Unless otherwise stated in the text, the following definitions apply to these information requests:

**Incident:** each incident identified in the above table.

**Claim and Notice:** shall have the meanings stated in 49 CFR §579.4(c). Claim and notice also specifically refer to the claim(s) and notice(s) that are the predicate for the early warning report on the incident.

**Manufacturer:** refers to GM.

**Vehicle:** the vehicle produced by GM that is identified in the claim or notice.

**Tire:** the tire produced by GM that is identified in the claim or notice.

**Equipment:** the item of motor vehicle equipment produced by GM that is identified in the claim or notice.

**Defect:** means any failure, malfunction, lack of durability, or other problem in performance, construction, a component, or material of a motor vehicle or piece of motor vehicle equipment.

**Document:** "Document(s)" is used in the broadest sense of the word and shall mean all written, typed, graphic and photographic matter whatsoever (except autopsy photographs), be it in original, copy or electronic form. Any photograph originally produced in color must be provided in color and in electronic form, if possible. Furnish all documents whether verified by GM or not. If a document is not in the English language, provide both the original document and an English translation of the document. Document(s) includes all documents in GM's custody and/or control.

Please provide numbered responses to the following inquiries, repeating the applicable request verbatim before each response. After GM's response to each request, identify the source of the information and indicate the last date the information was gathered. When documents are produced, the documents shall be produced in an identified, organized manner that corresponds to each pertinent information request. A separate response must be provided for each incident. Each response, document or attachment must be clearly identified with the incident Sequence ID (SeqID) number.

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.
2. Provide a copy of the Police Accident Report.
3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

If GM claims that any of the information or documents provided in response to this information request constitute confidential commercial material within the meaning of 5 U.S.C. § 552(b) (4), or are protected from disclosure pursuant to 18 U.S.C. § 1905, GM must submit supporting information together with the materials that are the subject of the confidentiality request, in accordance with 49 CFR Part 512, as amended (69 Fed. Reg. 21409 et seq; April 21, 2004), to the Office of Chief Counsel (NCC-110), National Highway Traffic Safety Administration, 1200 New Jersey Avenue, S.E., Washington, D.C. 20590. GM is required to submit two copies of the documents containing allegedly confidential information (except only one copy of blueprints) and one copy of the documents from which information claimed to be confidential has been deleted. Please remember that the words "CONFIDENTIAL BUSINESS INFORMATION" must appear at the top of each page containing information claimed to be confidential, and the information must be clearly identified in accordance with 5 U.S.C. § 512.6. If you submit a request for confidentiality for all or part of your response to this letter, that is in an electronic format (e.g., CD-ROM), your request and associated submission must conform to the new



requirements in NHTSA's Confidential Business Information Rule regarding submissions in electronic formats (49CFR 512.(c)). See Federal Register, volume 72, page 59434 (October 19, 2007).

12660

Your response to this letter, together with a copy of any confidentiality request, must be submitted to this office by **January 22, 2010**. Please include in your response the identification codes referenced on page one of this letter. If you are unable to provide all of the information requested within the time allotted, you must request an extension from me at (202) 366-4238, no later than five business days before the response due date. If all of the information requested by the original deadline is unavailable, you must submit a partial response by the original deadline with whatever information then is available, even if an extension is granted.

If you have any technical questions concerning this matter, please contact Mr. Leo Yon at (202) 366-7028 or by fax at (202) 366-7882.

Sincerely,



Christina Morgan, Chief  
Early Warning Division  
Office of Defects Investigation  
Enforcement



GENERAL MOTORS LLC  
Global Interior and Safety Center

11 February 2010

Ms. Christina Morgan, Chief  
Early Warning Division, NVS-217  
Office of Defects Investigation  
National Highway Traffic Safety Administration  
1200 New Jersey Ave., S.E.  
Washington, DC 20590

NVS-217kb  
DI09-096

Dear Ms. Morgan:

This is General Motors' (GM) response to your inquiry dated December 16th, 2009 regarding certain death and injury incidents reported by GM in its light vehicle early warning report from the 2nd quarter of 2009.

GM's response is comprised of 88 disks for the incidents that are the subject of DI09-096.

Attachment "A" includes instructions for navigating the disk. Each disk, on its face, is identified by the NHTSA Sequence ID number, the Manufacturer's Unique ID number and the year, make and model of the vehicle involved in the incident, e.g., 3 18605620-675350 and 2009 BUICK ENCLAVE. When the disk is launched, this identification number appears again along with all of the documents on the disk (including photographs and videos, if applicable) listed under "Filename." The first document listed under Filename is an index with the Request and Responses, e.g., identified as 3 18605620-675350\_00\_Request and Responses. The index is numbered 1 through 3 to correspond to Inquiries 1 through 3, which are repeated verbatim below. The index also details whether any documents responsive to each inquiry were located.

For example, the Inquiry and Response in the index  
for the disk are as follows:

DI09-096  
3 18605620-675350  
2009 BUICK ENCLAVE

Request for Information:

1. **Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.**



Response: See attached document.

2. **Provide a copy of the Police Accident Report.**

Response: See attached documents and photographs.

The remaining document listed under Filename, reference the Manufacturer's Unique ID number along with the responsive Inquiry number. For example:

- 3 18605620-675350 **\_01\_001** - is the first document responsive to Inquiry no. 1.  
3 18605620-675350 **\_02\_001** - is the first document responsive to Inquiry no. 2.

Your inquiries and our corresponding replies are as follows:

1. **Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.**

Response: See attached document.

The table below lists the incident that is the subject of DI09-066, by Reporting Category, Sequence ID, VIN and type of notice received by GM (as "notice" is commonly used, not as it is defined by 49 C.F.R. §579.4(c)). Incidents reported on GM's Early Warning Report Death and Injury worksheet fall into four categories: Lawsuit (LIT), NISM (Not In Suit Matters), Product Allegation Resolution (PAR) or Rumor (RMR). Lawsuit and NISM case types generally meet the §579.4(c) definition of "claim." PAR cases, in this context, refer to customer contacts in which an injury or fatality is alleged to have occurred as a result of a product defect, and are accompanied by a writing that may or may not meet the §579.4(c) definition of "claim" or "notice." Rumor incidents do *not* involve a written or verbal, implied or express allegation of a defect by a customer. Rather, rumor cases generally refer to incidents that GM learned of through the media, which were subsequently investigated further.

| <i>(88 Vehicles from the Light Vehicle Template)</i> |                                     |      |
|------------------------------------------------------|-------------------------------------|------|
| SEQUENCE ID                                          | VEHICLE IDENTIFICATION NUMBER (VIN) | TYPE |
| 3                                                    | 5GAER23D69J [REDACTED]              | NISM |
| 7                                                    | UNKNOWN                             | NISM |
| 15                                                   | 5GADS13S142 [REDACTED]              | NISM |
| 39                                                   | 1G6DU57V090 [REDACTED]              | LIT  |
| 63                                                   | UNKNOWN                             | NISM |
| 78                                                   | 1G1AL52F957 [REDACTED]              | NISM |
| 81                                                   | 1G1AK52F257 [REDACTED]              | NISM |
| 82                                                   | 1G1AK55F167 [REDACTED]              | NISM |
| 85                                                   | 1G1AK15F467 [REDACTED]              | NISM |
| 87                                                   | 1G1AK55F267 [REDACTED]              | NISM |



| SEQUENCE<br>ID | VEHICLE IDENTIFICATION NUMBER<br>(VIN) | TYPE |
|----------------|----------------------------------------|------|
| 88             | 1G1AM15B367                            | NISM |
| 89             | 1G1AL15FX67                            | NISM |
| 90             | 1G1AK15F367                            | NISM |
| 91             | 1G1AL58F977                            | NISM |
| 92             | 1G1AK15F077                            | NISM |
| 93             | 1G1AK55F577                            | NISM |
| 94             | 1G1AK15F477                            | NISM |
| 95             | 1G1AK55F577                            | LIT  |
| 96             | 1G1AK15F077                            | NISM |
| 98             | 1G1AK58FX77                            | NISM |
| 100            | 1G1AK55FX77                            | NISM |
| 101            | 1G1AK15F477                            | NISM |
| 103            | 1G1AK18F887                            | NISM |
| 105            | 1G1AL58F287                            | NISM |
| 106            | 1G1AK18F187                            | NISM |
| 107            | 1G1AL58F987                            | NISM |
| 108            | 1G1AK58F987                            | NISM |
| 109            | 1G1AL58F987                            | NISM |
| 110            | 1G1AT58H097                            | NISM |
| 131            | 3GNDA23P76S                            | NISM |
| 137            | 3GNDA13D48S                            | NISM |
| 145            | 2G1WF52E049                            | NISM |
| 146            | 2G1WF52E249                            | NISM |
| 148            | 2G1WH52K049                            | NISM |
| 149            | 2G1WH52K049                            | NISM |
| 158            | 2G1WT58N279                            | NISM |
| 167            | 2G1WT57K791                            | NISM |
| 168            | 2G1WC57M591                            | NISM |
| 178            | 1G1ZG57B39F                            | NISM |
| 209            | 1GCEK24009Z                            | NISM |
| 216            | 1GCHK29K57E                            | NISM |
| 219            | 1GBJC34K78E                            | NISM |
| 231            | 1GNFC16047J                            | NISM |
| 243            | 1GNFK33059R                            | NISM |
| 253            | 1GNDS13S642                            | NISM |
| 254            | 1GNDT13S052                            | NISM |
| 255            | 1GNDT13S052                            | NISM |
| 256            | 1GNDS13SX52                            | NISM |
| 257            | 1GNDT13S852                            | NISM |
| 258            | 1GNDT13S052                            | NISM |
| 259            | 1GNDT13S352                            | NISM |
| 251            | 1GNDT13S662                            | NISM |
| 263            | 1GNDT13S682                            | NISM |
| 264            | 1GNDT13S882                            | NISM |
| 266            | 1GNDS33S892                            | NISM |
| 270            | 1GNES16S866                            | NISM |
| 271            | 1GNEV23D29S                            | NISM |

| SEQUENCE ID | VEHICLE IDENTIFICATION NUMBER (VIN) | TYPE |
|-------------|-------------------------------------|------|
| 276         | 1GNDU03E64D [REDACTED]              | NISM |
| 281         | 1GKEV23D59J [REDACTED]              | NISM |
| 282         | 1GKEV23D99J [REDACTED]              | NISM |
| 288         | UNKNOWN                             | NISM |
| 289         | 1GKDS13S442 [REDACTED]              | NISM |
| 290         | 1GKDT13S442 [REDACTED]              | NISM |
| 291         | 1GKDT13S552 [REDACTED]              | NISM |
| 292         | 1GKDS13S962 [REDACTED]              | NISM |
| 293         | 1GKDS13S462 [REDACTED]              | NISM |
| 297         | 1GKET16S956 [REDACTED]              | NISM |
| 299         | 1GKES12S046 [REDACTED]              | NISM |
| 300         | 1GKES12S956 [REDACTED]              | NISM |
| 311         | 3GTEC13C48G [REDACTED]              | NISM |
| 312         | 3GTEK13378G [REDACTED]              | NISM |
| 327         | 5GTDN136568 [REDACTED]              | NISM |
| 338         | 1G2ZF55B264 [REDACTED]              | NISM |
| 339         | 1G2ZF55B0642 [REDACTED]             | NISM |
| 341         | 1G2ZG558364 [REDACTED]              | NISM |
| 343         | 1G2ZH18N374 [REDACTED]              | NISM |
| 344         | 1G2ZG58B574 [REDACTED]              | NISM |
| 345         | 1G2ZH57N584 [REDACTED]              | NISM |
| 346         | 1G2ZG57B384 [REDACTED]              | NISM |
| 348         | 1G2ZH57N684 [REDACTED]              | NISM |
| 349         | 1G2ZF57B584 [REDACTED]              | NISM |
| 351         | 1G2ZJ57B494 [REDACTED]              | NISM |
| 352         | 1G2ZH36N994 [REDACTED]              | NISM |
| 354         | 6G2EC57Y19L [REDACTED]              | NISM |
| 370         | 2G2WP552881 [REDACTED]              | NISM |
| 382         | 5S3ET13S662 [REDACTED]              | NISM |
| 390         | 5GZER13737J [REDACTED]              | NISM |
| 391         | 5GZEV23748J [REDACTED]              | NISM |

**2. Provide a copy of the Police Accident Report.**

Response: If available, see attached document(s) and photograph(s) on the enclosed disk(s).

**3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.**

Response: GM opts not to respond.

GM claims that certain information, in documents that are part of rumor, claim and lawsuit files maintained by the GM Legal Staff and its outside counsel, is attorney work product and/or privileged. That information includes notes, memos, reports, photographs, and evaluations by attorneys (and by consultants, claims analysts, investigators and engineers working at the request of attorneys). GM is producing



responsive documents from its rumor, claim and lawsuit files that are neither attorney work product nor privileged and withholding those that are attorney work product and/or privileged.

This response was compiled and prepared by this office upon review of documents retrieved by GM and does not include documents generated or received subsequent to the searches.

Please contact me at if you require further information.

Sincerely,

A handwritten signature in black ink, appearing to read 'G. Kent', with a stylized flourish at the end.


Gay P. Kent,  
Director, Product Investigations  
and Safety Regulations

Enclosures: 88 Disks  
Attachment A


## Attachment A

### *Instructions for using Disk Viewer*

1. Insert the disk into the disk ROM drive; the disk will open automatically.
2. Click the "Run JPegger" button on the pop up window.

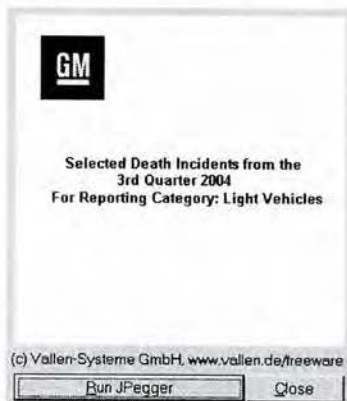

3. The program will launch in the browsing mode, which is shown in the image below.
4. You can use the down arrow key on your keyboard to browse through the images.

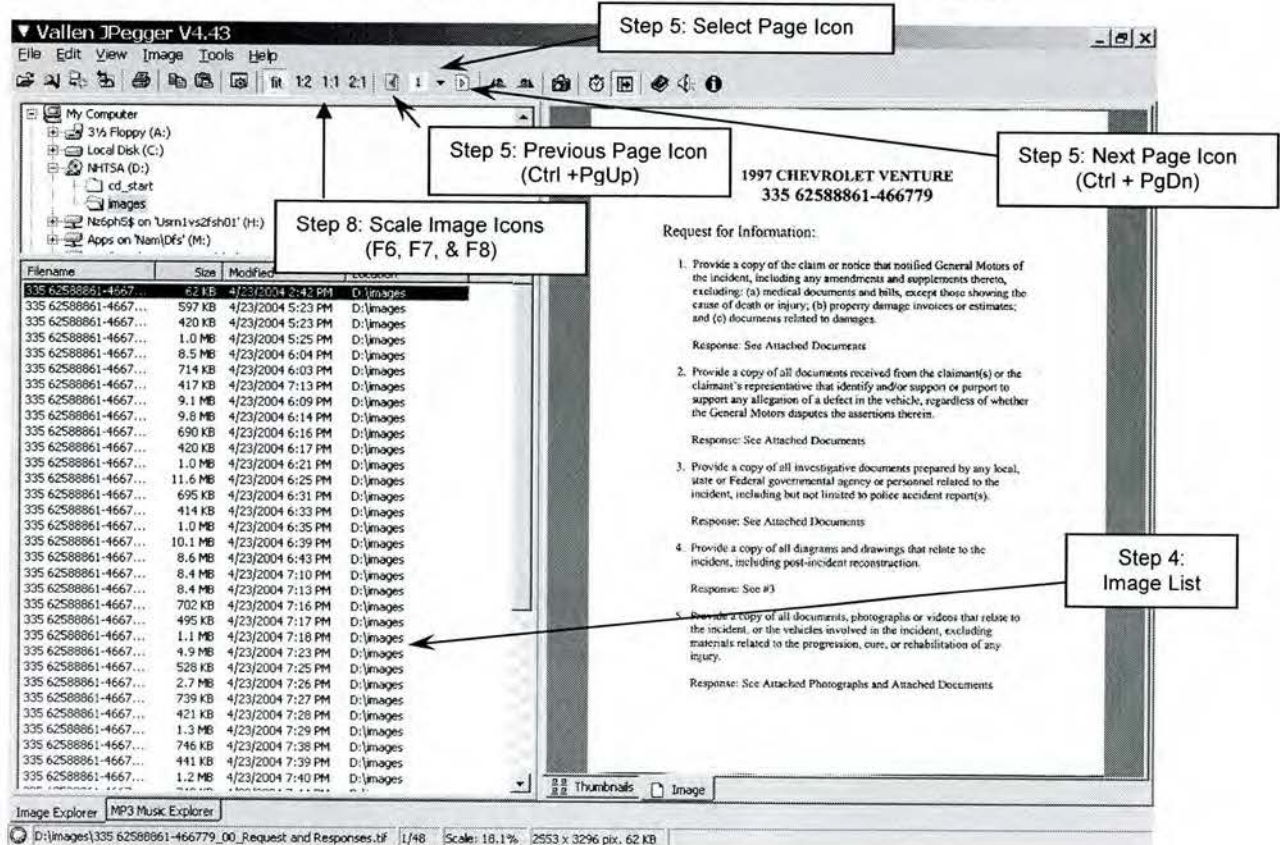

5. Each image file may contain multiple pages. In the browsing mode use **Next Page Icon (Ctrl + PgDn)**, **Select Page Icon** or **Previous Page Icon (Ctrl + PgUp)** to browse through all of the pages within an image file. (Note: Some image files may contain up to 80 pages)
6. By double-clicking on an image from the file list, a slide show will initiate, however, it will not automatically advance through the pages. Use **Ctrl + PgDn** or **Ctrl + PgUp** to browse through all of the pages within an image file. Left-clicking on an image, while in the slide show mode, will advance to the first page of the next image file.
7. Right click on the image to see the image properties, as shown below. Image properties can also be used to view each page within the documents (Next page), or to view the next document within the file list (Next Image).
8. If the image is difficult to view, the scale may be changed. Use **F5**, **F6**, **F7**, and **F8** to alternate between scales that fit the screen, or are 50%, 100%, and 200% of the image's original size.

The screenshot shows a legal document cover sheet titled "CIVIL CASE COVER SHEET" for the case "CARDONA V. CHEVROLET". The document is filed in the "SUPERIOR COURT FOR THE STATE OF CALIFORNIA, INDIO COUNTY". The cover sheet includes various checkboxes for case type, complexity, and other legal details. Annotations with arrows point to specific features:

- Step 7: Next File (Image)**: Points to the "Next Image" button in the right-hand menu.
- Step 7: Next page**: Points to the "Next page" button in the right-hand menu.
- Step 8: Scale Image**: Points to the "Scale" section in the right-hand menu, which includes options for "fit", "Scale to fit", "Scale 50%", "Scale 100%", and "Scale 200%".
- Step 7: Image Properties**: Points to the "Image Properties" button at the bottom of the right-hand menu.

The cover sheet itself contains the following information:

ATTORNEY OR PARTY-RELATED ATTORNEY FIRM, FIRM AND ADDRESS:  
 ERIC D. PARIS, ESQ., S/B# 147836  
 LAW OFFICES OF ERIC D. PARIS & ASSOCIATES  
 381 S. THOMAS STREET  
 SUITE 403  
 POMONA, CALIFORNIA 91766  
 TELEPHONE NO. 909-469-5127 FAX NO. 909-469-5126  
 ATTORNEY FOR: PLAINTIFF'S

NUMBER AND DATE OF COURT ORDER, DECREE, OR JUDICIAL ORDER, IF ANY:  
 SUPERIOR COURT FOR THE STATE OF CALIFORNIA  
 INDIO COUNTY

CASE NAME: CARDONA V. CHEVROLET

CIVIL CASE COVER SHEET  
☐ Limited ☒ Unlimited

Complex Case Designation  
☐ Counter ☐ Joinder  
 Filed with first appearance by defendant  
 (Cal. Rules of Court, rule 1811)

PLEASE COMPLETE ALL FIVE (5) ITEMS BELOW:

1. Check one box below for the case type that best describes this case:

☒ Auto Tort (22)  
☐ Other PIP/DWD (Personal Injury/Property Damage/Wrongful Death) Tort  
☐ Assisted (24)  
☐ Product liability (24)  
☐ Medical malpractice (45)  
☐ Other PIP/DWD (23)  
☐ Non-PIP/DWD (Other) Tort  
☐ Business tort/unfair business practice (37)  
☐ Child rights (e.g., discrimination, false arrest) (55)  
☐ Defamation (e.g., slander, RAD) (13)  
☐ Fraud (18)  
☐ Intellectual property (19)  
☐ Professional negligence (e.g., legal malpractice) (25)  
☐ Other non-PIP/DWD tort (26)  
☐ Employment  
☐ Wrongful termination (36)

☐ Contract  
☐ Breach of contract/warranty (46)  
☐ Collection (e.g., money owed, open book accounts) (39)  
☐ Insurance coverage (14)  
☐ Other contract (37)  
☐ Real Property  
☐ Eminent domain/condemnation (14)  
☐ Wrongful eviction (33)  
☐ Other real property (e.g., quiet title) (28)  
☐ Unlawful Detainer  
☐ Commercial (31)  
☐ Residential (32)  
☐ Drugs (34)  
☐ Juvenile Delinquency  
☐ Asset forfeiture (26)  
☐ Petition for restoration award (11)

☐ Will of decedent (32)  
☐ Other probate matter (37)  
☐ Provisionally Complex Civil Litigation (Cal. Rules of Court, rules 188a-1812)  
☐ Antitrust/Trade regulation (33)  
☐ Construction defect (10)  
☐ Claims insurance monies tort (33)

2. This case ☒ is ☐ is not complex under rule 1800 of the California Rules requiring nonpartisan judicial management:  
 a. ☒ Large number of separately represented parties b. ☐ Large number of parties  
 c. ☒ Extensive motion practice raising difficult or novel issues that will be time-consuming to resolve d. ☐ Coordination in other counties  
 e. ☒ Substantial amount of documentary evidence f. ☐ Substantial post-trial issues

3. Type of remedies sought (check all that apply):  
 a. ☒ Monetary b. ☐ Nonmonetary, declaratory or injunctive relief c. ☐ Other

4. Number of causes of action (specify): FIVE

5. This case ☐ is ☒ is not a class action suit.

Date: JULY 3, 2003

ERIC D. PARIS, ESQ., S/B# 147836  
 (Print or print name)

NOTICE  
 Plaintiff must file this cover sheet with the first paper filed in the action or proceeding (except under the Probate, Family, or Welfare and Institutions Codes) (Cal. Rules of Court, rule 1811).  
 File this cover sheet in addition to any cover sheet required by local court rule.  
 If this case is complex under rule 1800 at seq. of the California Rules of Court, you must also file a notice of complexity.  
 Unless this is a complex case, this cover sheet shall be used for statistical purposes only.

From adopted by Monterey County Superior Court of California  
 905-220-1100, January 1, 2008

CIVIL CASE COVER SHEET

Right-hand menu:  
 Next Image  
 Previous Image  
 Next page Ctrl+PgDn  
 Previous page Ctrl+PgUp  
 Full screen image Ctrl+F11  
 Slide show F10  
 fit Scale to fit F5  
 1:2 Scale 50% F6  
 1:1 Scale 100% F7  
 2:1 Scale 200% F8  
 Rotate left Ctrl+Alt+L  
 Rotate right Ctrl+Alt+R  
 Rotate by 180°  
 Copy to clipboard  
 Copy file to... Ctrl+C  
 Move file to... Ctrl+X  
 Rename file... F2  
 Delete file... Del  
 EXIF Image Information...  
 Preferences... Ctrl+H



**DI09-096**  
**101 278516397 – 669566**  
**2007 CHEVROLET COBALT**

**Request for Information:**

1. Provide a complete copy of the initial claim or notice document(s) that notified GM of the incident, excluding: (a) medical documents and bills, except those showing the cause of death or injury; (b) property damage invoices or estimates; and (c) documents related to damages.

Response: See Attached Document.

2. Provide a copy of the Police Accident Report.

Response: None.

3. At your option, provide GM's assessment of the circumstances that led to the incident including GM's analysis of the claim and/or notice regarding allegations of a defect.

Response: See Attached Documents. Assessments of claims may be attorney work product and/or privileged. Therefore, information and documents provided in this response, if any, consist only of non-attorney work product and/or non-privileged material for incidents that have been investigated and assessed.

## Service Request Detail

|                                                                    |                                                                                            |              |                                   |           |                         |
|--------------------------------------------------------------------|--------------------------------------------------------------------------------------------|--------------|-----------------------------------|-----------|-------------------------|
| SR No. (b) (6)                                                     | Ref No.                                                                                    | Goodwill     | No Goodwill Offered               | BRC Type  | PAR                     |
| Account                                                            | Site                                                                                       | GW SubType   |                                   | Bus. Unit | BRC                     |
| Last Name                                                          | First Name                                                                                 | Approval     | Not Initiated                     | Area      | PAR                     |
| Daytime #                                                          | Evening #                                                                                  | UCC          | Restraints - (SIR) - Driver Front | Sub-Area  | Initiate PAR- Collision |
| Address                                                            | City Zephyrhills                                                                           | Involved Dir | Buddy Foster Chevrolet, Inc.      | Safety    | Yes                     |
| State FL ZipCd                                                     | Con Acct                                                                                   | Source       | Phone                             | Updated   | 4/10/2009 03:26:13 PM   |
| Serial #/VIN 1G1AK15F477                                           | Model Year 2007                                                                            | Priority     | Medium License # CHEVROL          | Owner     | MORALECR                |
| Make Chevrolet                                                     | Warr. Start 05/24/2007                                                                     | Status       | Open                              | Opened    | 4/8/2009 01:14:00 PM    |
| Model Cobalt                                                       | Mileage 51000                                                                              | Sub-Status   | Satisfied                         | Closed    |                         |
| Abstract (ESIS) Restraints - (SIR) - Driver Front (Non-Deployment) |                                                                                            |              |                                   |           |                         |
| Customer Description                                               | This is a PAR File. Please do not Assume. Forward all Inquiries to Crystal Morales @ 41326 |              |                                   |           |                         |

## Pre-PAR

|                           |                                           |                |                                                                                                                                                                                                        |                 |              |           |             |               |
|---------------------------|-------------------------------------------|----------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------|--------------|-----------|-------------|---------------|
| PAR Notice                | Incident Date/Time                        | Injuries Y/N   | Other Veh                                                                                                                                                                                              | # People in Veh | Road Surface | Road Cond | Fire Report | Police Report |
| Owner                     | 4/1/2009 07:55:23 PM                      | Y              | 1                                                                                                                                                                                                      | 1               | Concrete     | Dry       | n/a         | Unknown       |
| Driver Last Name          | Driver First Name                         | Height         | DOB                                                                                                                                                                                                    | Disabilities    |              |           |             |               |
|                           |                                           |                |                                                                                                                                                                                                        | None            |              |           |             |               |
| Insurance Agent Last Name | Insurance Agent First Name                | Phone #        | Insurance Agency                                                                                                                                                                                       |                 |              |           |             |               |
| Unknown                   | Unknown                                   | (809) 841-3000 | GIECO                                                                                                                                                                                                  |                 |              |           |             |               |
| Incident Loc              | tampa florida-kennedy and del mavery blvd | Incident Desc  | was in the left lane headed northbound on del mavery highway, approached intersection of kennedy and drunk driver ran a red light entering the intersection, didn't have time to stop and t-boned him. |                 |              |           |             |               |
| Component                 | air bag                                   | Damage Desc    | Totalled, front end crushed, passenger fender damaged                                                                                                                                                  |                 |              |           |             |               |
| Vehicle Loc               | Buddy Foster Chevrolet                    | Add'l Info     | State Farm Insurance (Other party's Insurance)                                                                                                                                                         |                 |              |           |             |               |
| Emgcy Svc Names           | City of Tampa Police Department, Tampa FL | Main Loc       | Independants Various Ones                                                                                                                                                                              |                 |              |           |             |               |

## PAR Detail

|                        |                                                       |                      |                 |                         |                                 |                      |            |     |
|------------------------|-------------------------------------------------------|----------------------|-----------------|-------------------------|---------------------------------|----------------------|------------|-----|
| Collision              | Y                                                     | Non Collision        | Property Damage | N                       | Thermal Evt                     | N                    | Spec Equip | n/a |
| Vehicle Speed          | 45                                                    | Weather Condition    | Clear           | Prop Owner              | n/a                             | Property Type        | n/a        |     |
| Last Service Date      | 3/1/2009                                              | Loc Last Service     |                 | Property Location       | n/a                             | Prop Est Repair Cost |            |     |
| Veh Est Repair Cost    | \$8,000.00                                            | Spec Equip Installer | n/a             | Prop Damage Description | n/a                             |                      |            |     |
| Primary Veh Use        | Personal                                              | Inspection Type      |                 | Inspected By            | Inspection Not Performed        | Inspection Date/Time |            |     |
| Veh Damage Description | Totalled, front end crushed, passenger fender damaged |                      |                 | Explain Other           | File going to ESIS for injuries |                      |            |     |

## Service Request Detail

### PAR Injuries

|                                                                                      |            |     |                             |         |                                  |                |
|--------------------------------------------------------------------------------------|------------|-----|-----------------------------|---------|----------------------------------|----------------|
| Last Name                                                                            | First Name | DOB | Location                    | Phone # | Seating Pos                      | Restraint Type |
|                                                                                      |            |     | Occupant of Owner's Vehicle |         | Driver                           | seat belt      |
| Injury Description                                                                   |            |     | Medical Rpt                 |         | Treatment Location               | Treated By     |
| Neck sprain, back strain, right arm, right knee, bruising on hand, chronic headaches |            |     | Unknown                     |         | Memorial Hospital, Tampa Florida | Dr. Farag      |
| Street Address                                                                       |            |     | City                        | State   | Zip Code                         |                |
|                                                                                      |            |     | Zephyrhills                 | FL      |                                  |                |

### Activities

| Created                     | Created By | Assigned To        | Activity Type | Activity Sub-Type | Status      | Completed | Description      |
|-----------------------------|------------|--------------------|---------------|-------------------|-------------|-----------|------------------|
| 4/10/2009 03:35:56 PM       | AMSTUTST   | ESISBIQU           | Escalation    | ESIS - Injuries   | In Progress |           | assigned to ESIS |
| Contact Last Name           |            | Contact First Name |               | Account           |             | BAC Code  |                  |
|                             |            |                    |               |                   |             |           |                  |
| Comments                    |            |                    |               |                   |             |           |                  |
| Injuries, Chronic Headaches |            |                    |               |                   |             |           |                  |
| Confidential Comments       |            |                    |               |                   |             |           |                  |

| Created               | Created By | Assigned To        | Activity Type     | Activity Sub-Type          | Status | Completed             | Description                |
|-----------------------|------------|--------------------|-------------------|----------------------------|--------|-----------------------|----------------------------|
| 4/10/2009 03:26:13 PM | AMSTUTST   | AMSTUTST           | Ownership Changed | Ownership Escalated to BRC | Done   | 4/10/2009 03:26:13 PM | Ownership Escalated to BRC |
| Contact Last Name     |            | Contact First Name |                   | Account                    |        | BAC Code              |                            |
|                       |            |                    |                   |                            |        |                       |                            |
| Comments              |            |                    |                   |                            |        |                       |                            |
| Confidential Comments |            |                    |                   |                            |        |                       |                            |

| Created               | Created By | Assigned To        | Activity Type | Activity Sub-Type | Status | Completed             | Description     |
|-----------------------|------------|--------------------|---------------|-------------------|--------|-----------------------|-----------------|
| 4/10/2009 01:29:14 PM | KINZERTH   | AMSTUTST           | Notify CRM    |                   | Done   | 4/10/2009 03:38:14 PM | ESIS - Injuries |
| Contact Last Name     |            | Contact First Name |               | Account           |        | BAC Code              |                 |
|                       |            |                    |               |                   |        |                       |                 |
| Comments              |            |                    |               |                   |        |                       |                 |
| Confidential Comments |            |                    |               |                   |        |                       |                 |



## Service Request Detail

### Activities

| Created               | Created By | Assigned To        | Activity Type       | Activity Sub-Type | Status          | Completed | Description          |
|-----------------------|------------|--------------------|---------------------|-------------------|-----------------|-----------|----------------------|
| 4/10/2009 01:25:41 PM | MORALECR   | MORALECR           | Scheduled Follow-up |                   | Scheduled Alarm |           | Did Esis pick it up? |
| Contact Last Name     |            | Contact First Name |                     | Account           |                 | BAC Code  |                      |
|                       |            |                    |                     |                   |                 |           |                      |
| Comments              |            |                    |                     |                   |                 |           |                      |
|                       |            |                    |                     |                   |                 |           |                      |
| Confidential Comments |            |                    |                     |                   |                 |           |                      |
|                       |            |                    |                     |                   |                 |           |                      |

| Created                                   | Created By | Assigned To        | Activity Type | Activity Sub-Type | Status | Completed             | Description     |
|-------------------------------------------|------------|--------------------|---------------|-------------------|--------|-----------------------|-----------------|
| 4/10/2009 01:24:00 PM                     | MORALECR   | KINZERTH           | BRC PAR       | ESIS- Injuries    | Done   | 4/10/2009 01:29:13 PM | Forward to ESIS |
| Contact Last Name                         |            | Contact First Name |               | Account           |        | BAC Code              |                 |
|                                           |            |                    |               |                   |        |                       |                 |
| Comments                                  |            |                    |               |                   |        |                       |                 |
| Injuries-Chronic Headaches.               |            |                    |               |                   |        |                       |                 |
| Crystal Morales/PAR/ATX                   |            |                    |               |                   |        |                       |                 |
| Received and assigned for ESIS escalation |            |                    |               |                   |        |                       |                 |
| Thaddeus Kinzer/PAR Workflow/ATX          |            |                    |               |                   |        |                       |                 |
| Confidential Comments                     |            |                    |               |                   |        |                       |                 |
|                                           |            |                    |               |                   |        |                       |                 |

## Service Request Detail

### Activities

| Created               | Created By         | Assigned To | Activity Type        | Activity Sub-Type | Status | Completed             | Description                             |
|-----------------------|--------------------|-------------|----------------------|-------------------|--------|-----------------------|-----------------------------------------|
| 4/10/2009 01:17:51 PM | MORALECR           | MORALECR    | Outbound Call Dealer |                   | Done   | 4/10/2009 01:23:39 PM | Buddy Foster Chevrolet @ (813) 782-1538 |
| Contact Last Name     | Contact First Name | Account     | BAC Code             |                   |        |                       |                                         |

Comments: CRS attempted to reach Buddy Foster Chevrolet svc mgr at (813) 782-1538.

Svc Mgr: Don Reeves

What vehicle services including maint have been performed on the vehicle at the dr?

No history on the vehicle at all.

Is there any evidence of abuse misuse or lack of maint?

None

Are there any known product concerns that relate to the customer's allegation?

None that I know of.

If an inspection becomes necessary would you host that inspection?

Yes.

Crystal Morales/PAR/ATX

Confidential Comments:

| Created              | Created By         | Assigned To | Activity Type       | Activity Sub-Type | Status | Completed             | Description |
|----------------------|--------------------|-------------|---------------------|-------------------|--------|-----------------------|-------------|
| 4/9/2009 05:34:00 PM | MORALECR           | MORALECR    | Scheduled Follow-up |                   | Done   | 4/10/2009 11:32:05 AM | AVM INI     |
| Contact Last Name    | Contact First Name | Account     | BAC Code            |                   |        |                       |             |

Comments:

Confidential Comments:

## Service Request Detail

### Activities

| Created               | Created By         | Assigned To | Activity Type       | Activity Sub-Type | Status | Completed             | Description                                                       |
|-----------------------|--------------------|-------------|---------------------|-------------------|--------|-----------------------|-------------------------------------------------------------------|
| 4/9/2009 05:33:38 PM  | MORALECR           | MORALECR    | Scheduled Follow-up |                   | Done   | 4/10/2009 01:33:09 PM | Dealer INI and send to ESIS                                       |
| Contact Last Name     | Contact First Name | Account     | BAC Code            |                   |        |                       |                                                                   |
| Comments              |                    |             |                     |                   |        |                       |                                                                   |
| Confidential Comments |                    |             |                     |                   |        |                       |                                                                   |
| Created               | Created By         | Assigned To | Activity Type       | Activity Sub-Type | Status | Completed             | Description                                                       |
| 4/9/2009 05:33:18 PM  | MORALECR           | MORALECR    | Scheduled Follow-up |                   | Done   | 4/10/2009 12:05:06 PM | Complete cust ini                                                 |
| Contact Last Name     | Contact First Name | Account     | BAC Code            |                   |        |                       |                                                                   |
| Comments              |                    |             |                     |                   |        |                       |                                                                   |
| Confidential Comments |                    |             |                     |                   |        |                       |                                                                   |
| Created               | Created By         | Assigned To | Activity Type       | Activity Sub-Type | Status | Completed             | Description                                                       |
| 4/9/2009 05:32:58 PM  | MORALECR           | MORALECR    | Scheduled Follow-up |                   | Done   | 4/10/2009 11:43:57 AM | Complete Ack                                                      |
| Contact Last Name     | Contact First Name | Account     | BAC Code            |                   |        |                       |                                                                   |
| Comments              |                    |             |                     |                   |        |                       |                                                                   |
| Confidential Comments |                    |             |                     |                   |        |                       |                                                                   |
| Created               | Created By         | Assigned To | Activity Type       | Activity Sub-Type | Status | Completed             | Description                                                       |
| 4/8/2009 02:34:51 PM  | KINZERTH           | MORALECR    | Ownership Changed   |                   | Done   | 4/8/2009 02:34:51 PM  | Service Request Ownership has changed FROM: SERMONRA TO: MORALECR |
| Contact Last Name     | Contact First Name | Account     | BAC Code            |                   |        |                       |                                                                   |
| Comments              |                    |             |                     |                   |        |                       |                                                                   |
| Confidential Comments |                    |             |                     |                   |        |                       |                                                                   |

## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type    | Status | Completed             | Description                    |
|----------------------|--------------------|-------------|---------------|----------------------|--------|-----------------------|--------------------------------|
| 4/8/2009 02:34:32 PM | KINZERTH           | MORALECR    | BRC PAR       | Initial Contact- AVM | Done   | 4/10/2009 11:38:43 AM | Called Duffy Randy 404082 8815 |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                      |        |                       |                                |

#### Comments

DVM Name: Duffy Randy  
Node/Mailbox: 404082 8815  
This is Crystal Morales calling from the GM Product Allegation Dept to make you aware of a file that was received in your area.  
The request number is: 71-715393425  
The Customer's name is (spell): [REDACTED]  
The dealer involved is: Buddy Foster Chevrolet, Inc.  
Located in (be specific): Zephyrhills, FL  
The vehicle is a (year/make/model): 2007 Chevrolet Cobalt  
With current mileage: 51000  
The last 8 digits of the VIN# are: 77 [REDACTED]  
This involves: a mva where the customer alleges that the airbags should have deployed and did not. We will be fully investigating this allegation. This message is for informational purposes only, and requires no action on your part at this time. However, if you do have any questions please feel free to give me a call.  
Provided contact info.

Crystal Morales/PAR/ATX

Confidential Comments [REDACTED]

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type       | Status | Completed             | Description |
|----------------------|--------------------|-------------|---------------|-------------------------|--------|-----------------------|-------------|
| 4/8/2009 02:34:23 PM | KINZERTH           | MORALECR    | BRC PAR       | Initial Contact- Dealer | Done   | 4/10/2009 11:41:14 AM | Waved...    |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                         |        |                       |             |

#### Comments

Vehicle has not been to a dealer in over two years.

Crystal Morales/PAR/ATX

Confidential Comments [REDACTED]



## Service Request Detail

### Activities

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type      | Status | Completed             | Description |
|----------------------|--------------------|-------------|---------------|------------------------|--------|-----------------------|-------------|
| 4/8/2009 02:34:13 PM | KINZERTH           | MORALECR    | BRC PAR       | Initial Contact- Phone | Done   | 4/10/2009 12:06:48 PM | Called      |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                        |        |                       |             |

Comments: Customer sts taht she was in the left lane headed northbound on del mavery highway, approached intersection of Kennedy and drunk driver ran a red light entering the intersection, didn't have time to stop and I-boned him.

Cust sts that she suffered neck sprain, back strain, arm and knee strain, bruising and chronic headaches since the accident.

Cust sks why the airbags did not deploy.

Cust has retained an attorney against the other driver.

CRS advsd that due to the nature of the file/injuries the case will need to go to our Central Claims office. CRS advsd that an agent from Central Claims will follow up with the customer in 7 to 10 business days. CRS advsd if no one has contacted cust by the 10th business day please contact me and I can provide their number and the name of the agent handling the case.

Crystal Morales/PA/ATX

Confidential Comments:

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed             | Description |
|----------------------|--------------------|-------------|---------------|-------------------|--------|-----------------------|-------------|
| 4/8/2009 02:34:05 PM | KINZERTH           | MORALECR    | BRC PAR       | Acknowledgement   | Done   | 4/10/2009 11:43:30 AM | Called      |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                   |        |                       |             |

Comments: Crs Adv: This is Crystal Morales calling from the GM Product Allegation Dept. I have received your file and do require further information.

Cust was unavailable. CRS rec'd VM. CRS left detailed message with contact information.

Crystal Morales/PA/ATX

Confidential Comments:

| Created              | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description   |
|----------------------|--------------------|-------------|---------------|-------------------|--------|----------------------|---------------|
| 4/8/2009 02:33:57 PM | KINZERTH           | MORALECR    | Notify CRM    |                   | Done   | 4/9/2009 12:23:31 PM | File Assigned |
| Contact Last Name    | Contact First Name | Account     | BAC Code      |                   |        |                      |               |

Comments:

Confidential Comments:

## Service Request Detail

### Activities

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description  |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|--------------|
| 4/8/2009 02:33:50 PM | KINZERTH   | MORALECR    | Research      |                   | Done   | 4/9/2009 12:23:14 PM | Research VIN |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

| Comments |
|----------|
|          |

Open Recalls: None  
Closed Recalls: None

Previous Related Cases: None  
Previous Closed Cases: None

Vehicle Build: Your vehicle has a frontal airbag for the driver and a frontal airbag for the right front passenger. Your vehicle may also have roof-mounted side impact airbags. Roof-mounted side impact airbags are available for the driver and the passenger seated directly behind the driver and for the right front passenger and the passenger seated directly behind that passenger. If your vehicle has roof-mounted side impact airbags, the word AIRBAG will appear on the airbag covering on the garnish trim near the ceiling and the side windows.

Crystal Morales/PAR/ATX

| Confidential Comments |
|-----------------------|
|                       |

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description                        |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|------------------------------------|
| 4/8/2009 02:33:31 PM | KINZERTH   | MORALECR    | BRC PAR       | Case Assigned     | Done   | 4/9/2009 12:23:50 PM | Assigned to Crystal Morales x41326 |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

| Comments      |
|---------------|
| File Removed. |

Crystal Morales/PAR/ATX

| Confidential Comments |
|-----------------------|
|                       |

| Created              | Created By | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description                                           |
|----------------------|------------|-------------|---------------|-------------------|--------|----------------------|-------------------------------------------------------|
| 4/8/2009 02:13:37 PM | KINZERTH   | SERMONRA    | SR Opened     |                   | Done   | 4/8/2009 02:13:37 PM | SR In Status of Closed has been Re-Opened by KINZERTH |

| Contact Last Name | Contact First Name | Account | BAC Code |
|-------------------|--------------------|---------|----------|
|                   |                    |         |          |

| Comments |
|----------|
|          |

| Confidential Comments |
|-----------------------|
|                       |

## Service Request Detail

### Activities

| Created By            | Assigned To        | Activity Type | Activity Sub-Type     | Status | Completed            | Description                                |
|-----------------------|--------------------|---------------|-----------------------|--------|----------------------|--------------------------------------------|
| 4/8/2009 02:13:36 PM  | KINZERTH           | SERMONRA      | SR Closed - Satisfied | Done   | 4/8/2009 02:13:36 PM | Service Request has been Closed Satisfied. |
| Contact Last Name     | Contact First Name | Account       | BAC Code              |        |                      |                                            |
| Comments              |                    |               |                       |        |                      |                                            |
| Confidential Comments |                    |               |                       |        |                      |                                            |

| Created                                                                                             | Created By         | Assigned To | Activity Type | Activity Sub-Type | Status | Completed            | Description                     |
|-----------------------------------------------------------------------------------------------------|--------------------|-------------|---------------|-------------------|--------|----------------------|---------------------------------|
| 4/8/2009 01:24:08 PM                                                                                | SERMONRA           | KINZERTH    | Escalation    | Initiate PAR      | Done   | 4/8/2009 02:13:32 PM | Assigning activity to PAR QUEUE |
| Contact Last Name                                                                                   | Contact First Name | Account     | BAC Code      |                   |        |                      |                                 |
|                                                                                                     |                    |             |               |                   |        |                      |                                 |
| Comments                                                                                            |                    |             |               |                   |        |                      |                                 |
| CRS advised that a person from the PAR Department will contact the customer within 2 business days. |                    |             |               |                   |        |                      |                                 |
| John Jones/cac/T1(hv1)/mla                                                                          |                    |             |               |                   |        |                      |                                 |
| Received and assigned in PAR                                                                        |                    |             |               |                   |        |                      |                                 |
| Thaddeus Kinzer/PAR Workflow/ATX                                                                    |                    |             |               |                   |        |                      |                                 |
| Confidential Comments                                                                               |                    |             |               |                   |        |                      |                                 |

| Created                                                                                                            | Created By         | Assigned To | Activity Type         | Activity Sub-Type | Status | Completed            | Description                           |
|--------------------------------------------------------------------------------------------------------------------|--------------------|-------------|-----------------------|-------------------|--------|----------------------|---------------------------------------|
| 4/8/2009 01:21:51 PM                                                                                               | SERMONRA           | SERMONRA    | Inbound Call Customer | Complex Request   | Done   | 4/8/2009 01:24:06 PM | complaint veh- air bag did not deploy |
| Contact Last Name                                                                                                  | Contact First Name | Account     | BAC Code              |                   |        |                      |                                       |
| Comments                                                                                                           |                    |             |                       |                   |        |                      |                                       |
| CUST STS:<br>-had a head on collision on the first of this month and air bag did not deploy.                       |                    |             |                       |                   |        |                      |                                       |
| CUST SKS: gm needs to investigate this                                                                             |                    |             |                       |                   |        |                      |                                       |
| CRS advised customer that their information will be forwarded to the Product Allegation Department within the BRC. |                    |             |                       |                   |        |                      |                                       |
| John Jones/cac/T1(hv1)/mla                                                                                         |                    |             |                       |                   |        |                      |                                       |
| Confidential Comments                                                                                              |                    |             |                       |                   |        |                      |                                       |

### UCC Information

| UCC Code | Symptom              | Description                       |
|----------|----------------------|-----------------------------------|
| C46      | SIR - Did Not Deploy | Restraints - (SIR) - Driver Front |

## GM Vehicle Inquiry System Summary

Home - Summary - Claim History - Vehicle Build - Vehicle Component - Delivery Information - Dealer Information -  
Service Contract - Warranty Block - Branded Title

Help

|       |             |
|-------|-------------|
| VIN : | 1G1AK15F477 |
|-------|-------------|

### VEHICLE INFORMATION

|                       |                                                                                                      |                 |    |                           |                |              |      |
|-----------------------|------------------------------------------------------------------------------------------------------|-----------------|----|---------------------------|----------------|--------------|------|
| Merchandising Model : | 1AK37 -2007 COBALT 2-DOOR LS COUPE                                                                   |                 |    | Warranty Start Date :     | 05/24/2007     |              |      |
| BARS Order Type :     | 70 - RETAIL - STOCK                                                                                  |                 |    |                           |                |              |      |
| Delivering Dealer :   | BILL HEARD CHEVROLET, INC.-PLANT CITY<br>PO BOX 3209<br>PLANT CITY , FL 33563-0004<br>(813) 752-5123 |                 |    | Selling Source :          | 13 - CHEVROLET |              |      |
|                       |                                                                                                      |                 |    | Site Code :               | 26042          |              |      |
|                       |                                                                                                      |                 |    | Business Associate Code : | 171064         |              |      |
| Service Contract :    | No                                                                                                   | Branded Title : | No | Warranty Block :          | No             | PDI Status : | Paid |

### REQUIRED FIELD ACTIONS

Vehicle Has No Current Record Of Outstanding Campaigns

### SERVICE INFORMATIONAL ITEMS

Vehicle Has No Current Record Of Outstanding Service Information

### ON STAR AND XM SATELLITE RADIO INFORMATION

Vehicle Has No Associated On Star or XM Radio Information.

### APPLICABLE WARRANTIES

| Description                                                  | Effective Date | Effective Odometer | End Date   | End Odometer |
|--------------------------------------------------------------|----------------|--------------------|------------|--------------|
| 36/36000 BUMPER TO BUMPER LIMITED WARRANTY                   | 05/24/2007     | 7 miles            | 05/24/2010 | 36007 miles  |
| 72/100000 SHEET METAL COVERAGE RUST THROUGH LIMITED WARRANTY | 05/24/2007     | 7 miles            | 05/24/2013 | 100007 miles |
| 96/80000 FEDERAL EMISSION CATALYTIC CONV. AND PCM            | 05/24/2007     | 7 miles            | 05/24/2015 | 80007 miles  |
| 60/100000 POWERTRAIN COVERAGE LIMITED WARRANTY               | 05/24/2007     | 7 miles            | 05/24/2012 | 100007 miles |
| 36/36000 FEDERAL EMISSION                                    | 05/24/2007     | 7 miles            | 05/24/2010 | 36007 miles  |

### CLAIM HISTORY

| R.O Date | R.O | Type | Labor Operation | Odometer |
|----------|-----|------|-----------------|----------|
|----------|-----|------|-----------------|----------|

<http://198.208.187.167/gmvis/main/Summary?languageSelected=EN&VIN=1G1AK15F477...> 4/13/2009

|            | Number |   |                                             | Reading |
|------------|--------|---|---------------------------------------------|---------|
| 10/09/2006 | A83642 | I | Z7000 - PRE-DELIVERY INSPECTION - BASE TIME | 0 miles |

**CHECK HISTORY INFORMATION**

Vehicle Has No Associated Check History Information.

© 1998-2005 General Motors Corporation. All Rights Reserved.



## GM Vehicle Inquiry System Claim History

Home - Summary - Claim History - Vehicle Build - Vehicle Component - Delivery Information - Dealer Information -  
Service Contract - Warranty Block - Branded Title

Help

|       |             |
|-------|-------------|
| VIN : | 1G1AK15F477 |
|-------|-------------|

### CLAIM HISTORY

| Repair Order Date : |                                                                                                     | 10/09/2006 | Repair Order Number : |                                             | A83642                    | Odometer Reading : |                | 0 miles    |          |
|---------------------|-----------------------------------------------------------------------------------------------------|------------|-----------------------|---------------------------------------------|---------------------------|--------------------|----------------|------------|----------|
| Serviced By :       | BILL HEARD CHEVROLET, INC.-PLANT CITY<br>PO BOX 3209<br>PLANT CITY, FL 33563-0004<br>(813) 752-5123 |            |                       |                                             | Selling Source :          |                    | 13 - CHEVROLET |            |          |
|                     |                                                                                                     |            |                       |                                             | Site Code :               |                    | 26042          |            |          |
|                     |                                                                                                     |            |                       |                                             | Business Associate Code : |                    | 171064         |            |          |
| Cycle Date          | Cycle Nbr                                                                                           | Case       | Type                  | Labor Operation                             | Part                      | Auth Code          | Person Code    | Line Total | Comments |
| 10/13/2006          | 734                                                                                                 | 01         | I                     | Z7000 - PRE-DELIVERY INSPECTION - BASE TIME | N/A                       | N/A                | N/A            | \$ 104.92  | N        |

### CHECK HISTORY

|                                          |
|------------------------------------------|
| Vehicle Has No Associated Check History. |
|------------------------------------------|

© 1998-2005 General Motors Corporation. All Rights Reserved.

## GM Vehicle Inquiry System Vehicle Build

Home - [Summary](#) - [Claim History](#) - [Vehicle Build](#) - [Vehicle Component](#) - [Delivery Information](#) - [Dealer Information](#) - [Service Contract](#) - [Warranty Block](#) - [Branded Title](#)

[Help](#)

|     |             |
|-----|-------------|
| VIN | 1G1AK15F477 |
|-----|-------------|

### VEHICLE BUILD

|                               |                                    |                |        |
|-------------------------------|------------------------------------|----------------|--------|
| Merchandising Model :         | 1AK37 -2007 COBALT 2-DOOR LS COUPE |                |        |
| Gross Vehicle Weight Rating : | 1674 kg (3691 lb)                  | Order Number : | KKJW3Q |
| Build Date :                  | 10/09/2006                         | Build Plant :  | 177A   |

GMVIS is not the definitive source of GM Vehicle RPO information and is intended for service reference only. Should there be any questions about the vehicle's original build or RPO information please refer to the original vehicle invoice or window sticker.

### OPTION CODES

|                                                                     |                                                                               |
|---------------------------------------------------------------------|-------------------------------------------------------------------------------|
| AK5 - DRIVER & RIGHT FRONT PASSENGER AIR BAGS                       | AL0 - SENSOR INDICATOR INFLATABLE RESTRAINT, FRT PASS/CHILD PRESENCE DETECTOR |
| AR9 - DELUXE FRONT BUCKET SEAT                                      | AT8 - RESTRAINT PROVISIONS CHILD, RR SEAT, RR FACING                          |
| B34 - FLOOR MATS, FRONT/REAR                                        | B35 - REAR FLOOR MATS                                                         |
| B84 - BODY COLOR, BODYSIDE MOLDINGS                                 | C67 - ELECT. FRONT AIR CONDITIONER                                            |
| DC8 - MIRROR, O/S MANUAL FLDG, BLK                                  | DT4 - ASHTRAY AND LIGHTER                                                     |
| D36 - MIRROR I/S R/V TILT                                           | FE1 - SUSPENSION SYSTEM-SOFT RIDE                                             |
| FE9 - FEDERAL EMISSIONS                                             | FY1 - TRANS/AXLE 3.63 RATIO                                                   |
| IPB - INTERIOR TRIM DESIGN                                          | J41 - BRAKE, FRONT DISC/REAR DRUM                                             |
| K64 - 115 AMP GENERATOR                                             | LOD - ASSEMBLY PLANT - LORDSTOWN, OHIO                                        |
| L61 - ENGINE, 2.2L DOHC 4V ECOTEC                                   | MN5 - 4 SPEED AUTO TRANSMISSION                                               |
| MX0 - TRANSMISSION, 4 SPD AUTOMATIC                                 | NT7 - FEDERAL EMISSION TIER 2                                                 |
| N45 - 3 SPOKE STEERING WHEEL                                        | PG1 - 15" STEEL WHEEL                                                         |
| QTU - P195/60R15 TOURING BW TIRES                                   | R6K                                                                           |
| R6P - PREMIUM PAINT                                                 | R9N - HEATED LEATHER APPOINTED FRONT BUCKET SEATS                             |
| SLM - STOCK ORDERS                                                  | UQ4 - BASE SPEAKER SYSTEM                                                     |
| US8 - AM/FM STEREO, CD PLAYER & MP3 PLAYER (REPLACES STD/OPT RADIO) | VK3 - FRONT LICENSE PLATE BRACKET                                             |
|                                                                     |                                                                               |

<http://198.208.187.167/gmvis/main/VehicleBuild?languageSelected=EN&VIN=1G1AK15...> 4/13/2009

|                             |                                                   |
|-----------------------------|---------------------------------------------------|
| VT7 - OWNERS MANUAL ENGLISH | V73 - STATEMENT OF VEHICLE CERT.-<br>U.S. /CANADA |
| 1LS - 1LS BASE PACKAGE      | 1SZ - OPTION PACKAGE DISCOUNT                     |
| 14B - GRAY                  | 14I - GRAY                                        |
| 6AR - FRONT SPRING          | 7AR - FRONT SPRING                                |
| 74U - VICTORY RED           | 8AA - REAR SPRING                                 |
| 9AA - REAR SPRING           |                                                   |

© 1998-2005 General Motors Corporation. All Rights Reserved.

## CDR File Information

|                            |                                    |
|----------------------------|------------------------------------|
| User Entered VIN           | 1G1AK15F477                        |
| User                       | C. Garcia                          |
| Case Number                | 669566                             |
| EDR Data Imaging Date      | Friday, May 22 2009                |
| Crash Date                 | Wednesday, April 1 2009            |
| Filename                   | 1G1AK15F477 CDR                    |
| Saved on                   | Friday, May 22 2009 at 11:31:47 AM |
| Collected with CDR version | Crash Data Retrieval Tool 3.1.1    |
| Reported with CDR version  | Crash Data Retrieval Tool 3.1.1    |
| EDR Device Type            | airbag control module              |
| Event(s) recovered         | Non-Deployment                     |

**IMPORTANT NOTICE:** Robert Bosch LLC recommends that the latest production release of Crash Data Retrieval software be utilized when viewing, printing or exporting any retrieved data from within the CDR program. This ensures that the retrieved data has been translated using the most recent information including but not limited to that which was provided by the manufacturers of the vehicles supported in this product.

## Data Limitations

### Recorded Crash Events:

There are two types of recorded crash events. The first is the Non-Deployment Event. A Non-Deployment Event records data but does not deploy the air bag(s). The minimum SDM Recorded Vehicle Velocity Change, that is needed to record a Non-Deployment Event, is five MPH. A Non-Deployment Event contains Pre-Crash and Crash data. The SDM can store up to one Non-Deployment Event. This event can be overwritten by an event that has a greater SDM recorded vehicle velocity change. This event will be cleared by the SDM, after approximately 250 ignition cycles. This event can be overwritten by a second Deployment Event, referred to as Deployment Event #2, if the Non-Deployment Event is not locked. The data in the Non-Deployment Event file will be locked, if the Non-Deployment Event occurred within five seconds of a Deployment Event. A locked Non Deployment Event cannot be overwritten or cleared by the SDM.

The second type of SDM recorded crash event is the Deployment Event. It also contains Pre-Crash and Crash data. The SDM can store up to two different Deployment Events. If a second Deployment Event occurs any time after the Deployment Event, the Deployment Event #2 will overwrite any non-locked Non-Deployment Event. Deployment Events cannot be overwritten or cleared by the SDM. Once the SDM has deployed an air bag, the SDM must be replaced.

### Data:

- SDM Recorded Vehicle Velocity Change reflects the change in velocity that the sensing system experienced during the recorded portion of the event. SDM Recorded Vehicle Velocity Change is the change in velocity during the recording time and is not the speed the vehicle was traveling before the event, and is also not the Barrier Equivalent Velocity. For Deployment Events, the SDM will record 220 milliseconds of data after deployment criteria is met and up to 70 milliseconds before deployment criteria is met. For Non-Deployment Events, the SDM can record up to the first 300 milliseconds of data after algorithm enable. Velocity Change data is displayed in SAE sign convention.
- Maximum Recorded Vehicle Velocity Change is the maximum square root value of the sum of the squares for the vehicle's combined "X" and "Y" axis change in velocity.
- Event Recording Complete will indicate if data from the recorded event has been fully written to the SDM memory or if it has been interrupted and not fully written.
- SDM Recorded Vehicle Speed accuracy can be affected by various factors, including but not limited to the following:
  - significant changes in the tire's rolling radius
  - final drive axle ratio changes
  - wheel lockup and wheel slip
- Brake Switch Circuit Status indicates the open/closed state of the brake switch circuit.
- Pre-Crash data is recorded asynchronously.
- Pre-Crash Electronic Data Validity Check Status indicates "Data Invalid" if:
  - the SDM receives a message with an "invalid" flag from the module sending the pre-crash data
  - no data is received from the module sending the pre-crash data
  - no module is present to send the pre-crash data

-Driver's and Passenger's Belt Switch Circuit Status indicates the status of the seat belt switch circuit, except: The Passenger Belt Switch Circuit Status for 2005 vehicles is available only on the Cadillac STS. The Passenger Belt Switch Circuit Status for 2006 Chevrolet Cobalt Sport Coupe (AP) model vehicles, with the option package that includes Recaro brand seats (RPO ALV), always reports a default value of "Buckled," because there is no passenger belt switch with the Recaro seat option.

-The Time Between Non-Deployment to Deployment Events is displayed in seconds. If the time between the two events is greater than five seconds, "N/A" is displayed in place of the time. If the value is negative, then the Deployment Event occurred first. If the value is positive, then the Non-Deployment Event occurred first.

-If power to the SDM is lost during a crash event, all or part of the crash record may not be recorded.

-The ignition cycle counter relies upon the transitions through OFF->RUN->CRANK power-moding messages, on the GMLAN communication bus, to increment the counter. Applying and removing of battery power to the module will not increment the ignition counter.

-Steering Wheel Angle data is displayed as a positive value when the steering wheel is turned to the right and a negative value

1G1AK15F477

Page 1 of 11

Printed on: Friday, May 22 2009 at 11:32:43 AM

when the steering wheel is turned to the left, except for Cadillac STS model vehicles with StabiliTrak 3.0 systems (RPO JL7). For Cadillac STS model vehicles with StabiliTrak 3.0 systems (RPO JL7), when the steering wheel is turned to the right, a negative value will be displayed and when the steering wheel is turned to the left, a positive value will be displayed. The Steering Wheel Angle data is reported in 16 degree increments.

**Data Source:**

All SDM recorded data is measured, calculated, and stored internally, except for the following:

- Vehicle Status Data (Pre-Crash) is transmitted to the SDM, by various vehicle control modules, via the vehicle's communication network.
- The Belt Switch Circuit is wired directly to the SDM.



### Multiple Event Data

|                                                         |    |
|---------------------------------------------------------|----|
| Associated Events Not Recorded                          | 0  |
| An Event(s) Preceded the Recorded Event(s)              | No |
| An Event(s) was in Between the Recorded Event(s)        | No |
| An Event(s) Followed the Recorded Event(s)              | No |
| The Event(s) Not Recorded was a Deployment Event(s)     | No |
| The Event(s) Not Recorded was a Non-Deployment Event(s) | No |

### System Status At AE

|                                              |             |
|----------------------------------------------|-------------|
| Vehicle Identification Number                | **1AK15F*7* |
| Low Tire Pressure Warning Lamp (If Equipped) | Invalid     |
| Vehicle Power Mode Status                    | Run         |
| Remote Start Status (If Equipped)            | Inactive    |
| Run/Crank Ignition Switch Logic Level        | Active      |
| Brake System Warning Lamp (If Equipped)      | OFF         |

### System Status At 1 second

|                                                   |             |
|---------------------------------------------------|-------------|
| Transmission Range (If Equipped)                  | Fourth Gear |
| Transmission Selector Position (If Equipped)      | Fourth Gear |
| Traction Control System Active (If Equipped)      | Invalid     |
| Service Engine Soon (Non-Emission Related) Lamp   | OFF         |
| Service Vehicle Soon Lamp                         | OFF         |
| Outside Air Temperature (degrees F) (If Equipped) | 80          |
| Left Front Door Status (If Equipped)              | Closed      |
| Right Front Door Status (If Equipped)             | Closed      |
| Left Rear Door Status (If Equipped)               | Unused      |
| Right Rear Door Status (If Equipped)              | Unused      |
| Rear Door(s) Status (If Equipped)                 | Closed      |

### Pre-crash data

| Parameter                                         | -2 sec  | -1 sec  |
|---------------------------------------------------|---------|---------|
| Reduced Engine Power Mode                         | OFF     | OFF     |
| Cruise Control Active (If Equipped)               | Invalid | Invalid |
| Cruise Control Resume Switch Active (If Equipped) | Invalid | Invalid |
| Cruise Control Set Switch Active (If Equipped)    | Invalid | Invalid |


### Pre-Crash Data

| Parameter                                                 | -5 sec  | -4 sec  | -3 sec  | -2 sec  | -1 sec  |
|-----------------------------------------------------------|---------|---------|---------|---------|---------|
| Vehicle Speed (MPH)                                       | 44      | 45      | 45      | 47      | 24      |
| Engine Speed (RPM)                                        | 1536    | 1536    | 1600    | 1664    | 1152    |
| Percent Throttle                                          | 38      | 39      | 37      | 36      | 20      |
| Accelerator Pedal Position (percent)                      | 17      | 18      | 14      | 13      | 0       |
| Antilock Brake System Active (If Equipped)                | Invalid | Invalid | Invalid | Invalid | Invalid |
| Lateral Acceleration (feet/s <sup>2</sup> ) (If Equipped) | Invalid | Invalid | Invalid | Invalid | Invalid |
| Yaw Rate (degrees per second) (If Equipped)               | Invalid | Invalid | Invalid | Invalid | Invalid |
| Steering Wheel Angle (degrees) (If Equipped)              | 0       | 0       | 0       | 0       | 0       |


| Parameter                                           | -5 sec  | -4 sec  | -3 sec  | -2 sec  | -1 sec  |
|-----------------------------------------------------|---------|---------|---------|---------|---------|
| Vehicle Dynamics<br>Control Active (If<br>Equipped) | Invalid | Invalid | Invalid | Invalid | Invalid |

## System Status At Non-Deployment

|                                                                       |                       |
|-----------------------------------------------------------------------|-----------------------|
| Ignition Cycles At Investigation                                      | 3093                  |
| SIR Warning Lamp Status                                               | OFF                   |
| SIR Warning Lamp ON/OFF Time (seconds)                                | 655200                |
| Number of Ignition Cycles SIR Warning Lamp was ON/OFF Continuously    | 3078                  |
| Ignition Cycles At Event                                              | 3079                  |
| Ignition Cycles Since DTCs Were Last Cleared                          | 254                   |
| Driver's Belt Switch Circuit Status                                   | BUCKLED               |
| Passenger's Belt Switch Circuit Status                                | UNBUCKLED             |
| Automatic Passenger SIR Suppression System Validity Status            | Valid                 |
| Automatic Passenger SIR Suppression System Status                     | Air Bag<br>Suppressed |
| Diagnostic Trouble Codes at Event, fault number: 1                    | N/A                   |
| Diagnostic Trouble Codes at Event, fault number: 2                    | N/A                   |
| Diagnostic Trouble Codes at Event, fault number: 3                    | N/A                   |
| Diagnostic Trouble Codes at Event, fault number: 4                    | N/A                   |
| Diagnostic Trouble Codes at Event, fault number: 5                    | N/A                   |
| Diagnostic Trouble Codes at Event, fault number: 6                    | N/A                   |
| Maximum SDM Recorded Velocity Change (MPH)                            | 14.91                 |
| Algorithm Enable to Maximum SDM Recorded Velocity Change (msec)       | 110                   |
| Driver First Stage Deployment Loop Commanded                          | No                    |
| Driver Second Stage Deployment Loop Commanded                         | No                    |
| Driver Side Deployment Loop Commanded                                 | No                    |
| Driver Pretensioner Deployment Loop Commanded                         | No                    |
| Driver (Initiator 1) Roof Rail/Head Curtain Loop Commanded            | No                    |
| Driver (Initiator 2) Roof Rail/Head Curtain Loop Commanded            | No                    |
| Driver Knee Deployment Loop Commanded                                 | No                    |
| Passenger First Stage Deployment Loop Commanded                       | No                    |
| Passenger Second Stage Deployment Loop Commanded                      | No                    |
| Passenger Side Deployment Loop Commanded                              | No                    |
| Passenger Pretensioner Deployment Loop Commanded                      | No                    |
| Passenger (Initiator 1) Roof Rail/Head Curtain Loop Commanded         | No                    |
| Passenger (Initiator 2) Roof Rail/Head Curtain Loop Commanded         | No                    |
| Passenger Knee Deployment Loop Commanded                              | No                    |
| Driver Anchor Pretensioner Deployment Loop Commanded (If Equipped)    | No                    |
| Second Row Left Pretensioner Deployment Loop Commanded                | No                    |
| Third Row Left Roof Rail/Head Curtain Loop Commanded                  | No                    |
| Passenger Anchor Pretensioner Deployment Loop Commanded (If Equipped) | No                    |
| Second Row Right Pretensioner Deployment Loop Commanded               | No                    |
| Third Row Right Roof Rail/Head Curtain Loop Commanded                 | No                    |
| Second Row Center Pretensioner Deployment Loop Commanded              | No                    |
| Crash Record Locked                                                   | No                    |
| Vehicle Event Data (Pre-Crash) Associated With This Event             | Yes                   |
| Deployment Event Recorded in the Non-Deployment Record                | No                    |
| Event Recording Complete                                              | Yes                   |

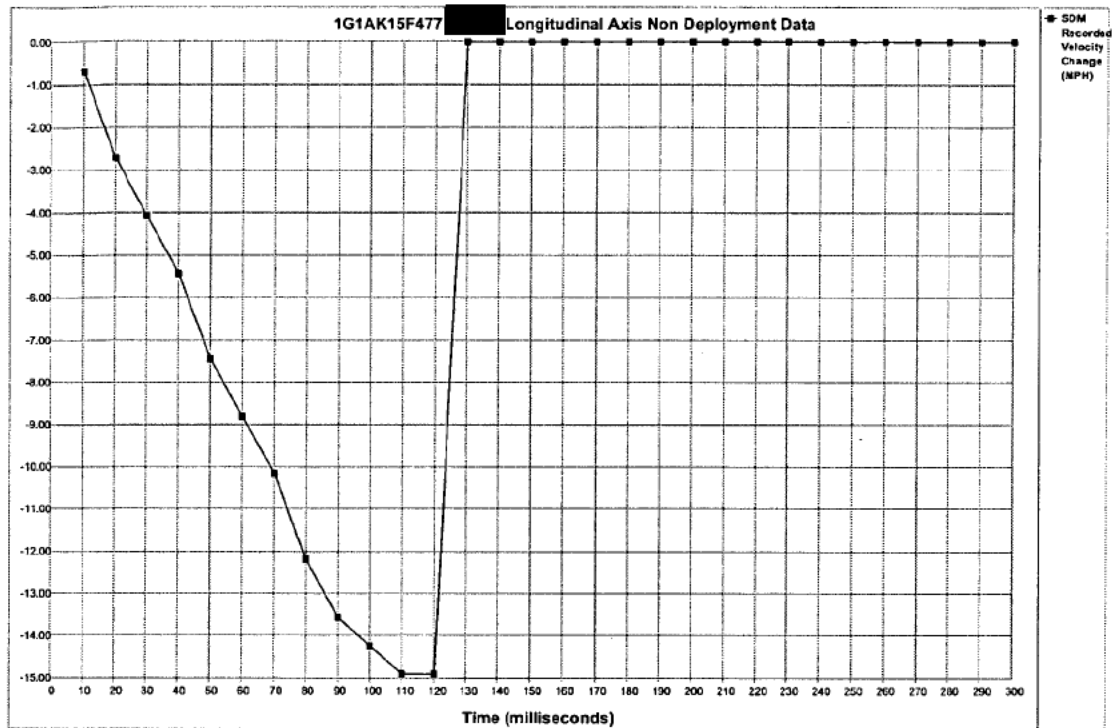

|                                                      |       |       |       |       |       |       |        |        |        |        |        |        |      |      |      |
|------------------------------------------------------|-------|-------|-------|-------|-------|-------|--------|--------|--------|--------|--------|--------|------|------|------|
| Time (milliseconds)                                  | 10    | 20    | 30    | 40    | 50    | 60    | 70     | 80     | 90     | 100    | 110    | 120    | 130  | 140  | 150  |
| SDM Longitudinal Axis Recorded Velocity Change (MPH) | -0.68 | -2.71 | -4.07 | -5.42 | -7.46 | -8.81 | -10.17 | -12.20 | -13.56 | -14.23 | -14.91 | -14.91 | 0.00 | 0.00 | 0.00 |
| Time (milliseconds)                                  | 160   | 170   | 180   | 190   | 200   | 210   | 220    | 230    | 240    | 250    | 260    | 270    | 280  | 290  | 300  |
| SDM Longitudinal Axis Recorded Velocity Change (MPH) | 0.00  | 0.00  | 0.00  | 0.00  | 0.00  | 0.00  | 0.00   | 0.00   | 0.00   | 0.00   | 0.00   | 0.00   | 0.00 | 0.00 | 0.00 |

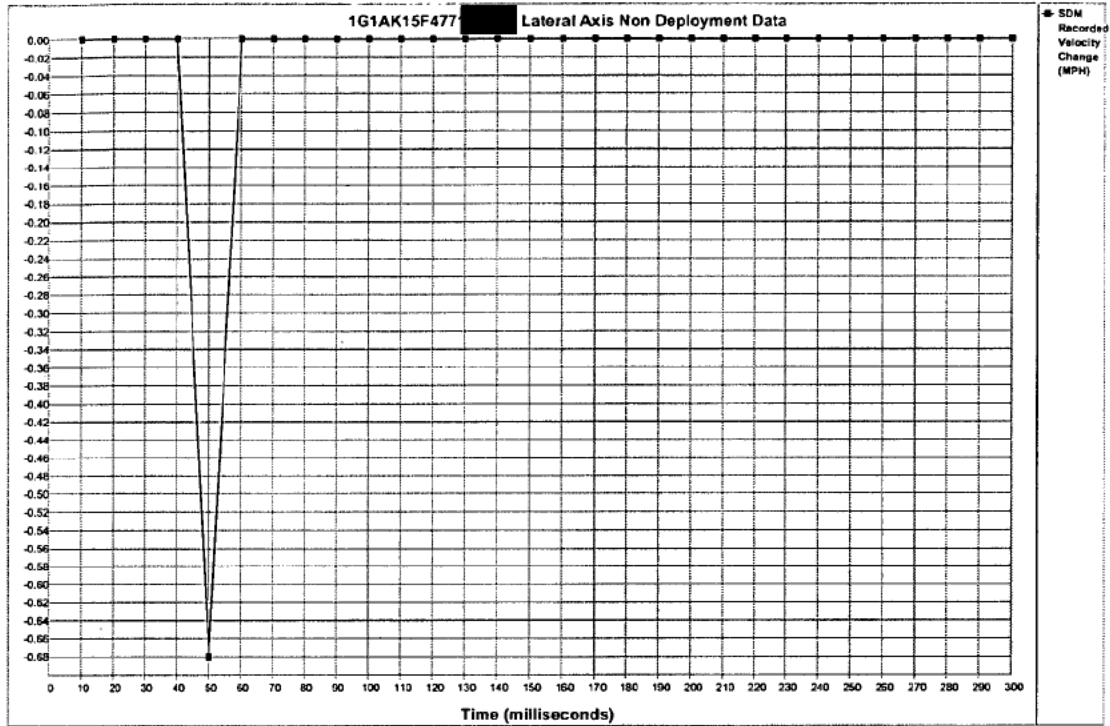

|                                                 |      |      |      |      |       |      |      |      |      |      |      |      |      |      |      |
|-------------------------------------------------|------|------|------|------|-------|------|------|------|------|------|------|------|------|------|------|
| Time (milliseconds)                             | 10   | 20   | 30   | 40   | 50    | 60   | 70   | 80   | 90   | 100  | 110  | 120  | 130  | 140  | 150  |
| SDM Lateral Axis Recorded Velocity Change (MPH) | 0.00 | 0.00 | 0.00 | 0.00 | -0.68 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |
| Time (milliseconds)                             | 160  | 170  | 180  | 190  | 200   | 210  | 220  | 230  | 240  | 250  | 260  | 270  | 280  | 290  | 300  |
| SDM Lateral Axis Recorded Velocity Change (MPH) | 0.00 | 0.00 | 0.00 | 0.00 | 0.00  | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 | 0.00 |

## Hexadecimal Data

Data that the vehicle manufacturer has specified for data retrieval is shown in the hexadecimal data section of the CDR report. The hexadecimal data section of the CDR report may contain data that is not translated by the CDR program. The control module contains additional data that is not retrievable by the CDR system.

```
$01 00 00 00 00 54 00 00
$02 30 00 00 00 00 00 00
$03 02 00 00 00 00 00 00
$04 02 00 00 00 00 00 00
$05 00 00 00 00 00 00 00
$06 04 0A 00 00 0A 39 15
$07 40 09 00 00 00 00 00
$08 00 FF 00 00 00 00 00
$09 00 86 85 00 00 00 00
$0A 00 00 00 00 00 00 00
$0B 00 00 01 0F 00 00 00
$0C 80 00 80 00 00 00 00
$0D 00 00 40 00 00 00 00
$0E 00 00 00 00 00 00 00
$0F A0 00 00 00 00 00 00
$10 47 31 41 4B 31 35 46
$11 34 37 37 31 38 33 36
$12 34 32 00 00 00 00 00
$13 00 00 00 00 00 00 00
$14 00 00 00 00 00 00 00
$15 00 00 00 00 00 00 00
$16 03 06 0C 16 34 00 00
$17 03 03 02 02 00 00 00
$18 02 02 00 00 00 00 00
$19 07 07 00 00 00 00 00
$1B 3F 00 00 67 00 7A 00
$1C 3F 00 00 02 00 1A 00
$1D 00 00 00 00 00 00 00
$1E 4F 00 00 4F 00 01 00
$1F 33 C1 00 00 00 23 00
$20 40 00 00 00 00 00 00
$21 01 FF 00 00 D0 00 00
$22 00 98 00 00 00 00 00
$24 00 00 00 00 00 00 00
$25 00 00 00 00 00 00 00
$26 00 00 00 00 00 00 00
$27 FF 00 FF 00 00 00 00
$2A 00 00 00 00 00 00 00
$2B 00 00 00 00 00 00 00
$2D 00 00 00 00 00 00 00
$2E 00 FF F0 0C 12 00 00
$2F 00 FE 0C 15 0E 00 00
$30 9D 00 00 00 00 00 00
$31 00 20 24 2F 2B 00 00
$32 00 00 00 80 00 00 00
$33 33 5B 5E 64 62 00 00
$34 12 1A 19 18 18 00 00
$35 27 4B 49 48 46 00 00
$36 00 00 00 00 00 00 00
$37 00 00 00 04 04 00 E2
$38 85 00 40 00 03 C0 00
$39 00 00 00 00 00 80 00
$3A 00 00 00 00 00 80 00
$3B 03 06 0C 00 00 00 00
$3C 00 00 00 00 00 00 C0
$3D 31 41 4B 31 35 46 00
```



```

$3E 37 18 36 42 00 00 00
$3F 00 00 90 00 00 00 00
$40 20 A5 00 00 00 00 00
$41 00 00 00 00 00 00 00
$42 00 FF F0 0C 06 00 00
$43 FE 0C 07 00 00 00 00
$44 00 00 00 00 00 00 00
$45 00 00 00 00 00 00 00
$46 00 00 00 00 00 00 00
$47 00 FF 00 FC 00 FA 00
$48 00 F8 FF F5 00 F3 00
$49 00 F1 00 EE 00 EC 00
$4A 00 EB 00 EA 00 EA 00
$4B 00 00 00 00 00 00 00
$4C 00 00 00 00 00 00 00
$4D 00 00 00 00 00 00 00
$4E 00 00 00 00 00 00 00
$4F 00 00 00 00 00 00 00
$50 00 00 00 00 00 00 00
$51 D0 00 00 00 00 00 00
$52 00 00 00 00 00 00 00
$53 0B 01 E4 00 00 00 00
$54 00 00 00 00 00 00 00
$55 00 00 00 00 00 00 00
$67 00 00 00 00 00 00 00
$68 F8 F8 90 C0 00 00 00
$69 80 FF FF FF FF 00 00
$6A FF FF FF 00 00 00 00
$6B FF FF FF FF FF FF 00
$6C FF FF FF FF FF FF 00
$6D FF FF FF FF FF FF 00
$6E FF FF FF FF FF FF 00
$6F FF FF FF FF FF FF 00
$70 FF FF FF FF FF FF 00
$71 FF FF FF FF FF FF 00
$72 FF FF FF FF FF FF 00
$73 FF FF FF FF FF FF 00
$74 FF FF FF FF FF FF 00
$75 FF FF FF FF FF FF 00
$76 FF FF FF FF FF FF 00
$77 FF FF FF FF FF FF 00
$78 F0 00 00 F0 00 00 00
$79 81 FF FF FF 00 00 00
$7A 82 FF FF 00 00 00 00
$7B FF FF FF FF FF FF 00

$01 41 55 01 02 03 04 52 53 41 32 03 09 01 AA AA 01
$02 01 02 03 04
$03 41 54 01 02 03 04 52 53 41 32 03 09 01 AA AA 01
$04 01 02 03 04
$05 42 55 FF FF FF FF FF FF FF FF FF FF FF FF FF
$06 FF FF FF FF
$07 42 54 FF FF FF FF FF FF FF FF FF FF FF FF FF
$08 FF FF FF FF
$0D 41 48 32 39 35 31 52 36 32 35 30 31 45 45 44 4A
$0E 01 5A 4B 31
$0F 41 4A 01 02 03 04 52 45 41 32 30 32 33 30 30 30
$10 01 02 03 04
$13 42 52 30 31 33 34 56 31 06 32 35 35 37 5A 37 53
$14 01 5A 74 02
$17 42 54 FF FF FF FF FF FF FF FF FF FF FF FF FF
$18 FF FF FF FF
$21 37 35 E1 72 6A 74 91 9A
$22 39 15
$23 31 41 FA FA FA FA FA
$24 31 41 FA FA FA FA FA
$25 32 41 FA FA FA FA FA

```

\$26 32 41 FA FA FA FA FA  
\$40 00 00  
\$41 3F 00 00 02 00 1A  
\$42 D0 C4  
\$43 00 00 8E 80  
\$44 C6 00 00 FC C0 C0  
\$45 07 01 07 01 05 01  
\$46 FF 1B 1B 64 28  
\$47 0A 64 06 04 04 05 0A 06 04 0A 00 00 FA 00 00 FF 04 64  
\$48 18 08 08  
\$B0 58  
\$B1 FD FE 00  
\$B2 FF FF FF FF FF  
\$B4 41 53 33 39 31 35 32 32 31 4B 42 35 20 20 20 20  
\$B7 50 AA 04 0F 07  
\$B8 43 48 70 02 09  
\$C1 30 46 30 37  
\$CA 30 46 30 37  
\$CB 01 89 6E 6B  
\$CC 01 89 6E 6B  
\$D1 00 00  
\$DB 00 00  
\$DC 00 00

**Comments**

Location- 12020 US Hwy 301, Riverview, Fl

Connection- DLC

Power- External battery

Miles- not registered

SIR- Instrument sir lamp flashed and went off during key on power

**Disclaimer of Liability**

The users of the CDR product and reviewers of the CDR reports and exported data shall ensure that data and information supplied is applicable to the vehicle, vehicle's system(s) and the vehicle ECU. Robert Bosch LLC and all its directors, officers, employees and members shall not be liable for damages arising out of or related to incorrect, incomplete or misinterpreted software and/or data. Robert Bosch LLC expressly excludes all liability for incidental, consequential, special or punitive damages arising from or related to the CDR data, CDR software or use thereof.

## CDR File Information

|                            |                                    |
|----------------------------|------------------------------------|
| User Entered VIN           | 1G1AK15F477 [REDACTED]             |
| User                       | C. Garcia                          |
| Case Number                | 669566                             |
| EDR Data Imaging Date      | Friday, May 22 2009                |
| Crash Date                 | Wednesday, April 1 2009            |
| Filename                   | 1G1AK15F477 [REDACTED].CDR         |
| Saved on                   | Friday, May 22 2009 at 11:31:47 AM |
| Collected with CDR version | Crash Data Retrieval Tool 3.1.1    |
| Reported with CDR version  | Crash Data Retrieval Tool 3.1.1    |
| EDR Device Type            | airbag control module              |
| Event(s) recovered         | Non-Deployment                     |

**IMPORTANT NOTICE:** Robert Bosch LLC recommends that the latest production release of Crash Data Retrieval software be utilized when viewing, printing or exporting any retrieved data from within the CDR program. This ensures that the retrieved data has been translated using the most recent information including but not limited to that which was provided by the manufacturers of the vehicles supported in this product.

## Data Limitations

### Recorded Crash Events:

There are two types of recorded crash events. The first is the Non-Deployment Event. A Non-Deployment Event records data but does not deploy the air bag(s). The minimum SDM Recorded Vehicle Velocity Change, that is needed to record a Non-Deployment Event, is five MPH. A Non-Deployment Event contains Pre-Crash and Crash data. The SDM can store up to one Non-Deployment Event. This event can be overwritten by an event that has a greater SDM recorded vehicle velocity change. This event will be cleared by the SDM, after approximately 250 ignition cycles. This event can be overwritten by a second Deployment Event, referred to as Deployment Event #2, if the Non-Deployment Event is not locked. The data in the Non-Deployment Event file will be locked, if the Non-Deployment Event occurred within five seconds of a Deployment Event. A locked Non Deployment Event cannot be overwritten or cleared by the SDM. The second type of SDM recorded crash event is the Deployment Event. It also contains Pre-Crash and Crash data. The SDM can store up to two different Deployment Events. If a second Deployment Event occurs any time after the Deployment Event, the Deployment Event #2 will overwrite any non-locked Non-Deployment Event. Deployment Events cannot be overwritten or cleared by the SDM. Once the SDM has deployed an air bag, the SDM must be replaced.

### Data:

- SDM Recorded Vehicle Velocity Change reflects the change in velocity that the sensing system experienced during the recorded portion of the event. SDM Recorded Vehicle Velocity Change is the change in velocity during the recording time and is not the speed the vehicle was traveling before the event, and is also not the Barrier Equivalent Velocity. For Deployment Events, the SDM will record 220 milliseconds of data after deployment criteria is met and up to 70 milliseconds before deployment criteria is met. For Non-Deployment Events, the SDM can record up to the first 300 milliseconds of data after algorithm enable. Velocity Change data is displayed in SAE sign convention.
- Maximum Recorded Vehicle Velocity Change is the maximum square root value of the sum of the squares for the vehicle's combined "X" and "Y" axis change in velocity.
- Event Recording Complete will indicate if data from the recorded event has been fully written to the SDM memory or if it has been interrupted and not fully written.
- SDM Recorded Vehicle Speed accuracy can be affected by various factors, including but not limited to the following:
  - significant changes in the tire's rolling radius
  - final drive axle ratio changes
  - wheel lockup and wheel slip
- Brake Switch Circuit Status indicates the open/closed state of the brake switch circuit.
- Pre-Crash data is recorded asynchronously.
- Pre-Crash Electronic Data Validity Check Status indicates "Data Invalid" if:
  - the SDM receives a message with an "invalid" flag from the module sending the pre-crash data
  - no data is received from the module sending the pre-crash data
  - no module is present to send the pre-crash data

- Driver's and Passenger's Belt Switch Circuit Status indicates the status of the seat belt switch circuit, except: The Passenger Belt Switch Circuit Status for 2005 vehicles is available only on the Cadillac STS. The Passenger Belt Switch Circuit Status for 2006 Chevrolet Cobalt Sport Coupe (AP) model vehicles, with the option package that includes Recaro brand seats (RPO ALV), always reports a default value of "Buckled," because there is no passenger belt switch with the Recaro seat option.
- The Time Between Non-Deployment to Deployment Events is displayed in seconds. If the time between the two events is greater than five seconds, "N/A" is displayed in place of the time. If the value is negative, then the Deployment Event occurred first. If the value is positive, then the Non-Deployment Event occurred first.
- If power to the SDM is lost during a crash event, all or part of the crash record may not be recorded.
- The ignition cycle counter relies upon the transitions through OFF->RUN->CRANK power-moding messages, on the GMLAN communication bus, to increment the counter. Applying and removing of battery power to the module will not increment the ignition counter.
- Steering Wheel Angle data is displayed as a positive value when the steering wheel is turned to the right and a negative value when the steering wheel is turned to the left, except for Cadillac STS model vehicles with StabiliTrak 3.0 systems (RPO JL7). For Cadillac STS model vehicles with StabiliTrak 3.0 systems (RPO JL7), when the steering wheel is turned to the right, a negative value will be displayed and when the steering wheel is turned to the left, a positive value will be displayed. The Steering Wheel Angle data is reported in 16 degree increments.

**Data Source:**

All SDM recorded data is measured, calculated, and stored internally, except for the following:

- Vehicle Status Data (Pre-Crash) is transmitted to the SDM, by various vehicle control modules, via the vehicle's communication network.
- The Belt Switch Circuit is wired directly to the SDM.

**Ignition Data**

| Data Location       | Data Value (Hex) | Parameter Descriptor             | Translated Value | Units  |
|---------------------|------------------|----------------------------------|------------------|--------|
| DPID \$2F Bytes 3-4 | \$0C15           | Ignition Cycles at Investigation | 3093             | cycles |

# Vehicle Status Data (Pre-Crash)

| Data Location          | Data Value (Hex) | Parameter Descriptor                                     | Translated Value | Units              |
|------------------------|------------------|----------------------------------------------------------|------------------|--------------------|
| DPID Pack \$31 Byte 1  | \$00             | Accelerator Pedal Position (-1 sec)                      | 0                | % full<br>throttle |
| DPID Pack \$31 Byte 2  | \$20             | Accelerator Pedal Position (-2 sec)                      | 13               | % full<br>throttle |
| DPID Pack \$31 Byte 3  | \$24             | Accelerator Pedal Position (-3 sec)                      | 14               | % full<br>throttle |
| DPID Pack \$31 Byte 4  | \$2F             | Accelerator Pedal Position (-4 sec)                      | 18               | % full<br>throttle |
| DPID Pack \$31 Byte 5  | \$2B             | Accelerator Pedal Position (-5 sec)                      | 17               | % full<br>throttle |
| DPID \$31 Byte 6 bit 7 | \$00             | Accelerator Pedal Position Validity Status               | Valid            |                    |
| DPID \$32 Byte 1 bit 7 | \$00             | Brake Switch State (-1 sec)                              | OFF              |                    |
| DPID \$32 Byte 1 bit 6 | \$00             | Brake Switch State (-2 sec)                              | OFF              |                    |
| DPID \$32 Byte 1 bit 5 | \$00             | Brake Switch State (-3 sec)                              | OFF              |                    |
| DPID \$32 Byte 1 bit 4 | \$00             | Brake Switch State (-4 sec)                              | OFF              |                    |
| DPID \$32 Byte 1 bit 3 | \$00             | Brake Switch State (-5 sec)                              | OFF              |                    |
| DPID \$32 Byte 2 bit 7 | \$00             | Brake Switch State Validity Status                       | Valid            |                    |
| DPID \$32 Byte 3 bit 7 | \$00             | Cruise Control Active (-1 sec) If Equipped               | No               |                    |
| DPID \$32 Byte 3 bit 6 | \$00             | Cruise Control Active (-2 sec) If Equipped               | No               |                    |
| DPID \$32 Byte 3 bit 5 | \$00             | Cruise Control Resume Switch Active (-1 sec) If Equipped | No               |                    |
| DPID \$32 Byte 3 bit 4 | \$00             | Cruise Control Resume Switch Active (-2 sec) If Equipped | No               |                    |
| DPID \$32 Byte 3 bit 3 | \$00             | Cruise Control Set Switch Active (-1 sec) If Equipped    | No               |                    |
| DPID \$32 Byte 3 bit 2 | \$00             | Cruise Control Set Switch Active (-2 sec) If Equipped    | No               |                    |
| DPID \$32 Byte 3 bit 1 | \$00             | Reduced Engine Power Mode (-1sec)                        | OFF              |                    |
| DPID \$32 Byte 3 bit 0 | \$00             | Reduced Engine Power Mode (-2sec)                        | OFF              |                    |
| DPID \$32 Byte 4 bit 7 | \$80             | Cruise Control Active Validity Status If Equipped        | Invalid          |                    |
| DPID \$33 Byte 1       | \$33             | Throttle Position (-1 sec)                               | 20               | % full<br>throttle |
| DPID \$33 Byte 2       | \$5B             | Throttle Position (-2 sec)                               | 36               | % full<br>throttle |
| DPID \$33 Byte 3       | \$5E             | Throttle Position (-3 sec)                               | 37               | % full<br>throttle |
| DPID \$33 Byte 4       | \$64             | Throttle Position (-4 sec)                               | 39               | % full<br>throttle |
| DPID \$33 Byte 5       | \$62             | Throttle Position (-5 sec)                               | 38               | % full<br>throttle |



| Data Location             | Data Value (Hex) | Parameter Descriptor                                       | Translated Value | Units   |
|---------------------------|------------------|------------------------------------------------------------|------------------|---------|
| DPID \$33 Byte 6 bit 7    | \$00             | Throttle Position Validity Status                          | Valid            |         |
| DPID \$34 Byte 1          | \$12             | Engine Speed (-1 sec)                                      | 1152             | RPM     |
| DPID \$34 Byte 2          | \$1A             | Engine Speed (-2 sec)                                      | 1664             | RPM     |
| DPID \$34 Byte 3          | \$19             | Engine Speed (-3 sec)                                      | 1600             | RPM     |
| DPID \$34 Byte 4          | \$18             | Engine Speed (-4 sec)                                      | 1536             | RPM     |
| DPID \$34 Byte 5          | \$18             | Engine Speed (-5 sec)                                      | 1536             | RPM     |
| DPID \$34 Byte 6 bit 7    | \$00             | Engine Speed Validity Status                               | Valid            |         |
| DPID \$35 Byte 1          | \$27             | Vehicle Speed (-1 sec)                                     | 24               | MPH     |
| DPID \$35 Byte 2          | \$4B             | Vehicle Speed (-2 sec)                                     | 47               | MPH     |
| DPID \$35 Byte 3          | \$49             | Vehicle Speed (-3 sec)                                     | 45               | MPH     |
| DPID \$35 Byte 4          | \$48             | Vehicle Speed (-4 sec)                                     | 45               | MPH     |
| DPID \$35 Byte 5          | \$46             | Vehicle Speed (-5 sec)                                     | 44               | MPH     |
| DPID \$35 Byte 6 bit 7    | \$00             | Vehicle Speed Validity Status                              | Valid            |         |
| DPID \$36 Byte 1          | \$00             | Steering Wheel Angle (-1 sec) If Equipped                  | 0                | degrees |
| DPID \$36 Byte 2          | \$00             | Steering Wheel Angle (-2 sec) If Equipped                  | 0                | degrees |
| DPID \$36 Byte 3          | \$00             | Steering Wheel Angle (-3 sec) If Equipped                  | 0                | degrees |
| DPID \$36 Byte 4          | \$00             | Steering Wheel Angle (-4 sec) If Equipped                  | 0                | degrees |
| DPID \$36 Byte 5          | \$00             | Steering Wheel Angle (-5 sec) If Equipped                  | 0                | degrees |
| DPID \$36 Byte 6 bit 7    | \$00             | Steering Wheel Angle Validity Status If Equipped           | Valid            |         |
| DPID \$37 Byte 1 bit 7    | \$00             | Antilock Brake System Active (-1 sec) If Equipped          | No               |         |
| DPID \$37 Byte 1 bit 6    | \$00             | Antilock Brake System Active (-2 sec) If Equipped          | No               |         |
| DPID \$37 Byte 1 bit 5    | \$00             | Antilock Brake System Active (-3 sec) If Equipped          | No               |         |
| DPID \$37 Byte 1 bit 4    | \$00             | Antilock Brake System Active (-4 sec) If Equipped          | No               |         |
| DPID \$37 Byte 1 bit 3    | \$00             | Antilock Brake System Active (-5 sec) If Equipped          | No               |         |
| DPID \$37 Byte 2 bit 7    | \$00             | Traction Control System Active (-1 sec) If Equipped        | No               |         |
| DPID \$37 Byte 3 bit 7    | \$00             | Vehicle Dynamics Control Active (-1 sec) If Equipped       | No               |         |
| DPID \$37 Byte 3 bit 6    | \$00             | Vehicle Dynamics Control Active (-2 sec) If Equipped       | No               |         |
| DPID \$37 Byte 3 bit 5    | \$00             | Vehicle Dynamics Control Active (-3 sec) If Equipped       | No               |         |
| DPID \$37 Byte 3 bit 4    | \$00             | Vehicle Dynamics Control Active (-4 sec) If Equipped       | No               |         |
| DPID \$37 Byte 3 bit 3    | \$00             | Vehicle Dynamics Control Active (-5 sec) If Equipped       | No               |         |
| DPID \$37 Byte 4 bits 3-0 | \$04             | Transmission Range (-1 sec) If Equipped                    | Fourth Gear      |         |
| DPID \$37 Byte 5 bits 3-0 | \$04             | Transmission Selector Position (-1 sec) If Equipped        | Fourth Gear      |         |
| DPID \$37 Byte 6 bit 7    | \$00             | Service Engine Soon (Non-Emission Related) Lamp (1 sec)    | OFF              |         |
| DPID \$37 Byte 6 bit 6    | \$00             | Service Vehicle Soon Lamp (1 sec)                          | OFF              |         |
| DPID \$37 Byte 6 bit 3    | \$00             | Brake System Warning Lamp If Equipped                      | OFF              |         |
| DPID \$37 Byte 6 bit 1    | \$00             | Low Tire Pressure Warning Lamp If Equipped                 | OFF              |         |
| DPID \$37 Byte 7 bit 7    | \$E2             | Antilock Brake System Active Validity Status If Equipped   | Invalid          |         |
| DPID \$37 Byte 7 bit 6    | \$E2             | Traction Control System Active Validity Status If Equipped | Invalid          |         |

| Data Location             | Data Value (Hex) | Parameter Descriptor                                                                   | Translated Value | Units                 |
|---------------------------|------------------|----------------------------------------------------------------------------------------|------------------|-----------------------|
| DPID \$37 Byte 7 bit 5    | \$E2             | Vehicle Dynamics Control Active Validity Status If Equipped                            | Invalid          |                       |
| DPID \$37 Byte 7 bit 4    | \$E2             | Transmission Range Validity Status If Equipped                                         | Valid            |                       |
| DPID \$37 Byte 7 bit 3    | \$E2             | Transmission Selector Position Validity Status If Equipped                             | Valid            |                       |
| DPID \$37 Byte 7 bit 2    | \$E2             | Service Engine Soon (Non-Emission Related) / Service Vehicle Soon Lamp Validity Status | Valid            |                       |
| DPID \$37 Byte 7 bit 1    | \$E2             | Low Tire Pressure Warning Lamp Validity Status If Equipped                             | Invalid          |                       |
| DPID \$38 Byte 1          | \$85             | Outside Air Temperature (-1 sec) If Equipped                                           | 80               |                       |
| DPID \$38 Byte 2 bit 7    | \$00             | Outside Air Temperature Validity Status (-1 sec) If Equipped                           | Valid            |                       |
| DPID \$38 Byte 5 bits 7-6 | \$03             | Left Front Door Status (-1 sec) If Equipped                                            | Closed           |                       |
| DPID \$38 Byte 5 bits 5-4 | \$03             | Right Front Door Status (-1 sec) If Equipped                                           | Closed           |                       |
| DPID \$38 Byte 5 bits 3-2 | \$03             | Rear Door(s) Status (-1 sec) If Equipped                                               | Closed           |                       |
| DPID \$38 Byte 5 bits 1-0 | \$03             | Left Rear Door Status (-1 sec) If Equipped                                             | Unused           |                       |
| DPID \$38 Byte 6 bits 7-6 | \$C0             | Right Rear Door Status (-1 sec) If Equipped                                            | Unused           |                       |
| DPID \$38 Byte 7 bit 7    | \$00             | Left Front Door Validity Status If Equipped                                            | Valid            |                       |
| DPID \$38 Byte 7 bit 6    | \$00             | Right Front Door Validity Status If Equipped                                           | Valid            |                       |
| DPID \$38 Byte 7 bit 5    | \$00             | Rear Door(s) Validity Status If Equipped                                               | Valid            |                       |
| DPID \$38 Byte 7 bit 4    | \$00             | Left Rear Door Validity Status If Equipped                                             | Valid            |                       |
| DPID \$38 Byte 7 bit 3    | \$00             | Right Rear Door Validity Status If Equipped                                            | Valid            |                       |
| DPID \$39 Byte 1          | \$00             | Lateral Acceleration (-1 sec) If Equipped                                              | 0                | feet/sec <sup>2</sup> |
| DPID \$39 Byte 2          | \$00             | Lateral Acceleration (-2 sec) If Equipped                                              | 0                | feet/sec <sup>2</sup> |
| DPID \$39 Byte 3          | \$00             | Lateral Acceleration (-3 sec) If Equipped                                              | 0                | feet/sec <sup>2</sup> |
| DPID \$39 Byte 4          | \$00             | Lateral Acceleration (-4 sec) If Equipped                                              | 0                | feet/sec <sup>2</sup> |
| DPID \$39 Byte 5          | \$00             | Lateral Acceleration (-5 sec) If Equipped                                              | 0                | feet/sec <sup>2</sup> |
| DPID \$39 Byte 6 bit 7    | \$80             | Lateral Acceleration Validity Status If Equipped                                       | Invalid          |                       |
| DPID \$3A Byte 1          | \$00             | Yaw Rate (-1 sec) If Equipped                                                          | 0                |                       |
| DPID \$3A Byte 2          | \$00             | Yaw Rate (-2 sec) If Equipped                                                          | 0                |                       |
| DPID \$3A Byte 3          | \$00             | Yaw Rate (-3 sec) If Equipped                                                          | 0                |                       |
| DPID \$3A Byte 4          | \$00             | Yaw Rate (-4 sec) If Equipped                                                          | 0                |                       |
| DPID \$3A Byte 5          | \$00             | Yaw Rate (-5 sec) If Equipped                                                          | 0                |                       |
| DPID \$3A Byte 6 bit 7    | \$80             | Yaw Rate Validity Status If Equipped                                                   | Invalid          |                       |

### VIN Data

| Data Location             | Data Value (Hex) | Parameter Descriptor                         | Translated Value | Units |
|---------------------------|------------------|----------------------------------------------|------------------|-------|
| DPID \$3D Byte 1          | \$31             | Vehicle Identification Number (VIN) Digit 3  | 1                |       |
| DPID \$3D Byte 2          | \$41             | Vehicle Identification Number (VIN) Digit 4  | A                |       |
| DPID \$3D Byte 3          | \$4B             | Vehicle Identification Number (VIN) Digit 5  | K                |       |
| DPID \$3D Byte 4          | \$31             | Vehicle Identification Number (VIN) Digit 6  | 1                |       |
| DPID \$3D Byte 5          | \$35             | Vehicle Identification Number (VIN) Digit 7  | 5                |       |
| DPID \$3D Byte 6          | \$46             | Vehicle Identification Number (VIN) Digit 8  | F                |       |
| DPID \$3E Byte 1          | \$37             | Vehicle Identification Number (VIN) Digit 10 | 7                |       |
| DPID \$3E Byte 2 bits 7-4 | \$18             | Vehicle Identification Number (VIN) Digit 12 | 1                |       |
| DPID \$3E Byte 2 bits 3-0 | \$18             | Vehicle Identification Number (VIN) Digit 13 | 8                |       |
| DPID \$3E Byte 3 bits 7-4 | \$36             | Vehicle Identification Number (VIN) Digit 14 | 3                |       |
| DPID \$3E Byte 3 bits 3-0 | \$36             | Vehicle Identification Number (VIN) Digit 15 | 6                |       |
| DPID \$3E Byte 4 bits 7-4 | \$42             | Vehicle Identification Number (VIN) Digit 16 | 4                |       |
| DPID \$3E Byte 4 bits 3-0 | \$42             | Vehicle Identification Number (VIN) Digit 17 | 2                |       |

### Multiple Event Data

| Data Location             | Data Value (Hex) | Parameter Descriptor                                    | Translated Value | Units |
|---------------------------|------------------|---------------------------------------------------------|------------------|-------|
| DPID \$3F Byte 1 bit 7    | \$00             | An Event(s) Preceded the Recorded Event(s)              | No               |       |
| DPID \$3F Byte 1 bit 6    | \$00             | An Event(s) was in Between the Recorded Event(s)        | No               |       |
| DPID \$3F Byte 1 bit 5    | \$00             | An Event(s) Followed the Recorded Event(s)              | No               |       |
| DPID \$3F Byte 1 bit 4    | \$00             | The Event(s) Not Recorded was a Deployment Event(s)     | No               |       |
| DPID \$3F Byte 1 bit 3    | \$00             | The Event(s) Not Recorded was a Non-Deployment Event(s) | No               |       |
| DPID \$3F Byte 1 bits 2-0 | \$00             | Associated Events Not Recorded                          | 0                |       |

### Power Mode Data

| Data Location             | Data Value (Hex) | Parameter Descriptor                  | Translated Value | Units |
|---------------------------|------------------|---------------------------------------|------------------|-------|
| DPID \$3F Byte 3 bits 7-6 | \$90             | Vehicle Power Mode Status             | Run              |       |
| DPID \$3F Byte 3 bit 5    | \$90             | Remote Start Status If Equipped       | Inactive         |       |
| DPID \$3F Byte 3 bit 4    | \$90             | Run/Crank Ignition Switch Logic Level | Active           |       |

## Non-Deployment Or Deployment #2 Event Data

| Data Location          | Data Value (Hex) | Parameter Descriptor                                               | Translated Value | Units   |
|------------------------|------------------|--------------------------------------------------------------------|------------------|---------|
| DPID \$40 Byte 1 bit 7 | \$20             | Crash Record Locked                                                | No               |         |
| DPID \$40 Byte 1 bit 6 | \$20             | Deployment Event Recorded in the Non-Deployment Record             | No               |         |
| DPID \$40 Byte 1 bit 5 | \$20             | Vehicle Event Data (Pre-Crash) Associated With This Event          | Yes              |         |
| DPID \$40 Byte 2       | \$A5             | Event Recording Complete                                           | Yes              |         |
| DPID \$41 Byte 1 bit 7 | \$00             | Driver 1st Stage Deployment Loop Commanded                         | No               |         |
| DPID \$41 Byte 1 bit 6 | \$00             | Driver 2nd Stage Deployment Loop Commanded                         | No               |         |
| DPID \$41 Byte 1 bit 5 | \$00             | Driver Side Deployment Loop Commanded                              | No               |         |
| DPID \$41 Byte 1 bit 4 | \$00             | Driver Pretensioner Deployment Loop Commanded                      | No               |         |
| DPID \$41 Byte 1 bit 3 | \$00             | Driver (Initiator 1) Roof Rail/Head Curtain Loop Commanded         | No               |         |
| DPID \$41 Byte 1 bit 2 | \$00             | Driver (Initiator 2) Roof Rail/Head Curtain Loop Commanded         | No               |         |
| DPID \$41 Byte 1 bit 1 | \$00             | Driver Knee Deployment Loop Commanded                              | No               |         |
| DPID \$41 Byte 2 bit 7 | \$00             | Passenger 1st Stage Deployment Loop Commanded                      | No               |         |
| DPID \$41 Byte 2 bit 6 | \$00             | Passenger 2nd Stage Deployment Loop Commanded                      | No               |         |
| DPID \$41 Byte 2 bit 5 | \$00             | Passenger Side Deployment Loop Commanded                           | No               |         |
| DPID \$41 Byte 2 bit 4 | \$00             | Passenger Pretensioner Deployment Loop Commanded                   | No               |         |
| DPID \$41 Byte 2 bit 3 | \$00             | Passenger (Initiator 1) Roof Rail/Head Curtain Loop Commanded      | No               |         |
| DPID \$41 Byte 2 bit 2 | \$00             | Passenger (Initiator 2) Roof Rail/Head Curtain Loop Commanded      | No               |         |
| DPID \$41 Byte 2 bit 1 | \$00             | Passenger Knee Deployment Loop Commanded                           | No               |         |
| DPID \$41 Byte 3 bit 7 | \$00             | Second Row Left Side Deployment Loop Commanded                     | No               |         |
| DPID \$41 Byte 3 bit 6 | \$00             | Second Row Left Pretensioner Deployment Loop Commanded             | No               |         |
| DPID \$41 Byte 3 bit 5 | \$00             | Third Row Left Roof Rail/Head Curtain Loop Commanded               | No               |         |
| DPID \$41 Byte 3 bit 4 | \$00             | Second Row Right Side Deployment Loop Commanded                    | No               |         |
| DPID \$41 Byte 3 bit 3 | \$00             | Second Row Right Pretensioner Deployment Loop Commanded            | No               |         |
| DPID \$41 Byte 3 bit 2 | \$00             | Third Row Right Roof Rail/Head Curtain Loop Commanded              | No               |         |
| DPID \$41 Byte 3 bit 1 | \$00             | Center Rear Pretensioner Deployment Loop Commanded                 | No               |         |
| DPID \$42 Byte 1 bit 7 | \$00             | SIR Warning Lamp Status                                            | OFF              |         |
| DPID \$42 Bytes 2-3    | FFFF0            | SIR Warning Lamp ON/OFF Time Continuously                          | 655200           | seconds |
| DPID \$42 Bytes 4-5    | \$0C06           | Number of Ignition Cycles SIR Warning Lamp was ON/OFF Continuously | 3078             | cycles  |
| DPID \$43 Byte 1       | \$FE             | Ignition Cycles Since DTCs Were Last Cleared                       | 254              | cycles  |
| DPID \$43 Bytes 2-3    | \$0C07           | Ignition Cycles at Event                                           | 3079             | cycles  |
| DPID \$44 Bytes 1-2    | \$0000           | DTC number for fault #1                                            | N/A              |         |
| DPID \$44 Byte 3       | \$00             | DTC fault type for fault #1                                        | \$00             |         |
| DPID \$44 Bytes 4-5    | \$0000           | DTC number for fault #2                                            | N/A              |         |
| DPID \$44 Byte 6       | \$00             | DTC fault type for fault #2                                        | \$00             |         |
| DPID \$45 Bytes 1-2    | \$0000           | DTC number for fault #3                                            | N/A              |         |

| Data Location       | Data Value (Hex) | Parameter Descriptor                                                                                   | Translated Value | Units |
|---------------------|------------------|--------------------------------------------------------------------------------------------------------|------------------|-------|
| DPID \$45 Byte 3    | \$00             | DTC fault type for fault #3                                                                            | \$00             |       |
| DPID \$45 Bytes 4-5 | \$0000           | DTC number for fault #4                                                                                | N/A              |       |
| DPID \$45 Byte 6    | \$00             | DTC fault type for fault #4                                                                            | \$00             |       |
| DPID \$46 Bytes 1-2 | \$0000           | DTC number for fault #5                                                                                | N/A              |       |
| DPID \$46 Byte 3    | \$00             | DTC fault type for fault #5                                                                            | \$00             |       |
| DPID \$46 Bytes 4-5 | \$0000           | DTC number for fault #6                                                                                | N/A              |       |
| DPID \$46 Byte 6    | \$00             | DTC fault type for fault #6                                                                            | \$00             |       |
| DPID \$47 Byte 1    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (10 ms after event enable or 70 ms before deployment) | 0.00             | MPH   |
| DPID \$47 Byte 2    | \$FF             | SDM Recorded Vehicle Velocity Change for Axis #2 (10 ms after event enable or 70 ms before deployment) | -0.68            | MPH   |
| DPID \$47 Byte 3    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (20 ms after event enable or 60 ms before deployment) | 0.00             | MPH   |
| DPID \$47 Byte 4    | \$FC             | SDM Recorded Vehicle Velocity Change for Axis #2 (20 ms after event enable or 60 ms before deployment) | -2.71            | MPH   |
| DPID \$47 Byte 5    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (30 ms after event enable or 50 ms before deployment) | 0.00             | MPH   |
| DPID \$47 Byte 6    | \$FA             | SDM Recorded Vehicle Velocity Change for Axis #2 (30 ms after event enable or 50 ms before deployment) | -4.07            | MPH   |
| DPID \$48 Byte 1    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (40 ms after event enable or 40 ms before deployment) | 0.00             | MPH   |
| DPID \$48 Byte 2    | \$F8             | SDM Recorded Vehicle Velocity Change for Axis #2 (40 ms after event enable or 40 ms before deployment) | -5.42            | MPH   |
| DPID \$48 Byte 3    | \$FF             | SDM Recorded Vehicle Velocity Change for Axis #1 (50 ms after event enable or 30 ms before deployment) | -0.68            | MPH   |
| DPID \$48 Byte 4    | \$F5             | SDM Recorded Vehicle Velocity Change for Axis #2 (50 ms after event enable or 30 ms before deployment) | -7.46            | MPH   |
| DPID \$48 Byte 5    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (60 ms after event enable or 20 ms before deployment) | 0.00             | MPH   |
| DPID \$48 Byte 6    | \$F3             | SDM Recorded Vehicle Velocity Change for Axis #2 (60 ms after event enable or 20 ms before deployment) | -8.81            | MPH   |
| DPID \$49 Byte 1    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (70 ms after event enable or 10 ms before deployment) | 0.00             | MPH   |
| DPID \$49 Byte 2    | \$F1             | SDM Recorded Vehicle Velocity Change for Axis #2 (70 ms after event enable or 10 ms before deployment) | -10.17           | MPH   |
| DPID \$49 Byte 3    | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (80 ms after event enable or at deployment)           | 0.00             | MPH   |

| Data Location    | Data Value (Hex) | Parameter Descriptor                                                                                   | Translated Value | Units |
|------------------|------------------|--------------------------------------------------------------------------------------------------------|------------------|-------|
| DPID \$49 Byte 4 | \$EE             | SDM Recorded Vehicle Velocity Change for Axis #2 (80 ms after event enable or at deployment)           | -12.20           | MPH   |
| DPID \$49 Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (90 ms after event enable or 10 ms after deployment)  | 0.00             | MPH   |
| DPID \$49 Byte 6 | \$EC             | SDM Recorded Vehicle Velocity Change for Axis #2 (90 ms after event enable or 10 ms after deployment)  | -13.56           | MPH   |
| DPID \$4A Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (100 ms after event enable or 20 ms after deployment) | 0.00             | MPH   |
| DPID \$4A Byte 2 | \$EB             | SDM Recorded Vehicle Velocity Change for Axis #2 (100 ms after event enable or 20 ms after deployment) | -14.23           | MPH   |
| DPID \$4A Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (110 ms after event enable or 30 ms after deployment) | 0.00             | MPH   |
| DPID \$4A Byte 4 | \$EA             | SDM Recorded Vehicle Velocity Change for Axis #2 (110 ms after event enable or 30 ms after deployment) | -14.91           | MPH   |
| DPID \$4A Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (120 ms after event enable or 40 ms after deployment) | 0.00             | MPH   |
| DPID \$4A Byte 6 | \$EA             | SDM Recorded Vehicle Velocity Change for Axis #2 (120 ms after event enable or 40 ms after deployment) | -14.91           | MPH   |
| DPID \$4B Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (130 ms after event enable or 50 ms after deployment) | 0.00             | MPH   |
| DPID \$4B Byte 2 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (130 ms after event enable or 50 ms after deployment) | 0.00             | MPH   |
| DPID \$4B Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (140 ms after event enable or 60 ms after deployment) | 0.00             | MPH   |
| DPID \$4B Byte 4 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (140 ms after event enable or 60 ms after deployment) | 0.00             | MPH   |
| DPID \$4B Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (150 ms after event enable or 70 ms after deployment) | 0.00             | MPH   |
| DPID \$4B Byte 6 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (150 ms after event enable or 70 ms after deployment) | 0.00             | MPH   |
| DPID \$4C Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (160 ms after event enable or 80 ms after deployment) | 0.00             | MPH   |
| DPID \$4C Byte 2 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (160 ms after event enable or 80 ms after deployment) | 0.00             | MPH   |
| DPID \$4C Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (170 ms after event enable or 90 ms after deployment) | 0.00             | MPH   |
| DPID \$4C Byte 4 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (170 ms after event enable or 90 ms after deployment) | 0.00             | MPH   |

| Data Location    | Data Value (Hex) | Parameter Descriptor                                                                                    | Translated Value | Units |
|------------------|------------------|---------------------------------------------------------------------------------------------------------|------------------|-------|
| DPID \$4C Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (180 ms after event enable or 100 ms after deployment) | 0.00             | MPH   |
| DPID \$4C Byte 6 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (180 ms after event enable or 100 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (190 ms after event enable or 110 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 2 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (190 ms after event enable or 110 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (200 ms after event enable or 120 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 4 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (200 ms after event enable or 120 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (210 ms after event enable or 130 ms after deployment) | 0.00             | MPH   |
| DPID \$4D Byte 6 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (210 ms after event enable or 130 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (220 ms after event enable or 140 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 2 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (220 ms after event enable or 140 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (230 ms after event enable or 150 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 4 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (230 ms after event enable or 150 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (240 ms after event enable or 160 ms after deployment) | 0.00             | MPH   |
| DPID \$4E Byte 6 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (240 ms after event enable or 160 ms after deployment) | 0.00             | MPH   |
| DPID \$4F Byte 1 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (250 ms after event enable or 170 ms after deployment) | 0.00             | MPH   |
| DPID \$4F Byte 2 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (250 ms after event enable or 170 ms after deployment) | 0.00             | MPH   |
| DPID \$4F Byte 3 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (260 ms after event enable or 180 ms after deployment) | 0.00             | MPH   |
| DPID \$4F Byte 4 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (260 ms after event enable or 180 ms after deployment) | 0.00             | MPH   |
| DPID \$4F Byte 5 | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (270 ms after event enable or 190 ms after deployment) | 0.00             | MPH   |

| Data Location          | Data Value (Hex) | Parameter Descriptor                                                                                                         | Translated Value | Units |
|------------------------|------------------|------------------------------------------------------------------------------------------------------------------------------|------------------|-------|
| DPID \$4F Byte 6       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (270 ms after event enable or 190 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 1       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (280 ms after event enable or 200 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 2       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (280 ms after event enable or 200 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 3       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (290 ms after event enable or 210 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 4       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (290 ms after event enable or 210 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 5       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #1 (300 ms after event enable or 220 ms after deployment)                      | 0.00             | MPH   |
| DPID \$50 Byte 6       | \$00             | SDM Recorded Vehicle Velocity Change for Axis #2 (300 ms after event enable or 220 ms after deployment)                      | 0.00             | MPH   |
| DPID \$51 Byte 1 bit 7 | \$D0             | Driver Belt Switch Circuit Status                                                                                            | BUCKLED          |       |
| DPID \$51 Byte 1 bit 6 | \$D0             | Driver Belt Switch Circuit Status Monitored                                                                                  | Yes              |       |
| DPID \$51 Byte 1 bit 5 | \$D0             | Passenger Belt Switch Circuit Status                                                                                         | UNBUCKLED        |       |
| DPID \$51 Byte 1 bit 4 | \$D0             | Passenger Belt Switch Circuit Status Monitored                                                                               | Yes              |       |
| DPID \$51 Byte 1 bit 3 | \$D0             | Front Center Belt Switch Circuit Status                                                                                      | UNBUCKLED        |       |
| DPID \$51 Byte 1 bit 2 | \$D0             | Front Center Belt Switch Circuit Status Monitored                                                                            | No               |       |
| DPID \$51 Byte 2 bit 7 | \$00             | Second Row Left Belt Switch Circuit Status                                                                                   | UNBUCKLED        |       |
| DPID \$51 Byte 2 bit 6 | \$00             | Second Row Left Belt Switch Circuit Status Monitored                                                                         | No               |       |
| DPID \$51 Byte 2 bit 5 | \$00             | Second Row Center Belt Switch Circuit Status                                                                                 | UNBUCKLED        |       |
| DPID \$51 Byte 2 bit 4 | \$00             | Second Row Center Belt Switch Circuit Status Monitored                                                                       | No               |       |
| DPID \$51 Byte 2 bit 3 | \$00             | Second Row Right Belt Switch Circuit Status                                                                                  | UNBUCKLED        |       |
| DPID \$51 Byte 2 bit 2 | \$00             | Second Row Right Belt Switch Circuit Status Monitored                                                                        | No               |       |
| DPID \$51 Byte 3 bit 7 | \$00             | Third Row Left Belt Switch Circuit Status                                                                                    | UNBUCKLED        |       |
| DPID \$51 Byte 3 bit 6 | \$00             | Third Row Left Belt Switch Circuit Status Monitored                                                                          | No               |       |
| DPID \$51 Byte 3 bit 5 | \$00             | Third Row Center Belt Switch Circuit Status                                                                                  | UNBUCKLED        |       |
| DPID \$51 Byte 3 bit 4 | \$00             | Third Row Center Belt Switch Circuit Status Monitored                                                                        | No               |       |
| DPID \$51 Byte 3 bit 3 | \$00             | Third Row Right Belt Switch Circuit Status                                                                                   | UNBUCKLED        |       |
| DPID \$51 Byte 3 bit 2 | \$00             | Third Row Right Belt Switch Circuit Status Monitored                                                                         | No               |       |
| DPID \$51 Byte 4 bit 7 | \$00             | Driver Seat Position Status                                                                                                  | Rearward         |       |
| DPID \$51 Byte 4 bit 6 | \$00             | Driver Seat Position Status Monitored                                                                                        | No               |       |
| DPID \$51 Byte 4 bit 5 | \$00             | Passenger Seat Position Status                                                                                               | Rearward         |       |
| DPID \$51 Byte 4 bit 4 | \$00             | Passenger Seat Position Status Monitored                                                                                     | No               |       |
| DPID \$52 Byte 1 bit 7 | \$00             | Automatic Passenger SIR Suppression System Validity Status / Passenger SIR Suppression Switch Circuit Status Validity Status | Valid            |       |



| Data Location             | Data Value (Hex) | Parameter Descriptor                                                                                                  | Translated Value                       | Units |
|---------------------------|------------------|-----------------------------------------------------------------------------------------------------------------------|----------------------------------------|-------|
| DPID \$52 Byte 1 bit 0    | \$00             | Automatic Passenger SIR Suppression System Status / Passenger SIR Suppression Switch Circuit Status                   | Air Bag Suppressed                     |       |
| DPID \$52 Bytes 2-3       | \$0000           | SDM Synchronization Counter                                                                                           | 0                                      |       |
| DPID \$52 Byte 4 bit 7-6  | \$00             | Rollover Sensor Message Status                                                                                        | No Rollover                            |       |
| DPID \$52 Byte 4 bit 5    | \$00             | Side Air Bag(s) Were First Commanded to Deploy Due to Side Impact Event                                               | No                                     |       |
| DPID \$52 Byte 4 bit 4    | \$00             | Side Air Bag(s) Were First Commanded to Deploy Due to Rollover Event                                                  | No                                     |       |
| DPID \$52 Byte 4 bits 3-0 | \$00             | Rollover Sensor Status                                                                                                | Last message received contained errors |       |
| DPID \$53 Byte 1          | \$0B             | Time From Algorithm Enable to Maximum SDM Recorded Vehicle Velocity Change                                            | 110                                    | msec  |
| DPID \$53 Bytes 2-3       | \$01E4           | Maximum SDM Recorded Vehicle Velocity Change                                                                          | 14.91                                  | MPH   |
| DPID \$54 Byte 1 bit 7    | \$00             | Automatic Passenger SIR Suppression System Validity Status / Passenger SIR Suppression Switch Circuit Validity Status | Valid                                  |       |
| DPID \$54 Byte 1 bit 1    | \$00             | Automatic Passenger SIR Suppression System Status / Passenger SIR Suppression Switch Circuit Status                   | Air Bag Suppressed                     |       |
| DPID \$54 Byte 2          | \$00             | Rollover Sensor - Time Between Successive Side Deploys                                                                | 0                                      | msec  |
| DPID \$54 Byte 3          | \$00             | Rollover Sensor - Time From Rollover Enable to Deploy                                                                 | 0                                      | msec  |
| DPID \$55 Byte 1          | \$00             | Driver 1st Stage Time From Algorithm Enable to Deployment Command Criteria Met                                        | 0                                      | msec  |
| DPID \$55 Byte 2          | \$00             | Driver 2nd Stage Time From Algorithm Enable to Deployment Command Criteria Met                                        | 0                                      | msec  |
| DPID \$55 Byte 3          | \$00             | Passenger 1st Stage Time From Algorithm Enable to Deployment Command Criteria Met                                     | 0                                      | msec  |
| DPID \$55 Byte 4          | \$00             | Passenger 2nd Stage Time From Algorithm Enable to Deployment Command Criteria Met                                     | 0                                      | msec  |
| DPID \$55 Byte 5          | \$00             | Driver Side or Roof Rail/Head Curtain Time From Algorithm Enable to Deployment Command Criteria Met                   | 0                                      | msec  |
| DPID \$55 Byte 6          | \$00             | Passenger Side or Roof Rail/Head Curtain Time From Algorithm Enable to Deployment Command Criteria Met                | 0                                      | msec  |