
# MITSUBISHI ECLIPSE SPORTBACK

4 doors / 5 seats / Hatch Back

(2026 - )





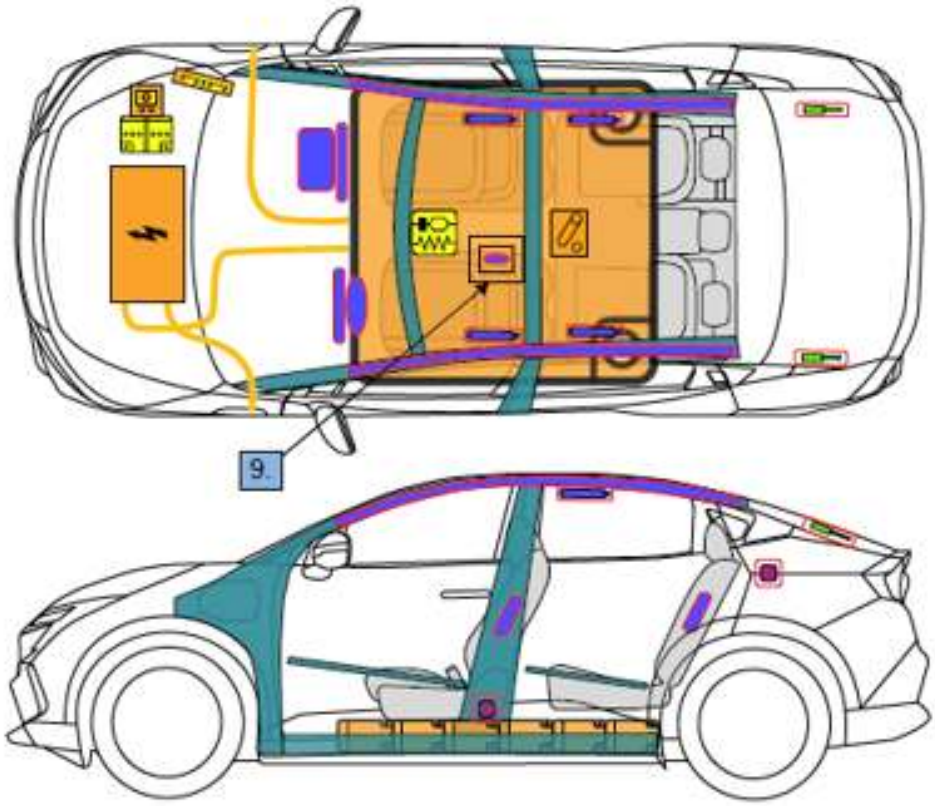


| | | | | | | | | | |
|---|---|---|---|---|---|---|---|---|---|
| | Air bag | | Stored gas inflator | | Seat belt pretensioner | | SRS control unit | | Gas strut / Preloaded Spring |
| | High strength zone | | Battery low voltage | | Fuse box disabling high voltage | | High voltage power cable | | Cable cut |
| | High voltage battery pack | | High voltage device that disconnects high voltage | | Zone requiring special attention | | Ultra-capacitor, low-voltage | | High voltage ultra-capacitor, |
| | | | | | | | | | |


| | ID No. | Version No. | Version Date. | Page |
|---|---|---|---|---|
| | DEA-NNRS-EN01 | 01 | 06/2026 | 1/4 |

Ⓒ MITSUBISHI MOTORS CORPORATION. All rights reserved.

# MITSUBISHI ECLIPSE SPORTBACK 4 doors / 5 seats / Hatch Back (2026 - ) – Additional Pages


## 1. Identification / recognition


LACK OF ENGINE NOISE DOES NOT MEAN VEHICLE IS OFF: SILENT MOVEMENT OR INSTANT RESTART CAPABILITY EXISTS UNTIL VEHICLE IS FULLY SHUT DOWN. WEAR APPROPRIATE PPE.

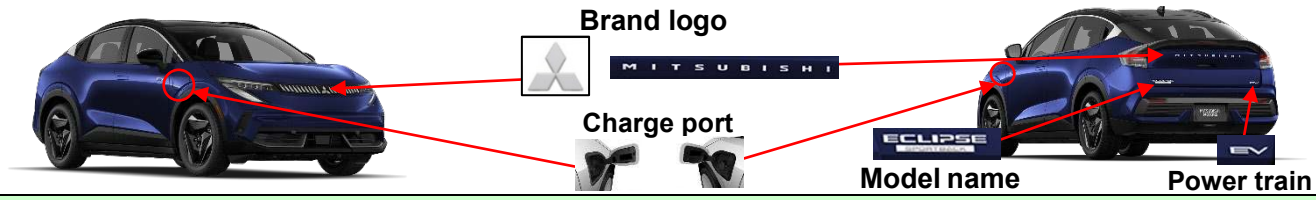


## 2. Immobilisation / stabilization / lifting


### Immobilise the vehicle:

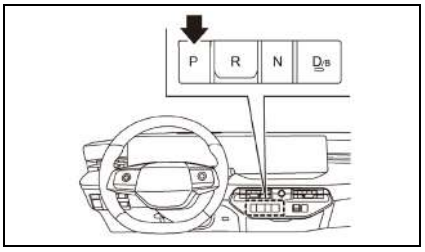

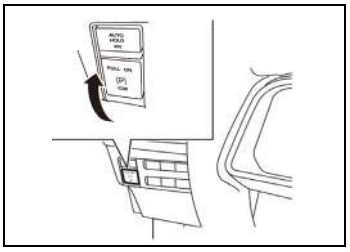1. Block the wheels.
2. Push the shift button “P” to shift to the P (Park) position.
3. Apply the parking brake.


### Lifting points:

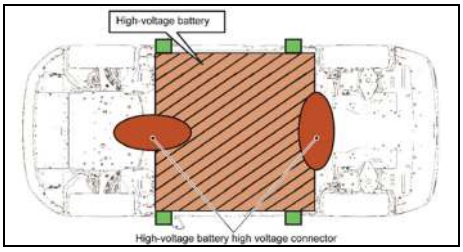



Appropriate stabilisation-lifting points

## 3. Disable direct hazards / safety regulations


### Main disabling method:

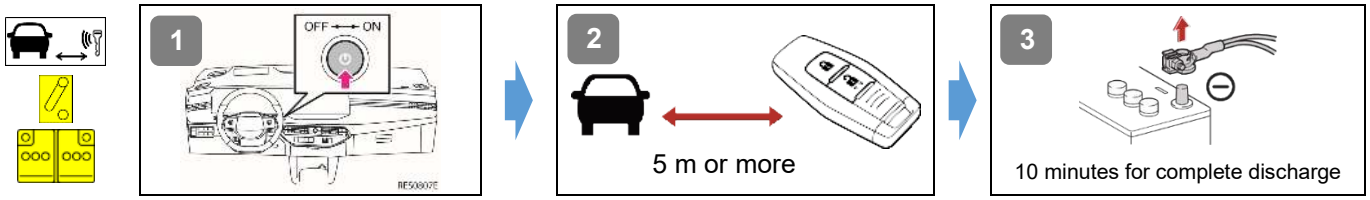



### Alternate Procedure 1 (Cable cut):

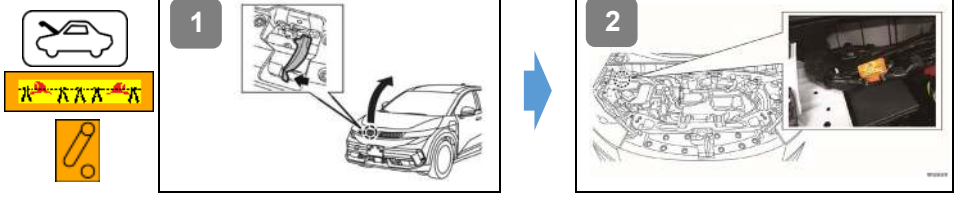


### Alternate Procedure 2 (Remove Service Plug):

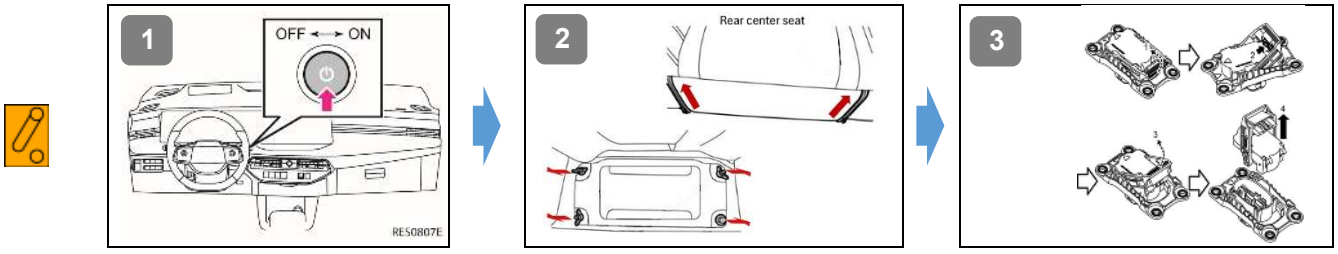


### Access:

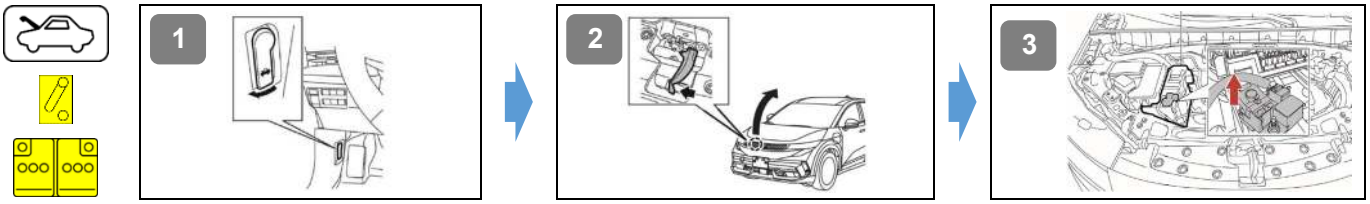




Ⓒ MITSUBISHI MOTORS CORPORATION. All rights reserved.


## 4. Access to the occupants

### Glass types:

A: Laminated glass

B: Laminated glass/Tempered glass


C: Tempered glass

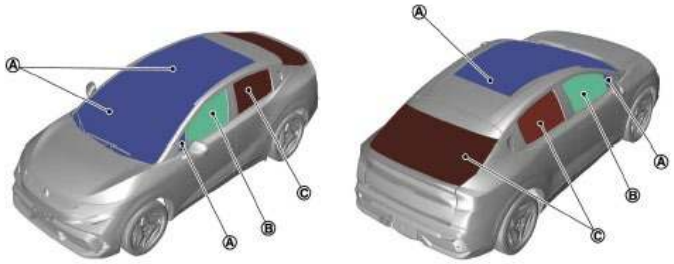


### Seat adjustment:

Manual Seat



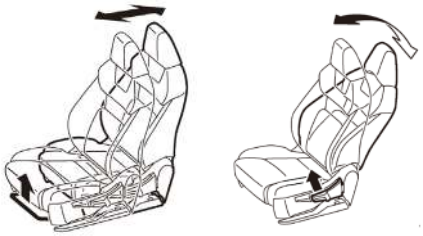


Power Seat





Recline the seatback

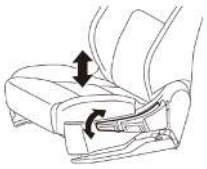


Recline the seatback



### Steering column adjustment:



Tilt and telescopic mechanism

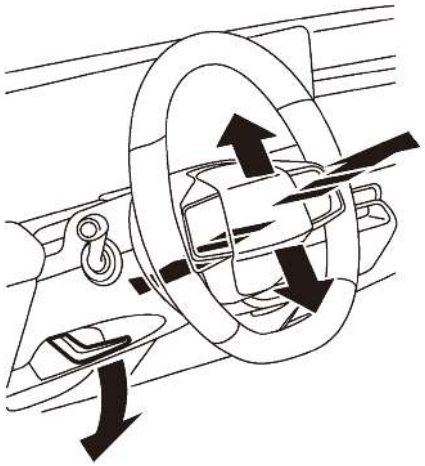


### High strength steel in body:







## 5. Stored energy / liquids / gases / solids

| | | |
|---|---|---|
|   |  | Lithium-ion 372V |
|  |  | 12-volt |
|  |  | R-1234yf 550 ± 25 g |



Ⓒ MITSUBISHI MOTORS CORPORATION. All rights reserved.

## 6. In case of fire

Use large amount of water

RE-IGNITION POSSIBLE !

## 7. In case of submersion

Do not touch any of the high-voltage components or cables, including the service plug, while the vehicle is submerged. Doing so may result in electric shock. Work on the vehicle only after the vehicle has been pulled out of the water.

## 8. Towing / transportation / storage


Store at safe distance from other vehicles!



## 9. Important additional information

Gas-filled dampers are installed on the tailgate.

Location of gas-filled dampers is shown in the mark 9 on page 1.

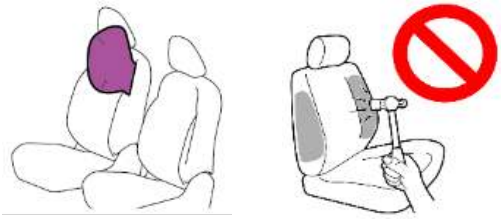

Driver's seat has a centre airbag in addition to the side airbag.

Location of centre airbag is shown in the mark 9 on page 1.

Do not apply excesive force to nor strongly hit the airbag installation area.

## 10. Explanation of pictograms used

| | | | | | |
|---|---|---|---|---|---|
| | Remove smart key | | Hazardous to the human health | | Seat height adjustment Right hand drive |
| | Warning, electricity | | Acute toxicity | | Steering wheel, tilt control |
| | General warning sign | | Corrosives | | Device to shut down power in vehicle |
| | Warning, low temperature | | Use ABC powder to extinguish the fire | | Explosive |
| | Air-conditioning component | | Use water to extinguish the fire | | Bonnet |
| | Electric Vehicle | | Use thermal infrared camera | | Left hand drive |
| | Flammable | | Seat adjustment, longitudinal | | |



Ⓒ MITSUBISHI MOTORS CORPORATION. All rights reserved.