


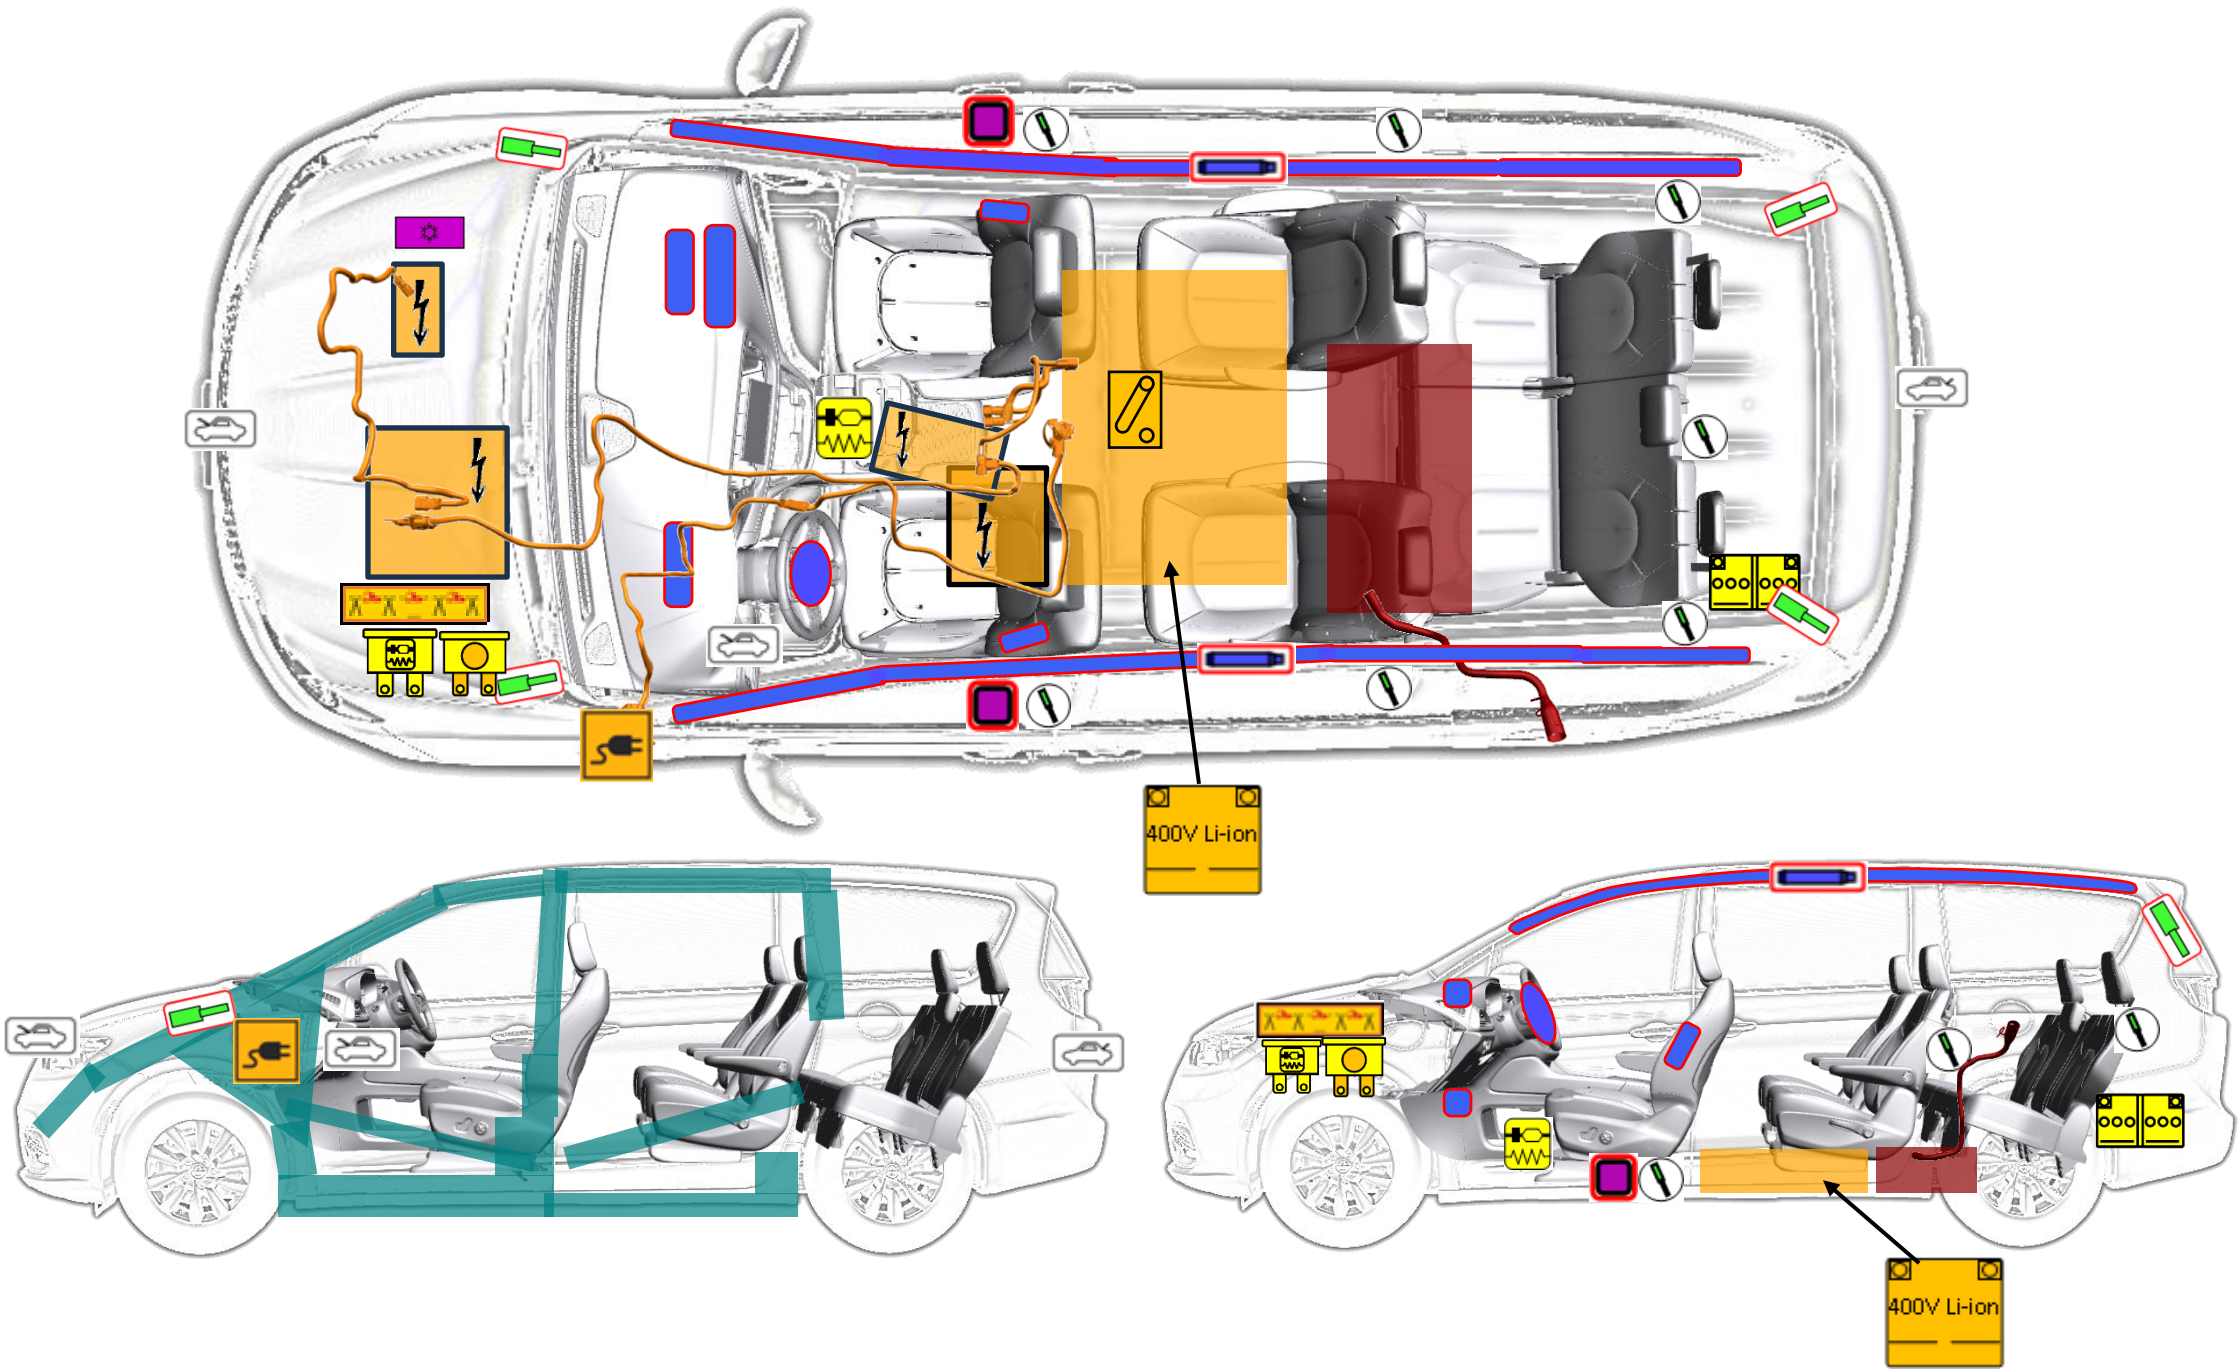


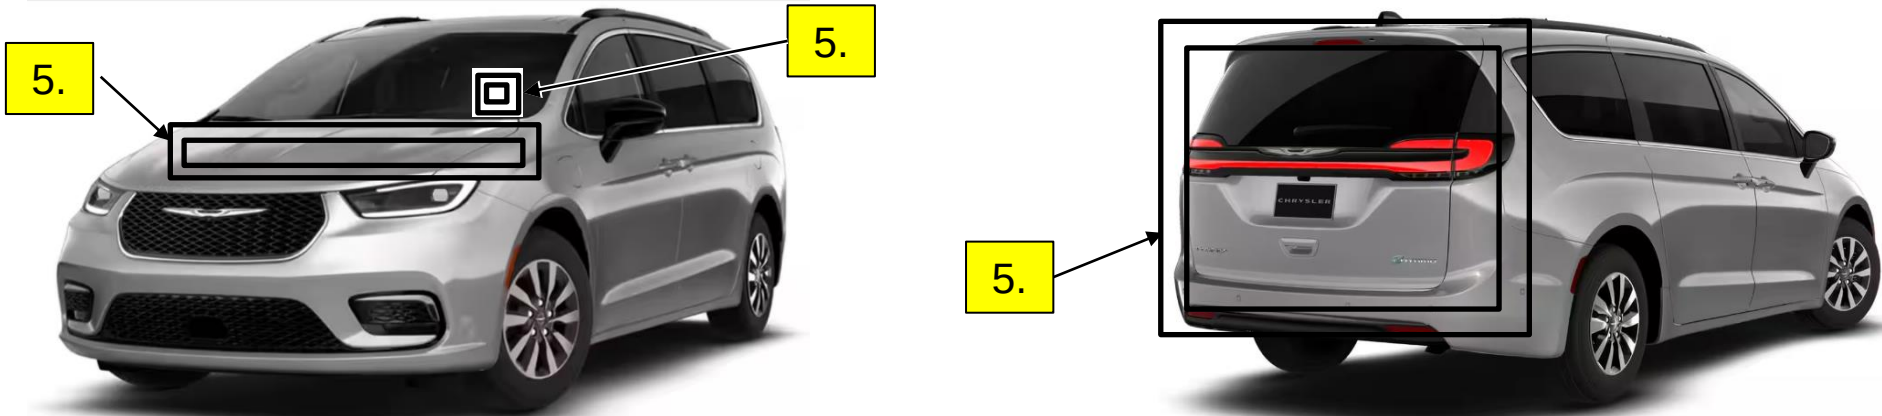

	AIR BAGS & BOLSTERS		SIDE CURTAIN AIR BAGS		AIR BAG INFLATION CARTRIDGE		SEATBELT PRETENSIONER		
	GAS STRUT		PRE-LOADED SPRING PRELOADED BELT RETRACTOR SPRING		SUPPLEMENTAL RESTRAINT (AIR BAG) CONTROLLER		HIGH STRENGTH STEEL		AREA OF SPECIAL CONCERN
	LOW VOLTAGE BATTERY		HIGH VOLTAGE LITHIUM-ION BATTERY				HIGH VOLTAGE CABLE		HIGH VOLTAGE DISCONNECT
	HIGH VOLTAGE DEVICE		LOW VOLTAGE FUSE BOX CONTROLLING HIGH VOLTAGE				RESPONDER CUT POINT FOR HV & SRS		
					AIR CONDITIONING REFRIDGERANT		HOOD RELEASE		TRUNK RELEASE
							HYBRID-ELECTRIC WITH GASOLINE OR ETHANOL		
	GASOLINE FUEL TANK				VEHICLE CHARGE PORT		LOW VOLTAGE FUSE BOX DISABLING SRS		
	LEFT HAND DRIVE								



WARNING: Lack of engine noise does not mean vehicle is off: vehicle movement capability exists until vehicle is fully shut down.



Always wear appropriate high voltage and turn-out PPE when addressing a damaged Chrysler Pacifica Hybrid PHEV.



WARNING: High voltage components may remain energized even after following the steps in this sheet.

1. Identification / recognition

Charging port door with “e” leaf logo on left side:



Charge status indicator on top of dash:
Only illuminated when plugged in and charging.



Left dash gauge is a power meter:



Badge rear lift gate right corner:




Unique engine cover:



2. Immobilisation / stabilisation / lifting

Immobility

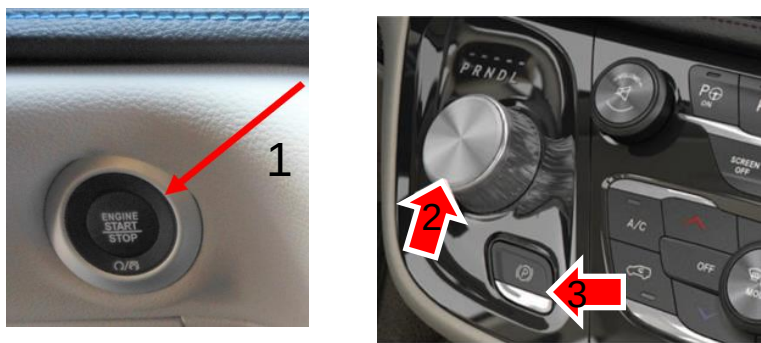


- 1. Set ignition to “RUN” or “ACC”.
- 2. Place Shifter in Park (rotate counterclockwise).
- 3. Set Parking Brake by pressing switch.


Stabilisation/lifting points

▲ Recommended Lift Points as viewed from below

Danger: High Voltage Battery Do not lift or apply force here

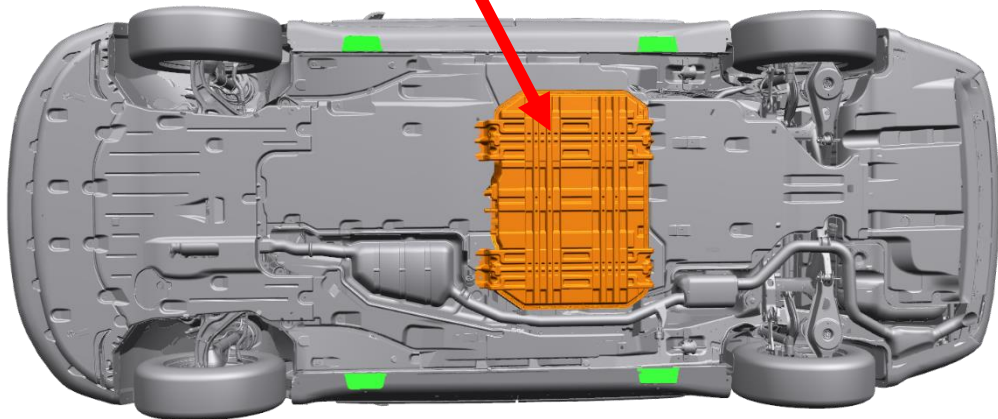

Chock wheels front and rear.

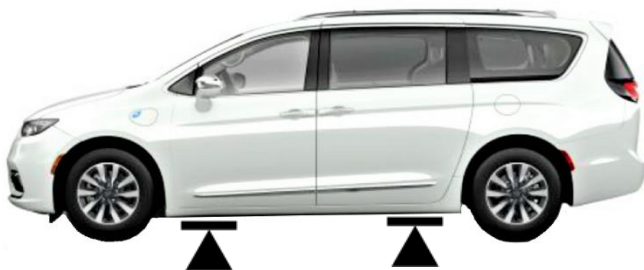

Note: 12V power must be activated to shift in and out of PARK or to change the PARKING BRAKE state.








WARNING: In rare instances, rotation of the drive wheels may result in the generation of high voltage electrical energy external to the high voltage battery isolation device and may trigger a propulsion system response. Place on PARK to prevent rotation if possible. DO NOT PUSH.

3. Disable direct hazards / safety regulations

PREFERRED METHOD

- 1. Unplug from any charging equipment.
- 2. Set Ignition to OFF.
- 3. Move key fob at least 7 meters (20 feet) away.
- 4. Open hood.
- 5. Remove a segment of cable by cutting on each side of the responder cut label.

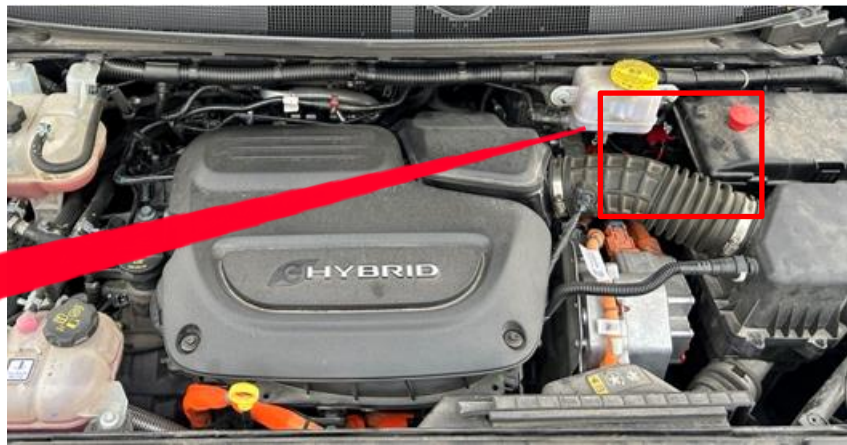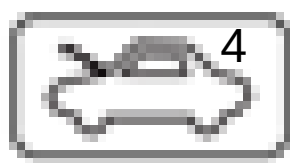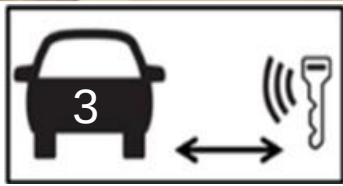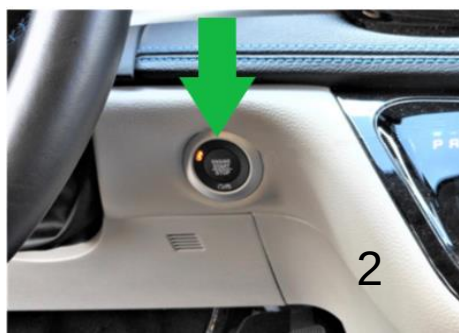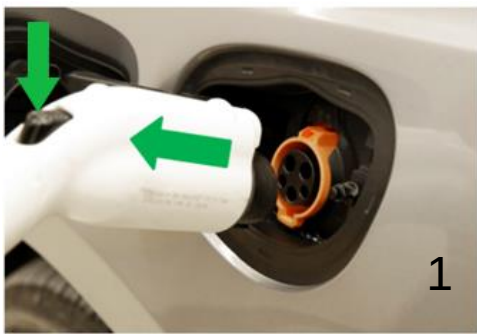

Responders cut label as seen in the vehicle.


This disables high voltage and some low voltage including restraints.



Wait 5 minutes after depowering for high voltage capacitors to drain. Always treat all high voltage components as if live, as the methods above can fail in cases of battery damage. Never cut any high voltage cables or components.


4. Access to the occupants

Do not cut into any hazards depicted on page 1. Also avoid cutting fuel, brake & coolant tanks/lines

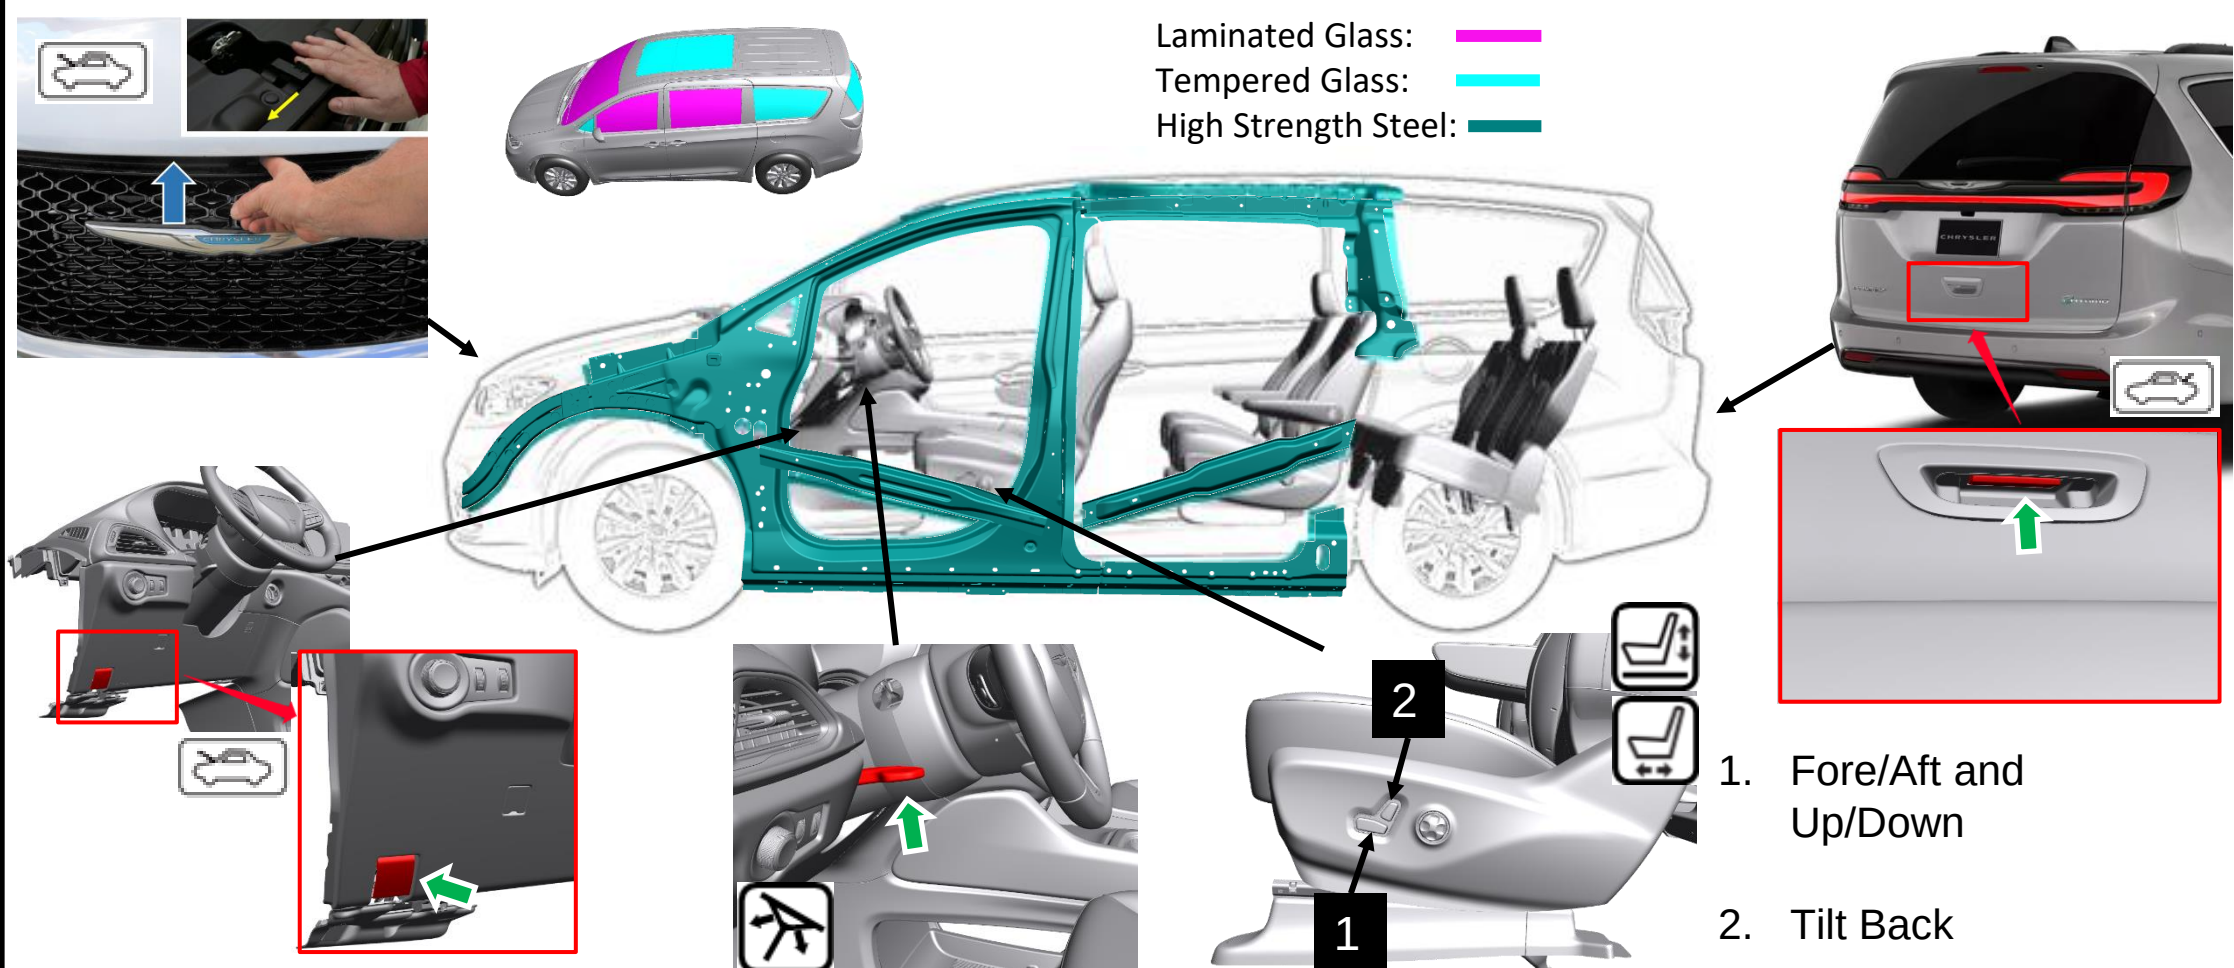

Do not cut into restraint system (belts only may be cut with a knife)

5. Stored energy / liquids / gases / solids

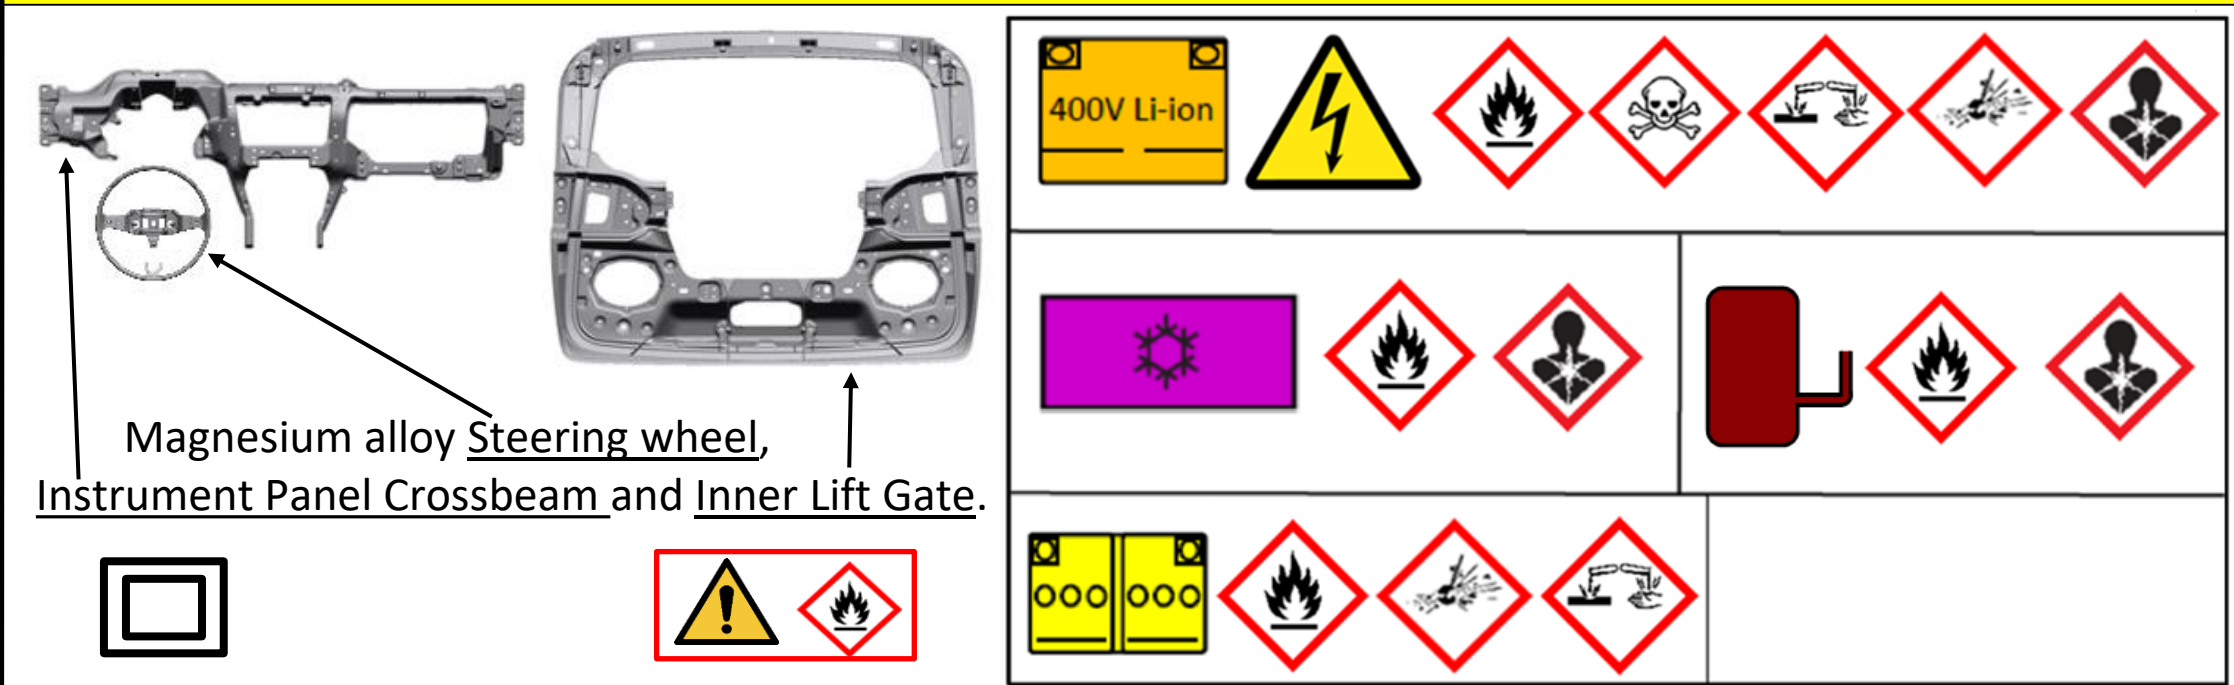

High voltage energy should be contained to within the Lithium-ion battery pack when possible. Do not discharge.

6. In case of fire

Do not cut into any hazards depicted on page 1. Also avoid cutting fuel, brake & coolant tanks/lines

Apply large amounts of water at the first sign of thermal activity. Misting is recommended.

WARNING: Gaseous emissions from a thermally active damaged lithium-ion battery include hydrogen, which is explosive when mixed with oxygen in the air.

WARNING: Gaseous emissions from a thermally active lithium-ion battery include hydrogen fluoride which when combined with moisture in the human body forms an acid that can cause burns, respiratory distress and injury, blindness and/or death.

RECOMMENDED: Immediately open all doors and remove all glass to maximize ventilation.

WARNING: Delayed ignition or re-ignition is possible. Monitor for thermal activity throughout response operations with an infrared thermometer or equivalent.

7. In case of submersion

With a Pacifica Hybrid that is without physical damage (such as from an accident) the risk of electrical shock when submerged or flooded is not increased.

A vehicle with impact damage presents an increased electrical shock hazard risk. If HV is open to the environment, you must stay away from damaged HV components.


In salt water, chlorine may be produced in concentrations that could be corrosive and could have adverse effects on human health.

8. Towing / transportation / storage

POST-INCIDENT DELIVERY TO SERVICE: If air bags have deployed, the vehicle cannot be driven again until repaired, as air bag protection will not be available to occupants in the event of a collision. After any collision, the vehicle should be taken to an authorized service center immediately.

Towing Instructions:

- 1. Place car in PARK, with brake on
- 2. Transport on flatbed or trailer ONLY
- 3. Drag vehicle onto flatbed or trailer
- 4. Secure fully to conveyance
- 5. At location, drag off conveyance
- 6. Leave vehicle in PARK with brake set
- 7. Chock wheels if not secured otherwise

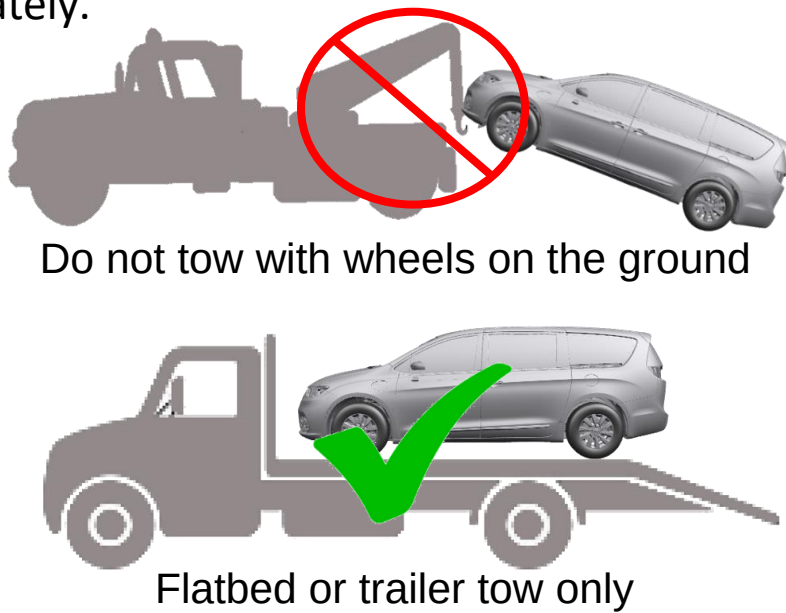

WARNING: Rotation of wheels may result in generation of high voltage or unexpected propulsion.



Monitor for thermal activity/fire throughout transport and storage. Store away from other vehicles, outside, and away from air inlets to occupied structures.

Collect spilled fluids for disposal as follows:

Collect spilled engine coolant and any coolant from electronic systems in the normal manner for spilled glycol/water mix.

Collect spilled engine and hydraulic oil with absorbent material, and use detergents to recover from masonry. Collect contaminated ground for disposal in accordance with local requirements as applicable.

Collect spilled gasoline in the same manner as oils, but employ precautions for the management of flammable and explosive vapors.

Collect spilled 12 V battery electrolyte with an absorbent that neutralizes the highly acidic sulfuric acid electrolyte. Do not handle 12 V battery electrolyte, or materials contaminated with 12 V battery electrolyte without chemically resistant protection.

All debris should be collected and disposed of in an environmentally appropriate manner. Skin contact with battery pack internals is to be avoided. Leakage of electrolyte from the Li-ion battery is unlikely. Any leaking battery fluids are likely glycol-water coolant.



9. Important additional information

- Stellantis / FCA US Customer Center: (877) 426-5337
- Stellantis / FCA Canada Customer Center: (800) 465-2001 (English) (800) 387-9983 (French)
- Stellantis / FCA Mexico Customer Center: +(52) 55 50817568
- Stellantis / FCA within Mexico City only: (800) 505-1300
- Stellantis / FCA Caribbean Customer Center: (877) 426-5337

This Rescue Sheet is a publication of FCA US LLC. All product illustrations and specifications are based upon current information at the time of publication approval. FCA US LLC reserves the right to make changes from time to time, without notice or obligation, in prices, specifications, colors and materials, and to change or discontinue models, which are considered necessary to the purpose of product improvement or for reason of design and/or marketing.

10. Explanation of pictograms used

	LIFT ONLY AT THESE POINTS		ELECTRIC SHOCK HAZRD		ATTENTION		DO NOT PUSH		USE WATER
	FLAMABLE		CORROSIVE		EXPLOSIVE		TOXIC		AFFECTS HUMAN HEALTH
	MOVE KEY FOB AWAY		SEAT ADJUST BACK TO FRONT		SEAT ADJUST UP/DOWN		STEERING WHEEL TILT ADJUST		USE INFRA-RED MONITORING
	DO NOT TOW WITH WHEELS ON GROUND		FLATBED/ TRAILER TOW ONLY						